

Appendix Q Historic and Cultural Resources Technical Memorandum





Chicago Red Line Extension Project

Historic and Cultural Resources Technical Memorandum

April 27, 2015 Updated September 9, 2015

Prepared for: Chicago Transit Authority 567 W. Lake Street Chicago, IL 60661

Prepared by:



125 S. Wacker Drive Suite 600 Chicago, IL 60606





Table of Contents

Section	1 Summary	1-1
1.1	Purpose and Scope	. 1-1
1.2	Identification of Archaeological Resources	. 1-1
1.3	Identification of Architectural Resources	. 1-1
1.4	Project Effects	. 1-2
1.5	Mitigation Recommendations	. 1-3
1.6	2014-2015 Red Line Extension Project Update	. 1-3
Section	2 Project Description	2-1
Section	3 Methods for Effect Evaluation	3-1
3.1	Regulatory Framework	
	3.1.1 Federal	. 3-1
	3.1.1.1 National Historic Preservation Act of 1966, as Amended	. 3-1
	3.1.1.2 National Environmental Policy Act of 1969	. 3-2
	3.1.1.3 Department of Transportation Act of 1966, as Amended	. 3-3
	3.1.2 State - Illinois	. 3-3
	3.1.3 Local	. 3-3
3.2	Effect Analysis Thresholds	. 3-3
3.3	Area of Potential Effects	. 3-4
3.4	Methods	. 3-5
	3.4.1 Historic Context and Known Sites	. 3-5
	3.4.2 Identification of Historic Resources	. 3-7
	3.4.3 Effects from the Project	. 3-9
	3.4.4 Consultation	. 3-9
Section	4 Archaeological Resources	
4.1	Prehistoric Context	4-1
	4.1.1 Natural Landscape	. 4-1
	4.1.2 Paleoindian Period (10,000 to 8,000 B.C.)	. 4-2
	4.1.3 Archaic Period (8,000 to 1,500 B.C.)	. 4-3
	4.1.4 Woodland Period (1,500 B.C. to A.D. 1,000)	4-4
	4.1.5 Mississippian Period (A.D. 1000 to A.D. 1600) and Proto-Historic Period (A.D. 1600-1673)	4-7
	4.1.6 Historic Period (1673 to Present)	. 4-8





4.2	Archaeological Sites in Project Vicinity		
4.3	Potential for Project Effects		
Section	5 Identification of Architectural Resources	5-1	
5.1	Washington Heights	5-1	
	5.1.1 Historic Context	5-1	
	5.1.2 Surveyed Resources	5-6	
	5.1.2.1 National Register of Historic Places-Eligible Resources	5-8	
	5.1.2.2 Properties Surveyed but Determined Ineligible	5-13	
5.2	Roseland Community	5-13	
	5.2.1 Historic Context	5-13	
	5.2.2 Surveyed Resources	5-19	
	5.2.2.1 Resources Eligible for National Register of Historic Places	5-26	
	5.2.2.2 Properties Surveyed but Determined Ineligible	5-34	
5.3	Morgan Park Community	5-34	
	5.3.1 Historic Context	5-34	
	5.3.2 Surveyed Resources	5-39	
5.4	West Pullman Community	5-39	
	5.4.1 Historic Context	5-40	
	5.4.2 Surveyed Resources	5-46	
	5.4.2.1 Resources Eligible for National Register of Historic Places	5-51	
	5.4.2.2 Properties Surveyed but Determined Ineligible	5-56	
5.5	Riverdale Community	5-56	
	5.5.1 Historic Context 5-5		
	5.5.2 Surveyed Resources	5-60	
	5.5.2.1 Resources Eligible for National Register of Historic Places	5-60	
	5.5.2.2 Properties Surveyed but Determined Ineligible	5-60	
5.6	Village of Calumet Park	5-60	
	5.6.1 Historic Context	5-60	
	5.6.2 Surveyed Resources	5-63	
	5.6.2.1 Resources Eligible for National Register of Historic Places	5-64	
	5.6.2.2 Properties Surveyed but Determined Ineligible	5-65	
5.7	Summary of CHRS Resources		
5.8	Parks as Historic Resources	5-66	
Section	6 Effects and Mitigations	6-1	





6.1	No Build Alternative	6-3
6.2	Bus Rapid Transit Alternative	6-3
6.3	Union Pacific Railroad Rail Alternative - Right-of-Way Option	6-4
	6.3.1 Segment UA	6-4
	6.3.2 Segment UB	6-6
	6.3.3 120th Street Yard and Shop	6-7
6.4	Union Pacific Railroad Rail Alternative - East Option	6-7
	6.4.1 Segment UA	6-7
	6.4.2 Segment UB	6-7
	6.4.3 120th Street Yard and Shop	6-7
6.5	Union Pacific Railroad Rail Alternative - West Option	6-7
	6.5.1 Segment UA	6-8
	6.5.2 Segment UB	6-8
	6.5.3 120th Street Yard and Shop	6-8
6.6	Halsted Rail Alternative	6-8
	6.6.1 Rail Corridor	6-8
	6.6.2 119th Street Yard and Shop	6-11
Section	7 Effects Remaining After Mitigation	7-1
Section	8 Section 106 Consultation Process	8-1
8.1	Initiation Activities	8-1
	8.1.1 Invitations to Participate	8-1
	8.1.2 Section 106 Kickoff Webinar	8-1
8.2	Identification of Historic Properties	8-2
8.3	Assessment of Effects	8-2
8.4	Resolution of Adverse Effects	8-2
Section	9 References Cited	9-1

Appendices

Appendix A - Maps of Properties Surveyed
Appendix B - Inventory Sheets for Properties Surveyed
Appendix C - Consultation and Correspondence
Appendix D - Displacement Maps
Appendix E - 2014-2015 Red Line Extension Project Update





Figures

Figure 2-1: RLE Project Alternatives	2-2
Figure 3-1: Area of Potential Effects and the Red Line Extension Alternatives	3-6
Figure 5-1: Community Areas and Red Line Extension Alternatives	5-2
Figure 5-2: Proposed Boundary for Green Street Historic District and Red Line Extension Area of Potential Effects	5-10
Figure 5-3: South Facade of the Eclectic Neo-Traditional Home at 444 W. 100th Place	5-11
Figure 5-4: West Facade of the Classical Revival Substation at 10227 S. Halsted Street	5-12
Figure 5-5: South Facade of Chicago Fire Department Engine Company 93	5-28
Figure 5-6: North Facade of the City of Chicago Roseland Pumping Station	5-29
Figure 5-7: North and East Facades of the French Eclectic Home at 11310 S. Emerald Avenue	5-30
Figure 5-8: East and North Facades of Church at 10920 S. Princeton Avenue	5-31
Figure 5-9: Front Facade (left) and East Wing (right) of 3 W. 111th Place	5-32
Figure 5-10: Front Facade of Nurses Home at 11321 S. Wentworth Avenue	5-33
Figure 5-11: South Facade of Galloy & Van Etten Industrial Building	5-52
Figure 5-12: East Facade of Fire Department Engine Company 115 at 931 W. 120th Street	5-53
Figure 5-13: South Facade of S.S. Peter & Paul Catholic Church at 12433-12439 S. Halsted Street	5-54
Figure 5-14: Front Facade of Venetian Hall	5-55
Figure 5-15: Cedar Park Cemetery Gatehouse	5-65
Figure 5-16: Surveyed Parks within the Area of Potential Effects	5-67
Figure 6-1: NRHP Eligible Sites within the Area of Potential Effects	6-2





Tables

Table 4-1: Archaeological Sites in the Red Line Extension Project Vicinity	4-9
Table 5-1: 69 Surveyed Properties in Washington Heights	5-7
Table 5-2: 279 Surveyed Properties in Roseland	5-19
Table 5-3: 13 Surveyed Properties in Morgan Park	5-39
Table 5-4: 172 Surveyed Properties in West Pullman	5-46
Table 5-5: Seven Surveyed Properties in Calumet Park	5-64
Table 5-6: Chicago Historic Resources Survey Red/Orange Properties in the Area of Potential Effects	5-66
Table 5-7: Eight Surveyed Parks in the Area of Potential Effects	5-68
Table 6-1: Effects Findings (BRT Alternative)	6-3
Table 6-2: Effects Findings (UPRR Rail Alternative - ROW Option)	6-4
Table 6-3: Effects Findings (Halsted Rail Alternative)	6-9
Table 7-1: Effects Findings	7-1





Abbreviations

APE	area of potential effect
BRT	bus rapid transit
CHA	Chicago Housing Authority
CHRS	Chicago Historic Resources Survey
CFR	Code of Federal Regulations
СТА	Chicago Transit Authority
EIS	Environmental Impact Statement
FTA	Federal Transit Administration
GIS	geographic information system
HARGIS	Historic Architectural Resources Geographic Information System
HUD	Department of Housing and Urban Development
MARS	Midwest Archaeological Research Services
NEPA	National Environmental Policy Act
NHPA	National Historic Preservation Act
NRHP	National Register of Historic Places
RLE	Red Line Extension
ROW	right-of-way
SHPO	State Historic Preservation Office
THPO	Tribal Historic Preservation Office
TIF	tax increment financing
UPRR	Union Pacific Railroad
USC	United States Code





Section 1 Summary

1.1 Purpose and Scope

Archeological and historic specialists on the CWC Transit Group team (Midwest Archaeological Research Services, Inc. [MARS, Inc.], independent consultant Jean Guarino, and CDM Smith) conducted a cultural resources overview analysis of archaeological sites and aboveground historic structures that may be affected by the Chicago Transit Authority's (CTA's) proposed Red Line Extension (RLE) Project. These specialists compiled the available records and datasets, conducted fieldwork, and prepared this technical memorandum, which is the historic and cultural resources analysis that will be presented in the Draft Environmental Impact Statement (Draft EIS).

This report follows the general outline of the analysis steps required by the National Historic Preservation Act (NHPA): the identification of historic resources, an assessment of effects of the project on historic resources, and the resolution of adverse effects through avoidance, minimization, and/or mitigation efforts. Additional sections describe the area of potential effects (APE), provide an overview of archaeological investigations, and describe the consultation process pursuant to Section 106 of the NHPA. Information about historic resources and project effects that is developed as part of the Section 106 process will be included in the EIS, satisfying the National Environmental Policy Act (NEPA) requirement that the effects of federal actions on the environment be considered.

The project area is in the City of Chicago and the Village of Calumet Park in Cook County, Illinois. The RLE Project would extend the Red Line from the 95th Street Terminal to the vicinity of 13oth Street, subject to the availability of funding. Four alternatives are being considered: the No Build Alternative, the Bus Rapid Transit (BRT) Alternative, the Union Pacific Railroad (UPRR) Rail Alternative, and the Halsted Rail Alternative. Analysis presented in this document is confined to the APE, the geographic area where a project may directly or indirectly change the character or use of historic properties.

1.2 Identification of Archaeological Resources

Cultural resource specialists conducted a records search to identify archaeological sites within the vicinity of the project area. Eight prehistoric Native American sites have been recorded within 0.6 mile of the project area. All eight fall outside of the RLE APE. The undertaking will produce no effect on these known resources. Additional archaeological sites may remain undiscovered within the RLE Project footprint; within areas of ground disturbance for the preferred alternative, archaeological investigations would occur prior to construction.

1.3 Identification of Architectural Resources

The cultural resource specialists evaluated 541 properties within the APE and determined that 15 historic resources are eligible for inclusion on the National Register of Historic Places (NRHP).



This includes 13 individual buildings plus two historic districts. No previously listed NRHP properties or districts lie within the APE.

The following resources were identified as NRHP eligible. Maps in Appendix A show the locations of these resources in relation to the alternatives considered:

- 1930 Eclectic Neo-Traditional Home at 444 W. 100th Place (Washington Heights)
- 1920 Classical Revival Substation at 10227 S. Halsted Street (Washington Heights)
- Green Street Historic District (Washington Heights/Morgan Park)
- 1917 Chicago Fire Department Engine Co. 93 at 324 W. 104th Street (Roseland)
- 1911 Roseland Pumping Station at 351 W. 104th Street (Roseland)
- 1928 French Eclectic Home at 11310 S. Emerald Avenue (Roseland)
- 1916 Romanesque Revival Church at 10920 S. Princeton Avenue (Roseland)
- 1934 Bethany Reformed Church Manse at 3 W. 111th Place (Roseland)
- 1930s Roseland Community Hospital Nurses Home at 11321 S. Wentworth Avenue (Roseland)
- 1931 Galloy & Van Etten Stone Contractors at 11756 S. Halsted Avenue (West Pullman)
- 1897–1911 Fire Department Engine Co. 115 at 931 W. 120th Street (West Pullman)
- 1958 S.S. Peter & Paul Catholic Church at 12433–12439 S. Halsted Street (West Pullman)
- 1925 former Venetian Hall at 133–139 E. Kensington Avenue (West Pullman)
- 1923 Romanesque Revival Gatehouse and Entryway to Cedar Park Cemetery at 12540 S. Halsted Street (Calumet Park)
- Altgeld Gardens Housing Project (Riverdale)

1.4 Project Effects

Neither the BRT nor the UPRR Rail Alternative would result in adverse effects on historic resources; however, the Halsted Rail Alternative would result in adverse effects on four historic resources: the Classical Revival substation at 10227 S. Halsted Street, the church at 12433–12439 S. Halsted Street, the fire station at 931 W. 120th Street, and the Cedar Park Cemetery gatehouse and entryway at 12540 S. Halsted Street. Although none of these structures would be physically demolished, the scale and proximity of the construction are anticipated to have an adverse effect on the characteristics that qualify each resource as eligible for NRHP listing.





1.5 Mitigation Recommendations

Due to the scale and proximity of construction for the Halsted Rail Alternative, it is unlikely that the anticipated adverse effects on these resources could be resolved; however, consultation with the State Historic Preservation Office (SHPO) and other interested parties may identify measures to mitigate effects. These measures may include but would not be limited to structural documentation, interpretative signage, further study to identify noise mitigation options for the church, or special provisions regarding construction in the vicinity.

1.6 2014-2015 Red Line Extension Project Update

In August 2014, based on the technical analysis and public input until then, CTA announced the NEPA Preferred Alternative—the UPRR Rail Alternative. CTA is considering two alignment (route) options of this alternative: the East Option and the West Option. At this time, CTA is also considering only the South Station Option of the 130th Street Station. In late 2014 and early 2015, CTA conducted additional engineering on the East and West Options to refine the East and West Option alignments. Appendix E of this technical memorandum summarizes the refined alignments and any additional or different impacts that would result. The information in Appendix E supersedes information presented in other chapters of this technical memorandum. (Updated July 29, 2015)





Section 2 Project Description

The CTA is proposing to extend the Red Line from the existing 95th Street Terminal to the vicinity of 130th Street, subject to the availability of funding. The proposed RLE would include four stations. Each station would include bus transfer and parking facilities. This project is one part of the Red Ahead Program to extend and enhance the entire Red Line. The CTA is also planning 95th Street Terminal improvements that are anticipated to be completed prior to the proposed RLE construction.


The project area is 11 miles south of the Chicago central business district (commonly referred to as the Loop) and encompasses approximately 20 square miles. The boundaries of the project area are 95th Street on the north, Ashland Avenue on the west, Stony Island Avenue on the east, and the Calumet-Sag Channel/Little Calumet River and 134th Street on the south. The I-57 Expressway and I-94 Bishop Ford Freeway cross the western and eastern edges of the project area, respectively. Lake Calumet is in the eastern portion of the project area. The project area encompasses parts of nine community areas in the City of Chicago and the eastern section of the Village of Calumet Park. Chicago community areas include Beverly, Washington Heights, Roseland, Morgan Park, Pullman, West Pullman, Riverdale, Hegewisch, and South Deering. The project area comprises residential (primarily single-family), industrial (both existing and vacant), transportation (including freight), and commercial development.

The Draft EIS focuses on the following alternatives (shown in Figure 2-1), which emerged from the Alternatives Analysis and the NEPA scoping process:

- No Build Alternative
- BRT Alternative
- UPRR Rail Alternative
 - o Right-of-Way (ROW) Option
 - East Option
 - West Option
- Halsted Rail Alternative





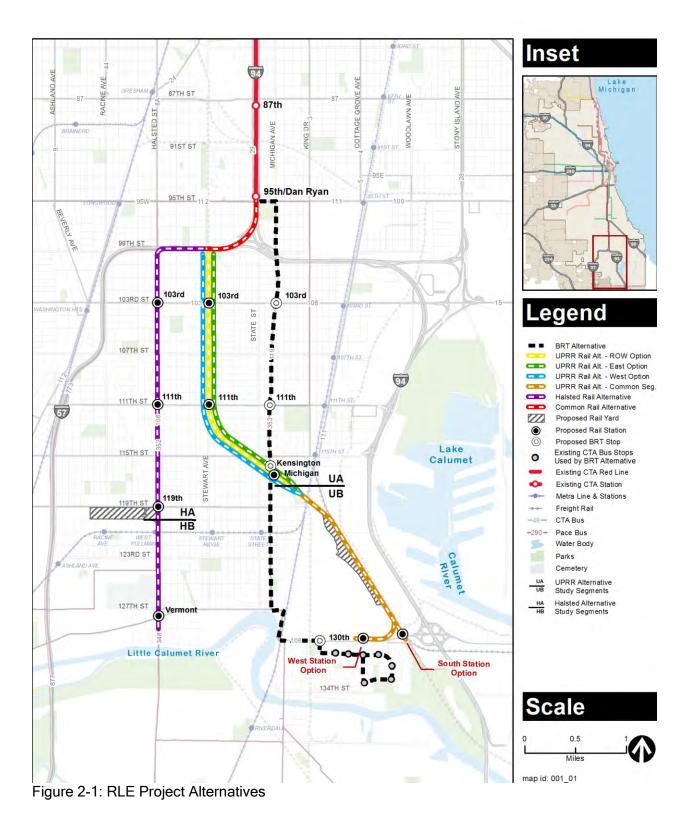





The No Build Alternative is a required alternative as part of the NEPA environmental analysis and is used for comparison purposes to assess the relative benefits and impacts of extending the Red Line. The No Build Alternative is carried into the Draft EIS phase of project development regardless of its performance versus the build alternatives under consideration. No new infrastructure would be constructed as part of the No Build Alternative other than committed transportation improvements that are already in the Chicago Metropolitan Agency for Planning Fiscal Year 2010–2015 Transportation Improvement Program, including the improvements to 95th Street Terminal. The Transportation Improvement Program projects within the project area consist of four bridge reconstructions, several road improvement projects including resurfacing and coordination of signal timing on 95th Street, work on Metra's facilities, construction of a bicycle/pedestrian multi-use trail, and preservation of historic facilities. The No Build Alternative includes regular maintenance of existing track and structures, and bus transit service would be focused on the preservation of existing services and projects. All elements of the No Build Alternative improve from existing conditions.

The BRT Alternative (formerly referred to as the Transportation Systems Management Alternative) is a 5.0-mile, limited-stop, enhanced BRT route, which is assumed to operate 24 hours per day along Michigan Avenue between the existing 95th Street Terminal and the intersection of 130th Street and Eberhart Avenue. No dedicated bus lanes would be provided for the BRT Alternative due to the limited existing lane capacity along the alignment; however, parking lanes would be removed for some portions of the alignment and four stops with improved bus shelters and park & ride facilities would be created at 103rd Street and Michigan Avenue, 111th Street and Michigan Avenue, Kensington Avenue and Michigan Avenue, and 130th Street and Eberhart Avenue. Although BRT service elements would not continue south of the 130th Street stop, the bus route would continue through Altgeld Gardens public housing project along the existing route with six stops. The BRT Alternative would be consistent with bus routing changes that may occur as part of improvements to the 95th Street Terminal. Under this alternative, travel times between 130th Street and the Loop would improve over existing conditions.

The UPRR Rail Alternative is a 5.3-mile extension of the heavy rail transit Red Line from its existing 95th Street Terminal to 130th Street, just west of I-94. The Chicago Transit Board designated the UPRR Rail Alternative as the Locally Preferred Alternative at its August 12, 2009 board meeting. This alternative includes construction and operation of new heavy rail transit tracks, mostly in existing transportation corridors. The UPRR Rail Alternative has three options for alignment (ROW, East, and West), all of which would include operation on elevated structure from 95th Street to just past the Canadian National/Metra Electric District tracks near 119th Street. The alignment would then transition to at-grade through an industrial area with no public through streets, terminating at 130th Street, 11th Street, Michigan Avenue, and 130th Street. The 130th Street station would be the terminal station, with two options under evaluation: the South Station Option and the West Station Option. A new yard and shop facility would be sited near 120th Street and Cottage Grove Avenue. The bus routes in the vicinity of the UPRR Rail Alternative would be modified to enhance connectivity between the Red Line and the bus network. The hours



of operation and service frequency for the UPRR Rail Alternative are assumed to be the same as for the current Red Line. Under this alternative, travel times between 130th Street and the Loop would improve substantially over existing conditions.

The Halsted Rail Alternative is a 5.0-mile heavy rail transit extension of the existing Red Line. In this alternative, the Red Line would operate on an elevated structure running south from 95th Street along I-57 to Halsted Street. The alignment would then turn south and continue along Halsted Street to the intersection of Halsted Street and Vermont Avenue near 127th Street. This alternative would include four new stations at 103rd Street, 11th Street, 119th Street, and Vermont Avenue. The Vermont Avenue station would be the terminal station. A new yard and shop would be sited west of Halsted Street and between the 119th Street and Vermont Avenue stations. The bus routes in the vicinity of the Halsted Rail Alternative would be modified to enhance connectivity to the Red Line. The hours of operation and service frequency for the Halsted Rail Alternative are assumed to be the same as for the current Red Line at the 95th Street Terminal. Under this alternative, travel times between 127th Street and the Loop would improve substantially over existing conditions. This alternative would not extend rail to the Altgeld Gardens public housing project, which would be served by bus connecting to the Vermont terminal station.





Section 3 Methods for Effect Evaluation

3.1 Regulatory Framework

This section discusses the applicable federal and state regulations that define archaeological resources and historic properties and provide thresholds for determining effects on the archaeological resources and historic properties.

3.1.1 Federal

Among the federal laws and regulations that address the protection of archaeological resources and historic properties are the NHPA, NEPA, and the Department of Transportation Act of 1966. These laws and regulations resulted from the recognition that historic resources provide valuable opportunities to study human behavior and to plan for the future while conserving and protecting these resources and environments.

Methods employed during the archaeological and architectural investigations associated with the RLE Project were conducted in accordance with the applicable federal laws and regulations as well as with the Secretary of the Interior's *Standards and Guidelines*.

3.1.1.1 National Historic Preservation Act of 1966, as Amended

Undertakings permitted, licensed, approved, or funded, in whole or in part, by a federal agency are required to comply with Section 106 of the NHPA (Public Law 89-665; 16 United States Code [USC] 470 et seq.). The NHPA set up a national framework for historic preservation, requiring the federal government to establish a national system for identifying, evaluating, protecting, and rehabilitating historic places. The act appropriated funds to conduct surveys and planning in each state (Section 101), called for the establishment of the NRHP (Section 101), requires federal agencies to consider archaeological resources and historic properties when undertakings are planned (Section 106), and established the Advisory Council on Historic Preservation (Section 201).

The Section 106 consultation process covers four distinct coordination points that apply to specific projects:

- 1. Initiation of the process, in which consulting parties (including the SHPO and appropriate Tribal Historic Preservation Offices [THPOs]) are invited to participate in the process
- 2. Identification of historic properties, in which the APE is established and a reasonable and good faith effort is undertaken to identify historic properties within the APE and evaluate their significance
- 3. Assessment of adverse effects, in which effects from the project are examined to determine whether they may alter the integrity of historic properties





4. Resolution of adverse effects, in which the SHPO, THPO, and other parties consult to develop measures to avoid, minimize, or mitigate adverse effects on historic resources

To guide the selection of properties included in the NRHP, the National Park Service developed Criteria for Evaluation (36 Code of Federal Regulations [CFR] 60.4). The quality of significance in American history, architecture, archaeology, engineering, or culture may be present in districts, sites, buildings, structures, or objects that possess integrity of location, design, setting, materials, workmanship, feeling, and association with one or more of the following criteria:

- A. Events that have made a significant contribution to the broad patterns of American history on a local, state, and/or national level
- B. Lives of persons significant in the history of the city, state, and/or the United States
- C. Distinctive characteristics of a type, period, or method of construction, or the work of a master, or high artistic values, or a significant and distinguishable entity whose components may lack individual distinction
- D. Information important in prehistory or history

Subpart B of the regulations for the NHPA (36 CFR 800.5) defines the assessment of adverse effects on archaeological resources and historic properties: "an adverse effect is found when an undertaking may alter, directly or indirectly, any of the characteristics of a historic property that qualify the property for inclusion in the National Register in a manner that would diminish the integrity of the property's location, design, setting, materials, workmanship, feeling, or association...Adverse effects may include reasonably foreseeable effects caused by the undertaking that may occur later in time, be farther removed in distance or be cumulative" (36 CFR 800.5.a.1). A finding of "no adverse effect" can be made when the undertaking's effects would not meet this Criteria of Adverse Effect or when the undertaking would be modified to avoid adverse effects (36 CFR 800.5.b).

An analysis of archaeological and historic resources undertaken for the RLE Project is documented in this technical memorandum and will be summarized in the EIS. This analysis satisfies the requirements of NEPA.

3.1.1.2 National Environmental Policy Act of 1969

NEPA (Public Law 91-190; 42 USC 4321-4347) requires federal agencies to evaluate the significance of potential direct and indirect effects on the environment, including effects on archaeological resources and historic properties. Information about historic resources and project effects that is developed as part of the Section 106 process will be included in the EIS, satisfying the requirements of NEPA.





3.1.1.3 Department of Transportation Act of 1966, as Amended

Section 4(f), a special provision of the Department of Transportation Act (Public Law 109-59; 49 USC 303, 23 USC 138; 23 CFR 774), provides substantive protection for archaeological resources and historic properties relating to undertakings on publicly owned land involving the U.S. Department of Transportation agencies. The act establishes a policy that mandates initiation of a special effort to preserve parks, wildlife refuges, and historic sites; consideration of feasible and prudent alternatives; and the implementation of measures to minimize harm. Adversely affected historic properties that would be subject to direct effects have been analyzed in accordance with the requirements of Section 4(f); this analysis is contained in a separate technical memorandum.

3.1.2 State - Illinois

Pertinent state laws, regulations, and guidelines relating to the proposed undertaking include the Human Skeletal Remains Protection Act of 1989 and the Illinois Archaeological and Paleontological Resources Act of 1989. The Illinois State Museum maintains site files for archaeological sites, which are available online to qualified researchers.

Methods employed during the archaeological and architectural investigations associated with the RLE Project were conducted in accordance with the applicable state laws and regulations as well as with the memorandum *Protecting Illinois Cultural Resources: An Introduction to Archaeological Surveys Cultural Resources Guidelines* and the *Survey and Reporting Requirements Addendum* (Illinois Historic Preservation Agency 2010).

3.1.3 Local

The City of Chicago has local historic preservation ordinances, commissions, and designated landmarks. Available data from the city was used to help identify previously listed historic properties. In addition, local government representatives and other local preservation groups were invited to participate in the Section 106 consultation process.

The 2003 Demolition Delay Ordinance establishes a 90-day hold period prior to demolition of historic buildings rated Red or Orange in the Chicago Historic Resources Survey (CHRS), a citywide historic survey completed from 1983 to 1995. These designations represent potentially significant resources at the city or community level, respectively. Although these resources are evaluated independent of the evaluation of NRHP eligibility, they are discussed in this technical memorandum as well.

3.2 Effect Analysis Thresholds

The NHPA establishes qualitative criteria that define whether a historic property would be subject to an adverse effect: when a project "may alter, directly or indirectly, any of the characteristics of a historic property that qualify the property for inclusion in the National Register in a manner that would diminish the integrity of the property's location, design, setting, materials, workmanship, feeling, or association" (36 CFR 800.5.a). Based on this regulatory framework, an adverse effect finding will be applied to any historic property that would be subject to one or more of the following (36 CFR 800.5.a.2):





- Physical destruction or damage to all or part of the archaeological resource or historic property
- Alteration that is inconsistent with the Secretary of the Interior's *Standards for the Treatment of Historic Properties*
- Removal of the property from its historic location
- Introduction of visual, atmospheric, or audible elements that diminish the integrity of the property's significant features
- Change to the character of the property's use or the physical features within the property's setting that contribute to its significance
- Neglect of a property that causes deterioration
- Transfer, lease, or sale of property out of federal ownership or control without adequate and legally enforceable restrictions or conditions to ensure long-term preservation

If an adverse effect is found, the Federal Transit Administration (FTA) would consult with the Illinois Historic Preservation Agency (the SHPO for Illinois) and other interested parties to develop and evaluate alternatives or modifications to the undertaking that could avoid, minimize, or mitigate adverse effects on the resource (36 CFR 800.6.a).

3.3 Area of Potential Effects

In the context of Section 106, the APE is defined as "the geographic area or areas within which an undertaking may directly or indirectly cause alterations in the character or use of historic properties, if any such properties exist" (36 CFR 800.16.d). The APE for the RLE Project was delineated after considering the location of the proposed alternatives; the potential for ground disturbance, destruction, or property taking; locations from which the undertaking may be visible and/or audible; and the scale and setting of the project. The APE was developed in consultation with CTA, FTA, and the SHPO.

Cultural resource specialists developed the APE boundaries after conducting site visits and reviewing the aerial maps and engineering details (such as alignment locations, elevation of the proposed rail line, expected ROW limits, and the locations of the yards, stations, and parking facilities) for the various alternatives.

Generally, the APE contains those parcels that are within one block of the centerlines for the UPRR Rail and Halsted Rail Alternatives. The APE widens to accommodate the locations of each park & ride and yard and shop beyond the one-block boundary. The APE for the BRT Alternative includes the area immediately surrounding park & ride facilities. Figure 3-1 shows the APE for each alternative corridor.





While the necessary archaeological investigations will occur within the APE, they will be limited only to areas of ground disturbance for the preferred alternative.

3.4 Methods

The Section 106 consultation process includes four distinct coordination points: initiation, identification of properties, assessment of effects, and mitigation of adverse effects. The following subsections summarize how technical analyses will be undertaken to facilitate these four consultation points.

For the RLE Project, "representative sampling" was pursued for the identification of aboveground historic resources. Because of the developed urban environment and linear nature of the project, effects on properties would be similar for adjacent properties. This method is consistent with November 2011 guidance provided by the Advisory Council on Historic Preservation regarding the "Reasonable and Good Faith Identification Standard in Section 106 Review."

3.4.1 Historic Context and Known Sites

Background research was conducted to describe the historic context for the project area. Understanding the historic context is essential in establishing the significance of individual properties, and by extension, NRHP eligibility for the built environment and any archaeological resources. In addition to reviewing the Historic Architectural Resources Geographic Information System (HARGIS) and city records, the following resources were consulted in developing the historic context:

- Sanborn Fire Insurance maps and other historic maps
- Chicago's citywide GIS database
- CHRS
- Previous architectural studies in the area
- Other relevant scholarly publications

Using information in HARGIS and the other sources listed above, a list of previously identified historic properties within the RLE APE was compiled and mapped. This effort included the identification of known archaeological sites, NRHP-listed districts and structures, and any properties identified as local landmarks in Chicago.

The delineation of the APE is described in **Section 3.3**. Historic contexts are presented for archaeological resources in **Section 4** and for individual communities in **Section 5**.





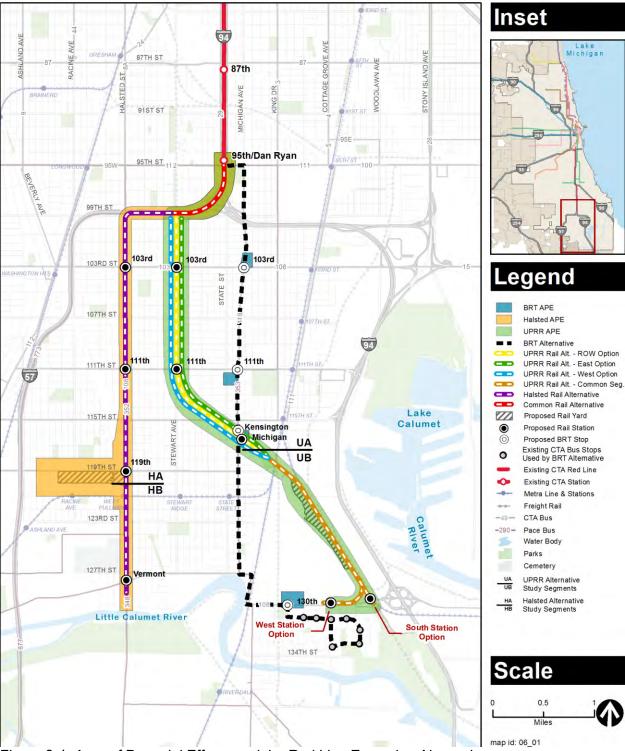


Figure 3-1: Area of Potential Effects and the Red Line Extension Alternatives





3.4.2 Identification of Historic Resources

Following the development of the APE and historic contexts, cultural resources specialists conducted field surveys on two distinct categories of properties: properties that would likely be displaced or demolished as a result of one or more alternatives, and a representative sample of other properties within the APE. The following subsection identifies how the representative sample in the latter category was identified.

For both categories of properties that were surveyed, cultural resource specialists conducted archival research and photo-documented the exterior of each structure from the public ROW. Each property was assessed for NRHP eligibility using the data gathered during the fieldwork and research phases of the investigation. Results of this analysis are described by community in **Section 5**.

Defining the Representative Sample

To determine the properties to be included in the representative sample, the team's architectural historian relied on the GIS database provided by the City of Chicago, the HARGIS database, online mapping resources, SHPO records, and field reconnaissance. Examining the APE block by block, the historic character of each block was considered, including the following:

- What age are the buildings?
- What types of buildings are present?
- What function(s) do they serve?
- What architectural styles are apparent?
- How does the structure fit the context of the larger neighborhood?

In light of the neighborhood and block level contexts, analysts selected one or more properties per block to represent the range of buildings over 50 years in age throughout the area. In areas where the project would likely cause more substantial effects, a greater concentration of sample properties was selected. More sample properties were selected for heterogeneous blocks (e.g., blocks having a mix of property types and ages) than homogenous blocks. Where multiple similar buildings exist within the block, analysts selected the building with the greatest integrity or most distinguishing architectural features.

For example, block A contains only residential buildings, both Craftsman style bungalows and Minimal Traditional brick homes. Structures date to the 1920s and 1930s. The project would cause moderate effects on the adjacent block, but block A would be screened from the transit line by an existing row of buildings. Analysts therefore selected one bungalow and one Minimal Traditional house from this block. Alternatively, Block B contains a mix of residential and commercial properties, dating from 1902 through the 1950s, plus some modern infill. A mix of architectural





styles is present. In this case, analysts selected five structures on this block to represent the crosssection of existing structures.

This process was repeated along the entire APE corridor.

Available Resources for Architectural Research

Architectural datasets for Cook County that were consulted for the RLE Project included the following:

- The HARGIS database was created by the Illinois Historic Preservation Agency in 2003 to manage information about Illinois historic properties; this database documents the state's built environment. The HARGIS database includes data gathered as a result of three statewide survey projects: the Illinois Historic Structures Survey, the Illinois Historic Landmarks Survey, and the Illinois Rural Survey (conducted 1970–1987). The HARGIS database also includes properties identified as part of a NRHP nomination, surveys by local preservation groups, and information from the Illinois Department of Transportation's Bridge Survey. The database includes data forms, photographs, background documentation, and spatial information within a geographical context for each historic property and historic district within the dataset.
- The CHRS is an inventory of buildings that was compiled during 1983–1995. The Chicago Department of Housing and Economic Development published its findings in a report titled *Chicago Historic Resources Survey: An Inventory of Architecturally and Historically Significant Structures* in 1996. Organized according to Chicago's 77 neighborhoods, the inventory lists over 17,000 architecturally and historically significant buildings and structures that predate 1940. The information is also available online and is searchable by neighborhood, building address, decade of construction, architect's name, building style and type, survey ranking, and landmark status.
- Sanborn Fire Insurance maps contain a wealth of information on the built environment in urban areas. Originally created and maintained to assess fire insurance liability, the maps provide dated contexts in which to describe the development of neighborhoods as well as the compositional components and historical use of individual buildings. Data especially useful for this project include the building footprint, number of stories, foundation material, and cladding material. The Sanborn maps are available online through subscription.
- NRHP nomination forms for individually listed historic properties and districts provide a wealth of contextual information for the individual properties and the historic districts. They include construction dates for most historic properties discussed therein and identify the architect in most instances.

Architectural datasets at the local level were reviewed as well, including information from the Commission on Chicago Landmarks.





The Commission on Chicago Landmarks recommends individual buildings, sites, objects, or entire districts to the Mayor and City Council for designation as Chicago Landmarks. To be recommended by the Commission for landmark designation, these resources must meet at least two criteria: (1) being valuable as an example of city, state, or national heritage, and (2) being historically significant—the site of a significant historic event, association with a significant person, architecturally significant, the work of a significant architect or designer, association with a significant historic theme, or a having unique visual feature. In addition, the potential landmark must maintain integrity in light of its location, design, setting, materials, workmanship, and ability to express such historic, community, architectural, or aesthetic interest or value. The Commission reviews any proposed alteration, demolition, or new construction affecting individual landmarks or properties in landmark districts as part of the permit review process. The Commission produces two new publications each year, one for individual landmarks and landmark districts and another for Chicago listings on the NRHP.

3.4.3 Effects from the Project

In consultation with FTA, CTA, the SHPO, and other consulting parties, effects were assessed for each resource previously listed on the NRHP and for those determined to be NRHP eligible. Effects were largely drawn from the other technical memos prepared for the RLE Project and were applied to the NRHP-eligible properties to assess how the project may alter the characteristics that qualify properties for inclusion in the NRHP. Because indirect effects (e.g., noise, vibration, and changes in the visual environment) would be similar for individual properties in close proximity along the corridor, effects on potentially historic properties beyond the representative sample set will be evaluated at a district or neighborhood level. Effects on historic resources are discussed in **Section 6**.

In consultation under Section 106, mitigation strategies will be developed to address any adverse effect determinations. As appropriate, a Memorandum of Agreement will be developed in consultation with FTA, CTA, and Section 106 consulting parties. Mitigation measures are discussed in **Section 7**.

3.4.4 Consultation

As required by Section 106 of the NHPA, consultation covered four distinct coordination points:

- 1. Initiation of the process
- 2. Identification of historic properties
- 3. Assessment of adverse effects
- 4. Resolution of adverse effects (developing measures to avoid, minimize, or mitigate adverse effects on historic resources)

Section 8 of this technical memorandum discusses the Section 106 consultation process for the RLE Project.





Section 4 Archaeological Resources

This chapter presents an overview of the prehistoric development of the area and an overview of archaeological discoveries in the vicinity. Eight prehistoric Native American sites have been recorded within 0.6 mile of the project area; no known sites fall within the project footprint or the APE itself. Although the landscape through which the transit lines would pass is developed, additional archaeological sites may remain undiscovered within protected locations such as parks and gardens.

4.1 Prehistoric Context

This section briefly describes the natural landscape features that influenced the prehistoric development of the area, followed by a description of the prehistoric context for the Paleoindian, Archaic, Woodland, Mississippian, Proto-Historic, and Historic Periods.

Although humans probably entered North America from Asia at least 20,000 years ago, solid evidence for their presence in the Midwest before 10,000 B.C. is elusive. From the time of the initial arrival until the arrival of the Europeans in the 17th century, the archaeological record shows evidence for continuous population growth and changing social adaptations to new developments in both the natural and cultural landscape.

The following description of the cultural landscape in northeastern Illinois will serve as a framework for assessing the significance of the archaeological remains within the APE (adapted and updated from Bird and Tolmie 2000). The recorded sites represent only a small percentage of the prehistoric cultural resources in the Chicago area, as substantial numbers of sites have been destroyed by urban development or were found by amateur archaeologists or relic collectors but have not been reported. Other sites remain undiscovered on unsurveyed land.

4.1.1 Natural Landscape

The RLE Project would be wholly contained within the exceptionally flat, crescent-shaped Chicago Lake Plain. The approximately 45-mile by 15-mile plain occupies the exposed floor of glacial Lake Chicago. Relief within the lake plain varies only 10 feet above the former lake floor where sand spits, dunes, and beaches formed near the shoreline during one of three high water stages of Lake Chicago, when water levels reached 600–620 feet: Glenwood Stage, Calumet Stage, and Tolleston Stage.

The project area includes lake plain-associated surface features such as Calumet Stage beach ridges, the Washington Heights Spit, and the Stewart Ridge Spit (Bretz 1939:105, 108, Plate 1).

Philip C. Hanson (1981), then with the Field Museum of Natural History, used the General Land Office survey notes and plats to reconstruct pre-settlement vegetation in the Chicago Lake Plain. Hanson's analysis (1981:160) identified nine plant communities within the lake plain, with wet





prairie, prairie, and oak savanna plant communities mapped along the RLE corridor. The savanna community, dominated by black oak and bur oak, is associated with the sandy beach ridges and spits in the "Calumet area" at the southern end of the lake plain (Hanson 1981:161). The beach ridges and spits provided dry, elevated landforms suitable for habitation sites and for travel by land. The wet prairie community is mapped south of the "Old Indian Reservation Boundary" line shown on the U.S. Geological Survey quadrangles, between the Little Calumet River to the south and Lake Calumet to the north. Hanson (1981) mapped prairie north of the boundary line. Surface water drains into Lake Michigan by way of the Little Calumet, Calumet, and Grand Calumet rivers, unless artificially diverted into the Calumet-Saganashkee Canal.

4.1.2 Paleoindian Period (10,000 to 8,000 B.C.)

During the Paleoindian Period, populations across the Midwest were highly mobile bands of hunters and gatherers occupying large territories. The Paleoindians hunted a variety of mammals including the now extinct mammoth and mastodon, elk, and deer, and gathered locally available plants. Sites within the Chicago area dating to the Paleoindian Period are rare, although individual tools are more common. The stone tools most often associated with this period, fluted projectile points and knives, are occasionally recovered as isolated finds in upland areas and along the margins of large river valleys and ancient lake beds. Many archaeological sites in the Chicago Lake Plain dating to the Paleoindian Period have been either destroyed by erosional processes or buried by natural deposition.

Very little is known regarding the actual distribution, subsistence pattern, and social organization of the Paleoindians. Within recent years three sites in northeastern Illinois dating to this period and/or a late Paleoindian/Early Archaic transitional period have been investigated. Fluted points and preforms, along with other tools diagnostic of early Paleoindian technology, have been recovered from Hawk's Nest (11-L-344) during archaeological investigations (Loebel, Amick, and Lurie 2000). The Gainey Phase Hawk's Nest site in Lake County is one of the few extensively studied early Paleoindian sites in northeastern Illinois. Repeated surface collections and limited excavations at the 11,000-year-old site have yielded close to 200 chipped stone tools, including fluted point preforms, end and sidescrapers, and gravers, along with manufacturing debris from raw materials obtained up to 350 miles away. The size of the assemblage and its distinctive content suggest a place that was repeatedly being used as a transient camp during extended hunting forays (perhaps seasonal) in the Upper Illinois and Lake Michigan basins (Amick et al. 2000).

The multi-component Garrison Site (11-L-337), on Lake Border Moraine till along a linear slough now carrying the North Branch of the Chicago River, contains an ephemeral late Paleoindian component that has not been disturbed by plowing. MARS, Inc. conducted Phase II testing and Phase III data recovery at Garrison over three field seasons (Lurie et al. 1993, Demel 2000). Floral and faunal analyses suggest a late summer through fall and possibly winter occupation of the site with a focus on plant and/or nut processing (Demel 2000:403).





Archaeologists from Northwestern University recovered late Paleoindian/Early Archaic diagnostic lithics during Phase II investigations at Plenemuk Mound (11-Wi-241). Plenemuk Mound is a 5.6-acre site with a buried Archaic component and an Upper Mississippian component including a probable Langford Tradition Upper Mississippian burial mound (estimated at about 3 feet high and 50 feet in diameter) associated with the 11-Wi-280 habitation site to the east (Bird 1997:321). The scatter of artifacts along a high terrace (valley train remnant) above the Kankakee River is most likely associated with a seasonally occupied late Paleoindian/Early Archaic base camp (Doershuk 1988:143). Late prehistoric people disturbed the earlier Paleoindian/Early Archaic occupation during the subsequent erection of a burial mound.

Recent research into the poorly defined Chesrow Complex of far southeastern Wisconsin has uncovered important information bearing on mammoth and mastodon exploitation (Overstreet 1993). Although radiocarbon dates from bone collagen and preserved spruce suggest that the megafauna were exploited by Paleoindians, no temporally diagnostic tools have been recovered in association with the remains and the integrity of some sites is questioned (Mason 1997:97).

4.1.3 Archaic Period (8,000 to 1,500 B.C.)

The long Archaic Period was a time of transition in the Midwest. After the final retreat of the glaciers, subsistence pursuits adjusted to the changing natural environment as deciduous forests replaced coniferous forests and as the prairie expanded to the east. Human population densities gradually increased, mobility decreased, resource exploitation and technology became more diverse and localized, and social organization became more complex.

During the Archaic Period, hunting began to focus on deer as the primary source of meat. A variety of smaller animals and fish were also collected, with increased emphasis on aquatic resources throughout the period. Plant foods including tubers, nuts, and seeds became increasingly important for subsistence. Some native plants, such as goosefoot, sumpweed, and possibly native squash or gourd, may have been domesticated during the latter part of the Archaic. Domesticated dog has been identified at archaeological sites in the Midwestern United States.

New tool types were developed, including new forms of spear or projectile points, the chipped stone adze, ground stone tools, copper tools, stone mortars for processing plants, and ornaments from bone, shell, and copper. The first cemeteries in Illinois appear during the Middle Archaic and late in this period; graves were occasionally covered with low mounds of earth. Toward the end of the Archaic Period, groups had established particular territories within which settlements were shifted to exploit the seasonally available natural resources. Networks for the exchange of resources within and between regions also developed toward the end of the Archaic.

Although many archaeological sites date within the long Archaic Period, few have been extensively excavated in the Upper Illinois drainage. Until recently, very little was known about the nature of subsistence practices, social organization, or the processes of cultural change and stability during the Archaic (Lurie et al. 2009). Demel (2000:482) posits that sites affiliated with Early Archaic and early Middle Archaic periods have been inundated under the waters of Lake





Michigan. Groups taking advantage of coastal resources would have established extraction camps and villages along the now inundated shoreline of glacial Lake Chippewa.

McGraw Farm (11-L-386) mortuary and habitation site, located on a prominent glacial kame overlooking the Fox River, was mitigated in 1996 (Porubcan et al. 1998). Formal burial features on the site were grouped into two sets, with Middle to late Middle Archaic burials (dated 3,630 to 3,350 B.C.) densely concentrated near the ridge crest. Multiple mortuary treatments including primary burial, cremation, and bundle reburial were represented, and no selection of treatment type based upon age or sex was apparent. Non-burial features contained moderate amounts of lithic debris, tool fragments, and carbonized plant and animal remains.

In 2001 and 2002 MARS, Inc. tested and mitigated the Chen site (11-Wi-2514), an unplowed Late Archaic Period campsite on a northwest-facing bluff slope above the DuPage River (Lurie et al. 2002). The excavations yielded over 2,700 artifacts including two Late Archaic Period projectile points or knives; geomorphological investigations confirmed the undisturbed nature of the deposits. Site location and analysis of chipped stone tools and debris suggest that the Chen site probably functioned as a spring, summer, or fall habitation where general activities linked to resource extraction from the nearby DuPage River floodplain and upland margin areas were conducted. Substantial amounts of lithic debris indicate that tool manufacture and maintenance were frequently conducted on site.

A nutshell, recovered in association with a Matanzas point in feature context at the Garrison site, was dated by calibrated radiocarbon assay at 3,363 B.C. Demel (2000:479) suggests that the site was most densely occupied during the Early Archaic and the late Middle Archaic/early Late Woodland as a residential camp where plant processing was an important activity.

4.1.4 Woodland Period (1,500 B.C. to A.D. 1,000)

The onset of the Woodland Period is traditionally marked by the introduction of pottery technology; however, in the southern Midwest pottery was manufactured as early as 2,500 B.C., well within the Late Archaic. This early pottery, such as Black Sand and Marion, tends to be thick and porous, with fiber or coarse grit temper. Gillette (1949:64) notes that Marion Thick sherds and Adena points have been found at the Fisher site (11-Wi-5) near the mouth of the Illinois River. Slaymaker and Slaymaker (1971:192) report "typical" Early Woodland pottery from surface collections at Knoll Spring (11-Ck-19) on Calumet Stage beach deposits overlooking the Sag Valley. The available information suggests, therefore, that both Black Sand and Marion ceramics have been recovered within Early Woodland Period sites in northeastern Illinois.

Early Woodland patterns of settlement, subsistence, and social organization were probably not very different from those of the Late Archaic. Hunting and fishing remained focal subsistence activities. While nuts continued to be an important food item, seeds were increasingly important, although plant cultivation did not account for the bulk of subsistence calories. Sunflower may have been added to the list of domesticated plants at this time. Data from the Lower Illinois Valley and the Mississippi River in Illinois suggest that Early Woodland groups focused on river bottom resources during at least part of the year. Early Woodland sites are identified by the





occurrence of the first pottery vessels, by particular forms of projectile points and other stone tools, and by the construction of substantial earthen burial mounds.

Charles Faulkner (1960:43-44) noted an early expression of the Early Woodland, contemporaneous with the Red Ochre Culture, at a small number of sites within the sand ridges of the lake plain surrounding the head of Lake Michigan. Red Ochre is now widely recognized to fall mainly within the Early Woodland Period, although ceramics are absent in the complex (Brown 1986:605).

During the Middle Woodland Period, settlements in the Midwest tended to concentrate along broad river valleys. Burials were placed in mounds on nearby bluffs, possibly serving as territorial markers. Sites were occupied for longer periods of time during the year and by greater numbers of people than in preceding periods. Subsistence activities focused on harvesting the abundant seed plants of the floodplain as well as on raising some native domesticates. Deer, fish, and a variety of small mammals and birds were also important food resources.

The best-known data on Middle Woodland come from the region of the Ohio, Mississippi, and Illinois Rivers in Ohio and Illinois. Along the lower Illinois River, Middle Woodland settlement systems consisted of a number of functionally differentiated site types including regional centers, base camps, small seasonal camps, and mortuary sites. Exotic and stylized artifacts called Hopewell have been found in both mortuary and habitation contexts throughout the Midwest during the period. They suggest a widespread social and economic network that stretched as far west as the Rocky Mountains, north to Lake Superior, south to the Gulf of Mexico, and east to the southern Appalachians. Middle Woodland can be recognized by diagnostic pottery vessel decoration, projectile point types, exotic artifacts, large burial mounds, complexes of earthworks, and other remains. Site 11-Ck-250 includes Middle Woodland artifacts (e.g., corner-notched projectile points, scrapers, and grit-tempered sherds) within the Oscar Biedes collection. Weaver ceramics in association with Steuben points, diagnostic of the transition from Middle Woodland to Late Woodland, have been recovered from two radiocarbon-dated sites in northeastern Illinois (11-Wi-684 and 11-Mh-125) excavated by Kullen (1995) and Lurie and Johnson (1996), respectively. The sites are confidently placed within the Steuben Phase (circa A.D. 200 to 419) as defined by Wolforth (1995).

During the late Middle Woodland and early Late Woodland, the trade of long-distance materials came to an end. Mortuary activities became less complex, and settlement patterns changed. There appears to have been a radical reorganization of social and economic systems in the Midwest, the impetus for which is currently unclear. Throughout the region, Late Woodland appears to have been a period of population growth and expansion with settlements no longer restricted to broad alluvial river valleys. Late Woodland sites are found in a variety of topographic settings, sometimes in the same locations as earlier Archaic sites. The hierarchy of sites present during the Middle Woodland disappeared and Late Woodland settlement systems apparently consisted of small seasonal villages and associated support camps.





Although subsistence continued to be based on hunting, fishing, and the gathering of plants, corn horticulture began to be increasingly important in the economy. The quantity and diversity of seeds recovered from Late Woodland period sites indicate extensive use of this resource in the subsistence strategy.

Burials continued to be placed in mounds. Some Late Woodland mounds were constructed in the form of animal effigies in southern Wisconsin and northern Illinois. Late Woodland sites can be recognized by the presence of thin-walled, harder, grit-tempered ceramics and new projectile point types, including arrow points. The Late Woodland Period local pattern may be suggested through examination and integration of information encompassing the recent investigations at Hurd (11-L-71) and McGraw Farm (11-L-386), o.6 mile northeast of Hurd (Bird 1998, Porubcan et al. 1998). Hurd and McGraw are temporally and culturally related sites, perhaps task-specific sites within the Late Woodland seasonal round—one a fall hunting and harvesting encampment, the other a mortuary facility. Flint Creek separates the encampment from the mortuary site. Three Late Woodland burial features have been identified at McGraw; these comprise a minimum burial population of ten individuals. Temporal affiliation was determined using radiocarbon assays, diagnostic artifacts in association with inhumations, and similarity of burial treatment program. Dr. Anne Grauer's analysis (Porubcan et al., 1998: 29) suggests that the Late Woodland burials appear to be primary interments, although the disposition of some of the flexed burials may indicate postmortem processing. The low incidence of infection and anemia compared to contemporaneous burial populations in west-central and southern Illinois suggests to Grauer that the McGraw Late Woodland population was not sedentary; however, equivalent rates of dental caries suggest that the McGraw population had a similar diet, high in carbohydrates and probably related to the consumption of corn.

Calibrated radiocarbon assays from Hurd and McGraw suggest that Hurd is somewhat later than McGraw. Hurd calibrated dates range from A.D. 1180 to 1280 while calibrated dates at McGraw range from A.D. 970 to 1195. Ceramics recovered from two of the features relate the occupation to people who used Starved Rock Collared jars within the territorial region encompassing the Upper Illinois River system and the Middle Rock River. The occupants grew corn and gathered resources from the uplands and floodplain at the confluence of Flint Creek and the Fox River.

Starved Rock and Aztalan Collared vessels are commonly found within sites south of the coniferous/deciduous tension zone in Wisconsin encompassing mixed prairie-oak-hickory woodland and the Prairie Peninsula. Hurley (1975), Fowler and Hall (1978:560), Benn (1979), Hall (1987:66-68), Salkin (1987, 1993), Goldstein (1991:224), Richards (1992:418), Bird (1997), Emerson and Titlebaum (2010), and Kelly (2002) have presented theories to account for the relationship among various Late Woodland groups in the Midwest. Most researchers agree that the Late Woodland collared-style pottery appears circa 900 to 1000, disappears circa 1100 or 1200, and is replaced by Upper Mississippian ceramics in the region. Based on morphological attributes and paste recipes, Aztalan Collared, Starved Rock Collared, and Upper Mississippian Langford Corded are indistinguishable without rim segments.





Two of the eight sites (11-Ck-244 and 11-Ck-246) recorded near the project area contain artifacts diagnostic of the Late Woodland Period (e.g., grit-tempered sherds and triangular projectile points). Both are situated on a low sand bar associated with glacial Lake Chicago and formed during the Calumet stage of Lake Chicago (Bretz 1939:Plate 1).

4.1.5 Mississippian Period (A.D. 1000 to A.D. 1600) and Proto-Historic Period (A.D. 1600-1673)

Mississippian subsistence relied increasingly on cultivated plants, particularly corn and squash. Beans enter the archaeological record for the first time in the Midwest late in the period. Deer was the most important faunal resource, although migratory waterfowl, elk, bison, fish, and raccoon also contributed to the protein intake.

Two types of Mississippian occupations have been identified in Illinois: Middle Mississippian and Upper Mississippian. Middle Mississippian sites tend to occur along rivers with wide, fertile floodplains and reliance on cultivated plants appears to have been substantial. Upper Mississippian sites, on the other hand, tend to occur along rivers extending into the Prairie Peninsula, where reliance on cultivation may have been less intense than for Middle Mississippian populations.

Middle Mississippian peoples achieved the greatest level of cultural complexity in the prehistory of the United States. The river valleys were densely occupied and the settlement systems included permanent towns surrounded by smaller villages and farmsteads. In the Greater St. Louis area of Illinois and Missouri, this Mississippian development may have reached urban proportions. Exchange networks and new systems of political control extended throughout much of the eastern United States. Middle Mississippian sites can be recognized by their diagnostic substructure mounds, house forms, pottery styles, and stone hoes. Although major Middle Mississippian sites are found in the southern part of the state, there is little evidence of Middle Mississippian occupation in northeastern Illinois.

Upper Mississippian peoples were probably more dispersed across the landscape than Middle Mississippian peoples, and apparently lived in smaller villages and farmsteads. In northeastern Illinois, Upper Mississippian occupations known as Fisher/Oneota and Langford are well documented and can be recognized primarily by their distinctive ceramics. The Sanctuary Golf Course in New Lenox in Will County, Illinois near the confluence of Marley and Hickory Creeks contains the remnants of a number of archaeological sites including 11-Wi-654, a 7.0-acre single component Langford Tradition habitation (circa A.D. 1110 and 1426), and 11-Wi-213, an 18.5-acre multi-component habitation (circa A.D. 1165 through 1644). The analysis of ceramics from these sites focused on separating site components, defining temporal trends, and examining regional interaction (Bird 1997). The analysis illuminated temporal, spatial, and social trends involving late prehistoric and proto-historic group interaction at the head of Lake Michigan (Bird 1999, 2010). Important Oneota sites within the Chicago Lake Plain include Huber (11-Ck-1), Hoxie (11-Ck-4) and Oak Forest (11-Ck-53). All three were situated to utilize the resources along the edge of the lake plain. Huber is 6.9 miles west of the confluence of Tinley Creek and the Sag. Hoxie is 7.1





miles south-southeast of Thorn Creek, south of the Little Calumet River. Oak Forest is 4.9 miles south of the interface between the morainal uplands and the lake plain.

Two of the eight sites (11-Ck-28 and 11-Ck-284) recorded near the RLE Project contain artifacts diagnostic of the Mississippian or Proto-Historic periods. The shell-tempered sherds recovered by Bluhm and Wenner from ridges adjacent to a slough at 11-Ck-28 suggest a Fisher/Oneota occupation for the site. Lace and Nowicki reported the Joe Louis site (11-Ck-284) above the south bank of the Little Calumet River near a spring. Artifacts included fauna, lithics, and late Fisher Phase shell-tempered ceramics (primarily), some from feature context (including superimposed pits). Subsequent survey and testing of this substantial habitation site further defined the site limits and concentrations of materials within the site.

4.1.6 Historic Period (1673 to Present)

Historic Indian tribes known to have inhabited northeastern Illinois during this time include Fox (Mesquakie), Kickapoo, Mascouten, Menominee, Miami, Ojibwa (Chippewa), Ottawa (Odawa), Potawatomi, Winnebago (Ho-Chunk), and Sauk (Tanner 1987:93, 98, 106, 140). The Potawatomi were firmly established in the vicinity when the settlers arrived following the Black Hawk War of 1832. Portage points and river junctures along the waterways were important locations for Native American encampments and villages as well as Euro-American trading posts, towns, and forts.

Trails around the head of Lake Michigan (Calumet Region) skirted the lakeshore or used beach ridges to cross the Chicago Lake Plain. The 1819 General Land Office plat notes an "Indian Trail" passing along the western shore of Lake Calumet. The Bishop Ford Freeway and Cottage Grove Avenue follow the approximate alignment of the old trail within the project area. Outside the project area, the trail continues to the southeast aligned with State Street through Calumet City. The "Indian Trail" joined Scharf's Trail P, a branch of the historic Chicago-Vincennes Trace (Quaife 1923:51-71), at about Kensington (near the center of Section 22). James Rees' 1851 map and Albert Scharf's 1901 map of *Indian Trails and Villages of Chicago* (1901) show Trail P crossing the Little Calumet River at the toll bridge established by George Dolton and Levi Osterhoudt in 1842 at Riverdale Crossing, which aligns with Indiana Avenue and Vincennes Avenue. The General Land Office "Indian Trail" and Trail P are branches of the Chicago-Vincennes Trace.

Railroads followed the same general alignments as the early trails, around the head of the lake from the eastern states into Chicago. The Illinois Central appears on the 1870 plat of Calumet Township and aligns with Trail P while the Michigan Central Railroad appears on the same plat aligned with the "Indian Trail." The rail lines, like the trails before them, join at Kensington (Van Vetchen 1870).

Sources of information about the Historic Period include accounts of traders, missionaries, Indian agents, surveyors, military personnel, travelers, and settlers as well as the insights gained from archaeological investigations.

Section 5 discusses the historic development of each of the six neighborhoods and communities along the RLE Project corridor.





4.2 Archaeological Sites in Project Vicinity

Based on artifacts collected by amateur archaeologists Albert Scharf, Oscar Biedes, and Ed Lace, as well as professional investigations completed by the Illinois State Archaeological Survey, eight prehistoric Native American sites have been recorded within 0.6 mile of the RLE Project vicinity, although none fall within the APE. The sites are listed in Table 4-1.

Site #	Site Name	Recorded	Archaeologist(s)	Temporal
11-Ck-28	T. Shapas Collection	1957	E. Bluhm, D. Wenner	Middle Woodland Upper Mississippian
11-Ck-177	(Detail No. 38)	1919	A. Scharf	Two mounds, Village
11-Ck-244	Flat Foot Lake South	1987	E. Lace	Late Woodland
11-Ck-245	Flat Foot Lake North	1987	E. Lace	Prehistoric
11-Ck-246	Flat Foot Lake Central	1987	E. Lace	Late Woodland
11-Ck-247	Beaubien Woods	1987	E. Lace	Prehistoric
11-Ck-250	Oscar Biedes Collection	1987	E. Lace	Middle Woodland
11-Ck-284	Joe Louis Site	1986, 2010	E. Lace, ISAS	Upper Mississippian

_ <i></i>		
Table 4-1: Archaeologica	I Sites in the Red Line	e Extension Project Vicinity

Source: Illinois State site files

Site 11-Ck-284 is south of the Little Calumet River (0.6 mile southwest of the Halsted Rail Alternative footprint), and sites 11-Ck-28, 11-Ck-177, 11-Ck-244 through 247, and 11-Ck-250 are near Flatfoot Lake within the 135-acre Beaubien Woods Forest Preserve of Cook County (0.6 mile southeast of the UPRR Rail Alternative footprint). Only the Joe Louis site (11-Ck-284) has been reviewed for NRHP eligibility and was determined eligible, independent of the RLE Project.

Elaine Bluhm and David J. Wenner recorded site 11-Ck-28 based on a collection of grit-tempered and shell-tempered ceramics gathered from the site and held by Theodore Shapas. The site dates to the Middle Woodland (grit-tempered sherds) and Upper Mississippian (shell-tempered, Oneota sherds) periods.

Betty Broyles recorded 11-Ck-177 in 1959 as comprising the village (Ckv125 and Ckv126) and associated mounds (Ck-127 and Ck-128) detailed by Chicago tobacconist and avocational archaeologist Albert Scharf in 1919: "Two mounds and a camp site were located along the bend of the river" (Brown 1917). Regarding the Calumet Marshes, Scharf (1919) notes:

"The several Indian villages in these marshes were all located along the canoe routes or portage trails of which they form the route simply passing from one to the other & together we have one of the links of the great highway leading from the Illinois River to the 'Great Lake."—Manuscript transcribed and on file at MARS, Inc.

David J. Keene and Theodore J. Karamanski (1980) reported sites 11-Ck-244 through 11-Ck-247 and site 11-Ck-250 in 1979 during survey work completed for the Forest Preserve District of Cook County. Ed Lace, an avocational archaeologist with the Forest Preserve District of Cook County





with whom Keene and Karamanski had worked on the project, formally recorded the Woodland Period and undefined prehistoric sites in 1987. An undated newspaper article from the Star-Tribune shows photographs of the Oscar Biedes collection (included with the 11-Ck-250 site form).

David J. Keene and Theodore J. Karamanski (1980) also reported site 11-Ck-284 within the Joe Louis "The Champ" Golf Course (designed by Dick Nugent) during survey work completed for the Forest Preserve District of Cook County. Ed Lace recorded the Joe Louis site in 1986 after an informal testing program. The 21.2-acre late Fisher Upper Mississippian site (circa A.D. 1200–1400) has been partially destroyed by golf course construction, but further testing in 2010 discovered that part of the site is preserved in the wooded area between the golf course and the Little Calumet River (Porubcan and Baltus 2011).

4.3 Potential for Project Effects

As no previously recorded sites fall within the RLE APE, the RLE Project would produce no effect on known archaeological resources. Additional archaeological sites may remain undiscovered within the project footprint; archaeological investigations will occur within areas of ground disturbance for the preferred alternative.





Section 5 Identification of Architectural Resources

This chapter presents the historic contexts and a description of historic properties for each of the six communities within the RLE Project APE: Washington Heights, Roseland, Morgan Park, West Pullman, and Riverdale within the City of Chicago, and the Village of Calumet Park. Figure 5-1 illustrates the location of each community relative to the project.

A series of maps in Appendix A graphically presents an overview of listed sites and surveyed properties; individual inventory sheets for surveyed properties are included in Appendix B. The map also identifies properties surveyed in the CHRS that were rated Red or Orange. CHRS properties are discussed further in **Section 5.7**.

Following the discussions of the built environment in the six communities, **Section 5.8** discusses parks that fall within the APE. Parks and other Section 4(f) resources are discussed in a separate technical memorandum prepared for the project; this memo only evaluates their eligibility for listing on the NRHP as historic resources.

5.1 Washington Heights

The following subsections include a description of the historic context for the development of Washington Heights (**Section 5.1.1**) and an overview of properties that were surveyed (**Section 5.1.2**). No NRHP-listed sites or districts fall within the RLE APE in the Washington Heights community.

5.1.1 Historic Context

The community of Washington Heights, approximately 11 miles south of Chicago's Loop, is roughly bounded by 89th and 91st Streets on the north, 107th Street on the south, Stewart Avenue on the east, and Beverly Avenue on the west.

Washington Heights Development in the 19th Century

The present community of Washington Heights is bisected by Vincennes Avenue, originally an Indian trail that served as an important route to Chicago from the south during the 19th century. Pioneer Norman Rexford established a home and tavern at 91st Street and Vincennes Avenue in 1834, just a year after Chicago was incorporated, and farmers slowly moved into the area during the ensuing decades. The coming of the railroads hastened drainage of the swampy flatlands, thereby encouraging settlement. In the 1860s a small settlement of German and Irish railroad workers gravitated to the vicinity of 103rd Street and Vincennes Avenue, near the intersection of the Chicago, Rock Island and Pacific Line, and the Panhandle Line (Pittsburgh, Cincinnati and St. Louis Railroad), an area that became known as "The Crossing" (Chicago Fact Book Consortium 1995:206).





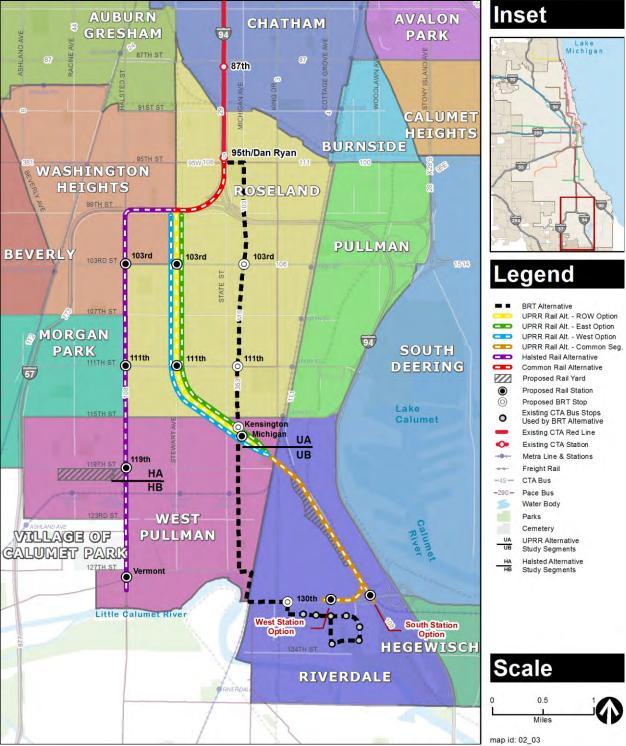


Figure 5-1: Community Areas and Red Line Extension Alternatives





Subdivision of the present Washington Heights community began in its southwestern corner during the mid-1860s when Willis M. Hitt and Lauren P. Hilliard bought farmland in the area between 103rd and 107th Streets, between Loomis and Racine Avenues. A small settlement was established around a new station on the Rock Island Railroad line that ran through this area. In 1870 the Blue Island Land and Building Company purchased and subdivided 1,500 acres between 99th and 107th Streets, but it was not extensively developed during the 19th century (Keating 2008:289).

The Village of Washington Heights was incorporated in 1874, with boundaries that stretched from 95th to 107th Streets between Halsted Street and Western Avenue and included much of the present Chicago community of Beverly. A substantial public school building was erected in 1874 at a cost of \$20,000, replacing a one-room schoolhouse built in 1866 along 103rd Avenue (Andreas 1884:647). Surviving houses from this early stage of development include a modest Greek Revival style frame house at 9635 South Genoa Avenue and a larger frame home at 9802 South Winston Avenue, distinguished by pointed arch windows in the Gothic Revival style; both homes date to the 1870s (Chicago Department of Housing and Economic Development 1996).

In 1874 the Catholic Church of the Sacred Heart established the Academy of Our Lady of the Sacred Heart in its convent along 95th Street. The school educated about 150 young women, both day and boarding students, by the mid-1880s. The growing population of the girls-only school led the church to build an impressive four-story red brick Romanesque Revival-style edifice at the southwest corner of 95th and Throop Streets in 1899. The girls' school housed classrooms, dormitories, and an auditorium. The German Lutheran Zion Congregation, also founded in 1874, built a frame church at the corner of 99th Street and Vincennes Avenue and a small adjacent school (Andreas 1884:648).

During the 1880s two additional settlements were established within the present boundaries of Washington Heights, although they were originally outside the 1874 boundaries of the Village of Washington Heights. The first, called "Fernwood," was located along the line of the Chicago and Eastern Illinois Railroad east of Halsted Street, between 99th and 103rd Streets. By 1885 there were a reported 180 homes in the area, inhabited mainly by native-born Americans and some Dutch (Keating 2008:289). In 1887 the newly formed Village of Fernwood created a wide parkway between 99th and 103rd Streets. Trees and grass were planted and the village extended Fernwood Parkway north to 95th Street the following year. Though the new parkway provided a lovely setting for new homes and its handful of businesses, the sleepy village remained sparsely settled in the 19th century.

The Brainerd subdivision was created in 1885 and extended from 87th Street to 91st Street, between Racine and Ashland Avenues. The portion of this subdivision north of the Rock Island tracks is now part of the Auburn Gresham community. A Rock Island station was opened at 89th and Loomis Streets in 1889, but settlement awaited the 20th century. By 1890 there were only about six houses in Brainerd (Keating 2008:289).





In 1889 Kansas City bridge builder Horace Horton established the Chicago Bridge and Iron Company in the southwest corner of Washington Heights near the "The Crossing" at 103rd Street and Vincennes Avenue. The company is credited with establishing the Beverly Bank in Washington Heights, which served as a mortgage lender to many Chicago Bridge and Iron Company workers.

Annexation by Chicago of what is now considered the Washington Heights community took place in three stages. In 1890 the area north of 95th Street, including the Brainerd subdivision, was annexed along with South Englewood. Later that year the Village of Washington Heights voted to join them. Fernwood residents feared that becoming part of Chicago would result in the opening of saloons and increasing taxes and thus voted against annexation. Due to its refusal to be annexed, the Village of Fernwood became an island in the city, nicknamed "the Monaco of Chicago" (Chicago Tribune 1890). Residents soon reconsidered their decision, as the small village could not afford to pave its streets or build a school. Annexation of the Fernwood neighborhood took place in 1891 and brought the last section of the current community area within the Chicago city limits. Washington Heights remained sparsely settled through the 1890s, although subdivision activity continued. The land from 91st to 95th Streets, between Vincennes and Ashland Avenues, was subdivided by Cremin and Brenan in 1891 and marketed as the Fairview Park Subdivision (Chicago Tribune 1891a).

Washington Heights Development: 1900 to 1950

By 1900 the western portion of Washington Heights had become known as Beverly. The low-lying eastern portion retained the name of Washington Heights. The present Washington Heights community grew slowly and continued its slow growth in the early 20th century due to poor transportation to Chicago's Loop. It wasn't until 1919 and 1920 that streetcar lines were extended southward along Halsted Street, Racine Avenue, and Ashland Avenue to Washington Heights. As late as 1920, Washington Heights had a population of just about 8,000 and still featured large areas of undeveloped land. This was to change during the citywide construction boom of the 1920s, during which the population more than doubled to 18,000 (Chicago Fact Book Consortium 1995: 206). Vacant parcels throughout the community were improved with brick bungalows and, to a lesser degree, with two- and three-flat residential buildings, homes designed in the popular American Foursquare style, and small brick apartment buildings.

Many of Washington Heights' residents during this period were Germans, Swedes, and Irish who had moved from South Englewood and Greater Grand Crossing in search of better housing. They were served by new institutions and parks, such as the Gothic Revival style Mt. Vernon Public School at 10540 S. Morgan Street, which featured a large adjacent park. The growing St. Margaret of Scotland Parish, which had a large Irish congregation, built a commodious new church (1928) and school (1930) near the intersection of 98th and Throop Streets. Architect Charles Wallace designed both of these Gothic Revival style edifices. The Academy of Our Lady School at 95th and Throop Streets (which became known as Longwood Academy) expanded its campus during the 1920s with three additional buildings that housed dormitories, a music conservatory, and a science hall. After 1950, it served only as a high school (Illinois High School Glory Days 2012).





The 5.5-acre Euclid Park at 9800 S. Parnell Avenue was established during the 1920s to serve the area that was once the old Village of Fernwood. An area real estate office building was moved into the new park for use as a small recreation building and ball fields were installed. The 8-acre Brainerd Park was established during the 1930s at 1246 S. 92nd Street, and featured outdoor athletic facilities and a small field house. It was named for Mr. Brainerd, one of the five founders of the Rock Island Railroad (Chicago Park District 2012).

The boom period of the 1920s was mainly confined to residential development. Washington Heights never developed a cohesive business district, although major thoroughfares in the community such as 103rd Street, Vincennes Avenue, and Halsted Street developed as mixed-use districts with one- to three-story commercial buildings and structures such as gas stations intermixed with residential buildings. Commercial buildings from this period were typically one to three stories in height, mainly faced in brick, with storefronts below and apartments above. Detailing was restrained and included stone lintels and sills, storefront surrounds of stone or terra cotta, and stone or metal cornices or parapets. Most of the commercial buildings were not designed in a specific architectural style, but often included details from a style, such as the Queen Anne, Romanesque, or Classical Revival.

The Chicago Bridge and Iron Company was a major employer in Washington Heights during the first half of the 20th century, with about 600 workers in 1910. During World War II, the company temporarily became a large military contractor and had 12,000 workers making military vessels (Wilson 2005). Residential growth continued through the Depression and World War II, and Washington Heights reached residential maturity before 1950. In that year the population was approaching 25,000 (Chicago Fact Book Consortium 1995:206).

Washington Heights Development: 1950 to Present

Vacant lots throughout Washington Heights were improved with suburban style tract homes and split-level homes during the 1950s and 1960s, a period that also saw the construction of Interstate 57 through the community's southeast quadrant. Community demographics also began to change in the post-World War II period as African-Americans began moving into the area east of Halsted Street. By 1960, African-Americans comprised 12 percent of the total population of about 30,000 residents. Irish, Germans, and Swedes were still the predominant white ethnic groups. During the 1960s, the white population dropped by almost two-thirds while the number of African-American residents increased. A new Washington Heights civic organization was formed in 1967 with the goal of promoting "racial stability" (Wright 1967). By 1970 African-Americans comprised 75 percent of the population, which peaked at 36,540. Ten years later the community had declined in population to 29,843 residents, 98 percent of whom were African-American (Chicago Fact Book Consortium 1995:206).

Several new Modernist style schools were erected in Washington Heights during this period, including the Charles Wacker Elementary School at 9746 S. Morgan Street; the two-story Medgar Evers Elementary School at 9811 S. Lowe Avenue; the three-story Marcus Garvey Elementary School at 10309 S. Morgan Street; and the three-story Percy Julian High School at 10330 S. Elizabeth Street, which opened in 1975. The Carter G. Woodson Regional Library at 9525 S.





Halsted Street, named for an African-American historian, opened in 1975. The two-story building features a 182-seat auditorium and houses the Vivian Harsh Collection, which is the second-largest collection of African-American history and literature in the country. Longwood Academy (originally Academy of Our Lady) at 95th and Throop Streets closed its doors in 1999 and its campus is now the home of Chicago International Charter School-Longwood (Bechetta 1999).

During the late 1990s, much of Halsted Street between 99th and 107th Streets was designated as a Redevelopment Area by the City Council. This designation entitled the city to acquire and assemble land to attract developers. Beautification efforts included median improvements and the installation of planters (Almada 1999). In 2001 the City designated a 58-acre parcel in the southwestern corner of the community as the 105th/Vincennes Avenue Tax Increment Financing (TIF) District. The parcel extends from 103rd to 107th Streets, between I-57 and Vincennes Avenue. Many blocks within the district are irregularly shaped due to the various railroad ROWs and the diagonal alignment of Vincennes Avenue. At the time of designation, this area was largely characterized by vacant and underused land and deteriorated and obsolete buildings, and suffered from a lack of private investment (URS/TPAP 2003:3-4).

The 105th/Vincennes Avenue TIF District was created to assemble large tracts of vacant and underused land for redevelopment as a cohesive and distinct residential neighborhood. Targeted development sites include the former Chicago Bridge and Iron Works property (Ernst and Young 2005, 2010, Camiros Ltd. 2003). New residential development within the TIF District has had a slow start, however. A plan to build 124 homes on six square blocks collapsed and only about two dozen two-story homes were built in the vicinity of 105th Street and Vincennes Avenue (Rodkin 2012). Today Washington Heights is a middle class, African-American neighborhood and the vast majority of its built landscape comprises small, single-family, owner-occupied homes. The community has seen little new construction in recent years.

5.1.2 Surveyed Resources

As part of the fieldwork for the RLE Project, 69 buildings within the Washington Heights portion of the APE were surveyed. These properties, along with their construction date and an assessment of their eligibility for listing on the NRHP, are presented in Table 5-1, alphabetized by street name. Properties determined individually eligible are highlighted. A series of maps in Appendix A graphically presents these findings; individual inventory sheets for surveyed properties are presented in Appendix B.





Table 5-1: 69 Surveyed Properties in Washington Heights

Address	Year Built	Description	Eligibility**
435 W. 100th Place	1942	Single-Family	Not Eligible
444 W. 100th Place	1930	Eclectic Neo-Traditional Home	Eligible
426 W. 100th Street	1943	Single-Family	Not Eligible
430 W. 100th Street	1919	Single-Family	Not Eligible
438 W. 101st Place	1955	Single-Family	Not Eligible
416 W. 102nd Place	1929	Chicago Style Bungalow	Not Eligible
444 W. 102nd Street	1913	Single-Family	Not Eligible
424 W. 103rd Street	1889	Religious Building	Not Eligible
748 W. 103rd Street	1928	Commercial (vacant)	Not Eligible
800-804 W. 103rd Street or 10252-10258 S. Halsted Street	1991	Commercial	Modern
814-824 W. 103rd Street	1958	Commercial	Not Eligible
418 W. 98th Place	1931	Chicago Style Bungalow	Not Eligible
401 W. 99th Street	1942	Single-Family	Not Eligible
9824 S. Eggleston Avenue	1965	Single-Family	Not Eligible
10024 S. Eggleston Avenue	1943	Single-Family	Not Eligible
10058 S. Eggleston Avenue	1930	Chicago Style Bungalow	Not Eligible
10100 S. Eggleston Avenue	1894	Single-Family	Not Eligible
10104 S. Eggleston Avenue	1904	Single-Family	Not Eligible
10142 S. Eggleston Avenue	1948	Single-Family	Not Eligible
10148 S. Eggleston Avenue	1919	Single-Family	Not Eligible
10200 S. Eggleston Avenue	1888	Single-Family	Not Eligible
10236 S. Eggleston Avenue	1913	Single-Family	Not Eligible
9818 S. Emerald Avenue	1899	Single-Family	Not Eligible
9823 S. Emerald Avenue	1944	Single-Family	Not Eligible
9900 S. Emerald Avenue	1947	Single-Family	Not Eligible
9906 S. Emerald Avenue	1942	Single-Family	Not Eligible
9909 S. Emerald Avenue	1944	Single-Family	Not Eligible
9936 S. Emerald Avenue	1955	Modernist Style Residence	Not Eligible
10004 S. Emerald Avenue	1909	Flat	Not Eligible
10100 S. Emerald Avenue	1940	Neo-Tudor Style Residence	Not Eligible
10134 S. Emerald Avenue	1939	Minimal Traditional Residence	Not Eligible
10216 S. Emerald Avenue	1956	Single-Family	Not Eligible
9909 S. Green Street	1929	Chicago Style Bungalow	Not Eligible
9957 S. Green Street	1952	Single-Family	Not Eligible
10051 S. Green Street	1928	Craftsman Style Residence	Not Eligible





Address	Year Built	Description	Eligibility**
10157 S. Green Street	1957	Single-Family	Not Eligible
10201 S. Green Street	1926	Chicago Style Bungalow	Not Eligible
10237 S. Green Street	1926	Chicago Style Bungalow	Not Eligible
10345 S. Green Street	1919	Single-Family	Not Eligible
10401 S. Green Street*	1949	Minimal Traditional Residence	Not Eligible
10457 S. Green Street*	1956	Single-Family	Not Eligible
10541 S. Green Street*	1962	Single-Family	Not Eligible
10601 S. Green Street*	1954	Single-Family	Not Eligible
9901 S. Halsted Street	1987	Commercial	Modern
9911 S. Halsted Street	1986	Commercial	Modern
9915 S. Halsted Street	1996	Substation & Cell Tower	Modern
10004 S. Halsted Street	1957	Commercial	Not Eligible
10019 S. Halsted Street	1996	Church	Modern
10114 S. Halsted Street	1903	Multi-Family	Not Eligible
10116 S. Halsted Street	1937	Multi-Family	Not Eligible
10159 S. Halsted Street	1952-1962	Religious	Not Eligible
10227 S. Halsted Street	1919-1920	Classical Revival Substation	Eligible CHRS Orange
10238-10240 S. Halsted Street	1938	Mixed-Use	Not Eligible
10241 S. Halsted Street	1894	Single-Family	Not Eligible
10326 S. Halsted Street	1938-1959	Mixed-Use	Not Eligible
10506 S. Halsted Street	1955	Commercial	Not Eligible
9906 S. Lowe Avenue	1904	Single-Family	Not Eligible
9907 S. Lowe Avenue	1926	Single-Family	Not Eligible
9822 S. Normal Avenue	1947	Single-Family	Not Eligible
9900 S. Normal Avenue	1953	Single-Family	Not Eligible
9925 S. Normal Avenue	1946	Single-Family	Not Eligible
9821 S. Parnell Avenue	1961	Single-Family	Not Eligible
9900 S. Parnell Avenue	1950	Single-Family	Not Eligible
9901 S. Parnell Avenue	1965	Single-Family	Not Eligible
9819 S. Union Avenue	1962	Single-Family	Not Eligible
9822 S. Union Avenue	1944	Single-Family	Not Eligible
9901 S. Union Avenue	1948	Minimal Traditional Residence	Not Eligible
9906 S. Union Avenue	1957	Single-Family	Not Eligible
9912 S. Wallace Street	1922	Single-Family	Not Eligible

CHRS = Chicago Historic Resources Survey * Surveyed property within proposed Green Street Historic District ** Properties noted as "Modern" are less than 50 years in age and do not exhibit "exceptional importance."





5.1.2.1 National Register of Historic Places-Eligible Resources

Of the 69 buildings surveyed within the Washington Heights portion of the RLE APE, 2 were identified as eligible for listing on the NRHP. These are briefly described below.

In addition, one NRHP-eligible historic district was identified along Green Street, between 104th Street and 109th Street. A cluster of Chicago Georgian and Raised Ranch homes exist in this area. While only one side of Green Street falls within the APE, the area could form a district under NRHP Criterion C based on its architecture. The linear streetscape features a cohesive grouping of vernacular homes of the type used to build up the outlying areas of Chicago that developed in the post-WWII era. Although such neighborhoods are common throughout the city, these five blocks include front gabled and hip roof ranch homes, front gabled cottages, and Chicago Georgian style homes with little to no modern infill. Individual homes date from the 1950s and 1960s and feature the same setbacks and similar brick cladding. They appear to be well maintained. A portion of the district falls within the Morgan Park neighborhood. The proposed district boundary is shown in Figure 5-2. Eight buildings were surveyed within the proposed Green Street Historic District but none are recommended as individually eligible.





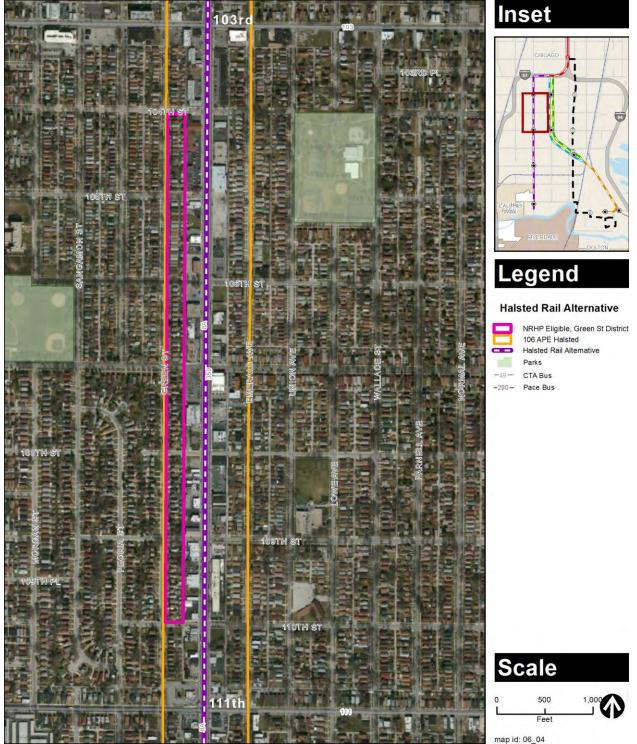


Figure 5-2: Proposed Boundary for Green Street Historic District and Red Line Extension Area of Potential Effects





Eclectic Neo-Traditional Home, 444 W. 100th Place

This one-story home in the Washington Heights community rests on a raised basement as shown in Figure 5-3. Built in 1930, it is clad with polychromatic brick and has a side gabled roof covered with asphalt shingles. Its front elevation has a gabled living room bay pavilion with paired basement windows, a group of three non-original one-over-one windows with concrete sills, brick arch lintels, colonettes with acanthus leaf capitals, and a small round-arched window in the gable. The house has a recessed corner porch with a metal storm door, round-arch openings, a Neo-Gothic castellated top, concrete steps, and brick sidewalls. The integrity of its materials and detailing is very good. Its Eclectic Neo-Traditional ornamentation makes it stand out among the vernacular, stripped-down brick and frame bungalows and cottages that comprise the predominant building stock in the Washington Heights community. As a result, it was identified as individually eligible for NRHP listing under Criterion C for its architecture.



Figure 5-3: South Facade of the Eclectic Neo-Traditional Home at 444 W. 100th Place





Classical Revival Substation, 10227 S. Halsted Street

This vacant two-story Classical Revival style substation in Washington Heights has a stone water table. Built circa 1920, it is clad with multi-hued brown face brick on its front elevation and common brick along its side and rear elevations. The building is shown in Figure 5-4. The building has a flat roof with parapet. Dark brown-colored brick accents the facade with stringcourses, soldier courses, and cruciform patterns against the reddish brown-colored brick. The front elevation features a centrally located entrance with a Classical surround that includes lonic columns and an entablature including a segmental pediment and frieze band with incised lettering that reads, "Southwest Substation." The original door, sidelight, and transom have been removed and their openings covered with plywood. Directly above the entrance is a strip of three plywood-covered window openings with stone casing. Decorative detailing includes full-height brick corner pilasters, a stone belt course above the windows, and a stone cornice with widely spaced dentils. Directly beneath the cornice is a stone panel with incised lettering that reads, "City of Chicago Dep't of Gas & Electricity." Nearly all of the side elevation window openings are covered with plywood.



Figure 5-4: West Facade of the Classical Revival Substation at 10227 S. Halsted Street

This is a rare extant example of a Classical Revival substation in Washington Heights. The substation has retained its decorative detailing; it is possible that original windows may be behind the wood covering. Assuming that the interior has retained interior fabric, this building is recommended as individually eligible for listing on the NRHP under Criterion A for its association with utilities infrastructure and under Criterion C for architecture.





5.1.2.2 Properties Surveyed but Determined Ineligible

Beyond the properties that were identified as individually eligible for NRHP listing, a number of properties were surveyed that did not meet the criteria. Generally, these properties had subsequent alterations that compromise their historic integrity, or they do not feature a level of distinctive architectural detailing necessary to qualify for the NRHP.

5.2 Roseland Community

The following subsections include a description of the historic context for the development of the Roseland community (Section 5.2.1) and an overview of historic properties that were surveyed (Section 5.2.2). No NRHP-listed sites or districts fall within the RLE APE in the Roseland community.

5.2.1 Historic Context

The Roseland community, which is approximately 12 miles south of Chicago's Loop, is bounded by train tracks on the north, 115th Street on the south, Cottage Grove Avenue on the east, and Halsted and Stewart Streets on the west. The community is served by public transportation via the CTA Red Line station at 95th Street, the last stop on this line, and by the Metra with four stops between 103rd and 115th Streets.

Roseland Development in the 19th Century

The Roseland community was undeveloped wet prairie with occasional patches of dry prairie in the mid-19th century. The Chicago-Thornton Road (now Indiana Avenue), which was built on high prairie, crossed the community. Initial settlement occurred in 1849 when a group of Dutch families from the district between Amsterdam and Rotterdam in Holland, in search of land for truck farming, established a settlement of frame houses along this road between 103rd and 111th Streets. One of the immigrants' first endeavors was to build a small wood meeting house at the southwest corner of 107th Street and Michigan Avenue in 1850 for the First Reformed Church of Roseland, the first of three Dutch churches on this site (Andreas 1884:607).

The immigrants became known as the "Hollanders of the High Prairie." They cultivated cabbage, cauliflower, beets, carrots, potatoes, and tomatoes, which they hauled to Chicago's South Water Street Market on the Chicago-Thornton Road. More Dutch immigrants settled the low-lying land between the high prairie and Lake Calumet to the east. Some of the Dutch worked on the construction of the new railroads. The community was called Hope when the first post office opened in 1861, and was initially part of the Lake Township. In 1867 the area east of State Street became part of the newly incorporated Village of Hyde Park (Chicago Fact Book Consortium 1995:152). The Dutch truck farmers also grew flowers, and the lavish annual display of red roses led to the adoption of the name of Roseland for the community in the 1870s. The gable-roofed cottage at 10057 S. Michigan Avenue (1869) is a rare extant home from this early period of agricultural settlement.

Roseland remained a sparsely settled pastoral village of 772 residents in 1880, featuring Old World language and customs as noted by A.T. Andreas (1884:607) in his History of Cook County:



"Its inhabitants are the sturdy phlegmatic, industrious, natives of Holland; and standing by some of the little, squat, small-windowed houses, hearing the high-Dutch gutturals, seeing the pollards and rectangular enclosures, the square-faced, wooden-shoed, towheaded little Dutchmen; in fact, observing the *tout ensemble* would cause one to fancy themselves rather near Amsterdam, or in primitive Nieuw Amsterdam, rather than fifteen miles from Chicago."

Roseland's transformation to an urban community began in the 1880s with the establishment of the Pullman Palace Car Company to the east and the development of several additional railroads along the borders of the area. The annexation of both Lake Township and the Village of Hyde Park in the early 1890s brought Roseland within Chicago's city limits. The Calumet region became steadily industrialized during the 1890s as the Illinois Central Railroad built its Burnside shops in the northeast section of Roseland.

Swedish, German, English, and Irish workers moved into the Roseland community in the late 19th century, attracted to readily available jobs for the railroads, the Pullman shops, steel plants, and other industries that moved into the Calumet region. Roseland's population spread to the south and west and the new residences included modest one- and one-and-a-half-story frame workers' cottages, such as those at 351 W. 109th Street (1889) and 11336 S. Yale Avenue (1894). Less common were cottages built of brick, such as the Italianate style example at 11452 S. Indiana Avenue (1880s).

An impressive Romanesque Revival style public elementary school, the Peter Van Vlissingen School at 137 W. 108th Street (demolished 1999), was completed in 1892 by the Chicago Board of Education. Numerous churches were built in the community during the 1880s and 1890s, including the German Catholic St. Nicholas Church at 11324 S. State Street (built 1896 by architect William Brinkmann) and the church at 11032 S. Indiana Avenue (1891), both designed in the Gothic Revival style. Holy Rosary Church at 113th Street and Martin Luther King Drive was built for the Irish community in 1890 and designed in the Romanesque style by Pullman architect Solon Beman. The First Reformed Church of Roseland at 10706 S. Michigan Avenue, a designated Chicago landmark built in 1887 by architects Henrik De Jong and Jan Kleinhuizen, became the third Dutch church on this site (Taussig 1989).

The corner of 11th Street and Michigan Avenue served as a commercial node for Roseland's earliest settlers, growing to the north and south with the extension of the Michigan Avenue streetcar line to 115th Street in 1892. The two-story buildings at 11314 S. Michigan Avenue, 11349 S. Michigan Avenue, and 11433 S. Michigan Avenue with ground floor shops and flats above are representative of this period of development. The 11314 and 11349 S. Michigan Avenue buildings retain their decorative second-story pressed metal window bays, while the 11433 S. Michigan Avenue building features intact terra cotta detailing. By the turn of the 20th century, Roseland's Michigan Avenue stores served customers from several nearby communities, including Burnside and West Pullman, and its merchants had formed the South End Merchants Association (later called the South End Chamber of Commerce).





Roseland Development: 1900 to 1950

Roseland's largest green space—the 40-acre Palmer Park—was created in 1904 on the tract bounded by 111th and 113th Streets to the north and south, and by King Drive and Indiana Avenue to the east and west. The park is named for Potter Palmer (1826–1902), one of Chicago's most successful merchants and a member of the South Park Commission that established Palmer Park as part of its revolutionary neighborhood parks system to provide green space in Chicago's crowded immigrant neighborhoods. Palmer Park, as well as the nine other South Side neighborhood parks that opened in 1905, was designed by the Olmsted Brothers, a nationally renowned landscape architecture firm. The Classically styled fieldhouse was designed by the prominent Chicago firm of D. H. Burnham and Company. In 1934, Park District Art Director James Edward McBurney created three murals for the Palmer Park Fieldhouse as a Works Progress Administration project funded by the federal government. They are titled "Native Americans," "Explorers," and "Dutch Settlers."

In 1910 the City of Chicago erected a pumping station and firehouse across the street from each other on the 300 block of West 104th Street and donated adjacent property to Chicago's Special Park Commission for the creation of a natatorium with swimming and changing room facilities. The natatorium, which opened in 1916, was equipped to serve 1,500 patrons per day. A gymnasium was added to the natatorium in the 1920s. The surrounding park was named in 1940 for Eugene H. Block (1865–1938), who served as Alderman for the 33rd and 9th Wards between 1910 and 1917.

The Pullman Free School of Manual Training opened in 1915 at 11006 S. Indiana Avenue, on the block just north of Palmer Park. Designed by architect Frank Jobson in the Classical Revival style, the school was built through a bequest of \$1.2 million made by George Pullman upon his death in 1897, with an additional bequest made later by Mrs. Pullman. The school served the children of employees of the Pullman car works and the Pullman-Roseland communities (*Chicago Tribune* 1914, 1915). The school closed in 1950, as its endowment could no longer sustain the rising costs of the school, which was prohibited from charging tuition according to Pullman's will. In subsequent years, the building served as the Gregor Mendel Roman Catholic High School, operated by the Augustinians (1951–88), and as St. Martin de Porres High School, operated by the Archdiocese of Chicago (1989–97). The building was sold to the Chicago Public Schools system in 1998, and opened in 1998 as the Southside College Preparatory Academy, which was renamed in 2001 in honor of Gwendolyn Brooks, a former South Side resident and U.S. poet laureate.

Polish and Italian immigrants were added to Roseland's ethnic mix in the early 20th century. In 1920 Roseland's population stood at 28,241 and abundant undeveloped land remained throughout the community. This situation was to change quickly during the decade to follow, when Roseland's population rapidly increased with an influx of Lithuanians, Italians, Germans, and a small number of African-Americans. The accompanying building boom of the 1920s transformed Roseland into a mature residential community and vacant parcels were improved with one- to two-story gable-roofed wood cottages, brick bungalows, and wood frame homes in the popular American Foursquare style. Some multi-family brick two-flats and small apartment buildings were built as well, including an Art Deco style apartment building at 10411 S. Rhodes Avenue (1929).





The years from 1900 to 1950 saw the erection of numerous churches to serve Roseland's growing multi-ethnic community. Holy Rosary Church added a rectory (1901) and a two-story Renaissance Revival style Catholic school (1916; Anders G. Lund) along the 113th block of Martin Luther King Drive (Chicago Real Estate Daily 2008). Solon S. Beman was the architect of the Classical Revival style Sixth Church of Christ, Scientist at 11325 S. Prairie Avenue (1911), one of six Christian Science church buildings he designed in Chicago. The Roseland Christian School, a three-story brick building at 314 W. 108th Street, was built by the Dutch community in 1929. Institutional buildings erected during the 1920s in Roseland included the Pullman Public Library at 1101 S. Indiana Avenue, a Classical Revival style building designed by Arthur Hussander, and the Roseland Community Hospital at 45 W. 11th Street.

During the early 20th century, Roseland's Michigan Avenue commercial district expanded to encompass the mile-long stretch from 103rd Street to 115th Street. Its wide range of small shops, department stores, and recreational amenities including bowling alleys and movie theaters attracted customers from an ever-expanding geographic area on the South Side. Buildings erected along Roseland's commercial spine were typically one to two stories in height, mainly faced in brick, with commercial storefronts and apartments above. Detailing was restrained and included stone lintels and sills, storefront surrounds of stone or terra cotta, and stone or metal cornices or parapets. The two-story building at 11000 S. Michigan Avenue is an example of a terra cotta-clad building from this period. Most of the commercial buildings were not designed in a specific architectural style, but often included details from a style such as the Queen Anne, Romanesque, Classical Revival, or Chicago School. Some buildings had more elaborate upper-story ornamentation, such as pressed metal window bays or Sullivanesque panels in terra cotta, as displayed in the one-story building at 10351 S. Michigan Avenue.

In 1917 James Gately opened the two-story Gately's People Store at the corner of 112th Street and Michigan Avenue, a Chicago School style department store that became a fixture in the community until its closure in 1980. The 2,000-seat State Theater at 110th Street and Michigan Avenue opened in 1922; the block-long building, which featured store-and-office wings flanking the theater, quickly became a prominent visual landmark in the community with its marquees and exuberant, Classically styled ornamentation in terra cotta. The considerably smaller Roseland Theater at 11331 S. Michigan Avenue was designed in a restrained version of the Art Deco style.

Roseland's growth slowed during the economic depression of the 1930s but rebounded during the 1940s following World War II, with population rising from 44,009 in 1940 to 56,705 in 1950 (Priddy 1954). African-Americans constituted a large portion of this increase. They moved to an enclave called Lilydale, which was established north of 99th Street after World War I. The Lilydale Improvement Association was formed to provide assistance to African-Americans seeking homeownership in the area (*Chicago Tribune* 1928). During the 1940sthe Lilydale neighborhood was increasingly developed with small brick homes and duplexes. Many of these homes were located in the Princeton Park development, which was built in 1944 and bounded by 91st Street, 95th Street, Wentworth Avenue, and Harvard Avenue, and later expanded to State Street. In 1947 prominent African-American contractor Matthew Goodwin Sr., who worked in partnership with his two sons, built 30 homes in the Lilydale neighborhood. Goodwin's work was described in a





1947 *Chicago Tribune* article by Albert F. Barnett titled "Chicago Negroes Fight Housing Shortage, Build Their Own Homes:"

Goodwin Sr. is rated in housing circles as one of the ablest contractors in the city regardless of race...Goodwin up to date has constructed more than 700 homes for Negroes, a record reportedly without precedent anywhere in the nation among Negroes...At present Goodwin and Sons has 30 homes under construction on the far Southside in the section ranging from 90th Street to 95th Street and from State Street west to Perry Avenue.

Roseland Development: 1950 to Present

The private rental Princeton Park development was joined in 1954 by an adjacent Chicago Housing Authority project, comprising 128 row houses in 18 clusters centered around 95th Street and Wentworth Avenue. Designed by architect Sydney H. Morris, the Governor Frank O. Lowden Homes were mainly occupied by African-Americans fleeing the Black Belt of the inner city (Bowly 1978:86). The growing African-American community in Roseland's northern section was served by the creation in 1950 of the 23-acre Abbott Park, which was bounded by 95th Street, 98th Street, State Street, and Michigan Avenue. The park, which features both a swimming pool and field, was named for Robert Abbott (1868–1940), who founded the influential *Chicago Defender* newspaper in 1905. In 1956, the park district sold a portion of the parkland to the Board of Education for the establishment of Harlan High School at 9652 S. Michigan Avenue.

During the 1950s and 1960s, Roseland served as a community—albeit on its northern end only where African-Americans could purchase a home and build a future. Construction of the Dan Ryan Expressway during the late 1950s cut a wide swath through Roseland's north end. This dramatic intervention on the urban landscape resulted in the demolition of many homes and physically divided this area from the remainder of the community to the south.

Roseland's vacant edges were developed from the 1950s through the early 1970s with clusters of identical one-story and split-level tract homes. Residents of Roseland and neighboring communities continued to be served by the Michigan Avenue commercial district, which thrived into the 1950s. A 1957 *Chicago Tribune* article noted that the stretch of Michigan Avenue from 101st Street to 119th Street, which included four blocks of the West Pullman community to the south, featured "close to 500 stores which saw a \$76 million retail business as far back as 1954." During the 1950s "The Avenue," as it was called by Roseland residents, featured 119 food stores, 72 eating and drinking places, 72 apparel stores, 34 furniture and appliance dealers, and 18 drug stores, leading a contemporary *Chicago Tribune* reporter (Bach 1957) to optimistically state "Roseland is alive with new plans to meet the demands of its promising business future."

Roseland's economic fortunes began a rapid decline in the 1970s, however, due in large part to the collapse of the South Side's industrial base. Industries such as the Pullman Company, Wisconsin Steel, International Harvester, CIP Warehousing, Allied Chemical, and Dutch Boy Paint Company that once hired numerous Roseland residents closed their doors, and other industries dramatically reduced their work forces. The establishment in 1972 of the Chicago State University on the former site of Illinois Central Railroad's Burnside Shops in the northeastern corner of the





community was seemingly the only bright spot during this period. Jobs in Roseland decreased from 22,945 to 9,889 between 1974 and 1985 (City of Chicago Department of Planning 1991:9). The 53 percent decline in employment in this decade had a devastating effect on many households and businesses in the area.

Chicago's South Side workers followed their jobs to the far south suburbs. Joining them were residents who feared integration during a period when Roseland's racial composition changed dramatically. During the decade of 1970–80, Roseland changed from a racially mixed community to an almost exclusively African-American community. Roseland's economic woes quickly sparked a downward slide that featured a variety of community woes, such as unemployment, mortgage defaults, business failures, and gang-related problems. More than 900 mortgages were foreclosed during the 1970s and the Department of Housing and Urban Development (HUD) announced the beginning of a repair-and-sell program for repossessed houses in the Roseland area (Chicago Fact Book Consortium 1995:152). Roseland also lost a key recreational amenity when the 1915 natatorium building with swimming pool and gymnasium in Block Park was razed in 1998 and its site was converted to green space.

The most dramatic changes to Roseland's urban landscape, however, have occurred throughout its once thriving and densely built spine along Michigan Avenue. Decline set in as early as the 1960s, as the district found it hard to compete with automobile-oriented shopping centers such as Evergreen Plaza (95th Street and Western Avenue in Evergreen Park), Ford City (75th Street and Cicero Avenue), and River Oaks (Calumet City). The loss of residents' buying power in subsequent decades hastened the decline of the business district, which spurred the closure of larger community businesses such as Gately's Peoples Store and J.C. Penney, leaving behind smaller and more marginal businesses. Numerous commercial buildings that suffered from years of vacancy and neglect were razed, including the block-long State Theater, once a prominent visual landmark in the community. By the 1990s the Michigan Avenue corridor was characterized by large swaths of land and vacant buildings, especially in the area between 104th and 110th Streets; however, the stretch between 110th and 115th streets retained a concentration of buildings with viable retail establishments.

In response to this situation, the Chicago Department of Housing and Economic Development initiated a Community Assistance Panel in 1990 to analyze the Michigan Avenue Commercial District and to provide recommendations for its revitalization. The panel recommended that the area between 110th and 116th Streets be designated as the community's primary commercial district and that the area between 103rd and 110th Streets be designated as a primarily residential district (Chicago Department of Planning 1990:1).

In 2002 the city created the Roseland/Michigan TIF District, which encompasses 176 acres of commercial, residential, and institutional properties along Michigan Avenue between 100th and 120th Streets in the Roseland and West Pullman communities. The TIF District was created "to encourage a broad range of improvements to existing commercial and residential properties and to foster new construction where appropriate" (Chicago Department of Housing and Economic Development 1996). At the time of its designation, there were 484 buildings in the project area,





420 (86 percent) of which were classified as deteriorating, and 252 vacant lots (Trkla, Pettigrew, Allen & Payne:4). Some positive new developments in Roseland over the past decade include the Victory Centre of Roseland, a senior housing development at 10450 S. Michigan Avenue, single-family houses and two-flats along South Michigan Avenue between 105th and 107th Streets by Neighborhood Housing Services, and the Art Deco style Roseland Theater at 11331 S. Michigan Avenue that has been restored and converted to retail space.

5.2.2 Surveyed Resources

As part of the fieldwork for the RLE Project, 279 buildings within the Roseland portion of the APE were surveyed. These properties, along with their construction date and an assessment of their eligibility for listing on the NRHP, are presented in Table 5-2, alphabetized by street name. Properties determined individually eligible are highlighted. A series of maps in Appendix A graphically present these findings; individual inventory sheets for surveyed properties are presented in Appendix B.

Address	Year Built	Description	Eligibility
222 W. 98th Street	1964	Single-Family	Not Eligible
349 W. 99th Place	1979	Single-Family	Modern
355 W. 99th Place	1972	Single-Family	Modern
124 W. 99th Street	1965	Single-Family	Not Eligible
314 W. 100th Place	1965	Single-Family	Not Eligible
319 W. 100th Place	1949	Single-Family	Not Eligible
348 W. 100th Place	1967	Single-Family	Modern
349 W. 100th Place	1967	Single-Family	Modern
352 W. 100th Place	1967	Single-Family	Modern
318 W. 100th Street	1947	Minimal Traditional Residence	Not Eligible
348 W. 100th Street	1974	Single-Family	Modern
349 W. 100th Street	1969	Single-Family	Modern
350 W. 100th Street	1973	Single-Family	Modern
351 W. 100th Street	1970	Single-Family	Modern
354 W. 100th Street	1967	Single-Family	Modern
355 W. 100th Street	1971	Single-Family	Modern
317 W. 101st Place	1966	Single-Family	Modern
334 W. 101st Place	1949	Single-Family	Not Eligible
349 W. 101st Place	1965	Single-Family	Not Eligible
352 W. 101st Place	1967	Single-Family	Modern
353 W. 101st Place	1973	Single-Family	Modern
355 W. 101st Place	1973	Single-Family	Modern
331 W. 101st Street	1952	Single-Family	Not Eligible

Table 5-2: 279 Surveyed Properties in Roseland





Address	Year Built	Description	Eligibility
342 W. 101st Street	1948	Single-Family	Not Eligible
348 W. 101st Street	1970	Single-Family	Modern
349 W. 101st Street	1930	Chicago Style Bungalow	Not Eligible
351 W. 101st Street	1930	Chicago Style Bungalow	Not Eligible
352 W. 101st Street	1960	Single-Family	Not Eligible
355 W. 101st Street	1971	Single-Family	Modern
330 W. 102nd Place	1930	Chicago Style Bungalow	Not Eligible
347 W. 102nd Place	1973	Single-Family	Modern
348 W. 102nd Place	1927	Single-Family	Not Eligible
351 W. 102nd Place	1973	Single-Family	Modern
353 W. 102nd Place	1972	Single-Family	Modern
354 W. 102nd Place	1973	Single-Family	Modern
320 W. 102nd Street	1929	Single-Family	Not Eligible
337 W. 102nd Street	1930	Single-Family	Not Eligible
342 W. 102nd Street	1940	Single-Family	Not Eligible
347 W. 102nd Street	1966	Single-Family	Modern
348 W. 102nd Street	1939	Minimal Traditional Residence	Not Eligible
351 W. 102nd Street	1967	Single-Family	Modern
352 W. 102nd Street	1930	Single-Family	Not Eligible
353 W. 102nd Street	1969	Single-Family	Modern
301 W. 103rd Place	1921	Craftsman Style Residence	Not Eligible
306 W. 103rd Place	1941	Single-Family (vacant)	Not Eligible
321 W. 103rd Place	1924	Craftsman Style Residence	Not Eligible
326 W. 103rd Place	1923	Multi-Family	Not Eligible
426 W. 103rd Place	1909	Single-Family	Not Eligible
427 W. 103rd Place	1898	Multi-Family	Not Eligible
436 W. 103rd Place	1908	Single-Family	Not Eligible
440 W. 103rd Place	1893	Single-Family	Not Eligible
455 W. 103rd Place	1908	Single-Family	Not Eligible
316 W. 103rd Street	1962	Commercial (vacant)	Not Eligible
319 W. 103rd Street	1953	Commercial	Not Eligible
403-405 W. 103rd Street	1900	Former Hay, Grain, & Feed Store	Not Eligible
421 W. 103rd Street	1899	Single-Family	Not Eligible
453 W. 103rd Street	1878	Single-Family	Not Eligible
262 W. 104th Place	1910	Single-Family	Not Eligible
328 W. 104th Place	1923	Craftsman Style Residence	Not Eligible
335 W. 104th Place	1919	Single-Family	Not Eligible
310 W. 104th Street	1923	Craftsman Style Residence	Not Eligible





Address	Year Built	Description	Eligibility
324 W. 104th Street or 328- 330 W. 104th Street	1917	Fire Department Engine Co. 93	Eligible CHRS Orange
325 W. 104th Street	1924	Single-Family	Not Eligible
351 W. 104th Street	1911	Roseland Pumping Station	Eligible CHRS Orange
401 W. 104th Street	1967	Education	Modern
405 W. 104th Street	1967	Education	Modern
415 W. 104th Street	1923	Single-Family	Not Eligible
430 W. 104th Street	1927	Chicago Style Bungalow	Not Eligible
457 W. 104th Street	1922	Single-Family	Not Eligible
351 W. 105th Place	1972	Single-Family	Modern
355 W. 105th Place	1972	Single-Family	Modern
343 W. 105th Place	1926	Craftsman Style Residence	Not Eligible
344 W. 105th Place	1925	Craftsman Style Residence	Not Eligible
411 W. 105th Street	1960/2005	Industrial	Not Eligible
416 W. 105th Street or 410 W. 105th Street	1929	Mixed-Use (vacant)	Not Eligible
338 W. 106th Place	1913	Single-Family	Not Eligible
340 W. 106th Place	1925	Craftsman Style Residence	Not Eligible
343 W. 106th Place	1907	Single-Family	Not Eligible
349 W. 106th Place	1914	Single-Family	Not Eligible
350 W. 106th Place	1908	Single-Family	Not Eligible
352 W. 106th Place	1924	Single-Family	Not Eligible
353 W. 106th Place	1972	Single-Family	Modern
341 W. 106th Street	1903	Single-Family	Not Eligible
346 W. 106th Street	1964	Single-Family	Not Eligible
351 W. 106th Street	1898	Single-Family	Not Eligible
352 W. 106th Street	1972	Single-Family	Modern
353 W. 106th Street	1924	Single-Family	Not Eligible
354 W. 106th Street	1972	Single-Family	Modern
332 W. 107th Place	1949	Single-Family	Not Eligible
333 W. 107th Place	1924	Craftsman Style Residence	Not Eligible
346 W. 107th Place	1927	Industrial	Not Eligible
355 W. 107th Place	1986	Industrial	Modern
335 W. 107th Street	1899	Single-Family	Not Eligible
350 W. 107th Street	1979	Single-Family	Modern
352 W. 107th Street	1974	Single-Family	Modern
400 W. 107th Street	1929	Industrial	Not Eligible
415 W. 107th Street	1920	Commercial	Not Eligible





Address	Year Built	Description	Eligibility
432 W. 107th Street	1962	Single-Family	Not Eligible
744 W. 107th Street	1957	Single-Family	Not Eligible
300 W. 108th Place	1908	Single-Family	Not Eligible
313 W. 108th Place	1918	Single-Family	Not Eligible
348 W. 108th Place	1928	Single-Family	Not Eligible
349 W. 108th Place	1909	Single-Family	Not Eligible
234 W. 108th Street or 314 W. 108th Street	1928	Educational	Not Eligible
340 W. 109th Place	1925	Craftsman Style Residence	Not Eligible
341 W. 109th Place	1883	Single-Family	Not Eligible
348 W. 109th Place	1930	Single-Family	Not Eligible
350 W. 109th Place	1908	Multi-Family	Not Eligible
301 W. 109th Place	1905	Multi-Family (vacant)	Not Eligible
349 W. 109th Street	1888	Multi-Family	Not Eligible
350 W. 109th Street	1894	Single-Family	Not Eligible
351 W. 109th Street	1889	Single-Family	Not Eligible
354 W. 109th Street	1894	Single-Family	Not Eligible
404-410 W. 109th Street	1965	Industrial (vacant)	Not Eligible
407-409 W. 109th Street	1956	Industrial	Not Eligible
743 W. 109th Street	1954	Single-Family	Not Eligible
332 W. 110th Place	1899	Single-Family	Not Eligible
341 W. 110th Place	1916	Single-Family	Not Eligible
347 W. 110th Place	1892	Single-Family	Not Eligible
301 W. 110th Street or 11010 S. Princeton Avenue	1903	Single-Family	Not Eligible
331 W. 110th Street	1909	Single-Family	Not Eligible
340 W. 110th Street	1909	Multi-Family	Not Eligible
352 W. 110th Street	1968	Industrial	Modern
401 W. 110th Street	1981	Industrial	Modern
Two W. 111th Place	1922	Apartment Building	Not Eligible
3 W. 111th Place	1934	Bethany Reformed Church Manse	Eligible
340 W. 111th Place	1908	Multi-Family	Not Eligible
344 W. 111th Place	1913	Single-Family	Not Eligible
303 W. 111th Street	1923	Craftsman Style Residence	Not Eligible
316 W. 111th Street	1893	Multi-Family (vacant)	Not Eligible
339-341 W. 111th Street	1924	Mixed-Use	Not Eligible
349 W. 111th Street	1917	Greystone Flat	Not Eligible
401 W. 111th Street	1964	Commercial	Not Eligible





Address	Year Built	Description	Eligibility
428 W. 111th Street	1960	Single-Family	Not Eligible
256 W. 112th Place	1888	Single-Family	Not Eligible
303 W. 112th Place	1909	Single-Family	Not Eligible
312 W. 112th Place	1914	Single-Family	Not Eligible
319 W. 112th Place	1914	Multi-Family	Not Eligible
325 W. 112th Place	1899	Single-Family	Not Eligible
328 W. 112th Place	1963	Single-Family	Not Eligible
330 W. 112th Place	1966	Single-Family	Modern
339 W. 112th Place	1908	Industrial	Not Eligible
10 E 112th Street	1883	Single-Family (vacant)	Not Eligible
20 E 112th Street	1926	Mixed-Use	Not Eligible
303 W. 112th Street	1908	Single-Family	Not Eligible
334 W. 112th Street	1912	Single-Family	Not Eligible
340 W. 112th Street	1964	Flat (vacant)	Not Eligible
410 W. 112th Street	1929	Chicago Style Bungalow	Not Eligible
139 W. 113th Place	1923	Flat (vacant)	Not Eligible
228 W. 113th Street	1890	Single-Family	Not Eligible
235 W. 113th Street	1905	Single-Family	Not Eligible
303 W. 113th Street	1919	Single-Family	Not Eligible
307 W. 113th Street	1917	Multi-Family	Not Eligible
309 W. 113th Street	1904	Multi-Family	Not Eligible
310 W. 113th Street	1904	Multi-Family (vacant)	Not Eligible
312 W. 113th Street	1962	Single-Family	Not Eligible
316 W. 113th Street	1962	Single-Family	Not Eligible
320 W. 113th Street	1962	Single-Family	Not Eligible
337 W. 113th Street	1910	Single-Family	Not Eligible
340 W. 113th Street	1924	Multi-Family	Not Eligible
345 W. 113th Street	1911	Single-Family	Not Eligible
41 W. 114th Place	1889	Single-Family	Not Eligible
62 W. 114th Place	1924	Craftsman Style Residence	Not Eligible
131 W. 114th Street	1903	Single-Family	Not Eligible
135 W. 114th Street or 131 W. 114th Street	1922	Religious	Not Eligible
138 W. 114th Street	1909	Single-Family	Not Eligible
235 W. 114th Street	1964	Single-Family	Not Eligible
324 W. 114th Street	1907	Multi-Family	Not Eligible
8 W. 115th Street	1903	Flat	Not Eligible
40 W. 115th Street	1894	Multi-Family	Not Eligible





Address	Year Built	Description	Eligibility
42 W. 115th Street	1899	Single-Family	Not Eligible
112 W. 115th Street	1927	Industrial	Not Eligible
116 W. 115th Street	1904	Multi-Family	Not Eligible
120 W. 115th Street	1899	Single-Family	Not Eligible
10415 S. Eggleston Avenue	1927	Craftsman Style Residence	Not Eligible
10531 S. Eggleston Avenue	1940	Minimal Traditional Residence	Not Eligible
10558 S. Eggleston Avenue	1924	Craftsman Style Residence	Not Eligible
10601 S. Eggleston Avenue	1929	Chicago Style Bungalow	Not Eligible
10612 S. Eggleston Avenue	1947	Single-Family	Not Eligible
10720 S. Eggleston Avenue	1924	Single-Family (vacant)	Not Eligible
10757 S. Eggleston Avenue	1923	Single-Family (vacant)	Not Eligible
10904 S. Eggleston Avenue	1927	Single-Family	Not Eligible
10953 S. Eggleston Avenue	1960	Single-Family	Not Eligible
11130 S. Eggleston Avenue	1914	Flat	Not Eligible
11133 S. Eggleston Avenue	1888	Single-Family	Not Eligible
11139 S. Eggleston Avenue	1915	Single-Family	Not Eligible
11211 S. Eggleston Avenue	1922	Craftsman Style Residence	Not Eligible
11257 S. Eggleston Avenue	1908	Single-Family	Not Eligible
10316 S. Emerald Avenue	1919	Craftsman Style Residence	Not Eligible
10428 S. Emerald Avenue	1941	Single-Family	Not Eligible
10554 S. Emerald Avenue	1962	Single-Family	Not Eligible
10614 S. Emerald Avenue	1948	Minimal Traditional Residence	Not Eligible
10750 S. Emerald Avenue	1956	Single-Family	Not Eligible
10824 S. Emerald Avenue	1955	Single-Family	Not Eligible
10952 S. Emerald Avenue	1962	Single-Family	Not Eligible
11034 S. Emerald Avenue	1924	Single-Family	Not Eligible
11104 S. Emerald Avenue	1951	Single-Family	Not Eligible
11212 S. Emerald Avenue	1951	Single-Family	Not Eligible
11310 S. Emerald Avenue	1928	French Eclectic Style House	Eligible, CHRS Orange
11456 S. Emerald Avenue	1951	Single-Family	Not Eligible
10401-10419 S. Halsted Street	1957	Mid-Century Modern Church	Not Eligible
10615 S. Halsted Street	1954	Commercial	Not Eligible
10861 S. Halsted Street	1954	Commercial	Not Eligible
11011 S. Halsted Street	1961	Commercial	Not Eligible
11013 S. Halsted Street	1879	Multi-Family	Not Eligible
11121 S. Halsted Street	1969	Commercial	Modern
11139 S. Halsted Street	1957	Modernistic Commercial Building	Not Eligible





Address	Year Built	Description	Eligibility
9820 S. Harvard Avenue	1959	Single-Family	Not Eligible
9823 S. Harvard Avenue	1915	Single-Family	Not Eligible
11314 S. Harvard Avenue	1926	Craftsman Style Residence	Not Eligible
11356 S. Harvard Avenue	1916	Multi-Family (vacant)	Not Eligible
11415 S. Harvard Avenue	1898	Flat (vacant)	Not Eligible
10204 S. Indiana Avenue	1903	Single-Family	Not Eligible
10242 S. Indiana Avenue	1906	Multi-Family	Not Eligible
9723 S. La Salle Street	1955	Single-Family	Not Eligible
9738 S. La Salle Street	1964	Single-Family	Not Eligible
9902 S. La Salle Street	1919	Single-Family	Not Eligible
9706 S. Lafayette Avenue or 9708 S. Perry Avenue	1957	Single-Family	Not Eligible
10159 S. Michigan Avenue	1918	Craftsman Style Residence	Not Eligible
10213 S. Michigan Avenue	1888	Single-Family	Not Eligible
10220 S. Michigan Avenue	1900s	Multi-Family	Modern
10259 S. Michigan Avenue	1888	Commercial	Not Eligible
11156 S. Michigan Avenue	1923	Commercial	Not Eligible
11200-11206 S. Michigan Avenue	1904	Mixed-Use	Not Eligible CHRS Orange (11206)
10457 S. Normal Avenue	1927	Dutch Colonial Style Residence	Not Eligible
10511 S. Normal Avenue	1949	Single-Family	Not Eligible
10641 S. Normal Avenue	1925	Chicago Style Bungalow	Not Eligible
10701 S. Normal Avenue	1955	Ranch	Not Eligible
10747 Normal Avenue	1928	Craftsman Style Residence	Not Eligible
10853 S. Normal Avenue	1929	Chicago Style Bungalow	Not Eligible
10959 S. Normal Avenue	1938	Minimal Traditional Residence	Not Eligible
11001 S. Normal Avenue	1938	Single-Family	Not Eligible
11035 S. Normal Avenue	1924	Single-Family	Not Eligible
11439 S. Perry Avenue or 11439 S. Pippin Avenue	1892	Industrial Complex	Not Eligible
11426 S. Perry Avenue	1920s	Industrial Complex	Not Eligible
9815 S. Princeton Avenue	1963	Single-Family	Not Eligible
9818 S. Princeton Avenue	1964	Single-Family	Not Eligible
9915 S. Princeton Avenue	1964	Single-Family	Not Eligible
9938 S. Princeton Avenue	1964	Single-Family	Modern
10000 S. Princeton Avenue	1967	Single-Family	Modern
10040 S. Princeton Avenue	1967	Single-Family	Modern
10054 S. Princeton Avenue	1934	Multi-Family	Not Eligible
10136 S. Princeton Avenue	1954	Single-Family (vacant)	Not Eligible





Address	Year Built	Description	Eligibility
10224 S. Princeton Avenue	1930	Single-Family	Not Eligible
10920 S. Princeton Avenue	1916	Romanesque Revival Style Church	Eligible CHRS Orange
11122 S. Princeton Avenue	1922	Apartment Building	Not Eligible
11142 S. Princeton Avenue	1908	Flat	Not Eligible
11319 S. Princeton Avenue	1916	Single-Family	Not Eligible
11321 S. Princeton Avenue	1903	Single-Family	Not Eligible
11325 S. Princeton Avenue	1903	Single-Family	Not Eligible
11327 S. Princeton Avenue	1903	Single-Family	Not Eligible
11340 S. Princeton Avenue	1948	Single-Family	Not Eligible
11210 S. State Street	1910, 1936	Gothic Revival Style Church	Not Eligible
11118 S. Stewart Avenue	1922	Garage	Not Eligible
11124 S. Stewart Avenue	1972	Commercial	Modern
11130 S. Stewart Avenue	1914	Single-Family	Not Eligible
11142 S. Stewart Avenue	1950	Industrial (vacant)	Not Eligible
11224 S. Stewart Avenue	1923	Single-Family	Not Eligible
11229 S. Stewart Avenue	1924	Single-Family (vacant)	Not Eligible
11231 S. Stewart Avenue	1925	Craftsman Style Residence	Not Eligible
9745 S. Wentworth Avenue	1964	Single-Family	Not Eligible
9756 S. Wentworth Avenue	1963	Single-Family	Not Eligible
9907 S. Wentworth Avenue	1966	Single-Family	Modern
11321 S. Wentworth Avenue	1911-1938	Roseland Community Hospital Nurses Home	Eligible
11334 S. Wentworth Avenue	1906	Single-Family	Not Eligible
11352 S. Wentworth Avenue	1897	Single-Family	Not Eligible
11428 S. Wentworth Avenue	1908	Single-Family (vacant)	Not Eligible
11441 S. Wentworth Avenue	1974-1988	Church	Modern
9808 S. Yale Avenue	1963	Single-Family	Not Eligible
9904 S. Yale Avenue	1923	Craftsman Style Residence	Not Eligible
9905 S. Yale Avenue	1924	Craftsman Style Residence	Not Eligible
11319 S. Yale Avenue	1909	Single-Family (vacant)	Not Eligible
11330 S. Yale Avenue	1916	Single-Family	Not Eligible
11334 S. Yale Avenue	1922	Multi-Family	Not Eligible
11336 S. Yale Avenue	1894	Single-Family	Not Eligible
11343 S. Yale Avenue	1914	Craftsman Style Residence	Not Eligible
11347 S. Yale Avenue	1966	Single-Family	Modern
11413 S. Yale Avenue	1920	Craftsman Style Residence	Not Eligible
11417 S. Yale Avenue	1914	Single-Family	Not Eligible

CHRS = Chicago Historic Resources Survey





5.2.2.1 Resources Eligible for National Register of Historic Places

Of the 279 buildings surveyed within the Roseland portion of the RLE APE, 6 were identified as eligible for listing on the NRHP. These are briefly described below.





Fire Department Engine Company 93, 324 W. 104th Street

This two-story firehouse in the Roseland community is clad with light brown face brick, as shown in Figure 5-5. The building has a flat roof and a parapet with concrete coping. The front elevation has a two-story projecting pavilion, an overhead garage door, two window openings, an off-center, hollow-core metal door on the first floor, and a strip of three windows and a single window on the second floor. All windows are non-original, one-over-one aluminum sash. The spandrel area between the garage door and the windows above features a large stone sign plate inscribed with the words, "City of Chicago Fire Department." The spandrel area between the corner door and window above has a metal plate identifying the 1917 construction date and the names of a series of people associated with the building's construction, including the mayor, alderman, city architect (Charles W. Kallal), and contractor (Butler & Co.). Detailing includes stone door and window surrounds on the first floor, bracketed stone window lintels, concrete belt courses, and brick pilasters topped by stone panels with the City of Chicago's "Y" emblem and decorative scrolls. The "Y" emblem is also repeated above the off-center door.

This building is eligible for individual listing on the NRHP under Criterion C for architecture. It is a rare extant example of an early 20th century neighborhood firehouse in Roseland, has largely retained its original building materials and detailing, and still functions as a firehouse.



Figure 5-5: South Facade of Chicago Fire Department Engine Company 93





Roseland Pumping Station, 351 W. 104th Street

The two-story Prairie style Roseland Pumping Station, designed by architect William G. Kreig in 1911, is clad in brown brick, as shown in Figure 5-6. The building has a high limestone water table, a flat roof, parapet, and two square towers at the corners of the front elevation. The front elevation features a projecting, two-story, flat roofed entrance pavilion with a pair of centrally located glass double doors, sidelights, and a stone panel above that features the City of Chicago's "Y" emblem in metal. The entrance has a smooth stone surround. Above the entrance is a limestone panel incised with the words "City of Chicago Roseland Pumping Station." Detailing on the entrance pavilion includes brick pilasters with stone bases and coping and geometric motifs. The parapet is clad in limestone and features decorative geometric motifs. The building's fenestration is largely composed of multi-paned, steel-sash windows, some of which have transoms.

This is an excellent intact example of a neighborhood pumping station with fine integrity that still functions in its original use. It was identified as individually eligible for the NRHP under Criterion C for architecture, as it stands as an excellent, well-preserved example of a neighborhood pumping station designed in the Prairie style.



Figure 5-6: North Facade of the City of Chicago Roseland Pumping Station





French Eclectic Style Home, 11310 S. Emerald Avenue

This two-story, asymmetrical French Eclectic style house in the Roseland community is clad with brownish-orange face brick. Built circa 1928, it is shown in Figure 5-7. The building has a steeply pitched roof covered with slate, a pair of gabled pavilions along its north elevation, and an L-shaped footprint with a one-story, side-gabled wing that features two flat-roofed dormers. The front elevation of the main block has two first-floor windows that are obscured by metal grates and two through-the-cornice wall dormers with paired casement windows. The recessed front door has a smooth stone surround. A stone-clad, upper-story oriel is at the juncture between the front wing and its adjacent gabled pavilion. Attic windows in the paired gable pavilions are surrounded by stone quoins. Fenestration appears to be mainly casement windows.

This is an unusual example of a French Eclectic style home in Roseland and stands as a visual landmark among the predominant building stock of cottages and bungalows. Although windows appear to be replacements, overall it has very good integrity and is individually eligible for NRHP listing under Criterion C for architecture.



Figure 5-7: North and East Facades of the French Eclectic Home at 11310 S. Emerald Avenue





Romanesque Revival Style Church, 10920 S. Princeton Avenue

This circa 1916 Romanesque Revival style church in the Roseland community has a front elevation and two flanking towers clad with brown face brick, while the remainder of the side elevation and the rear elevation are clad with common brick. Shown in Figure 5-8, the church has a gable roof covered with asphalt shingles and gable wall dormers with shaped parapets on both side elevations. The east tower has a flat roof and a shaped parapet while the west tower has a peaked roof with overhanging eaves and exposed rafters and is topped by a finial. The central bay of the front elevation has a broad, round-arched entrance with a stone surround and two sets of singlelight oak double doors. A strip of double-hung windows is within a broad arch and there is a rose window with tracery. Windows on both towers and along the side elevations include round-arch windows with tracery. It is unknown whether the original stained glass for all of these windows is extant inside the church. Both towers also feature paired casement windows. Window openings at the top of the west tower have been boarded over. Detailing includes stone sills, belt courses, brick pilasters, and keystones. A one-story, brick-clad entrance vestibule is along the rear of the west elevation.

Built as the First Reformed Church of Roseland, this church was identified as individually eligible for NRHP listing under Criterion A for its association with the community's once-dominant Dutch population and under Criterion C as a fine example of a Romanesque Revival style church in Roseland.



Figure 5-8: East and North Facades of Church at 10920 S. Princeton Avenue





Bethany Reformed Church Manse, 3 W. 111th Place

This Craftsman house at the southwest corner of 111th Place and State Street sits on a raised basement and is clad with brown face brick. The building has a hip roof covered with asphalt shingles, overhanging eaves with knee braces, and a hip dormer along the 111th Place elevation. Built in 1934, the main block of the house has two additions: a one-story Gothic Revival style east wing with a flat roof and battlemented parapet and a one-story hipped-roof sun porch to the west that is surrounded by double-hung windows. Both wings are also clad in brown face brick. The home's front elevation has a centrally located single-light wood door with sidelights, brick piers, concrete steps with low brick sidewalls, and a flat-roofed wood canopy. The front entrance is flanked on either side by a group of three windows: a picture window flanked by double-hung windows. The front elevation of the Gothic Revival style wing has an off-center metal storm door with slit windows on either side, as well as a picture window flanked by double-hung windows. The door and window group have stone quoins and drip molding. Detailing also includes stone insert blocks.

The residence is identified as individually eligible for NRHP listing under Criterion B due to its association with Reverend Harry J. Hager (1899-1983), a pioneer in media evangelism in Chicago during the mid-20th century. Reverend Hager served as pastor of the adjacent Bethany Reformed Church for 44 years (1929-1975). He was a pioneer in the emerging media ministry, beginning in 1933 with the weekly Bethany Bible Broadcast on the FM station WHIP. Starting in 1944, Reverend Hager's preaching reached a national audience when Chicago's high-powered AM station WCFL began broadcasting his Sunday evening services across America. The manse is shown in Figure 5-9.



Figure 5-9: Front Facade (left) and East Wing (right) of 3 W. 111th Place





Roseland Community Hospital Nurses Home, 11321 S. Wentworth Avenue

Shown in Figure 5-10, this four-story building has a flat roof and parapet. Its symmetrical front elevation is clad with brown face brick and has a centrally located entrance with a glass door and stone surround topped by two stone owls holding books. Windows are non-original one-over-one aluminum sash; those directly above the entrance have stone casings. Detailing includes stone sills, coping, insert blocks, sill courses, cornice, panels, and pinnacles at the parapet level.

This building is locally significant and eligible for NRHP listing under Criterion A for Education. Formerly the Roseland Community Hospital Nurses Home, it was built by the hospital as a dormitory and educational facility for its nurses. Closely affiliated with Roseland Community Hospital, which has served as an important institution in the Roseland area since its establishment in 1924, the Nurses Home is an excellent example of this building type on Chicago's South Side. The exterior of the building has very good integrity and the interior—which now functions as a homeless shelter—appears to retain classrooms and other spaces associated with its original use.



Figure 5-10: Front Facade of Nurses Home at 11321 S. Wentworth Avenue





5.2.2.2 Properties Surveyed but Determined Ineligible

Beyond the properties that were identified as individually eligible for NRHP listing, a number of properties were surveyed that did not meet the criteria. Generally, these properties have had subsequent alterations that compromise their historic integrity or do not feature a level of distinctive architectural detailing necessary to qualify for the NRHP.

5.3 Morgan Park Community

The following subsections include a description of the historic context for the development of the Morgan Park community (**Section 5.3.1**) and an overview of historic properties that were surveyed (**Section 5.3.2**). No NRHP-listed sites or districts fall within the RLE APE in the Morgan Park community.

5.3.1 Historic Context

The community of Morgan Park, approximately 16 miles southwest of Chicago's Loop, is roughly bounded by 107th Street on the north, 115th and 119th Streets on the south, Halsted Street on the east, and California and Rockwell Avenues on the west.

Morgan Park Development in the 19th Century

Morgan Park is named for Thomas Morgan, an Englishman who in 1844 purchased a heavily wooded 3,000-acre tract stretching from the present 91st to 115th Streets on either side of a glacial moraine. The Blue Island moraine remnant, which is roughly 6 miles long and 2 miles wide, is the only high ground within this portion of the lake plain. Morgan built a home at 92nd Street and Pleasant Avenue, in today's Beverly community, and fenced his land for farming, ranching, and hunting (Chicago Fact Book Consortium 1995:210). Other farmers purchased land near the Morgan farm and used the Vincennes Trail along the morainal ridge for access to Chicago.

The transformation of the rural ridge area to a suburban community began in 1869 when the Blue Island Land and Building Company purchased Morgan's property from his heirs and subdivided the land south of 107th Street, between Ashland and Western Avenues, as a subdivision of the Washington Heights community (much of which is Beverly today) to the north (Andreas 1884:639). West of Vincennes Avenue, English landscape architect Thomas F. Nichols designed a series of picturesque, curving streets dotted with parks on behalf of the Blue Island Company (Pacyga and Skerrett 1976:535). This area featured large, deep lots suitable for spacious Victorian homes and evoked the ambiance of an English country town. East of Vincennes Avenue and south of 11th Street, the area was platted with a more typical, rectilinear street grid featuring smaller lots. This section was developed with more modest homes.

The new subdivision benefitted from the 1871 opening of a branch line of the Chicago, Rock Island, and Pacific Railroad, which provided commuter service from Blue Island to downtown Chicago and included a stop at 111th (formerly Morgan) Street. Several important early institutions were established that spurred development in the area. In 1873 the Blue Island Company donated land for the Mt. Vernon Military Academy, which still exists as the Morgan Park Academy, on 111th Street between Hoyne and Bell Avenues. The military academy's headmaster lived in the





house at 2203 W. 111th Street, which was built during the 1870s. Dwight Perkins designed a fieldhouse, located at 2147 W. 112th Street, for the Academy in 1900. The exclusive Chicago Female College was established in 1875, but has been demolished.

In 1877 the Blue Island Company convinced the Baptist Union Theological Seminary to move to Morgan Park from the Douglas area of Chicago. By 1879 its well-regarded faculty included William Rainey Harper, who later became the first president of the University of Chicago (Keating 2008:216). The seminary was located near the present day intersection of 11th Street and Western Avenue, a block west of the Morgan Park Academy. According to an early guidebook, the seminary, together with the Morgan Park Military Academy and the Chicago Female College, "formed the chief attraction of the place" (Pacyga and Skerrett 1976:536). Morgan Park received its first Baptist Church in 1874 at 110th Street and Bell Avenue (replaced by a new church begun in 1896). With the arrival of the Baptist Union Theological Seminary in 1877, Morgan Park Baptist Church became one of the most powerful institutions in the community.

During these early years, the Blue Island Company sponsored land auctions and advertised in Chicago newspapers and building journals. An 1889 publication of Morgan Park boosters noted that the village was "much superior to other localities" because it was "near enough to Chicago and sufficiently far removed to afford all the blessings of a Suburban Home with all the conveniences and advantages of the city, far from all its objectionable features." The scenery was an added attraction. Set on a ridge 100 feet above Lake Michigan, it was claimed to be in "semi-mountainous" country, on "the oak-shaded heights of the Blue Island plateau" (Mayer and Wade 1969:170).

Italianate mansions from the early 1870s are located along the ridge at 11347 S. Lothair Avenue and at 11410 S. Longwood Drive. More modest houses from the same period include those at 10934 S. Prospect Avenue, 10970 S. Prospect Avenue, and 2204 W. 111th Street. Reflecting its origins as a Baptist community, Morgan Park prohibited the sale of liquor in the area between Western and Vincennes Avenues when it was incorporated as a village in 1882. Its middle-class character was further reinforced by the construction of other mainline protestant churches, among them Methodist (1888), Episcopalian (1889), Congregational (1890), and Presbyterian (1891), rivaling in size and influence the earlier Morgan Park Baptist Church (Keating 2008:217). For decades, village life centered on its churches; Morgan Park developed a reputation as a temperance town.

Prospect Avenue became Morgan Park's most fashionable street during the 1880s and 1890s, although elaborately designed homes were also built on nearby streets. Examples of the Queen Anne style include an 1888 house at 10920 S. Oakley Avenue and an 1892 house at 11156 S. Longwood Avenue. Local architect Harry Hale Waterman developed a distinctive picturesque style, exemplified by houses at 10838 S. Longwood Drive (1892) and 2023 W. 108th Place (1894). Among those who built homes in the village were executives of the Rock Island line, the Chicago stockyards, and the Chicago Bridge and Iron Company, which opened in 1889 on nearby Vincennes Avenue.





By the late 1880s, 2,800 people lived in Morgan Park (Chicago Fact Book Consortium 1995:210) and the community received regular commuter service to downtown Chicago via the Rock Island Railroad's branch commuter line, the tracks of which were situated to the west of the railroad's main line. Monterey Avenue became the community's commercial center, concentrated around the railroad's Queen Anne style depot at the intersection of 11th Street and Hale Avenue (1890). The year 1890 also saw the completion of Esmond Public School, a substantial three-story, brick edifice at the intersection of Montvale and Home Avenues, and the Walker Library at 11071 S. Hoyne Avenue. The Walker Library was donated by George C. Walker, President of the Blue Island Land and Building Company, and designed in the Richardsonian Romanesque style by noted Chicago architect Charles Frost.

Despite these clear signs of growth, Morgan Park lost its bid to become the home of the University of Chicago, which settled in Hyde Park. After the Baptist Theological Union left Morgan Park in 1892, its buildings were used by Morgan Park Military Academy. During the 1890s The Budget, a local newspaper, advocated streetcar connections with nearby communities as the way to build up Morgan Park. Although service along Vincennes Avenue began in 1896, Morgan Park and its twin community of Beverly to the north remained isolated from the expanding city (Pacyga and Skerrett 1976:537).

Morgan Park Development: 1900 to 1950

The battle over annexation to Chicago, which began in 1911, sharply divided the community and dragged on in court until 1914, finally passing with a margin of only 15 votes (Chicago Fact Book Consortium 1995:210). The building boom that occurred in Morgan Park between 1910 and 1930 reinforced earlier patterns of settlement and the community remained suburban in character. No saloons, factories, or businesses were allowed along the ridge, and developers took care to remove "only trees that actually interfere with building" (Pacyga and Skerrett 1976:539). The community lacked industry, major commercial thoroughfares with heavy traffic, and recreational amenities such as movie palaces or dance halls. Community leaders believed that streetcar lines threatened the exclusivity of the area and consequently streetcars were not extended along Western Avenue to Morgan Park until the 1930s.

Morgan Park's small town character remained appealing to many, and residential growth increased as existing subdivisions were re-divided and new subdivisions were platted west of Western Avenue and south of 115th Street. The Classical Revival style Morgan Park High School opened in 1916 at 11th Street and Vincennes Avenue. The community's growing population, which increased from 7,780 to 12,747 between 1920 and 1930 (Keating 2008:216), necessitated a high school addition in 1925 that featured a new gymnasium, auditorium, and natatorium. Monterey Avenue remained the community's commercial center during this period, although retail strips along 95th Street to the north and along Michigan Avenue to the east, in the Roseland community, also attracted shoppers.

Many of the homes erected during the early 20th century reflected the popular Craftsman style of the period, which was used for both frame bungalows and American Foursquare homes. Builders constructed brick Chicago Style Bungalows as well as more elaborate homes in a variety of





historical styles, with Tudor and Colonial Revival being especially popular. Although a few apartment buildings were erected, Morgan Park remained primarily a community of single-family homes.

During the 1920s Longwood Drive emerged as the area's most prestigious street, eclipsing Prospect Avenue as the main north-south thoroughfare. Many elaborate homes were also built along Hoyne Avenue between 111th and 112th Streets. Sidewalks, shade trees, and carefully tended lawns enhanced Morgan Park's high quality housing. Longwood Drive was also the setting for several prominent churches including the brick Gothic Revival style Morgan Park Methodist Church at 11030 S. Longwood Drive. Built in 1913 and designed by Henry H. Waterman, the church received a 1927 addition designed by Dwight Perkins. A Gothic Revival style stone Presbyterian Church was designed by Anders Lund and erected at 11052 S. Longwood Drive in 1933.

Whereas Morgan Park's Protestants tended to live and worship in the oldest part of the neighborhood, in 1904 a small community of French immigrant Roman Catholics established Sacred Heart Church at 11652 S. Church Street. The largely Irish Roman Catholic parishes of St. Cajetan at 2445 W. 112th Street (1927) and St. Walter at 11722 S. Oakley Street (1953) drew most of their congregations from the area west of Western Avenue.

Morgan Park was also home to a small but growing middle class African-American community during this period, which had established itself in the area between Vincennes Avenue and Halsted Street in the late 19th century. In 1921 the Chicago Commission on Race Relations reported that whites and blacks in Morgan Park "maintain a friendly attitude," but it also noted "there seems to be a common understanding that Negroes must not live west of Vincennes Road" (Pacyga and Skerrett 1976:540). Public institutions such as the Morgan Park High School and the Walker Branch Public Library, however, were integrated. The African-American population in Morgan Park increased from 12 percent in 1920 to 35 percent in 1930. Other residents were mostly of English, German, Swedish, and Irish descent, with only a small proportion of foreign-born residents (Chicago Fact Book Consortium 1995:210).

Morgan Park Development: 1950 to Present

Morgan Park experienced a residential building boom following World War II as the community developed areas along its fringes and subdivided some of the large lots in the older area of the community for single-family homes. The community maintained a stable residential population and continued to be "dry," a prohibition demanded by early Baptist settlers and upheld by Catholic newcomers. By 1960 an increase in the number of Irish residents made them the predominant group, followed by those of German, English, and Swedish descent. The South Side St. Patrick's Day parade down Western Avenue, organized in 1979, has become a symbol of the large Irish population and the Catholic presence in the ridge area that stretches north to the neighboring Beverly community.

The Morgan Park Military Academy dropped the military aspect of its program in 1950 and is today a private coeducational grammar school and high school that attracts students from all over the South Side of Chicago and neighboring suburbs. Monterey Avenue remained the business





center of old Morgan Park until the 1970s. After urban renewal, all that remain of the former commercial district are the post office, police station, train station, and a few stores west of Hale Avenue.

During the late 1960s the I-57 Expressway had effectively isolated the older black settlement east of Vincennes Avenue. Between 1960 and 1970 Morgan Park's population peaked at more than 31,000 due to an over 50 percent increase in the number of African-Americans (Chicago Fact Book Consortium 1995:210). Perhaps the greatest change to Morgan Park's urban landscape involved the construction of nearly 400 "Section 235" subsidized housing units between 1969 and 1974, the largest number built in any Chicago neighborhood. Most of these homes—which were modern versions of the 19th-century workers cottage—were built along Vincennes Avenue, south of Morgan Park High School (Pacyga and Skerrett 1976:544).

During the 1970s the Beverly Area Planning Association, comprising civic groups from both Morgan Park and neighboring Beverly, succeeded in halting panic peddling by unscrupulous real estate dealers to avoid the rapid racial turnover experienced by other Chicago South Side neighborhoods. As a result, by the mid-1970s home values in both communities had stabilized and began to rise. The African-American population rose to 63 percent in 1980 and then slowed. Today Morgan Park has both integrated and racially segregated areas: the population east of Ashland is nearly all black; the population west of Western Avenue is nearly all white; and the area in between is mixed (Chicago Fact Book Consortium 1995:210).

Residents of both Morgan Park and Beverly began to jointly promote their shared architectural heritage of historic homes along the ridge through the leadership of the Beverly Area Planning Association, which sponsored home tours that continue to attract thousands of Chicagoans each year. The establishment of the Ridge Historical Society in 1971 sparked an interest in the past of Morgan Park and Beverly with its museum at 10616 S. Longwood Drive. The Society has identified landmark homes throughout the area over the past several decades and established an oral history program and archives.

Today Morgan Park's winding, tree-shaded streets display a rich array of residential architecture. The Ridge Historic District, listed on the NRHP in 1975, is centered on Longwood Drive, running from 87th to 115th Streets and linking the center of Morgan Park to the Beverly community area to the north. In 1981 the Longwood Drive District became a designated City of Chicago landmark district. This narrow, 12-block-long district extends along Longwood Drive between 98th and 110th Streets and also along Seeley Avenue between 102nd and 107th Streets. Both districts feature intact collections of homes dating from the 1870s through the 1920s that display a wide variety of architectural styles including the Italianate, Queen Anne, Tudor Revival, Colonial Revival, French Provincial, Craftsman, and Prairie. Morgan Park remains a stable, largely integrated, middle-class neighborhood that boasts the Beverly Arts Center's complex for the performing arts, which was built in 2002 at 2407 W. 111th Street and has sparked redevelopment at the intersection of 111th Street and Western Avenue.





5.3.2 Surveyed Resources

As part of the fieldwork for the RLE Project, 13 buildings within the Morgan Park portion of the APE were surveyed. These properties, along with their construction date and an assessment of their eligibility for listing on the NRHP, are presented in Table 5-3, alphabetized by street name. No properties were determined individually eligible. A series of maps in Appendix A graphically presents these findings; individual inventory sheets for surveyed properties are presented in Appendix B.

Address	Year Built	Description	Eligibility
808 W 111th Street or 11050 S. Halsted Street	1982	Commercial	Modern
10701 S. Green Street*	1950	Single-Family	Not Eligible
10757 S. Green Street*	1947	Single-Family	Not Eligible
10829 S. Green Street*	1948	Single-Family	Not Eligible
10901 S. Green Street*	1948	Single-Family	Not Eligible
11001 S. Green Street	1942	Single-Family	Not Eligible
11039 S. Green Street	1942	Single-Family	Not Eligible
11121 S. Green Street	1959	Multi-Family	Not Eligible
11247 S. Green Street	1950	Single-Family	Not Eligible
11359 S. Green Street	1951	Single-Family	Not Eligible
11038 S. Halsted Street	1977	Commercial	Modern
11200 S. Halsted Street	1925	Commercial	Not Eligible
11320-11322 S. Halsted Street	1962	Modernistic Mixed-Use Building	Not Eligible

* Surveyed property within proposed Green Street Historic District

Of the 13 buildings surveyed within the Morgan Park portion of the RLE APE, none were identified as eligible for listing on the NRHP. Generally, these properties have had alterations that compromise their historic integrity or do not feature a level of distinctive architectural detailing necessary to qualify for the NRHP. A portion of the Green Street Historic District, which was identified as NRHP eligible, falls within the Morgan Park community. A description of the resource is presented in **Section 5.1.2.1**.

5.4 West Pullman Community

The following subsections include a description of the historic context for the development of the West Pullman community (**Section 5.4.1**) and an overview of historic properties that were surveyed (**Section 5.4.2**). No NRHP-listed sites or districts fall within the RLE APE in the West Pullman community.





5.4.1 Historic Context

The West Pullman community, approximately 16 miles south of Chicago's Loop, is bounded by 115th Street to the north, 123rd Street and the Little Calumet River to the south, Front Street and railroad tracks to the east, and Ashland Avenue, Halsted Street, and Morgan Street (city limits) to the west.

West Pullman Development in the 19th Century

The first settlers in the area known as West Pullman were civil engineer and land surveyor David Andrews and his wife Caroline, who married in 1840 and established a 360-acre farm near the northeast corner of the future community. The couple only had two neighbors who were about 3 miles away, and at that time, "prairie wolves, deer, and prairie chickens abounded, and occasionally a lynx was seen" according to A. T. Andreas in his *History of Cook County* (1884:603). The first signs of change arrived in 1852, when the Illinois Central and Michigan Central Railroad companies established the Calumet Station at the present intersection of 115th Street and Cottage Grove Avenue. A settlement grew slowly around the Calumet Station and came to be called Kensington. It initially consisted of a general store and saloon at the corner of Front Street and Kensington Avenue, wood shanties, and a boarding house inhabited by men working on freight handling for the railroads.

Kensington became part of the Village of Hyde Park in 1867. Ten years later, the small community comprised only about 20 houses; however, Kensington's population would soon more than quadruple, from 250 in 1880 to 1,280 in 1883. This sudden growth was due to the establishment of the Pullman Palace Car Factory as well as other industries, such as the Chicago Forge Company Works at 116th Street and Cottage Grove Avenue. Kensington's boundaries came to encompass the area bounded by 115th and 125th Streets, between State Street and the Illinois Central tracks. Some of the more prominent residents who arrived in the community during this decade were from the East Coast. They included native New Yorkers Thomas Gaines, proprietor of the Gaines Hotel, A. Burchard, a physician who established a large medical practice in the community, and various other merchants who created commercial enterprises (Andreas 1884:604-606).

In 1881, the Gano Company of Cincinnati purchased and subdivided a large tract of land that was part of Calumet Township, just west in Kensington. This subdivision, then called Gano, extended from 115th Street to 119th Street, between State Street and Wentworth Avenue. In 1888, the Village of Gano was organized and withdrawn from control of Calumet Township. The new village extended from 115th Street to the Little Calumet River, between State and Halsted Streets, but was only very sparsely settled along its eastern portion. The area beyond the initial Gano subdivision boundaries comprised open prairie and farmland, including what would become the West Pullman residential district. Kensington was annexed to Chicago in 1889 and Gano's need to secure municipal services led its residents to seek annexation the following year (Chicago Fact Book Consortium 1995:161).

The name West Pullman came to the current community area in the 1890s following the West Pullman Land Association's November 1891 purchase of 480 acres of farmland that encompassed





much of the former Village of Gano (West Pullman Land Association 1900:3). This initial parcel was between 119th and 123rd Streets, from Wentworth Avenue to Halsted Street. By January 1893, the Land Association purchased additional tracts of undeveloped land that extended their original holdings west to Ashland Avenue, between 115th and 123rd Streets. The land was platted to include an industrial district west of Halsted Street, workers' housing in the center with a commercial strip along Halsted Street, and a district called Stewart Ridge for the "finer class of residence" to the east. The Association aimed to create an industrial village to rival and even surpass the already established town of Pullman to the northeast, as was clear by the comments made by director H. D. Patton at a May 17, 1893 groundbreaking for the Whitman and Barnes Company:

"You are in the center of what will be the greatest manufacturing district in the world, and I predict that in time this suburb will outgrow the beautiful citadel to the east, that it will eventually be known as east Pullman and this place will take the parent name (*Chicago Tribune* 1893c)."

Whitman and Barnes, whose large facility encompassed 19 buildings, was one of two manufacturers of agricultural implements that moved to West Pullman in 1893. The other was the Plano Manufacturing Company, which relocated from Plano, Illinois to a sprawling facility on its 25-acre tract in West Pullman. The *Chicago Tribune* (1893b) estimated that Plano Manufacturing would employ 1,500 workers. Other early industries located in West Pullman's factory district by 1893 were the Illinois Electrical Forging Company, the White and Ballard Shoe Company, the Burgland & Sheal Woodenware Company, and the West Pullman Lumber Company. They were joined by the end of the decade by others including the Chicago Malleable Casting Company, the Chicago Pail Company, the Inglis Photographic Supply Company, the Phoenix Boot and Shoe Company, and the Chicago Brass Bed Factory (West Pullman Land Association 1900:8-9).

The West Pullman Land Association had phenomenal success in attracting both industry and workers to its industrial village at the southern outskirts of Chicago due to a range of transportation improvements. The Illinois Central constructed its Blue Island Branch westward along 121st Street and located three stations within West Pullman, including one in the midst of the Stewart Ridge residential district, one at Halsted Street, and one within the factory district. The Pittsburg, Cincinnati, Chicago & St. Louis (known as the Pan Handle of the Pennsylvania railway system) already crossed the property from north to south and established passenger and freight stations at 119th and 120th Streets. The Chicago, Rock Island & Pacific Railway Company arriving from the west established its freight station at Morgan and 119th Streets. The Land Association constructed and controlled a terminal railway system connecting these three trunk lines to ensure they reached all parts of the factory district. The Illinois Central's passenger service from West Pullman ran an express train north to 67th Street that reached the Loop in 38 minutes. Additional passenger service along Michigan Avenue was provided by the Calumet Electric Railway, which was extended south from 115th Street to 119th Street and then westward along 119th Street to Halsted in 1893 (West Pullman Land Association 1900:8-9, 16; Chicago Tribune 1893a). West Pullman was annexed to the City of Chicago in 1895.





Many executives of the West Pullman Land Association and of the community's various industries resided in the community's Stewart Ridge district, which was about a mile east of the factory district, around the Illinois Central's station at the intersection of Stewart and 121st Streets. Streets on either side of Stewart, such as Harvard and Princeton Avenues to the east and Eggleston and Normal Avenues to the west, featured large, architect-designed homes of various styles built between the 1890s and the early 1900s. The homes at 12134 S. Eggleston Avenue (1896), 12112 S. Normal Avenue (1895), and 12021 S. Stewart Avenue (1896) are representative of this period of development.

Outside the Stewart Ridge district, 19th century residential development throughout West Pullman—including the earlier Kensington and Gano communities of the 1880s—featured workers' housing with modest one- to two-story, gable-roof, frame cottages and homes. An Italianate style home at 605 W. 116th Street (1880s) is among the extant homes from West Pullman's earlier period of development. By 1893 the West Pullman Land Association had built nearly 300 speculative homes and also had sold lots to individuals and builders, providing for some variety in the stock of workers' homes erected during this decade of rapid growth. A promotional booklet developed by the Land Association wrote that this area provided "every opportunity for cheap, good and contented living," noting the following:

"The property there is of low price, ranging from \$350 to \$500 per lot; and if a home-seeker lacks either the means or the inclination to build, a company having capital and surplus of \$200,000 and especially organized for this purpose, stands ready to construct such a home as may be desired, to be paid for on the monthly installment plan (West Pullman Land Association 1900:24)."

Nineteenth-century workers who flocked to West Pullman's newly established industries were a multi-ethnic mix of French, Dutch, Swedish, Irish, and German immigrants who established their own churches and parochial schools. These included St. Louis de France Church (later called St. Ambrose), established by the French community in the 1880s at 117th and State Streets; the Irish St. Catherine of Genoa Church at 118th and Lowe Streets (founded 1890s); the Polish St. Salomea Catholic Church at 118th Street and Indiana Avenue (founded 1890s); and the Norwegian Nazareth Lutheran Church at the corner of 118th and Yale Streets (founded 1890s). Two large public schools were also built in West Pullman during the 1890s for its rapidly growing population: the Romanesque Revival style West Pullman School at 11919 S. Parnell Avenue (1894) and the Classical Revival style Thomas Scanlon School at 11721 S. Perry Avenue (1897; now the Songhai Learning Institute); both feature Classical detailing.

West Pullman residents were served by community commercial districts that sprang up along Michigan Avenue, between 115th and 119th Streets to the east, and around the intersection of 119th and Halsted Streets to the west. Historic photos show that 19th century commercial buildings erected in these areas were typically one to three stories in height, mainly faced in brick, with storefronts on the ground level and apartments above. Detailing was restrained and included stone lintels and sills, storefront surrounds of stone or terra cotta, and stone or metal cornices or





parapets. Most of the commercial buildings were not designed in a specific architectural style, but often included details from a style such as the Queen Anne, Romanesque, or Classical Revival.

An 1893 *Chicago Tribune* article that discussed a tour of West Pullman by a number of dignitaries noted, "Halsted Street is the principal business thoroughfare, and considerable favorable comment was indulged in at the amount of business now carried on and the number of business blocks that have been built since the suburb sprang into existence a year ago" (1893c). Another article from the same year that highlighted the construction of a new commercial block at the corner of 119th Street and Lowe Avenue reported, "There is demand for business houses, and especially for hotels and boarding houses, to accommodate the increasing population" (*Chicago Tribune* 1893d). The Enright Block at the corner of Emerald Avenue and 120th Street was "rapidly filled with businesses: a tailor store, grocery, printing office, bakery, and millinery store being among the number" (*Chicago Tribune* 1893e).

West Pullman Development: 1900 to 1950

The early 20th century brought a wave of Eastern European immigrants that included Lithuanians, Poles, Hungarians, Armenians, and Czechoslovakians. After World War I, many Italians arrived. These new residents built their own churches and ethnic institutions, and in some cases older groups expanded their existing institutions. In 1903 the Italian community built the Renaissance Revival style St. Anthony of Padua Church at 1153 S. Prairie Avenue.

The Lithuanian community built S.S. Peter and Paul Catholic Church at 123rd Street and Emerald Avenue in 1914 (now St. Titus Missionary Baptist Church), which features Romanesque Revival style detailing. In 1928 the Irish parish of St. Catherine of Genoa replaced its earlier church with a Renaissance Revival style edifice at the corner of 118th Street and Lowe Avenue, and also added an elementary school and convent during this period.

West Pullman saw the erection of two church complexes—Assumption of the Blessed Virgin Mary and St. Salomea—built by its large Polish community in the early 20th century. The Assumption Blessed Virgin Mary Society, which had been founded in 1895, built a frame church in 1904 at 123rd Street and Parnell Avenue. In 1907, the parish built a brick rectory at 544 W. 123 Street and converted its old rectory at 12240 S. Parnell Avenue into classrooms. A convent was built at 12242 S. Parnell Avenue in 1919 (now demolished) and 4 years later, a brick church/school building was erected at 12238 S. Parnell Avenue to accommodate the needs of the rapidly growing parish (now Glory to the Holy Family Baptist Church). At that time, the former frame church was remodeled as a parish hall (now demolished) (Polish Genealogical Society of America 2012). In 1911, St. Salomea parish built an imposing Gothic Revival style church at the corner of 118th Street and Indiana Avenue in West Pullman's Kensington neighborhood and also erected an adjacent rectory and elementary school.

Corporate officers continued to reside in the Stewart Ridge district, where larger than average homes of varying styles continued to be built through the early 1900s. The most notable home in this district was designed by Frank Lloyd Wright for Stephen A. Foster, a director of the West Pullman Land Association (1900). The Stephen A. Foster House and Stable at 12147 S. Harvard





Avenue, a designated Chicago landmark, shows Wright's interest in Japanese architecture during the years he was developing his Prairie style (Chicago Historical and Architectural Landmarks 1996). The Queen Anne style home at 12225 S. Harvard Avenue (1905) and the Colonial Revival style home at 12204 S. Stewart Avenue (1903) are representative of this period in the Stewart Ridge neighborhood's development.

The West Pullman Land Association went bankrupt in 1908 during an economic downturn, but residential development continued sporadically with mainly gable-roofed frame cottages, Craftsman style bungalows, and some multi-family two-flats and small apartment buildings. The community received an important recreational amenity with the establishment of the 15-acre West Pullman Park in 1915. The park—which extends from 123rd to 124th Street, between Princeton and Normal Avenues—included tennis courts, baseball diamonds, and a one-story brick field house that offered a range of civic education and social welfare programs in its early years.

In 1920, West Pullman had a population of 23,019 and still featured large areas of undeveloped land. This was to change during the citywide construction boom of the 1920s, during which vacant parcels throughout the community were improved with bungalows and two-flat residential buildings in frame and brick, homes designed in the popular American Foursquare style, and small brick apartment buildings. By 1930 West Pullman's population reached 28,000. Commercial streets continued to develop with buildings such as the Classical Revival style State Bank of West Pullman at 622 W. 120th Street (1919; John Hetherington), now Lively Stone Apostolic Church. In 1927–28, two additional parcels of industrial land along the Calumet River were annexed to Chicago, completing the land area of the present West Pullman community (Chicago Fact Book Consortium 1995:161). Many developers of new subdivisions in the community placed restrictions on their property that prohibited its purchase by African-Americans, contributing to a concerted effort among residents to keep Pullman white. Some employers hired only white workers; International Harvester refused to hire African-Americans at its West Pullman works until mandated to do so during World War II (Keating 2008:298-299).

West Pullman Development: 1950 to Present

West Pullman's population rose from 29,000 in 1950 to 35,000 in 1960, a period in which Poles, Italians, and Germans predominated among the whites who constituted nearly 100 percent of the community's population (Chicago Fact Book Consortium 1995:161). Vacant lots throughout the community and along its undeveloped southern and western edges were improved during the post-War period with suburban style tract homes and split-level homes. Duplexes were also built, especially on the south, north, and west sides of the factory district. Starting in the 1960s, some of the vacant land on West Pullman's western edges, such as the Maple Park subdivision, finally opened to African-Americans. Gradually, African-Americans began moving into other West Pullman neighborhoods, although racial turnover in the next decade was accompanied by brewing social unrest. By 1980, 90 percent of West Pullman's 45,000 residents were African-American. This figure rose to 94 percent by 1990 (Chicago Fact Book Consortium 1995:161).



The collapse of the South Side's industrial base, starting in the 1970s, led to a rapid decline of West Pullman's economic fortunes. Industries such as the Pullman Company, Wisconsin Steel, International Harvester, and Dutch Boy Paint Company that once hired numerous West Pullman residents closed their doors. Other industries such as Carl Buddig and Ingersoll Products dramatically reduced their work forces. Layoffs and plant shutdowns made it difficult for many residents to continue payments on their homes, which had been acquired through loans from HUD. After owners defaulted, many HUD homes were foreclosed. By 1982 the Greater Roseland Organization began rehabilitating HUD homes in the northeastern area, where the housing stock is the oldest. Continued depressed economic conditions during the 1980s contributed to the demolition of 450 homes by the end of the decade (Chicago Fact Book Consortium 1995: 161). In 1985 West Pullman received a major new institution when Christ Universal Church was built on a 32-acre parcel at 119th Street and Ashland Avenue. (Buursma 1985).

By the 1990s West Pullman's once thriving industrial district west of Halsted Street featured large tracts of vacant land, blighted or underutilized buildings, deteriorated infrastructure, and substantial environmental contamination, which served as major impediments to redevelopment and new industrial investment. In response to this situation, in 1998 the City of Chicago created the 220-acre West Pullman Industrial Park TIF, which aims to foster the area's revitalization through site assembly efforts, soil remediation projects, and numerous infrastructure improvements. The TIF District also supports job training and relocation costs (Friedman & Co. 1997:1).

Some important developments within the West Pullman Industrial Park TIF District boundaries since its designation include the redevelopment of a 39-acre brownfield parcel around the 1000 block of 120th Street—formerly the home of International Harvester's West Pullman Works and the Dutch Boy Paint factory—as a solar energy facility by Chicago-based Exelon and SunPower, a California energy company. Opened in 2010, the parcel is the largest urban solar panel plant in the nation, capable of providing electricity for as many as 1,500 homes. Just a couple of blocks east of this ambitious project is the new West Pullman Branch of the Chicago Public Library at 830 W. 119th Street. Perhaps the most important project in terms of its direct effect on a large number of residents is the \$160 million Ray and Joan Kroc Community Center, which opened in 2012 on a 33-acre site at 1250 W. 119th Street. The multi-purpose center features an aquatics center, a performing arts center, a soccer field, and other recreational activities, as well as job training classes (Bryne 2012).

Adjacent to the West Pullman Park Industrial TIF District is the 183-acre 119th/Halsted TIF District, which was designated by the City of Chicago in 2002. The TIF District includes the stretch of Halsted Street from 113th to 123rd Street, as well as stretches of 119th, 120th, and 121st Streets east of Halsted Street. The area encompassed by the 119th/Halsted TIF District consists of commercial, residential, industrial, and mixed-use property. It also includes Metra's electric rail commuter line along 121st Street with a commuter station on Halsted and 121st Streets. By the 1990s, this area was characterized by blighted and vacant buildings and large amounts of vacant land created through building demolition. The TIF District aims to foster a viable business district along Halsted Street at its intersections with 115th and 119th Streets, while promoting the





development of affordable rental and for-sale housing along portions of 1119th and 120th Streets. The TIF District also supports the creation of a pedestrian/bike trail along the former Penn Central Railroad ROW, which was purchased by the Chicago Department of Transportation (Camiros, Ltd. 2001, 2003:5-6, 15).

Small portions of land along West Pullman's western edge are included within the 119th/I-57 TIF District designated by the City of Chicago in 2002 to enable new development at key sites within the Morgan Park community. The West Pullman portions of this TIF District include 111th Street between Ashland and Racine Avenues, and the parcel roughly bounded by 119th and 123rd Streets, between Ashland Avenue and Loomis Street. Homeowners within both the 119th/Halsted TIF District and the 119th/I-57 TIF District are eligible for home repair grants through the City's TIF District-Neighborhood Improvement Program, which is administered through HUD. In recent years, new homes have been built along West Pullman's western edge near Christ Universal Church, including a gated community called Renaissance Estates in the Victory Heights neighborhood.

5.4.2 Surveyed Resources

As part of the fieldwork for the RLE Project, 172 buildings within the West Pullman portion of the APE were surveyed. These properties, along with their construction date and an assessment of their eligibility for listing on the NRHP, are presented in Table 5-4, alphabetized by street name. Properties determined individually eligible are highlighted. A series of maps in Appendix A graphically present these findings; individual inventory sheets for surveyed properties are presented in Appendix B.

Address	Year Built	Description	Eligibility
1 W. 115th Street	1907	Queen Anne Style Mixed-Use	Not Eligible
17 W. 115th Street	1897	Greystone Flat	Not Eligible
23 W. 115th Street	1883	Single-Family (vacant)	Not Eligible
35 W. 115th Street	1936	Commercial	Not Eligible
143 W. 115th Street	1911	Single-Family	Not Eligible
738 W. 116th Place	1925	Craftsman Style Residence	Not Eligible
8 E. 116th Street	1908	Single-Family	Not Eligible
12 E. 116th Street	1913	Multi-Family Not Eligible	
16 E. 116th Street	1902	Single-Family Not Eligible	
20 E. 116th Street	1893	Queen Anne Style Single-Family Not Eligible	
32 E. 116th Street	1922	Garage	Not Eligible
36 E. 116th Street	1918	Flat	Not Eligible
38 E. 116th Street	1888	Multi-Family Not Eligible	
144 E. 116th Street	1888	Single-Family	Not Eligible
150 E. 116th Street	1891	Single-Family	Not Eligible

Table 5-4: 172 Surveyed Properties in West Pullman





Address	Year Built	Description	Eligibility
151 E. 116th Street	1898	Multi-Family	Not Eligible
153 E. 116th Street	1898	Multi-Family	Not Eligible
155 E. 116th Street	1903	Single-Family	Not Eligible
157 E. 116th Street	1898	Multi-Family	Not Eligible
159 E. 116th Street	1903	Single-Family	Not Eligible
163 E. 116th Street	1898	Multi-Family	Not Eligible
165 E. 116th Street	1898	Single-Family	Not Eligible
207 E. 116th Street	1888	Multi-Family	Not Eligible
742 W. 116th Street	1919	Single-Family	Not Eligible
120 E. 117th Place	1908	Single-Family	Not Eligible
736 W. 117th Place	1946	Single-Family	Not Eligible
126 E. 117th Street	1898	Multi-Family	Not Eligible
128 E. 117th Street	1908	Single-Family	Not Eligible
132 E. 117th Street	1908	Single-Family	Not Eligible
149 E. 117th Street	1908	Craftsman Style Residence	Not Eligible
312 E. 117th Street	1891	Single-Family	Not Eligible
322 E. 117th Street	1878	Single-Family	Not Eligible
345 E. 117th Street	1903	Single-Family	Not Eligible
742 W. 117th Street	1925	Craftsman Style Residence	Not Eligible
306 E. 118th Street	1898	Single-Family Not Eligi	
354 E. 118th Street	1886	Single-Family	Not Eligible
737 W. 118th Street	1897	Multi-Family	Not Eligible
834 W. 118th Street	1909	Single-Family	Not Eligible
738 W. 119th Street	1893	Multi-Family	Not Eligible
829-837 W. 119th Street	1971	Commercial	Modern
846 W. 119th Street	1915	Industrial	Not Eligible
918 W. 119th Street	1925	Multi-Family	Not Eligible
956 W. 119th Street	1906	Religious	Not Eligible
820 W. 120th Street	1968	Industrial	Modern
931 W. 120th Street	1897-1911	Fire Department, Engine Co. 115	Eligible
1455 W. 120th Street	1919	Single-Family	Not Eligible
738 W. 129th Place	1951	Single-Family	Not Eligible
743 W. 129th Place	1952	Single-Family	Not Eligible
814 W. 129th Place	1953	Single-Family Not Eligible	
817 W. 129th Place	1956	Single-Family Not Eligible	
1215 S. Ada Street	2000	Industrial	Modern
12015 S. Bishop Street	1914	Single-Family	Not Eligible
12050 S. Bishop Street	1889	Single-Family	Not Eligible





Address	Year Built	Description	Eligibility
11727 S. Calumet Avenue	1893	Single-Family	Not Eligible
11824 S. Emerald Avenue	1927	Multi-Family	Not Eligible
12012 S. Emerald Avenue	1904	Multi-Family	Not Eligible
12110 S. Emerald Avenue	1949	Single-Family	Not Eligible
12206 S. Emerald Avenue	1923	Craftsman Style Residence	Not Eligible
12254 S. Emerald Avenue	1904	Multi-Family	Not Eligible
12300 S. Emerald Avenue	1915	Mixed-Use	Not Eligible
12350 S. Emerald Avenue	1931	Craftsman Style Residence	Not Eligible
12400 S. Emerald Avenue	1924	Craftsman Style Residence	Not Eligible
12446 S. Emerald Avenue	1950	Single-Family	Not Eligible
12552 S. Emerald Avenue	1942	Single-Family	Not Eligible
12608 S. Emerald Avenue	1925	Single-Family	Not Eligible
12650 S. Emerald Avenue	1943	Single-Family	Not Eligible
12706 S. Emerald Avenue	1957	Single-Family	Not Eligible
12814 S. Emerald Avenue	1952	Single-Family	Not Eligible
12842 S. Emerald Avenue	1954	Single-Family	Not Eligible
12904 S. Emerald Avenue	1955	Single-Family	Not Eligible
11730-11736 S. Front Avenue	1952-1962	Industrial Complex	Not Eligible
12143 S. Green Street	1909	Flat Not Eligi	
12257 S. Green Street	1911	Single-Family	Not Eligible
12713 S. Green Street	1953	Single-Family	Not Eligible
12817 S. Green Street	1952	Single-Family	Not Eligible
12819 S. Green Street	1952	Single-Family	Not Eligible
12823 S. Green Street	1952	Single-Family	Not Eligible
12825 S. Green Street	1952	Single-Family	Not Eligible
12829 S. Green Street	1952	Single-Family	Not Eligible
12831 S. Green Street	1952	Single-Family	Not Eligible
12835 S. Green Street	1952	Single-Family	Not Eligible
12837 S. Green Street	1952	Single-Family	Not Eligible
12851 S. Green Street	1951	Single-Family	Not Eligible
12877 S. Green Street	1952	Single-Family	Not Eligible
11600 S. Halsted Street	1962	Commercial Not Eligibl	
11601 S. Halsted Street	1987	Commercial Modern	
11642 S. Halsted Street	1925	Chicago Style Bungalow Not Eligible	
11753 S. Halsted Street	1914	Craftsman Style Residence Not Eligible	
11756 S. Halsted Street	1931	Galloy & Van Etten Stone Contractors	Eligible
11763 S. Halsted Street	1904	Multi-Family	Not Eligible
11800 S. Halsted Street	1922	Former Coal Yard Storage	Not Eligible





Address	Year Built	Description	Eligibility
11932 S. Halsted Street	1893	Commercial	Not Eligible
11934-11938 S. Halsted Street	1926	Commercial	Not Eligible
11944 S. Halsted Street	1926	Mixed-Use	Not Eligible
11946 S. Halsted Street	1926	Commercial	Not Eligible
11948-11950 S. Halsted Street	1926	Former Feed Store	Not Eligible
11958 S. Halsted Street	1894	Mixed-Use	Not Eligible
12000 S. Halsted Street	1939	Art Deco Commercial	Not Eligible
12001-12003 S. Halsted Street	1894	Commercial	Not Eligible
12018 S. Halsted Street	1916	Mixed-Use	Not Eligible
12022 S. Halsted Street	1898	Mixed-Use	Not Eligible
12033 S. Halsted Street	1914	Multi-Family	Not Eligible
12048 S. Halsted Street	1901	Mixed-Use	Not Eligible
12142 S. Halsted Street	1942	Single-Family	Not Eligible
12155 S. Halsted Street	1920	Multi-Family	Not Eligible
12156 S. Halsted Street	1937	Commercial	Not Eligible
12212-12220 S. Halsted Street	1955	Commercial	Not Eligible
12217 S. Halsted Street	1928	Mixed-Use	Not Eligible
12246 S. Halsted Street	1929	Industrial	Not Eligible
12309 S. Halsted Street	1953	Commercial	Not Eligible
12345 S. Halsted Street	1959	Commercial	Not Eligible
12433-14239 S. Halsted Street	1958	S.S. Peter & Paul Catholic Church	Eligible
12717 S. Halsted Street	1952	Mixed-Use	Not Eligible
12730 S. Halsted Street	1957	Religious	Not Eligible
12746-12804 S. Halsted Street	1952	Commercial	Not Eligible
12747 S. Halsted Street	1968	Commercial	Modern
12801-12811 S. Halsted Street	1957	Commercial	Not Eligible
12825 S. Halsted Street	1970	Industrial	Modern
12841 S. Halsted Street	1955	Commercial	Not Eligible
12856-12900 S. Halsted Street	1952-1962	Religious	Not Eligible
11615-11617 S. Indiana Avenue	1964-1973	Public Building	Modern
11708 S. Indiana Avenue	1908	Multi-Family	Not Eligible
11709 S. Indiana Avenue	1908	Single-Family Not Eligible	
11715 S. Indiana Avenue	1908	Multi-Family Not Eligible	
11740 S. Indiana Avenue	1888	Single-Family (vacant) Not Eligible	
112 E. Kensington Avenue	1900	Flat	Not Eligible
121 E. Kensington Avenue	1900	Flat	Not Eligible
121 1/2 E. Kensington Avenue	1888	Multi-Family	Not Eligible





Address	Year Built	Description	Eligibility
133-139 E. Kensington Avenue	1925	Commercial Building (former Venetian Hall)	Eligible
11528 S. Lafayette Avenue	1889	Single-Family	Not Eligible
11532 S. Lafayette Avenue	1888	Single-Family	Not Eligible
11557 S. Lafayette Avenue	1883	Multi-Family	Not Eligible
12018 S. Loomis Street	1904	Single-Family	Not Eligible
11563-11565 S. Michigan Avenue	1900/1962	Industrial	Not Eligible
11592 S. Michigan Avenue	1888	Commercial	Not Eligible
11593 S. Michigan Avenue	1883	Mixed-Use	Not Eligible
11601-11603 S. Michigan Avenue	1966	Religious	Modern
11611 S. Michigan Avenue	1888	Multi-Family	Not Eligible
11835 S. Morgan Street	1971	Single-Family	Modern
9939 S. Normal Avenue	1939	Single-Family	Not Eligible
11701 S. Peoria Street	1904	Multi-Family	Not Eligible
11805 S. Peoria Street	1913	Flat	Not Eligible
11842 S. Peoria Street	1890	Single-Family	Not Eligible
12139 S. Peoria Street	1951	Industrial (vacant)	Not Eligible
11515 S. Perry Avenue	1965	Single-Family	Not Eligible
11516 S. Perry Avenue	1913	Craftsman Style Residence	Not Eligible
11521 S. Perry Avenue	1879	Multi-Family	Not Eligible
11630 S. Prairie Avenue	1898	Single-Family	Not Eligible
11632 S. Prairie Avenue	1888	Multi-Family	Not Eligible
11634 S. Prairie Avenue	1927	Multi-Family	Not Eligible
11718 S. Prairie Avenue	1885	Single-Family	Not Eligible
11814 S. Prairie Avenue	1926	Chicago Style Bungalow	Not Eligible
11801 S. Sangamon Street	1909	Religious	Not Eligible
11820 S. Sangamon Street	1904	Multi-Family	Not Eligible
11546 S. State Street	1901	Single-Family	Not Eligible
11548 S. State Street	1889	Single-Family	Not Eligible
11567 S. State Street	1908	Multi-Family (vacant)	Not Eligible
11569 S. State Street	1898	Single-Family	Not Eligible
11571 S. State Street	1898	Single-Family	Not Eligible
11573 S. State Street	1908	Single-Family	Not Eligible
11575 S. State Street	1908	Single-Family (vacant)	Not Eligible
11583 S. State Street	1926	Single-Family	Not Eligible
11594 S. State Street	1924	Religious Building	Not Eligible
741 W. Vermont Street	1954	Single-Family	Not Eligible
814 W. Vermont Street	1953	Single-Family	Not Eligible





Address	Year Built	Description	Eligibility
817 W. Vermont Street	1956	Single-Family	Not Eligible
821 W. Vermont Street	1956	Single-Family	Not Eligible
825 W. Vermont Street	1956	Single-Family	Not Eligible
11572 S. Wabash Avenue	1903	Multi-Family	Not Eligible
11573 S. Wabash Avenue	1910	Garage	Not Eligible
11574 S. Wabash Avenue	1922	Multi-Family	Not Eligible
11578 S. Wabash Avenue	1893	Multi-Family	Not Eligible

5.4.2.1 Resources Eligible for National Register of Historic Places

Of the 172 buildings surveyed within the West Pullman portion of the RLE APE, 4 were identified as eligible for listing on the NRHP. These are described briefly below.







Galloy & Van Etten Stone Contractors, 11756 S. Halsted Street

This two-story light industrial building in the West Pullman community was built in 1931 and is home to the Flagstone Veneer Stone/Galloy & Van Etten Inc. Cut Stone Contractors business. The building has a one-story wing at its south end; both the main building and wing have flat roofs. A line of buttresses divides the building's long Halsted Street elevation into a series of 13 bays; large windows have all been filled in with synthetic materials. One of these bays features an overhead garage door. The front (south) elevation of the one-story office wing has a hollow-core metal door with a filled in transom, three non-original one-over-one aluminum-sash windows, and two large window openings filled with concrete block. An additional flat-roofed one-and-a-half-story wing is situated along the rear of the main building block. Its west elevation features a series of windows and overhead doors. Detailing includes concrete stringcourses and applied letters.

Shown in Figure 5-11, this industrial building is eligible for NRHP listing under Criterion A for Industry. Dutch immigrant Abram Van Etten and his partner George Galloy established the stone fabricating company in 1899. It has been in operation at its current location for nearly 100 years. Located in a community that experienced a collapse of its industrial base in the 1970s and considerable disinvestment since that time, the building serves as an important and rare example of an early 20th century industrial building in West Pullman that retains its original use and ownership. It retains the majority of its original materials with the exception of fenestration along Halsted Street, where it appears that the windows have either been covered or removed.



Figure 5-11: South Facade of Galloy & Van Etten Industrial Building





Fire Department Engine Company 115, 931 W. 120th Street

This two-story firehouse in the West Pullman community was built circa 1897–1911 and has a flat roof and parapet. The building is shown in Figure 5-12. The front elevation is clad in brown face brick and has a centrally located overhead metal door flanked by single one-over-one windows on the first floor. Four non-original one-over-one windows are on the second floor. The overhead opening for the station's fire truck features a Classical stone surround with Ionic columns atop low pedestals, a frieze band incised with the words "Fire Department," and a pediment. Detailing includes a circular motif in stone, stone sills, sill courses, and a metal cornice. This is an excellent example of a neighborhood fire station that still functions in its original use and has very good integrity. It is individually eligible for listing on the NRHP under Criterion C.



Figure 5-12: East Facade of Fire Department Engine Company 115 at 931 W. 120th Street





S.S. Peter & Paul Roman Catholic Church, 12433-12439 S. Halsted Street

This Mid-Century Modern church at the northeast corner of 125th and Halsted Streets in the West Pullman community was built in 1958 for the parish of Saints Peter and Paul. Shown in Figure 5-13, the church is clad with orange face brick and stone veneer. The building has a steeply pitched gable roof, deep roof overhangs along the front elevation, and a square hip-roofed corner tower with a vertical strip of leaded glass windows. The front elevation has a central pavilion flanked by projecting full-height brick piers, three sets of original double doors divided by concrete piers and topped with a concrete spandrel with incised lettering that reads "S.S. Peter and Paul," and an expansive area above which is glazed with leaded glass. The side elevations feature a series of narrow windows that appear to be double-hung.

This building was identified as individually eligible for NRHP listing under Criterion C for architecture as an excellent and rare example of a Mid-Century Modern church in West Pullman.



Figure 5-13: South Facade of S.S. Peter & Paul Catholic Church at 12433-12439 S. Halsted Street





Venetian Hall, 133-139 E Kensington Avenue

The two-story performance hall was built for cultural and recreational purposes, although it has long since been repurposed as a church. The 1938 Sanborn map shows the hall with a stage, balcony, and place for storage of scenery. The street entrance was flanked by two storefronts in 1938, as it is today.

Shown in Figure 5-14, the 1925 building is clad with face brick on its front elevation and common brick on its side and rear elevations. The building has a flat roof and a shaped parapet with concrete coping. The first floor of the front elevation has a recessed, centrally located bay with three pairs of multi-light wood doors and in-filled transoms. This central bay is flanked by two original storefronts with central recessed doors and flanking display windows that are covered with wood and topped by transoms that have been filled in with glass block. Separating the central bay from the two flanking storefronts and providing access to the second floor are two doors with transoms. The spandrel area directly above the central entrance bay has a concrete sign plate with incised lettering that reads "Venetian Hall." Fenestration on the second floor features six-over-one and three-over-one wood-sash windows arranged in pairs and in groups of three, topped by round-arch stone lintels with rosette motifs. The parapet features a series of Classical shields and swags.



Figure 5-14: Front Facade of Venetian Hall

The exterior of this building has good overall integrity, although elements of the original storefront materials are no longer extant. It does not display sufficient distinguishing architectural features to qualify as individually eligible for listing on the NRHP for its architecture. Instead, is recommended for individual listing under Criterion A for its original use



as a social venue for area residents in the early 20th century. Local theater houses such as the Venetian Hall were jewels within the local communities. It is rare to see an early 20th century neighborhood social hall that retains its original storefronts and is set within a residential area of workers' housing, rather than along a commercial thoroughfare. The opening of Illinois Terra Cotta Works in the first half of the 20th century brought Italians to Kensington; the area gradually became a center of South Side Italian-American life with the establishment of Venetian Hall and the nearby San Antonio de Padua (patron saint of Venice) Roman Catholic Church.

5.4.2.2 Properties Surveyed but Determined Ineligible

Beyond the properties that were identified as individually eligible for NRHP listing, a number of properties were surveyed that did not meet the criteria. Generally, these properties have had subsequent alterations that compromise their historic integrity or do not feature a level of distinctive architectural detailing necessary to qualify for the NRHP.

5.5 Riverdale Community

The following subsections include a description of the historic context for the development of the Riverdale community within Chicago (**Section 5.5.1**) and an overview of historic properties that were surveyed (**Section 5.5.2**).

5.5.1 Historic Context

The community of Riverdale—distinct from the adjacent Village of Riverdale to the southwest—is approximately 16 miles south of Chicago's Loop. It is bounded by the Bishop Ford Expressway (I-94) on the east, the Illinois Central Railroad on the west, 115th Street on the north, and the Chicago city limits (138th Street) on the south. The northern two-thirds of the community is occupied by rail yards, industry, and the Calumet Sewage Treatment Plant, while residential development is concentrated south of 130th Street and east of Indiana Avenue.

Riverdale Development in the 19th Century

The earliest settler in the Riverdale area was George Dolton, who arrived with his wife and seven children in 1835. He was joined near the banks of the Little Calumet River by several other pioneers over the next few years, including J. C. Matthews. Dolton and Matthews operated a ferryboat across the river starting in 1836. In 1836, Dolton and another settler, Levi Osterhoudt, built a toll bridge across the river, which they operated until 1842 when it was purchased by the county (Goodspeed and Healy 1909:317). The area grew slowly as a truck farming community that provided produce to Chicago. Early farmers were soon joined by Dutch and Swedish railroad workers during construction of the Illinois Central tracks through the area from 1850 to 1852 (Andreas 1884:601-602).

Riverdale became part of Hyde Park Township in 1867, the year a small frame school was built in the community. The following year George Dolton commissioned David Andrews, an early resident of West Pullman, to make the first plat of Riverdale. The name Riverdale came into common use in 1873 when the first post office was opened. Prior to that time, the area had been called Dolton or Dolton Junction. A larger school building replaced the earlier one in 1874. By





1884 the Riverdale settlement had a population of just 600, and settlement was concentrated around the railroad station and post office on West 137th Street (Andreas 1884:602).

Riverdale was annexed to Chicago in 1889. During the 1880s and 1890s the fledgling community consisted mostly of small frame cottages. Surviving homes of this period can be found at 231 E. 136th Street and 13778 S. Leyden Avenue. A storefront building with flats above from the 1880s at 136176 S. Indiana Avenue recalls the early Indiana Avenue commercial district that was shared with the Village of Riverdale to the west. A *Chicago Tribune* article (1891b) about Riverdale's volunteer fire department noted, "The town consists of only a few dozen scattered houses and a few stores, and its comparative insignificance, coupled with the fact that it lies just on the edge of the corporation line, has caused the Fire Department to overlook its needs for fire protection." The population of Riverdale became more mixed as Irish groups moved into the area to work on the railroads and in the factories. A group of Russians of German descent settled north of the Little Calumet River between 133rd and 136th Streets (Chicago Fact Book Consortium 1995:163).

Riverdale's industrial development had its beginnings in the 1860s, when widespread truck farming gave rise to establishments that processed foods, such as a sugar beet refinery founded in 1865. The Union Copper Distilling Company of Chicago established the Riverdale Distillery in 1871, and by 1883 the company employed an average of 50 men and boasted a profit of \$1.5 million. In the late 19th century Riverdale was also home to lumber yards and planing mills operated by the Riverdale Lumber Company, which was established in 1879, and by the Calumet Lumber Company (Andreas 1884:602). Several railroads were built through the area between 1852 and 1880, claiming large parcels of land for their ROWs and yards. In addition to the Illinois Central, the railroads included the Pittsburg, Cincinnati, Chicago and St. Louis Railroad and the Chicago and Eastern Line.

The Pullman Company owned substantial acreage in the northern section of Riverdale, upon which they operated several businesses including a farm, a brickyard, and a paint company. Lake Calumet was dredged to supply clay for the brick-making operation that by 1893 reportedly manufactured from 20 to 30 million bricks a year. The Calumet Paint Company on 116th Street manufactured the paint used in Pullman's shops and factories. The paint company was purchased by Sherwin-Williams in 1888. The 140-acre Pullman Farm was fertilized by the sewage from George M. Pullman's self-sustaining, planned community; the farm's most profitable crops were onions, cabbage, and celery (Doty 1893:31-32, 155).

Riverdale Development: 1900 to 1950

By the start of the 20th century, the land in the northern two-thirds of the community had become increasingly industrialized. In 1902, Sherwin-Williams enlarged its 116th Street facility with new buildings on an additional 10 acres purchased that year from the Pullman Land Company. Over the next half century, the company's Riverdale plant grew to encompass 100 acres, which included land once used by the Pullman Farm. It became one of the largest paint factories in the world, capable of making the complete product, from raw material to container (*Chicago Tribune* 1902, Sherwin-Williams 2008). Other industries that moved into the area





included Chicago Drop Forge, the Illinois Terra Cotta Works, and the Swift and Knickerbocker ice plants (Keating 2008:259).

Industries dumped wastes into Calumet waterways, and sewers deposited human wastes in increasing amounts as factories and population grew. The currents flowing into the lake were inadequate to remove sewage and industrial wastes, and frequent dredging was necessary to keep channels open. The dredging and widening of the Little Calumet River to make it navigable for barges and the building of the Cal-Sag Channel (1911–1922) by the Sanitary District of Chicago (now Metropolitan Water Reclamation District of Greater Chicago) spurred further industrialization of the Calumet area during the first decades of the 20th century. The Cal-Sag Canal channel was dug between the Little Calumet River and the Sanitary and Ship Canal, altering the flow of the rivers and diverting wastes to the Illinois River and away from Lake Michigan. In 1922 the Sanitary District located a sewage treatment plant in Riverdale to service the growing communities on Chicago's Far South Side.

Riverdale's population did not keep pace with its burgeoning industries due to its remoteness from downtown Chicago and lack of accessible public transit. By 1920 the community had a population of just 1,207, which was concentrated between 133rd and 138th Streets. Its small housing stock consisted mainly of single-family frame cottages and bungalows. By 1940 there were only 1,500 residents and Riverdale was widely considered a place to work, but not to live (Chicago Fact Book Consortium 1995:163).

World War II revitalized industries on Chicago's Far South Side and stimulated demand for lowcost war-worker housing for African-Americans. The response of the federal government and the Chicago Housing Authority (CHA) was construction of the Altgeld Gardens public housing project on an immense 157-acre tract of vacant land between 130th and 133rd Streets, from Langley to Greenwood Avenues. Construction started in November 1943 and the complex was dedicated before a crowd of 5,000 people on August 26, 1945. It was developed and managed by CHA in conjunction with the National Housing Agency and the Federal Public Housing Authority. Ownership was originally held by the federal government but was transferred to CHA in 1956 (*Chicago Tribune* 1945, Bowly 1978:42).

Built at a cost of \$9 million, Altgeld Gardens featured 1,500 apartments that housed 7,000 people in 162 two-story row houses. The complex was designed by the modernist Chicago firm of Naess and Murphy. Its architects Sigurd Naess and Charles Murphy subsequently designed Chicago's first major skyscraper in the post-war era, the Prudential Building (1952-55). The row houses are constructed of common brick with concrete canopies over the front doors, and each house features a front lawn and rear yard (Bowly 1978:43-44).

Because Altgeld Gardens was created at an isolated location far from the established residential sections of the city, it lacked easy access to mass transit except for limited bus service. Provision had to be made for many community facilities including a Board of Health station, public library, nursery school, auditorium, and a community center. The Chicago Board of Education built four one-story school buildings for elementary and high school classes. Included in the center of the





development were privately owned businesses including a grocery store, bakery, barber and beauty shops, and a drug store. An interdenominational church was built in 1950 under the sponsorship of the Church Federation of Greater Chicago (Bowly 1978:45, *Chicago Tribune* 1944). Residents were served by the adjacent 16-acre Carver Park with its indoor gymnasium, swimming pool, fitness center, boxing ring, and multi-purpose clubrooms. Outside, the park offers a playground, baseball diamonds, and basketball courts. Carver High School—named for African-American scientist and educator George Washington Carver—was built in 1947 at 13100 S. Doty Avenue (Chicago Park District 2012).

Riverdale Development: 1950 to Present

The creation of Altgeld Gardens dramatically altered life in Riverdale as its population more than quadrupled by 1950 to 9,790 residents. In 1954 the CHA built the Philip Murray Homes as a 500unit extension of Altgeld Gardens. Its two-story row houses, also designed by Naess and Murphy, were similar to, if somewhat simpler than, the adjacent houses of Altgeld Gardens. The new complex boosted Riverdale's population to more than 11,000 in 1960, 90 percent of whom were African-Americans residing in public housing.

In 1967–1968, the 800-unit Eden Green was built as the nation's first majority African-American owned and operated apartment and town house complex. The federally financed project, built on a 50-acre tract along Indiana Avenue between 130th and 133rd Streets, was sponsored by the Antioch Missionary Baptist Church of Englewood through the Antioch Foundation and targeted low and moderate-income families. The series of low-rise buildings were designed by architect Charles Edward Stade and featured housing that ranges in size from one-bedroom garden apartments to four-bedroom town houses (*Chicago Tribune* 1967a, 1967b, 1968).

Riverdale's population reached a peak of 15,018 by 1970, despite the fact that several hundred white residents moved out. The area has lost both population and jobs since that time. A long history of heavy industrial use throughout the community—factories, railroads, landfills, and a wastewater treatment facility—has likely contaminated large tracts of land; additional information about hazardous materials and contaminations is presented in the *Hazardous Materials Technical Memorandum*. By 1990 only 10,821 people lived in Riverdale and two-thirds of its households lived in poverty. By 2000, the population had dropped to 9,809 residents and nearly all Riverdale residents are African-American (Keating 2008:260). Riverdale still lacks basic commercial amenities; most residents shop in retail areas in Roseland or in the south suburbs. Roseland Community Hospital on 11th Street is the nearest major medical facility.

Limited educational options for Riverdale children led to the 2009 construction of the Chicago International Lloyd Bond Charter School in Altgeld Gardens, which serves kindergarten through eighth grade. The school is named for Lloyd Bond, a Johns Hopkins-trained psychologist who grew up in Altgeld on the same block where the school now stands. The school replaced the private Our Lady of the Gardens, which was a fixture in the complex since its inception (Mack 2009). Particularly problematic for the community was the transformation of Carver High School to a selective high school military academy in 2000. This meant that high school students from Altgeld Gardens had to travel about 5 miles to Fenger High School in the Roseland community,





the next closest school. A long-running feud between Altgeld and Fenger students culminated in the death of a Fenger student in 2009 (Ahmed 2009). Escalating tensions finally prompted the Chicago Public Schools to build the Larry Hawkins Charter School in Altgeld Gardens, which opened in time for the 2010–2011 school year and serves grades 7 to 12.

A more than decade-long grassroots campaign by residents and community groups—including a young community organizer named Barack Obama—to have asbestos removed from apartments at Altgeld Gardens culminated in the 2003 asbestos abatement program funded by the federal government. In 1992, Altgeld Gardens was determined eligible for listing on the National Register by the Preservation Services staff of the Illinois Historic Preservation Agency.

Riverdale's most significant natural amenity is the 135-acre Beaubien Preserve, part of the Forest Preserve District of Cook County, which is in the southeastern corner of the community. The wooded preserve features large oaks that are over 100 years old with a few pockets of remnant prairie that harbor native species. At the center of the preserve is Flatfoot Lake, a popular fishing spot in the region. In recent years the Forest Preserve District of Cook County has worked to rehabilitate the area around the lake by cleaning up debris, testing water quality, restocking the lake with fish, refurbishing facilities, and establishing access to the waterway.

5.5.2 Surveyed Resources

As part of the fieldwork for the RLE Project, one building within the Riverdale portion of the APE was surveyed: 501 E. 130th Street. Altgeld Gardens, which was identified as an NRHP-eligible resource independent of the RLE Project, also lies within the Riverdale community. Maps in Appendix A present these findings graphically.

5.5.2.1 Resources Eligible for National Register of Historic Places

Altgeld Gardens, which was identified as NRHP-eligible independent of the RLE Project, was not surveyed as part of the RLE Project but lies within the Riverdale community.

5.5.2.2 Properties Surveyed but Determined Ineligible

The one surveyed property, a commercial property at 501 E. 130th Street, is too recent (constructed circa 1974–1988) to be eligible for inclusion on the NRHP.

5.6 Village of Calumet Park

The following subsections include a description of the historic context for the development of the Village of Calumet Park (**Section 5.6.1**) and an overview of historic properties that were surveyed (**Section 5.6.2**). No NRHP-listed sites or districts fall within the RLE APE in the Village of Calumet Park.

5.6.1 Historic Context

The Village of Calumet Park is approximately 15 miles south of Chicago's Loop. It is roughly bounded by 123rd Street on the north, with a parcel west of I-57 that extends to 119th Street; the





Metra train tracks on the west; Halsted Street, Racine Avenue, and Morgan Street to the east; and the Chicago city limits (138th Street) to the south.

Village of Calumet Park Development: 1900 to 1950

The Village of Calumet Park, settled by 200 to 300 residents representing a variety of ethnicities, was incorporated in 1912 as the Village of De Young (*Chicago Tribune* 1962). By 1914, the name had changed to Burr Oak. Throughout the first half of the 20th century it remained a sparsely settled, virtually lawless area that was mainly associated in the public's mind with vice and crime. A search of the *Chicago Tribune* historical archive for the Village of Burr Oak during the 1910s and 1920s revealed dozens of articles regarding notorious road houses, taverns, and poolrooms, mainly in the north section of the community, that were havens of drugs and gambling and locations for shootouts with outside authorities. The most infamous of these was the Burr Oak Inn at 119th and Wood Streets, a tavern and dance hall known as the "Crime Castle" in news accounts. It featured secret escape tunnels, concealed opium dens, and underground arsenals before it burned to the ground in 1920 (*Chicago Tribune* 1918a, 1918b, 1920).

Regular raids of the village seemingly did little to curb its illicit activities. During a January 1922 raid of four saloons and poolrooms in which four slot machines were confiscated, the Chief Deputy Sheriff admitted, "these places have been raided before," and vowed to "continue these raids, one after the other, until all gambling is stopped" (*Chicago Tribune* 1921). The most lucrative activity in the village during the 1920s era of Prohibition was bootlegging. A July 1924 raid of 11941 S. Wood Street revealed a moonshine layout, which Chief Raider Otto Grewuch described as "the most wonderful I've ever seen," that was in full operation. Three truckloads of moonshining equipment were confiscated, including 100-gallon stills and 100 barrels of mash (*Chicago Tribune* 1924b). In one 1927 raid, 35 prohibition agents discovered stills ranging from 50 gallons to 500 gallons at various locations throughout the village. A vat of 3,500 gallons of newly brewed beer was still simmering at 12402 S. Green Street (*Chicago Tribune* 1927).

The unsavory reputation of their village led residents to petition the mayor and the board of trustees for a name change from Burr Oak to Calumet Park in 1925 (*Chicago Tribune* 1925). Among the earliest residential subdivisions was Calumet Highlands, a 40-acre tract bounded by Ashland Avenue, Loomis Street, 125th Street, and 127th Street. The tract was owned by the National Realty Association, which in 1924 announced its intention to build approximately 200 bungalows and two-flat residential buildings at a cost of \$1.5 million (*Chicago Tribune* 1924a). The Village of Calumet Park received its first recreational amenity in 1938 with the opening of the 23-acre Raceway Park at the southeast corner of Ashland Avenue and Vermont Street (*Chicago Tribune* 1938). This ¹/₄-mile stock car racetrack, which operated for decades, mainly featured midget car racing during the late 1930s and early 1940s. Calumet Park remained largely undeveloped during the first half of the 20th century and did not have a single religious institution within its boundaries. By 1940 it had a population of just 1,593 (Biggott 2005).

Village of Calumet Park Development: 1950 to Present

The Village of Calumet Park experienced its greatest period of growth during the 1950s, a decade that saw its population more than double from 2,500 in 1950 to an estimated 5,600 in 1955





(*Chicago Tribune* 1955a). By 1959 the population had nearly doubled again to approximately 9,000 residents (Bliss 1959c). During this decade streetscapes began to fill with small, one-story brickclad tract homes that remain the predominant building type in the village, along with split-level homes and some small apartment buildings. Calumet Park still featured large tracts of undeveloped land in the late 1950s, as evidenced by a 1959 Chicago Tribune article about a proposed 90-home development in the vicinity of 124th and Bishop Streets (*Chicago Tribune* 1959a). Although the area had been subdivided, it was unpaved and lacked sewer and water mains.

In 1951 Calumet Park received its first religious edifice with the construction of the Church of the Seven Holy Founders at 124th and Ada Streets. The brick building of modernist design included five classrooms for the parish's 300 Polish and Irish Catholic families, who had worshipped in the Village Hall since 1949 (*Chicago Tribune* 1951). In 1956, the Community Covenant Church of Calumet Park erected an educational building at 125th and Loomis Streets. Designed by Whitehead, Billman and Associates, the one-story brick building housed a large fellowship hall intended for worship services and 15 classrooms for its congregation of 100, which the pastor expected to double within the year (*Chicago Tribune* 1955b).

The growing suburb retained its reputation for vice, however. In 1959, the *Chicago Tribune* ran a series of articles on the village, noting that it had replaced Calumet City as the center of gambling by organized crime in the south suburbs. The village at that time lacked a full-time police force, although it had 26 part-time men on the payroll at \$1.25 an hour. Its part-time police chief worked during the day as a clerk in the office of the Cook County Recorder of Deeds. The most elaborate and profitable gambling enterprise in the village at that time was the Club Corral at 12906 S. Ashland Avenue, which one reporter referred to as the "mob's newest gaming den," doing business that "far exceeded the hopes of the syndicate." According to one gambler who patronized its four roulette wheels, four dice tables, two blackjack tables, and faro and poker games, the Corral handled more money in one night than any single gambling room in Las Vegas. The swanky club, with its plush bar and attractive restaurant, attracted customers of the "mink coat set" from Chicago's North Shore suburbs (Bliss 1959a).

Business at the Club Corral was booming seven nights a week until it was shut down following a July 1959 exposé on the establishment. Illegal gambling run by the crime syndicate was not, however, confined to one establishment. On an ordinary afternoon, hundreds of factory workers and housewives could be found making horse race bets and gambling in numerous taverns and other buildings throughout the village. For example, the second floor of a large garage at 1129 W. 127th Street hosted a busy gaming operation run by George (Babe) Tuffanelli, the gambling power in the south Cook County area. And a tavern at the southwest corner of 123rd and Green Streets had so many customers for its gaming operations in 1959 that residents had to park two and three blocks from their homes (Bliss 1959e).

Village President John Swalec's reaction to newspaper revelations of widespread gambling aroused the ire of residents when he stated at an August 1959 public meeting, "he never heard of gambling in the village until he read about it in the Tribune." In response, one woman shouted:



"Our town has the biggest crap game in the country" (*Chicago Tribune* 1959b). Four Calumet Park trustees, who were elected on a "good government" platform, pressed for reform and vowed they would work for an end to gaming in the village (Bliss 1959b). Swalec's subsequent clampdown on church bingo games was widely viewed by residents as a vindictive measure (Bliss 1959d).

The decade of the 1960s saw construction of the I-57 expressway through the west side of Calumet Park. The Burr Oak Elementary School at 1440 W. 125th Street received a four-room addition in 1964 (*Chicago Tribune* 1964a). In the same year, the Calumet Park recreation association built a public swimming pool at 124th and Morgan Streets, and the village established a small public library in rented quarters at 12545 S. Ashland Avenue (*Chicago Tribune* 1964b). By 1970 the population reached 10,069 with 60 businesses, most of which were along the commercial strips of 127th Street and Ashland Avenue (Biggott 2005). The lack of diversity among these commercial establishments—which featured numerous fast food restaurants, motels, and automotive services—led residents to depend on larger neighbors such as Blue Island for jobs and shopping.

As late as 1978 the village's population was 80 percent white, 5 percent African-American, and 15 percent Latino (Gaspar 1978). By 1992 African-Americans accounted for 72 percent of the population (Biggott 2005). The transition from a white to a black suburb produced conflict. In the summer of 1992 two black prisoners died in the village jail within weeks of each other, allegedly by suicide. The incidents attracted the attention of Chicago Alderman Robert Shaw and led to rallies and protests against the community's all-white police force (Kirby 1992). Buster Porch was elected in 1996 as the first African-American mayor of Calumet Park.

Despite its dip in population from 8,516 to 7,835 between 2000 and 2010, Calumet Park has experienced some development over the past decade, including two large condominium buildings erected in 1998 on 127th Street west of I-57 and at 123rd and Laflin Streets (Kukec 1998). In the same year, 17 single-family homes were erected near 129th and Aberdeen Streets. Raceway Park continued in operation through the 20th century, featuring many types of motorsport activity over the decades including stock car and motorcycle racing and demolition derbies. The racetrack closed in 2000 and was subsequently replaced by the Raceway Park Shopping Center.

5.6.2 Surveyed Resources

As part of the fieldwork for the RLE Project, seven buildings within the Calumet Park portion of the APE were surveyed. These properties, along with their construction date and an assessment of their eligibility for listing on the NRHP, are presented in Table 5-5, alphabetized by street name. Properties determined individually eligible are highlighted. A series of maps in Appendix A graphically present these findings; individual inventory sheets for surveyed properties are presented in Appendix B.





Address	Year Built	Description	Eligibility
12317 S. Green Street	1907	Single-Family	Not Eligible
12359 S. Green Street	1949	Single-Family	Not Eligible
12409 S. Green Street	1925	Single-Family	Not Eligible
12308 S. Halsted Street	1950	Commercial	Not Eligible
12338 S. Halsted Street	1938-1952	Public	Not Eligible
12352 S. Halsted Street	1924	Single-Family	Not Eligible
12540 S. Halsted Street	1923	Cedar Park Cemetery Entryway and Gatehouse	Eligible

Table 5-5: Seven Surveyed Properties in Calumet Park

5.6.2.1 Resources Eligible for National Register of Historic Places

Of the seven resources surveyed within the Calumet Park portion of the RLE APE, one was identified as eligible for listing on the NRHP.

Gatehouse and Entryway to Cedar Park Cemetery, 12540 S. Halsted Street

The Cedar Park Cemetery, founded in the early 20th century, comprises a formal landscape on 94.5 acres at 12540 S. Halsted Street. Plantings include large deciduous shade trees, as well as ornamental shrubs and mowed lawn. Grave markers are mounted flush with the lawn. Extant buildings and structures include the office/gatehouse with ornamental gate and fence, an obelisk, three mausoleums, and a cinder block building.

Overall, the landscape is not exceptional, nor does it contain any distinctive design features; the cemetery does not warrant listing on the NRHP. Of the extant structures, only the gatehouse and adjacent fenced entryway were identified as NRHP-eligible. The unusual stonework that is not readily seen in the area, the high quality of craftsmanship in their construction, and the high level of integrity the resource retains in regards to location, materials, design, setting, workmanship, and feeling, make the building, piers, and gates locally eligible for NRHP listing under Criterion C for architecture.

Cedar Park Cemetery's one-story Romanesque Revival style gatehouse, shown in Figure 5-15, is at its Halsted Street entrance. The entrance features two pairs of massive stone gateposts and metal entrance gates. Original metal fencing extends along the length of the cemetery's Halsted Street boundary, which also features several stone piers. The gatehouse, gateposts, and piers are built of grey, brown, and pink stones that are randomly laid. The building and piers have excellent integrity and were likely installed circa 1923, along with the metal entrance gates and fencing along Halsted Street, when the Cedar Park Cemetery Association purchased its original 53-acre site. The building, piers, and gates are locally eligible for NRHP listing under Criterion C for architecture due to their high quality craftsmanship and unusual stonework.







Figure 5-15: Cedar Park Cemetery Gatehouse

The gatehouse has a flat roof, parapet, and stone cornice. All windows have stone sills and stone lintels with a type of scallop shell motif. The Halsted Street elevation has four windows: a small stained glass window in its projecting bay, a single window with round-arched transoms on either side of the bay, and a small, round-arched window flanked by slender colonettes in the parapet gable. The Halsted Street elevation bay is topped with stone banding incised with the words "Cedar Park Cemetery." The north elevation has a centrally located pair of wood French doors and six wood sash windows, three each on either side of the entrance. The south elevation has a centrally located, multi-paned wood door with sidelights flanked by slender engaged columns. The south elevation's four windows include a single one-over-one window on one side of the door and a group of three windows—a single pane flanked by one-over-one windows—on the other. Doors on both the north and south elevations are topped by flat stone lintels and accessed via concrete steps flanked by stone piers. The rear elevation has five one-over-one windows: a single, centrally located window with a pair of windows on either side.

Elsewhere in the cemetery, the three granite-clad mausoleums appear to date from the middle to late 20th century. One of these features a chapel, which hosts non-denominational funeral services. The cinder block building, accessed by a secondary entrance just north of 125th Street, is utilitarian in nature and may serve as a maintenance building and/or as a crematorium. Neither the mausoleums nor the cinder block building are eligible for inclusion on the NRHP.

5.6.2.2 Properties Surveyed but Determined Ineligible

Beyond the properties that were identified as individually eligible for NRHP listing, a number of properties were surveyed that did not meet the criteria. Generally, these properties have had subsequent alterations that compromise their historic integrity or do not feature a level of distinctive architectural detailing necessary to qualify for the NRHP.





5.7 Summary of CHRS Resources

Independent of the evaluation process described above, several resources within the APE were evaluated as part of the CHRS. Those rated as Red or Orange in the survey are subject to the City's Demolition Delay Ordinance. Red- and Orange-rated properties within the RLE APE are listed in Table 5-6, alphabetized by street name.

Table 5-6: Chicago Historic Resources Survey Red/Orange Properties in the Area of Potential Effects

Address	CHRS Rating
Chicago Fire Department, 324 W. 104th Street (Alternate: 328-330 W. 104th Street)	Orange
Roseland Pumping Station, 351 W. 104th Street	Orange
1000-1120 W. 120th Street (Note: Demolished since CHRS completed)	Orange
House, 11310 S. Emerald Avenue	Orange
Substation, 10227 S. Halsted Street	Orange
St. Salomea Church, 11800-11808 S. Indiana Avenue	Orange
Commercial Building, 11206 S. Michigan Avenue	Orange
First Christian Reform Church, 10920 S. Princeton Avenue (Alternate: 10914 S. Princeton Avenue)	Orange

5.8 Parks as Historic Resources

Eight parks fall within the RLE APE. They are summarized in Table 5-7 and shown graphically in Figure 5-16. Cultural historians conducted archival research, drawing largely from recent work by Julia Bachrach of the Chicago Park District, and visited these sites in fall 2012 to assess their eligibility according to NRHP guidelines. Of the eight parks, none are recommended eligible for NRHP listing; however, each will be described in the separate *Section* 4(f) *Technical Memorandum* for the RLE Project.





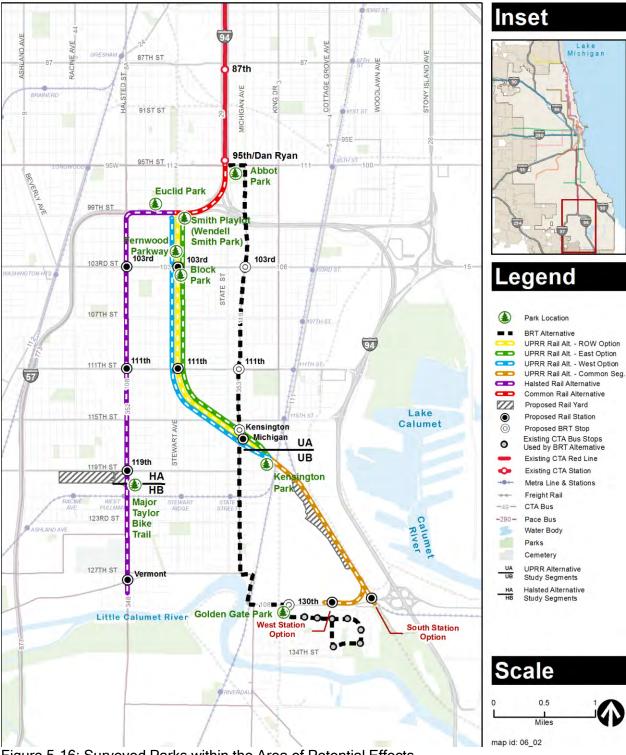


Figure 5-16: Surveyed Parks within the Area of Potential Effects



Park	Address*	Date Open	Eligibility
Abbot Park	49 E. 95th Street	1950	Not Eligible: Lacks Historic Integrity
Block Park	341 W. 104th Street	1912	Not Eligible: Building Razed
Euclid Park	9800 S. Parnell Avenue	1926	Not Eligible: Lacks Historic Integrity
Fernwood Parkway	9501 S. Eggleston Avenue	1887	Not Eligible: Lacks Historic Integrity
Golden Gate Park	13000 S. Eberhart Avenue	1969	Not Eligible: Less than 50 years
Kensington Park	345 E. 118th Street	1942	Not Eligible
Major Taylor Bike Trail	117th to 122nd Streets	2007	Not Eligible: Less than 50 years
Smith Playlot (Wendell Smith Park)	9912 S. Princeton Avenue	1970	Not Eligible: Less than 50 years

Table 5-7: Eight Surveyed Parks in the Area of Potential Effects

* Based on Chicago Park District files

Three of the parks within the APE do not meet the 50-year age threshold for listing in the NRHP. The five older parks have had modern alterations that compromise their historic integrity, as summarized below:

- Abbot Park, which opened in 1950, is home to modern recreational amenities including baseball diamonds, tennis courts, a volleyball court, a basketball court, a swimming pool, walking trails, and playground equipment. Two structures on the property are over 50 years in age; neither has distinguishing architectural features. Overall, the historic integrity of the park has been compromised by modern alterations.
- Block Park, which opened in 1912, originally included the Griffith Natatorium and Roseland Park. The natatorium was razed in 1998; today the park includes open space with benches and walking paths. Overall, the historic integrity of the park has been compromised by the demolition of the structure.
- Euclid Park, which opened in 1926, originally contained open space and ball fields. The park
 was rehabilitated in the 1960s, when the original structure was replaced with a new
 fieldhouse. Overall, the historic integrity of the park has been compromised by modern
 modifications.
- Fernwood Parkway, which was established in 1887, originally included green space planted with trees and lawn. In the early 20th century the park was replanted and a wading lagoon was added, but was removed in the 1920s. Additional alterations occurred in the 1960s and 1970s including planting, lighting, and grading. Although Fernwood Parkway was the first parkland in the neighborhood and has long been a defining feature of the Roseland community and Fernwood area, the park site lacks integrity and sufficient historical significance to be considered eligible for NRHP listing.





Kensington Park, which was purchased by the City in 1942, contains a number of recreational amenities: a mid-2oth century field house that is no longer in use, modern playground equipment, a splash pad, a paved basketball court, a horseshoe pit, and baseball fields. Although the fieldhouse is over 50 years in age, it lacks any distinguishing architectural features. The remaining elements of the park are modern additions. Overall, the historic integrity of the park has been compromised by modern alterations.





Section 6 Effects and Mitigations

The following subsections describe the effect findings following consultation with the SHPO and consulting parties. Figure 6-1 presents the locations of each NRHP-eligible resource in relation to the proposed project alternatives; maps in **Appendix D**, prepared for the *Displacements and Relocations of Existing Uses Technical Memorandum*, depict the relationship between each alternative alignment and nearby historic resources at a larger scale.





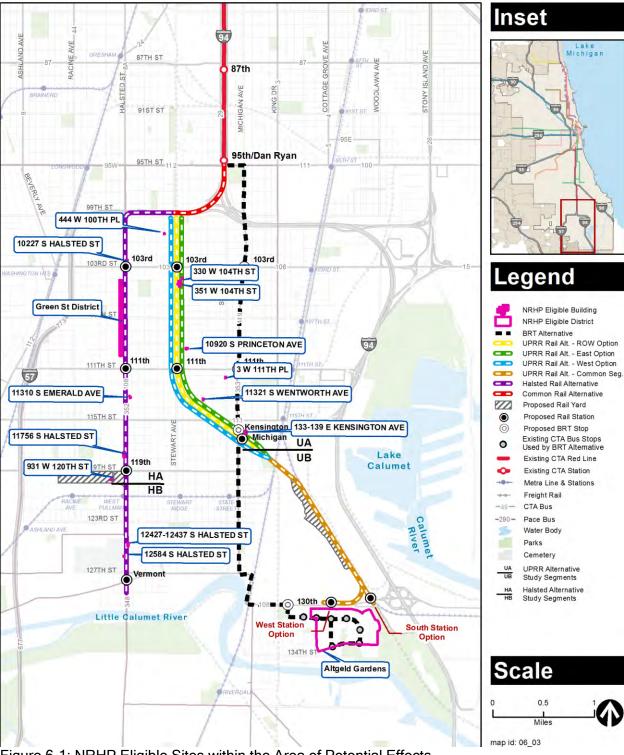


Figure 6-1: NRHP Eligible Sites within the Area of Potential Effects





6.1 No Build Alternative

No adverse effects to historic resources are anticipated to occur as a result of the No Build Alternative.

6.2 Bus Rapid Transit Alternative

Three resources near the BRT corridor have been identified as NRHP-eligible: the Bethany Reformed Church Manse at Three West 111th Place, the Venetian Hall at 133–139 East Kensington Avenue, and the Altgeld Gardens Housing Project. None are anticipated to be adversely affected by the BRT Alternative. Table 6-1 summarizes effects for each historic resource.

Table 6-1: Effects Findings (BRT Alternative)

NRHP Eligible Resource	Effect Finding
Bethany Reformed Church Manse, 3 W. 111th Place	No Effect
Former Venetian Hall, 133-139 E. Kensington Avenue	No Adverse Effect
Altgeld Gardens Housing Project	No Effect

Bethany Reformed Church Manse: No Effect

This Craftsman style residence was home to pioneer media evangelist Reverend Harry J. Hager; it is eligible under Criterion B for its association with Reverend Hager. Under the BRT Alternative, a surface parking lot would be constructed to the east of the building.

The Bethany Reformed Church Manse would not be displaced by the BRT Alternative. Technical analyses suggest that the property would not be subject to visual, noise, or vibratory effects. Construction activities would not affect the characteristics that qualify the resource for inclusion on the NRHP; therefore, the finding is that the BRT Alternative would have no effect on the Bethany Reformed Church Manse.

Former Venetian Hall: No Adverse Effect

This former social venue and performance hall for Italian-Americans has been converted to a church; it is eligible under Criterion A for its original use as a social venue for area residents in the early 20th century. Under the BRT Alternative, a three-story parking structure would be constructed to the south and west of the building.

The former Venetian Hall would not be displaced by the BRT Alternative. While the construction of the parking structure would alter the local setting visually, it would not adversely affect the characteristics that qualify the property for inclusion on the NRHP. Technical analyses suggest that the former Venetian Hall would not be subject to noise or vibratory effects. While construction activities would likely be perceptible at the hall, it would not adversely affect the characteristics that qualify the resource for inclusion on the NRHP; therefore, the finding is that the BRT Alternative would have no adverse effect on the Venetian Hall.

Altgeld Gardens Housing Project: No Effect

This large housing project was built in the early 1940s and is eligible as a district for NRHP listing





under Criterion A for its association with community development, planning, and social history. Under the BRT Alternative, buses would travel between the 95th Street Terminal and 130th Street before continuing to circulate through Altgeld Gardens.

The Altgeld Gardens public housing project would not be displaced or have any direct effects due to implementation of the BRT Alternative. No visual, noise, vibration, or construction effects would affect the characteristics that qualify the resource for inclusion on the NRHP; therefore, the finding is that the BRT Alternative would have no effect on the Altgeld Gardens public housing project as a historic resource.

6.3 Union Pacific Railroad Rail Alternative - Right-of-Way Option

Seven resources near the UPRR corridor have been identified as NRHP-eligible: the Eclectic Neo-Traditional Home at 444 W. 100th Place, the fire station at 324 W. 104th Street, the Roseland Pumping Station at 351 W.104th Street, the Romanesque revival church at 10920 S. Princeton Avenue, the Venetian Hall at 133–139 E. Kensington Avenue, the Roseland Community Hospital Nurses Home at 11321 S. Wentworth Avenue, and the Altgeld Gardens Housing Project. None are anticipated to be adversely affected by the UPRR Rail Alternative; Table 6-2 summarizes effects for each historic resource. With the exception of one property (the Roseland Pumping Station), effects for all three UPRR Rail Alternative options (ROW, East, and West) would be the same.

NRHP Eligible Resource	Effect Finding
Eclectic Neo-Traditional Home, 444 W. 100th Place	No Effect
Fire Department Engine Co. 93, 324 W. 104th Street	No Effect
Roseland Pumping Station, 351 W. 104th Street	No Effect
Romanesque Revival Church, 10920 S. Princeton Avenue	No Effect
Roseland Community Hospital Nurses Home, 11321 S. Wentworth Avenue	No Effect
Former Venetian Hall, 133-139 E. Kensington Avenue	No Effect
Altgeld Gardens Housing Project	No Effect/No Adverse Effect ¹

Table 6-2: Effects Findings (UPRR Rail Alternative - ROW Option)

¹ No Effect finding for South Station Option; No Adverse Effect for West Station Option

Archaeological sites may be uncovered during construction activities. If this occurs, additional investigations will be necessary to determine the eligibility of sites and whether the project would lead to an adverse effect.

6.3.1 Segment UA

Six of the seven resources fall within the northern portion of the route, Segment UA.

Eclectic Neo-Traditional Home: No Effect

The Eclectic Neo-Traditional Home at 444 W. 100th Place is NRHP-eligible under Criterion C for its architecture. The UPRR Rail Alternative ROW Option corridor would be approximately one block east of the property.





The Eclectic Neo-Traditional Home would not be displaced by the UPRR Rail Alternative. No visual, noise, vibration, or construction effects would affect the characteristics that qualify the resource for inclusion on the NRHP; therefore, the finding is that the UPRR Rail Alternative ROW Option would have no effect on this residence.

Fire Department Engine Company 93: No Effect

The fire station at 324 W. 104th Street is NRHP-eligible under Criterion C for its architecture. The UPRR Rail Alternative ROW Option corridor would be approximately 200 feet east of the property.

The Fire Department Engine Company 93 station would not be displaced by the UPRR Rail Alternative. No visual, noise, vibration, or construction effects would affect the characteristics that qualify the resource for inclusion on the NRHP; therefore, the finding is that the UPRR Rail Alternative ROW Option would have no effect on this property.

Roseland Pumping Station: No Effect

The Roseland Pumping Station is NRHP-eligible under Criterion C for its architecture. The UPRR Rail Alternative ROW Option corridor would be immediately east of the property.

The pumping station would not be displaced or directly affected by the UPRR Rail Alternative. No visual, noise, vibration, or construction effects would affect the characteristics that qualify the resource for inclusion on the NRHP. The close proximity of the proposed alternative to the resource is offset by the presence of the existing UPRR freight line; implementation of the UPRR Rail Alternative would not alter the setting or feeling of the resource. Therefore, the finding is that the UPRR Rail Alternative ROW Option would have no effect on this resource.

Romanesque Revival Church: No Effect

The church at 10920 S. Princeton Avenue is NRHP-eligible under Criterion A for its association with the community's former Dutch population and under Criterion C for its architecture. The UPRR Rail Alternative ROW Option corridor would be over ½ block west of the property.

The church would not be displaced or directly affected by the UPRR Rail Alternative. No visual, noise, vibration, or construction effects would affect the characteristics that qualify the resource for inclusion on the NRHP; therefore, the finding is that the UPRR Rail Alternative ROW Option would have no effect on the church.

Roseland Community Hospital Nurses Home: No Effect

Built by the Roseland Community Hospital, this former nurses' home served as an educational facility for nurses; it is NRHP-eligible under Criterion A for its association with education. The UPRR Rail Alternative ROW Option corridor would be over 350 feet southwest of the property, separated from the line by numerous smaller residential buildings.

The Roseland Community Hospital Nurses Home would not be displaced by the UPRR Rail Alternative. No visual, noise, vibration, or construction effects would affect the characteristics





that qualify the resource for inclusion on the NRHP; therefore, the finding is that the UPRR Rail Alternative ROW Option would have no effect on this resource.

Former Venetian Hall: No Effect

This former social venue and performance hall for Italian-Americans has been converted to a church; it is NRHP-eligible under Criterion A. The UPRR Rail Alternative ROW Option corridor would be over 150 feet southwest of the property, separated from the line by smaller buildings and a vacant surface lot.

The former Venetian Hall would not be displaced by the UPRR Rail Alternative. No visual, noise, vibration, or construction effects would affect the characteristics that qualify the resource for inclusion on the NRHP; therefore, the finding is that the UPRR Rail Alternative ROW Option would have no effect on this resource.

6.3.2 Segment UB

One of the seven resources falls within the southern portion of the route, Segment UB.

<u>Altgeld Gardens Housing Project</u>: No Effect for South Station Option; No Adverse Effect for West Station Option

This large housing project was built in the early 1940s and is eligible for NRHP listing under Criterion A for its association with community development, planning, and social history. Under the UPRR Rail Alternative, an at-grade station to provide access to Altgeld Gardens would be constructed in one of two locations: a South Station Option or a West Station Option. Either station location option is separated from Altgeld Gardens Historic District by a multi-lane street (i.e., E. 130th Street and/or E. 130th Place). Preliminary plans for each terminal station option would include parking for 2,300 vehicles through a combination of a parking structure and surface parking lots.

The complex would not be displaced or directly affected by the UPRR Rail Alternative.

The South Station Option parking structure for the UPRR 130th Street Station is approximately 800 feet from Altgeld Gardens Historic District at its closest point; the parking structure would not be visible from within the historic district and would not affect the historic district.

The West Station Option parking structure for the UPRR 130th Street Station is approximately 400 feet from Altgeld Gardens Historic District at its closest point and would only be visible from the outer line of buildings on the north side of the Altgeld Gardens development. This outer row of buildings would obstruct the view of the parking structure from interior buildings and streets. The construction of the West Station Option would not adversely affect the characteristics that qualify the district as eligible for NRHP listing, i.e., its association with community development, planning, and social history.

Therefore, the finding is that the South Station Option would have no effect on this resource, and the West Station Option would have no adverse effect on this resource.





6.3.3 120th Street Yard and Shop

No properties identified as NRHP-eligible lie in the vicinity of the proposed yard and shop location; therefore, no effects are anticipated.

6.4 Union Pacific Railroad Rail Alternative - East Option

For six of the seven properties, findings for effects on historic properties under the UPRR Rail Alternative East Option are the same as those presented in **Section 6.3** for the ROW Option:

6.4.1 Segment UA

- Eclectic Neo-Traditional Home at 444 W. 100th Place, No Effect
- Fire Department Engine Company 93 at 324 W. 104th Street, No Effect
- Roseland Pumping Station at 351 W. 104th Street, No Adverse Effect discussed below
- Romanesque Revival Church at 10920 S. Princeton Avenue, No Effect
- Roseland Community Hospital Nurses Home at 11321 S. Wentworth Avenue, No Effect
- Former Venetian Hall at 133-139 E. Kensington Avenue, No Effect

6.4.2 Segment UB

• Altgeld Gardens Housing Project, No Effect

Because of the proximity of the East Option to the Roseland Pumping Station, the project is anticipated to have no adverse effect. Based on conceptual designs, the track structure is approximately 8.8 feet from the side of the building at its nearest point. It should be noted that an existing at-grade freight line runs in close proximity to this location. The pumping station would not be displaced or directly affected by the UPRR Rail Alternative. The changes in the setting (visual, noise, vibration, etc.) would not adversely affect the characteristics that qualify the resource as eligible for NRHP listing, i.e., its architecture.

Archaeological sites may be uncovered during construction activities. If this occurs, additional investigations will be necessary to determine the eligibility of sites and whether the project would lead to an adverse effect.

6.4.3 120th Street Yard and Shop

No properties identified as NRHP-eligible lie in the vicinity of the proposed yard and shop location; therefore, no effects are anticipated.

6.5 Union Pacific Railroad Rail Alternative - West Option

Findings for effects on historic properties under the UPRR Rail Alternative West Option are the same as those presented in **Section 6.3** for the ROW Option:





6.5.1 Segment UA

- Eclectic Neo-Traditional Home at 444 W. 100th Place, No Effect
- Fire Department Engine Company 93 at 324 W. 104th Street, No Effect
- Roseland Pumping Station at 351 W. 104th Street, No Effect
- Romanesque Revival Church at 10920 S. Princeton Avenue, No Effect
- Roseland Community Hospital Nurses Home at 11321 S. Wentworth Avenue, No Effect
- Former Venetian Hall at 133-139 E. Kensington Avenue, No Effect

6.5.2 Segment UB

Altgeld Gardens Housing Project, No Effect

Archaeological sites may be uncovered during construction activities. If this occurs, additional investigations will be necessary to determine the eligibility of sites and whether the project would lead to an adverse effect.

6.5.3 120th Street Yard and Shop

No properties identified as NRHP-eligible lie in the vicinity of the proposed yard and shop location; therefore, no effects are anticipated.

6.6 Halsted Rail Alternative

6.6.1 Rail Corridor

Seven resources near the Halsted Rail Alternative corridor have been identified as NRHP-eligible: the Green Street Historic District, the former substation at 10227 S. Halsted Street, the French Eclectic residence at 11310 S. Emerald Avenue, the Galloy and Van Etten industrial building at 11756 S. Halsted Street, the church at 12427 S. Halsted Street, the fire station at 931 W. 120th Street, and the Cedar Park Cemetery entryway and gatehouse at 12540 S. Halsted Street. The fire station lies within the footprint of the proposed rail yard and is discussed separately in **Section 6.6.2**. Four resources are anticipated to be adversely affected by the alternative. Table 6-3 summarizes effects for each historic resource.



Table 6-3: Effects Findings (Halsted Rail Alternative)

NRHP Eligible Resource	Effects Finding
Green Street Historic District	No Adverse Effect
Former Classic Revival Substation, 10227 S. Halsted Street	Adverse Effect
French Eclectic Home, 11310 S. Emerald Avenue	No Adverse Effect
Galloy & Van Etten Stone Contractors, 11756 S. Halsted Street	No Adverse Effect
S.S. Peter & Paul Catholic Church, 12433-12439 S. Halsted Street	Adverse Effect
Cedar Park Cemetery Entryway and Gatehouse, 12540 S. Halsted Street	Adverse Effect
Fire Department Engine Co. 115, 931 W. 120th Street	Adverse Effect

Archaeological sites may be uncovered during construction activities. If this occurs, additional investigations will be necessary to determine the eligibility of sites and whether the project would lead to an adverse effect.

Green Street Historic District: No Adverse Effect

This district along Green Street between 104th and 109th Streets is eligible under Criterion C as a cohesive collection of 1950s and 1960s homes. The Halsted Rail Alternative corridor would be over 100 feet west of the property, generally screened by commercial properties along the western side of Halsted Street.

No homes within the Green Street Historic District would be displaced or directly affected by the Halsted Rail Alternative. Construction of the track structure would alter the setting along Halsted Street; this change would be visible from some locations within the district and would lead to a severe noise impact along Green Street. With the installation of noise walls, the noise impact would be reduced to moderate. These changes in setting along Halsted Street would not adversely affect the characteristics that qualify the district for inclusion on the NRHP. Technical analyses suggest that the homes would not be subject to vibratory effects. While construction activities would likely be perceptible within the district, they would not adversely affect the characteristics that qualify the noise on the NRHP. The finding is that the Halsted Rail Alternative would not have an adverse effect on this resource.

Classical Revival Substation: Adverse Effect

The Classical Revival style substation at 10227 S. Halsted Street is eligible under Criterion C for its architecture. The Halsted Rail Alternative corridor would be immediately adjacent to the property.

Although the former substation would not be demolished as a result of implementing the Halsted Rail Alternative, the elevated track structure would be located a few feet from the front facade. This resource would be subject to an adverse visual impact due to construction of the Halsted Rail Alternative. Short-term effects due to construction activities may also lead to adverse effects, depending on the construction techniques employed. Neither noise nor vibratory effects would affect the characteristics that qualify the resource for inclusion on the NRHP. The finding is that the Halsted Rail Alternative would have an adverse effect on this resource.





French Eclectic Home: No Adverse Effect

The home at 11310 S. Emerald Avenue is NRHP-eligible under Criterion C for its architecture. The Halsted Rail Alternative corridor would be over 150 feet west of the property, screened by vegetation and a commercial property on Halsted Street.

The home would not be displaced or directly affected by the Halsted Rail Alternative. Changes in the setting along Halsted Street would not adversely affect the characteristics that qualify the French Eclectic Home as eligible for NRHP listing, i.e., its architecture. The property stands away from the proposed track structure and would be screened by the intervening space, vegetation, and buildings along Halsted Street; therefore, the finding is that the Halsted Rail Alternative would have no adverse effect on this resource.

Galloy and Van Etten Stone Contractors: No Adverse Effect

The industrial building at 11756 S. Halsted Street is eligible under Criterion A for its association with industry. The Halsted Rail Alternative corridor would be immediately adjacent to the property.

Although the property would not be demolished as a result of implementing the Halsted Rail Alternative, the elevated track structure would be located a few feet from the side of the building. While it would be subject to visual, noise, and construction impacts due to implementation of this alternative, these changes would not adversely affect the characteristics that qualify the resource for inclusion on the NRHP. Technical analyses suggest that the property would not be subject to vibratory effects. The finding is that the Halsted Rail Alternative would have no adverse effect on this resource.

S.S. Peter & Paul Catholic Church: Adverse Effect

The modernistic church at 12427 S. Halsted Street is eligible under Criterion C for its architecture. The Halsted Rail Alternative corridor would be immediately adjacent to the property.

Although the church would not be demolished as a result of implementing the Halsted Rail Alternative, the elevated track structure would be located a few feet from the facade. This resource would be subject to an adverse visual impact due to construction of the Halsted Rail Alternative and an adverse noise impact due to its operation, which would alter the feeling and setting associated with the quieter atmosphere anticipated within a religious building. With the installation of noise walls, the severity of the noise impact would be reduced. Short-term effects due to construction activities may also lead to adverse effects, depending on the construction techniques employed. Vibratory effects would not affect the characteristics that qualify the resource for inclusion on the NRHP. The finding is that the Halsted Rail Alternative would have an adverse effect on this resource.

Cedar Park Cemetery Gatehouse and Entryway: Adverse Effect

The Cedar Park Cemetery entryway and gatehouse, at 12540 S. Halsted Street, is NRHP-eligible under Criterion C for its architecture. The Halsted Rail Alternative corridor would be immediately adjacent to the property.





Although the entrance would not be demolished as a result of implementing the Halsted Rail Alternative, the elevated track structure would be located a few feet in front of the resource. This resource would be subject to an adverse visual impact due to construction of the Halsted Rail Alternative. Short-term effects due to construction activities may also lead to adverse effects, depending on the construction techniques employed. Noise and vibratory effects would not affect the characteristics that qualify the resource for inclusion on the NRHP. The finding is that the Halsted Rail Alternative would have an adverse effect on this resource.

6.6.2 119th Street Yard and Shop

The fire station at 931 W. 120th Street lies within the footprint of the proposed yard. The Fire Department Engine Company 115 is eligible under Criterion C for its architecture. Although the fire station would not be demolished as a result of implementing the alternative, it would be surrounded by track on three sides, in close proximity to the west. This resource would be subject to an adverse visual impact due to construction of the Halsted Rail Alternative. Short-term effects due to construction activities may also lead to adverse effects, depending on the construction techniques employed. Neither noise nor vibratory effects would affect the characteristics that qualify the resource for inclusion on the NRHP. The finding is that the Halsted Rail Alternative would have an adverse effect on this resource.





Section 7 **Effects Remaining After Mitigation**

Due to the scale and proximity of construction of the Halsted Rail Alternative, it is unlikely that the anticipated adverse effects on these resources could be resolved; however, consultation with the SHPO and other interested parties may identify measures to mitigate effects. This may include, but would not be limited to, structural documentation, interpretative signage, further study to identify noise mitigation options for the church, and special provisions regarding construction in the vicinity. Measures mentioned by consulting parties at the May 2014 effects meeting included reconsidering the design and scale of proposed garages and incorporating the former Classic Revival substation into the Halsted 103rd Street Station designs.

Table 7-1 summarizes the effect findings following consultation with the SHPO and consulting parties. Properties are rated as experiencing No Effect (NE), No Adverse Effect (NAE), or an Adverse Effect (AE) as defined under the NHPA.

NRHP Eligible Resource	No Build	Bus Rapid Transit	Union Pacific Railroad Rail	Halsted Rail
Bethany Reformed Church Manse, 3 W. 111th Place	NE	NE	NE	NE
Eclectic Neo-Traditional Home, 444 W. 100th Place	NE	NE	NE	NE
Fire Department Engine Co. 93, 324 W. 104th Street	NE	NE	NE	NE
Roseland Pumping Station, 351 W. 104th Street	NE	NE	NE/NAE ¹	NE
Romanesque Revival Church, 10920 S. Princeton Avenue	NE	NE	NE	NE
Roseland Community Hospital Nurses Home, 11321 S. Wentworth Avenue	NE	NE	NE	NE
Former Venetian Hall, 133-139 E. Kensington Avenue	NE	NAE	NE	NE
Altgeld Gardens Housing Project	NE	NE	NE/NAE ²	NE
Green Street Historic District	NE	NE	NE	NAE
Former Classic Revival Substation, 10227 S. Halsted Street	NE	NE	NE	AE
French Eclectic Home, 11310 S. Emerald Avenue	NE	NE	NE	NAE
Galloy & Van Etten Stone Contractors, 11756 S. Halsted Street	NE	NE	NE	NAE
S.S. Peter & Paul Catholic Church, 12433-12439 S. Halsted Street	NE	NE	NE	AE
Cedar Park Cemetery Entryway and Gatehouse, 12540 S. Halsted Street	NE	NE	NE	AE
Fire Department Engine Co. 115, 931 W. 120th Street	NE	NE	NE	AE

Table 7-1: Effects Findings

NE = No Effect; NAE = No Adverse Effect; AE = Adverse Effect

¹ No Effect finding for ROW and West Options; No Adverse Effect for East Option

² No Effect finding for South Station Option; No Adverse Effect for West Station Option







Section 8 Section 106 Consultation Process

In accordance with requirements for consultation established in Section 106 of the NHPA, four distinct rounds of coordination occurred during the RLE Project: initiation activities, identification of historic properties, assessment of effects, and resolution of adverse effects. Each outreach effort is described in the following sections.

8.1 Initiation Activities

8.1.1 Invitations to Participate

In August 2012 FTA sent invitation letters to 11 Native American tribes to inform them of the process and request assistance in identifying areas with potential cultural and/or religious significance. Letters were sent to the following nations: the Ho-Chunk Nation, the Miami Tribe of Oklahoma, the Peoria Tribe of Indians of Oklahoma, the Sac and Fox Nation of Oklahoma, the Pokagon Band of Potawatomi Indians, the Prairie Band of the Potawatomi Nation, the Citizen Potawatomi Nation, the Forest County Potawatomi Nation, the Potawatomi Nation, the Sac and Fox Nation of Mississippi in Iowa, and the Sac and Fox Nation of Missouri.

Also in August 2012, CTA sent invitation letters to 20 state and local level preservation interest groups to inform them of the project and invite them to participate in the upcoming consultation process. Invitation letters were sent to the following groups: the SHPO, the Advisory Council on Historic Preservation, the Illinois State Museum, Illinois State Archaeological Survey, the City of Chicago Historic Preservation Division Department of Housing and Economic Development, Preservation Chicago, Landmarks Illinois, the Chicago Historical Society, the Ridge Historical Society, the Beverly Area Planning Association, the East Beverly Association, the Rosemoor Community Association, the Cottage Grove Heights Community Coalition, the Historic Pullman Foundation, the South Suburban Genealogical and Historical Society, Chicago Neighborhood Initiatives, Neighborhood Housing Services of Chicago, Mercy Housing Lakefront, and Friends of the Parks. Nine groups indicated they would like to participate in the process. Accordingly, materials and meeting notices were sent to the SHPO, the City of Chicago Historic Preservation Division Department of Housing and Economic Development, Preservation Chicago, Landmarks Illinois, the Ridge Historical Society, the Rosemoor Community Association, Chicago Neighborhood Initiatives, and Friends of the Parks. The list of organizations that accepted the invitation to participate in the consultation process is included in Appendix C.

8.1.2 Section 106 Kickoff Webinar

On October 24, 2012, a kickoff webinar was held. The webinar included an overview of the Section 106 process, a description of the project and the build alternatives, and an outline of the schedule for the consultation process over the coming months. A full summary of this meeting is provided in **Appendix C**.





8.2 Identification of Historic Properties

On January 30, 2013, the project team held a meeting at CTA to discuss the identification of historic properties, specifically those that were recommended as eligible for listing on the NRHP. A CD containing a summary table, maps of the resources, and individual site forms was mailed to consulting parties on January 5, 2013. A full summary of the meeting is provided in **Appendix C**. The meeting was followed by an informal tour of the corridor that afternoon.

As part of this phase of coordination, written comments were received from six consulting parties. A summary of these comments and copies of the individual letters are included in **Appendix C**.

8.3 Assessment of Effects

On May 8, 2014, the project team held a meeting at CTA to discuss potential project effects on NRHP historic properties. A Draft Effects Report was mailed to consulting parties on April 18, 2014, requesting any written comments by May 23, 2014. A full summary of the meeting is provided in **Appendix C**.

As part of this phase of coordination, written comments were received from four consulting parties. A summary of these comments and copies of the individual letters are included in **Appendix C**.

8.4 Resolution of Adverse Effects

This stage of consultation has not yet occurred.





Section 9 References Cited

Ahmed, Azam. 2009. Charter School May Ease Rift: Altgeld Gardens Site May Give Kids Option to Fenger. In Chicago Tribune, November 5, 2009.

Almada, Jeanette. 1999. Redevelopment Area Plans Advance. In Chicago Tribune, February 28, 1999.

Amick, Daniel S, Thomas J. Loebel, Rochelle Lurie, and Julieann Van Nest. 2000. Results of Continued Surface Collection and Phase II Testing at the Hawk's Nest Clovis (Gainey) Site in Northeastern Illinois. In Current Research in the Pleistocene. 17:1-3.

Andreas, A.T. 1884. History of Cook County. A.T. Andreas, Chicago, Illinois.

Bach, Erwin. 1957. Sees Harbor Boom as Aid to Roseland. In Chicago Tribune, August 25, 1957.

Barnett, Albert G. 1947. Chicago Negroes Fight Housing Shortage, Build Their Own Homes. In Chicago Tribune, June 7, 1947.

Bechetta, Jackson. 1999. Storied Catholic School Closing Its Doors. In Chicago Tribune, 30 January 1999.

Benn, David A. 1979. Some Trends and Traditions in Woodland Cultures of the Quad State Region in the Upper Mississippi Basin. Wisconsin Archaeologist. 60(1):47-82.

Biggott, Joseph C. Calumet Park, Illinois. In The Encyclopedia of Chicago, http://www.encyclopedia.chicagohistory.org/pages/201.html Accessed 10/22/12.

Bird, M. Catherine. 2010. To Eat from a Common Plate: Ceramic Inventory, International Relations, and Multi-Ethnic Communities. Paper presented at the annual Society for American Archaeology meeting.

Bird, M. Catherine. 1999. Temporal, Spatial, and Social Trends: Late Prehistoric and Proto-Historic Group Interaction. Paper presented at the Society for American Archaeology 1999 Annual Meeting. [Published 2003 in Method, Theory, and Practice in Modern Archaeology, edited by R. Jeske and D. Charles, Greenwood Press, Wescott, Connecticut].

Bird, M. Catherine. 1998. Phase II Archaeological Testing of Three Hurd Estate Sites 11-L-71, 11-L-72, and 11-L-498 in Cuba Township, Lake County, Illinois. Midwest Archaeological Research Services, Inc. Cultural Resources Management Report No. 711.





Bird, M. Catherine. 1997. Broken Pieces: Langford Tradition Settlement System and the Role of Material Culture in the Maintenance of Social Boundaries. Ph.D. dissertation submitted to the Department of Anthropology, University of Wisconsin-Milwaukee.

Bird, M. Catherine and Clare Tolmie. 2000. FERC Environmental Report and Environmental Management Support: Whitecap Energy System: Onshore Cultural Resources. Midwest Archaeological Research Services, Inc. Cultural Resources Management Report No. 881.

Bliss, George. 1959a. An Odd Café Just a Front For Casino. In Chicago Tribune, July 25, 1959.

Bliss, George. 1959b. Chief Denies Knowledge of Gambling Den. In Chicago Tribune, July 30, 1959.

Bliss, George. 1959c. Calumet Park Housewives Demand Lift of Bingo Ban. In Chicago Tribune, August 16, 1959.

Bliss, George. 1959d. Bookie Joints Easy to Find in Calumet Park. In Chicago Tribune, August 24, 1959.

Bliss, George. 1959e. Bookie Joints Easy to Find in Calumet Park. In Chicago Tribune, 24 August, 1959.

Borzo, Greg. 2007. The Chicago "L." Arcadia Press, Chicago.

Bowly Jr., Devereaux. 1978. The Poorhouse: Subsidized Housing in Chicago: 1895-1976. Southern Illinois University Press, Carbondale, Illinois.

Bretz, J. Harlen. 1939. Geology of the Chicago Region. Illinois State Geological Survey, Bulletin No. 65, Part I, Urbana, Illinois.

Brown, Charles. 1917. Field Notes of an Indian History and Prehistory Survey of Chicago and Vicinity Made in 1910. Wisconsin Archaeological Society, Madison.

Brown, James. 1986. Early Ceramics and Culture: A Review of Interpretations. In Early Woodland Archaeology. Center for American Archeology Press, Kampsville, Illinois.

Byrne, John. Kroc Community Center Brings Hope, Opportunity to West Pullman. In Chicago Tribune, June 16, 2012.

Buursma, Bruce. 1985. Minister Practices What She Preaches; her Gospel is Success. In Chicago Tribune, July 28, 1985.

Camiros, Ltd. 2003. 119th and Halsted Redevelopment Project Area Redevelopment Plan and Project. Prepared for the City of Chicago, June 29, 2001; Revised 24 January 2003. Chicago Department of Housing and Economic Development. 1996.





Chicago Historic Resources Survey: An Inventory of Architecturally and Historically Significant Structures. Chicago Department of Planning and Development, Chicago. Available online <http://webapps.cityofchicago.org/landmarksweb/search/home.htm > Accessed January-March 2012.

Chicago Department of Planning, Community Assistance Panel. 1990. Michigan Avenue Commercial District: 103rd Street to 116th Street: Roseland. Department of Planning, Chicago.

Chicago Fact Book Consortium. 1995. Local Community Area Fact Book – Chicago Metropolitan Area, 1990. Chicago Board of Trustees of the University of Illinois, Urbana.

Chicago Historical and Architectural Landmarks. 1996. Stephen A. Foster House. Preliminary Staff Summary. Submitted to the Commission on Chicago Historical and Architectural Landmarks, November 1996.

Chicago-L.org. 2005. Stations. http://www.chicago-l.org/stations/index.html Accessed February-March 2012.

Chicago Park District. 2012. History of Brainerd Park. http://www.chicagoparkdistrict.com/parks/Brainerd-Park/> Accessed 10/16/12.

Chicago Park District. 2012. History of Carver Park. http://www.chicagoparkdistrict.com/parks/Carver-Park/ Accessed 10/17/2012.

Chicago Real Estate Daily. 2008. In Brief: Old Obama Office For Sale, New Coffee Shop Coming. In Chicago Real Estate Daily, September 4, 2008. http://www.chicagorealestatedaily.com/apps/pbcs.dll/article?AID=9999200030874> Accessed 10/16/12.

Chicago Tribune. 1890. Poor Lonely Fernwood: It Voted to Make Itself the Monaco of Cook County. In Chicago Tribune, November 16, 1890.

Chicago Tribune. 1891a. Opening a Large Subdivision: Signs of Great Development Along the Line of the Rock Island Railroad. In Chicago Tribune, February 8, 1891.

Chicago Tribune. 1891b. Linked by a Line of Fire Hose. In Chicago Tribune, December 13, 1891.

Chicago Tribune. 1893a. To Move Its Plant, Plano Manufacturing Company to Settle in West Pullman. In Chicago Tribune, January 24, 1893.

Chicago Tribune. 1893b. Sold the Stanley Matthews Tract: Property Adjoining West Pullman Brings \$600,000 Suburban Improvement. In Chicago Tribune, January 25, 1893.

Chicago Tribune. 1893c. For a Big Factory: Earth Turned for the Whitman & Barnes Plant. In Chicago Tribune, May 18, 1893.





Chicago Tribune. 1893d. Activity at Manufacturing Towns: Lots Sold and Buildings of all Kinds are Being Erected at West Pullman. In Chicago Tribune, June 11, 1893.

Chicago Tribune. 1893e. Industrial Town Improvements. In Chicago Tribune, June 23, 1893.

Chicago Tribune. 1902. Sherwin-Williams Company Figures in a Transfer Which Means More Compact Plant. In Chicago Tribune, May 21, 1902.

Chicago Tribune. 1914. Pullman Fund to Build School. In Chicago Tribune, February 18, 1914.

Chicago Tribune. 1915. Pullman School—Dedicated to the Task of Dignifying Overalls. In Chicago Tribune, April 1, 1915.

Chicago Tribune. 1918a. Burr Oak Inn, "Crime Castle," Again Closed. In Chicago Tribune, June 9, 1918.

Chicago Tribune. 1918b. Gangsters Raid Burr Oak Inn; Three Wounded. In Chicago Tribune, October 31, 1918.

Chicago Tribune. 1920. Burr Oak Inn's Wages of Sin is Fiery Death. In Chicago Tribune, October 13, 1920.

Chicago Tribune. 1921. Burr Oak Raided as Jury Votes 9 Gambling Bills. In Chicago Tribune, January 22, 1921.

Chicago Tribune. 1924a. \$1,500,000 In New Homes for Burr Oak Subdivision. In Chicago Tribune, June 15, 1924.

Chicago Tribune. 1924b. Finest Still Seized in Raid on Burr Oak. In Chicago Tribune, August 3, 1924.

Chicago Tribune. 1925. Ask New Name to Wipe Stain Off Burr Oak. In Chicago Tribune, August 31, 1925.

Chicago Tribune. 1927. 35 Dry Agents Raid Stills in Calumet Park. In Chicago Tribune, July 14, 1927.

Chicago Tribune. 1928. Lilydale Improvement Association Gives Honor to President. In Chicago Tribune, July 14, 1928.

Chicago Tribune. 1938. Raceway Park to Hold Second Program Tonight. In Chicago Tribune, October 1, 1938.

Chicago Tribune. 1944. Calumet Area House Project to Open Soon: Altgeld Gardens to Shelter 7,000. In Chicago Tribune, August 6, 1944.





Chicago Tribune. 1945. Altgeld Gardens Housing Dedicated Before 5,000. In Chicago Tribune, 27, August 1945.

Chicago Tribune. 1951. Calumet Park to Have Church After 39 Years. In Chicago Tribune, 15, November 1951.

Chicago Tribune. 1955a. Calumet Park Awaits Result of New Census. November 10, 1955.

Chicago Tribune. 1955b. Calumet Park Church Breaks Ground Today. In Chicago Tribune, December 11, 1955.

Chicago Tribune. 1959a. Builder Seeks Damages from Calumet Park. In Chicago Tribune, January 22, 1959.

Chicago Tribune. 1959b. Calumet Park Trustees Vow to End Gaming. In Chicago Tribune, July 29, 1959.

Chicago Tribune. 1959c. Calumet Park Gaming Stirs Citizens' Ire. In *Chicago Tribune*, August 15, 1959.

Chicago Tribune. 1962. Calumet Park to Open Golden Jubilee Celebration. In Chicago Tribune, July 26, 1962.

Chicago Tribune. 1964a. Work Begun on Burr Oak School Rooms. In Chicago Tribune, August 30, 1964.

Chicago Tribune. 1964b. Donate Some Books; Library Can Use 'Em in Calumet Park. In Chicago Tribune, November 12, 1964.

Chicago Tribune. 1967a. Mahalia Jackson to Greet Visitors at 6 Model Homes. In Chicago Tribune, February 25, 1967.

Chicago Tribune. 1967b. Housing Role Told By Church. In Chicago Tribune, December 10, 1967.

Chicago Tribune. 1968. Dedication of Eden Green to be August 18. In Chicago Tribune, August 9, 1968.

City of Chicago Department of Planning. 1991. Applied Real Estate Analysis, Inc. Retail Market Analysis: South Michigan Avenue, Roseland. Prepared for the City of Chicago Department of Planning, February 1991.

Cook, Frederick F. 1910. Bygone Days in Chicago: Recollections of the "Garden City" of the Sixties. A.C. McClurg & Co., Chicago.





Currey, J. Seymour. 1912. Chicago: Its History and Its Builders. S.J. Clarke Publishing Company, Chicago. Davis, James L. 1965. The Elevated System and the Growth of Northern Chicago. Northwestern University, Studies in Geography Number 10, Evanston, Illinois.

Demel, Scott J. 2000. Understanding Remnant Archaic Settlement along the Western Coast of Lake Michigan. Doctoral dissertation, Department of Anthropology, University of Wisconsin-Milwaukee.

Doershuk, John F. 1988. Plenemuk Mound and the Archaeology of Will County. Historic Preservation Agency, Illinois Cultural Resources Study 3, Springfield, Illinois.

Doty, Duane. 1893. The Town of Pullman: Its Growth with Brief Accounts of Its Industries. T. P. Struhsacker, Pullman, Illinois.

Emerson, Thomas E. and Anne R. Titlebaum. 2000. The Des Plaines Complex and the Late Woodland Stage of Northern Illinois. In Late Woodland Societies: Tradition and Transformation across the Midcontinent. University of Nebraska Press, Lincoln.

Ernst and Young, LLP. 2005. 2004 Report, 105th/Vincennes Redevelopment Project Area. Prepared for the City of Chicago, 30 June 2005.

Ernst and Young, LLP. 2010. 2009 Annual Report, 119th/I-57 Redevelopment Project Area. Prepared for the City of Chicago, June 30, 2010.

Faulkner, Charles H. 1960. The Red Ochre Culture: An Early Complex in Northern Indiana. In Wisconsin Archaeologist. 41(2): 35-49.

Fowler, Melvin L. and Robert L. Hall. 1978. Late Prehistory of the Illinois Area. Handbook of North American Indians, Volume 15 Northeast, edited by B. G. Trigger. Smithsonian Institution, Washington, D.C.

Gaspar, Michele. Housing Center "Marketing" Calumet Park. In Chicago Tribune, April 9, 1978.

Gillette, Charles E. 1949. The Non-Mississippian Manifestations at the Fisher Site, Will County, Illinois. Master's thesis, Department of Anthropology, University of Chicago.

Goodspeed, Weston A. and Daniel D. Healy, Editors. 1909. History of Cook County, Illinois. The Goodspeed Historical Association, Chicago.

Goldstein, Lynne G. 1991. The Implications of Aztalan's Location. In New Perspectives on Cahokia, Views from the Periphery, edited by J. B. Stoltman. Prehistory Press, Madison, Wisconsin.

Grossman, James R., Ann Durkin Keating, and Janice L. Reiff. 2004. The Encyclopedia of Chicago. University of Chicago Press, Chicago.





Hall, Robert L. 1987. Type Description of Starved Rock Collared. Wisconsin Archaeologist. 68(1): 65-70.

Historical Publishing Company. 1886. Origin, Growth and Usefulness of the Chicago Board of Trade, Its Leading Members, and Representative Business Men in Other Branches of Trade. Historical Publishing Company, New York.

Hotchkiss, George W. 1894. Industrial Chicago: The Lumber Interests. The Goodspeed Publishing Company, Chicago.

Hurley, William M. 1975. An Analysis of Effigy Mound Complexes in Wisconsin. University of Michigan, Museum of Anthropology, Anthropological Papers No. 59, Ann Arbor.

Illinois High School Glory Days. 2012. Chicago Academy of Our Lady/aka Longwood Academy "Blue Devils." http://www.illinoishsglorydays.com/id700.html Accessed 10/16/12.

Illinois Historic Preservation Agency (IHPA). 2003. Historic Architectural and Archaeology Resources Geographic Information System (HARGIS) <http://gis.hpa.state.il.us/hargis> Accessed December 2011-January 2012.

Jackson, Bechetta. 1999. Storied Catholic School Closing Its Doors. In Chicago Tribune, January 30, 1999.

Keating, Ann Durkin. 2008. Chicago Neighborhoods and Suburbs. University of Chicago Press, Chicago.

Keene, David J. and Theodore Karamanski. 1980. Cultural Resource Survey of the Cook County Forest Preserve, Palos and Calumet Divisions. IHPA Document No. 570.

Kelly, John Martin. 2002. Delineating the Spatial and Temporal Boundaries of Late Woodland Collared Wares from Wisconsin and Illinois. Unpublished Master's thesis, Department of Anthropology, University of Wisconsin-Milwaukee.

Kirby, Joseph. Rally Decries Hangings in Calumet Park Jail. In Chicago Tribune, July 19, 1992.

Kukec, Anna Marie. 1998. At Home In Calumet Park. In Chicago Tribune, January 13, 1998.

Kullen, Douglas. 1995. Phase II Historical Significance Evaluation of the Fiddyment Creek Site (11-Wi-684) Lockport, Will County, Illinois. Allied Archaeology to Midwest Consulting, Inc., Aurora, Illinois.

Loebel, Thomas, Daniel Amick, and Rochelle Lurie. 2000. Report on Phase II Excavations at the Hawk's Nest Site (11L344) in Lake County, Illinois. Cultural Resource Management Report No. 844, Harvard, Illinois.





Lurie, Rochelle *et al.* 1993. Investigations at the Garrison Site in Lake County, Illinois. Midwest Archaeological Research Services, Inc. Cultural Resources Management Report No. 200, Marengo, Illinois. See Demel 2000.

Lurie, Rochelle, M. Catherine Bird, and Richard Johnson. 1996. Phase II Archaeological Testing on Five Sites Alden Township, McHenry County, Illinois. Midwest Archaeological Research Services, Inc. Cultural Resources Management Report No. 520, Marengo, Illinois.

Lurie, Rochelle, Douglas Kullen, and Scott Demel. 2009. Defining the Archaic in Northern Illinois. In Archaic Societies: Diversity and Complexity across the Midcontinent. State University of New York Press, Albany.

Lurie, Rochelle, Thomas J. Loebel, Sara L. Pfannkuche, and Clare Tolmie. 2002. Report on the Phase II Archaeological Testing of 11-Wi-2514 on the Kukuen Chen Property (North), DuPage Township, Will County, Illinois. Midwest Archaeological Research Services, Inc. Cultural Resources Management Report No. 1050.

Mack, Kristen. 2009. Altgeld School Gets a New Start. In Chicago Tribune, August 19, 2009.

Mason, Ronald J. 1997. The Paleo-Indian Tradition. In The Wisconsin Archaeologist. 78(1-2):78-110.

Mayer, Harold M. and Richard C. Wade. 1969. Chicago: Growth of a Metropolis. University of Chicago Press, Chicago.

Mitchell, William L. 1898. Snyder's Real Estate Map of Cook, DuPage, and part of Will Counties, Illinois. F. M. Snyder & Co., Chicago.

Moffat, Bruce G. 1995. The "L:" The Development of Chicago's Rapid Transit System, 1888-1932. Central Electric Railfans' Association, Bulletin 131, Chicago.

Overstreet, David F. 1993. Chesrow: A Paleoindian Complex in the Southern Lake Michigan Basin. In Case Studies in Great Lakes Archaeology, Number 2. Great Lakes Archaeological Press, Milwaukee.

Pacyga, Dominic and Ellen Skerrett. 1986. Chicago, City of Neighborhoods. Loyola University Press, Chicago.

Polish Genealogical Society of America. 2012. Assumption BVM Church History. http://www.pgsa.org/ArchChiPolPar/archchicago_descr.php?pageID=2> Accessed 10/16/12.

Porubcan, Paula J. and Melissa Baltus. 2011. NRHP Eligibility and Project Clearance for Site 11Ck284 (Joe Louis) Cal-Sag Bicycle Trail, Cook County. Memorandum Submitted to the Illinois Department of Transportation.





Porubcan, Paula J., Anne Grauer, and Rochelle Lurie. 1998. Results of Phase III Archaeological Mitigation of the McGraw Farm Site (11-L-386), Cuba Township, Lake County, Illinois. Midwest Archaeological Research Services, Inc. Cultural Resources Management Report No. 621, Marengo, Illinois.

Priddy, Gladys. 1954. Bit of Holland Survives Changing Roseland Scene. In Chicago Tribune, February 11, 1954.

Quaife, Milo M. 1923. Chicago's Highways Old and New: From Indian Trail to Motor Road. D.F. Keller and Company, Chicago.

Rees, James H. 1851. Map of the Counties of Cook and DuPage, the East Part of Kane and Kendall, the North Part of Will, State of Illinois. Ferd. Mayer's, Chicago.

Richards, John D. 1992. Ceramics and Culture at Aztalan, a Late Prehistoric Village in Southeast Wisconsin. Dissertation on file, Department of Anthropology, University of Wisconsin-Milwaukee.

Rodkin, D. 2012. Sales at Stalled Washington Heights Development. <http://www.chicagomag.com/Chicago-Magazine/March-2012/Sale-at-Stalled-Washington-Heights-Development/> Accessed 10/16/2012.

S.B. Friedman & Company. 1997. West Pullman Industrial Park Conservation Area: Industrial Jobs Recovery Law Tax Incremental Financing Eligibility Study and Redevelopment Planning and Project Plan. Prepared for the City of Chicago Department of Planning and Development, October 1997.

S.B. Friedman & Company. 2009. North Pullman Redevelopment Project Area: Tax Increment Finance District Eligibility Study, Redevelopment Plan and Project. Prepared for the City of Chicago, February 2009.

Salkin, Philip H. 1987. A Reevaluation of the Late Woodland Stage in Southeastern Wisconsin. In Wisconsin Academy Review. 33(2):75-79.

Sanborn Fire Insurance Company. *Sanborn Fire Insurance Maps for Chicago, Vol. E, G.* Sanborn Fire Insurance Company, New York, 1897, 1911.

Sanborn Fire Insurance Company. *Sanborn Fire Insurance Maps for Chicago, Vol. 41*. Sanborn Fire Insurance Company, New York, 1938, 1950.

Scharf, Albert F. 1901. Indian Trails and Villages of Chicago and of Cook, DuPage, and Will Counties, Ills. Chicago History Museum, reprint, Chicago.

Scharf, Albert F. n.d. Various unpublished notes transcribed by Jane Taylor for MARS, Inc. with originals now curated at the Chicago History Museum.





Sherwin-Williams. 2008. How to Grow a Paint Company. http://excellence.sherwin.com/history_timeline.html Accessed 10/17/2012.

Sinkevitch, Alice. 1993. AIA Guide to Chicago. Harcourt Brace & Co., New York.

Slaymaker, Charles M. III and Charles M. Slaymaker, Jr. 1971. Au Sagaunashke Village: The Upper Mississippian Occupation of the Knoll Spring Site, Cook County, Illinois. In Mississippian Site Archaeology in Illinois. Illinois Archaeological Survey Bulletin 8, Urbana.

Swallow, Ann. 1991. They Came, They Saw, They Surveyed. Historic Illinois. October 1991.

Tanner, Helen Hornbeck. 1987. Atlas of Great Lakes Indian History. University of Oklahoma, Norman.

Taussig, Meredith. 1989. Lilydale Progressive M.B. Church (originally First Reformed Church of Roseland), 10706 South Michigan Avenue, Chicago, Illinois: Preliminary Staff Summary of Information Submitted to the Commission on Chicago Landmarks.

Trkla, Pettigrew, Allen & Payne. Roseland-Michigan Avenue Tax Increment Financing Redevelopment Area Project and Plan. Chicago: City of Chicago Department of Planning and Development, July 3, 2001.

Urban Development Action Grant Committee. 1978. Urban Development Action Grant Application, North Pullman Rehabilitation Project.

URS/TPAP. 2003. Amended 105th Street and Vincennes Avenue Tax Increment Financing Redevelopment Project and Plan. May 12, 1997, Amended August 29, 2003.

Van Vechten, J. 1870. Map of Cook and DuPage County also the northern part of Lake County, Indiana. J. Van Vetchen, Chicago.

West Pullman Land Association. 1900. West Pullman and Stewart Ridge, Chicago, Illinois, 1892-1900. West Pullman Land Association, Chicago.

Willman, H. B. 1971. Summary of the Geology of the Chicago Area. Illinois State Geological Survey, Circular 460, Urbana.

Wilson, Mark R. Chicago Bridge & Iron Co. In Directory of Leading Chicago Businesses (1820-2000). < http://www.encyclopedia.chicagohistory.org/pages/2597.html> Accessed 11/2/12.

Wolforth, Thomas. 1995. An Analysis of the Distribution of Steuben Punctated Ceramics. In Wisconsin Archaeologist. 76(1-2):27-47.


Wright, Edward. 1967. Racial Stability is Aim of Washington Heights Group. In Chicago Tribune, May 7, 1967.







Appendix A Maps of Properties Surveyed




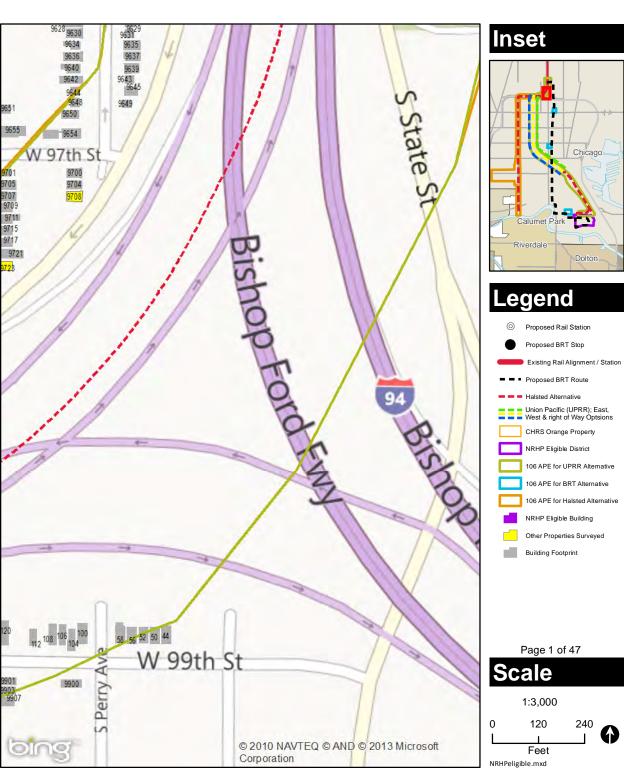


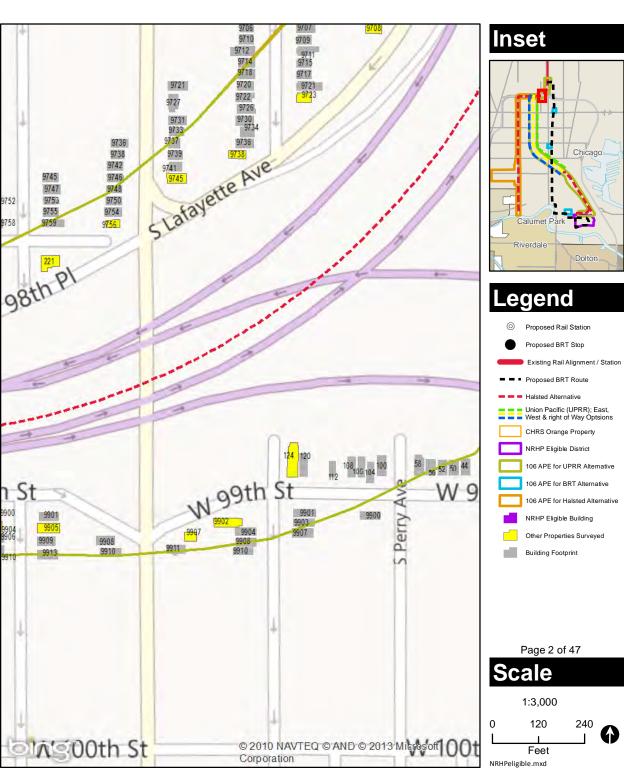

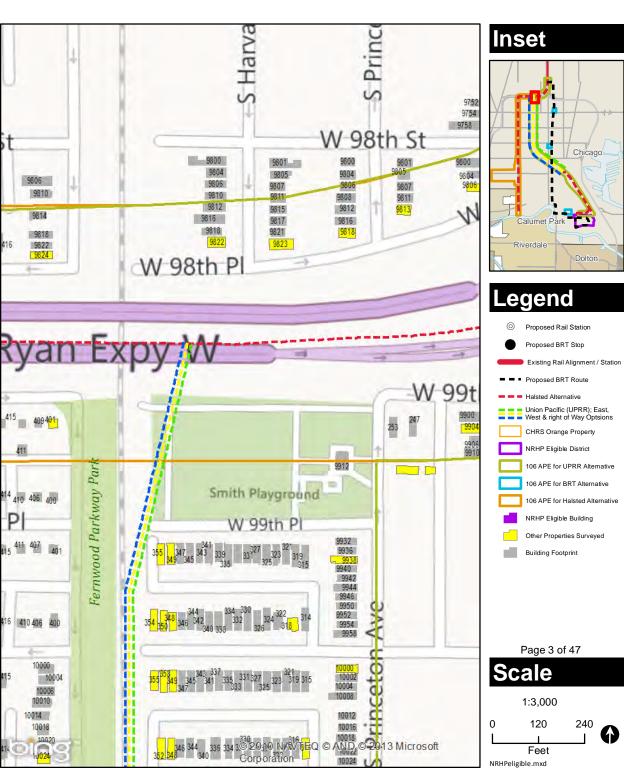



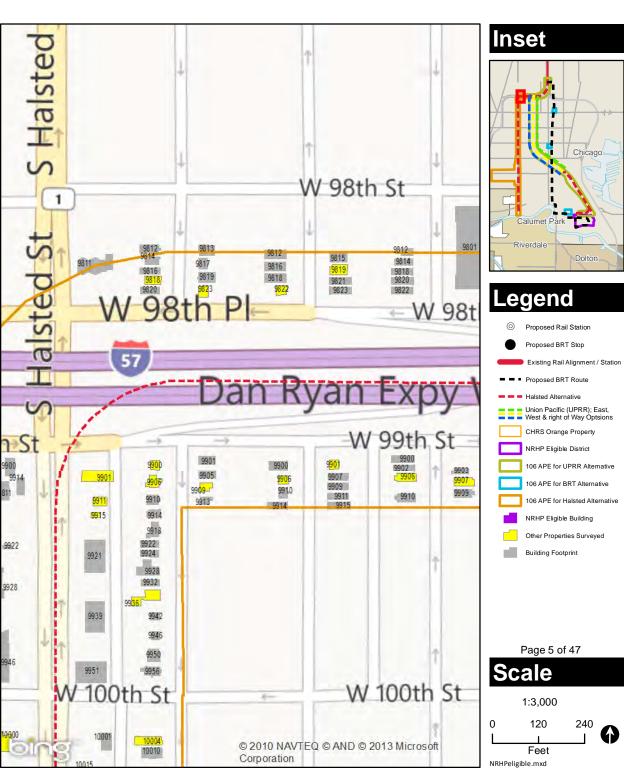


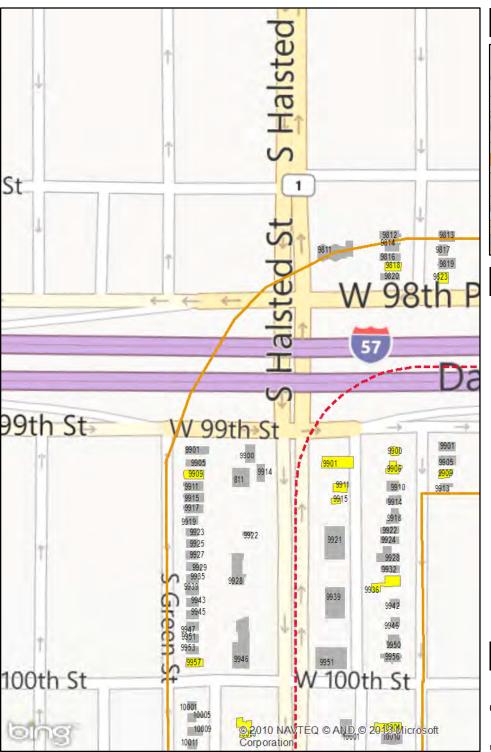



Inset





Legend 0 Proposed Rail Station Proposed BRT Stop Existing Rail Alignment / Station Proposed BRT Route Halsted Alternative Union Pacific (UPRR); East, West & right of Way Optsions CHRS Orange Property NRHP Eligible District 106 APE for UPRR Alternative 106 APE for BRT Alternative 106 APE for Halsted Alternative NRHP Eligible Building Other Properties Surveyed Building Footprint

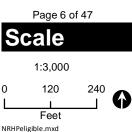


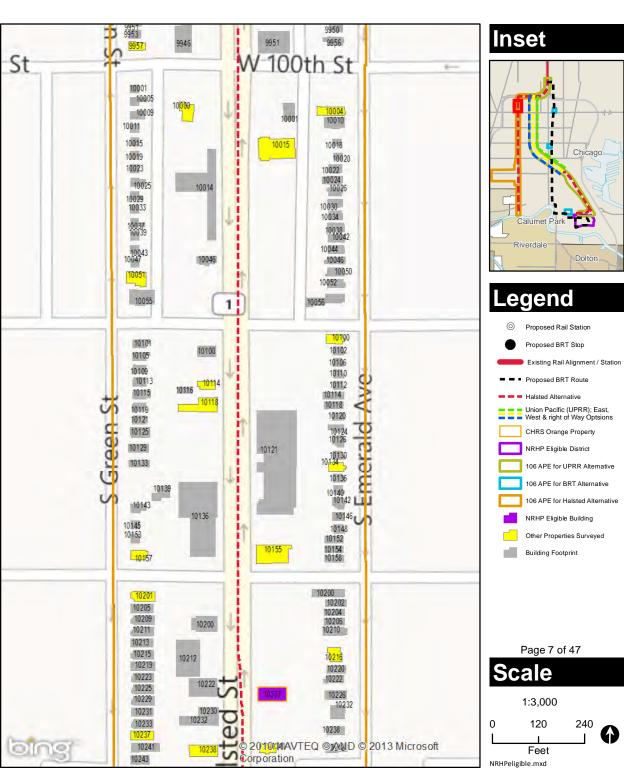


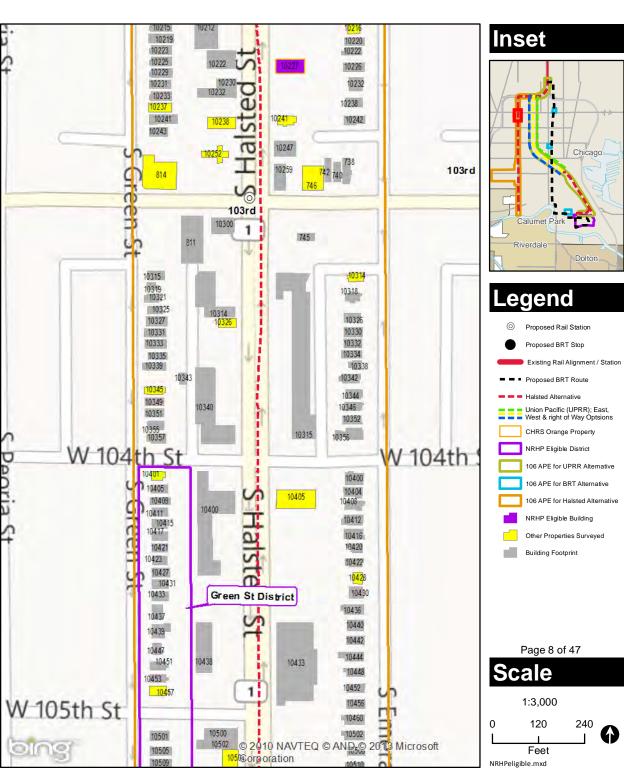


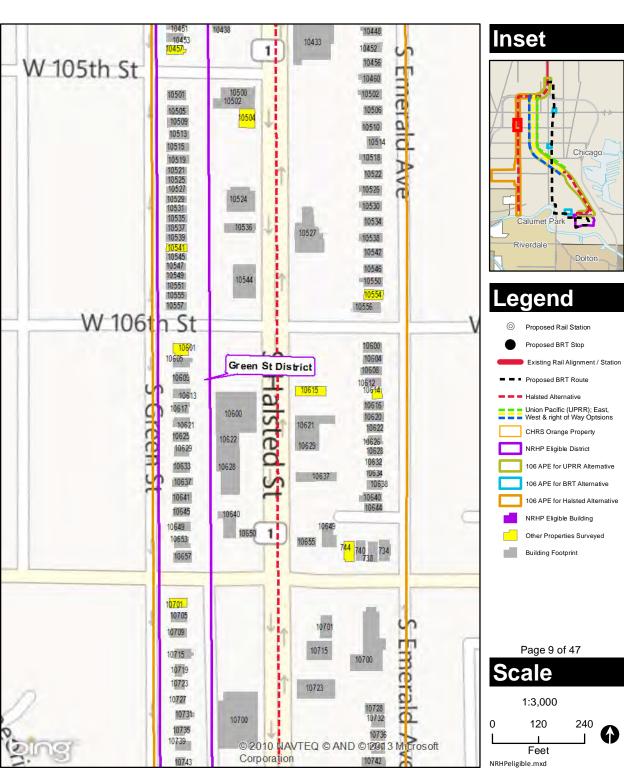


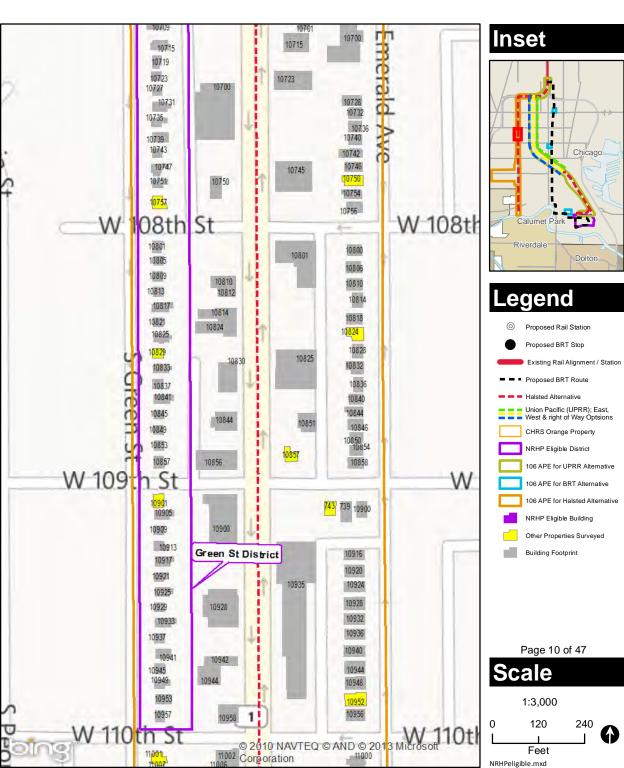


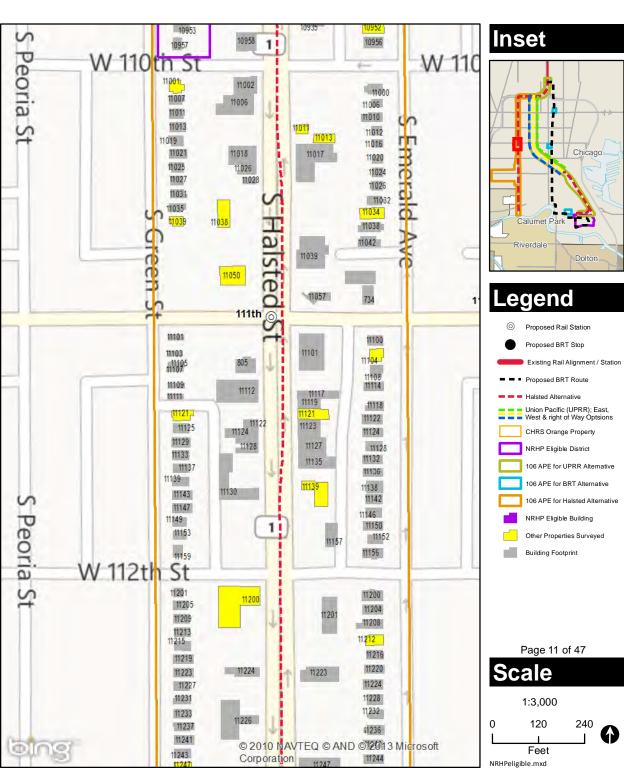


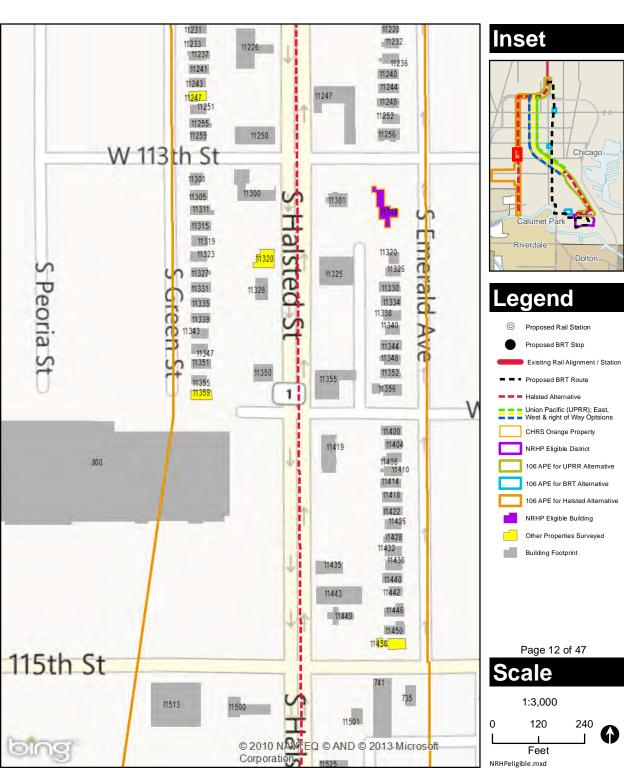

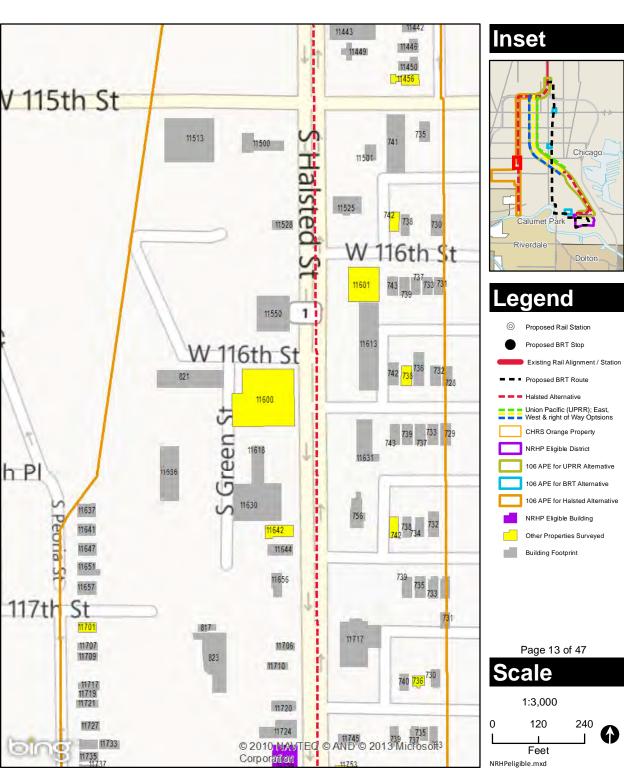

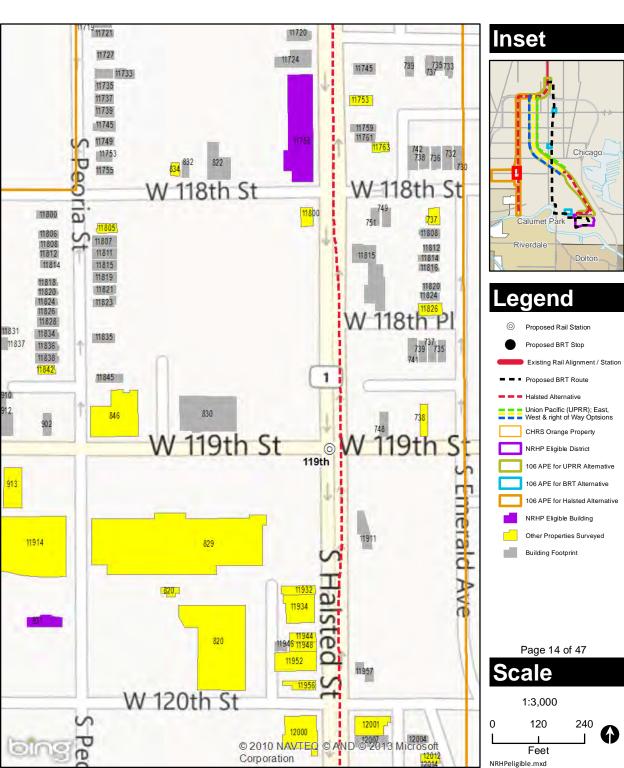


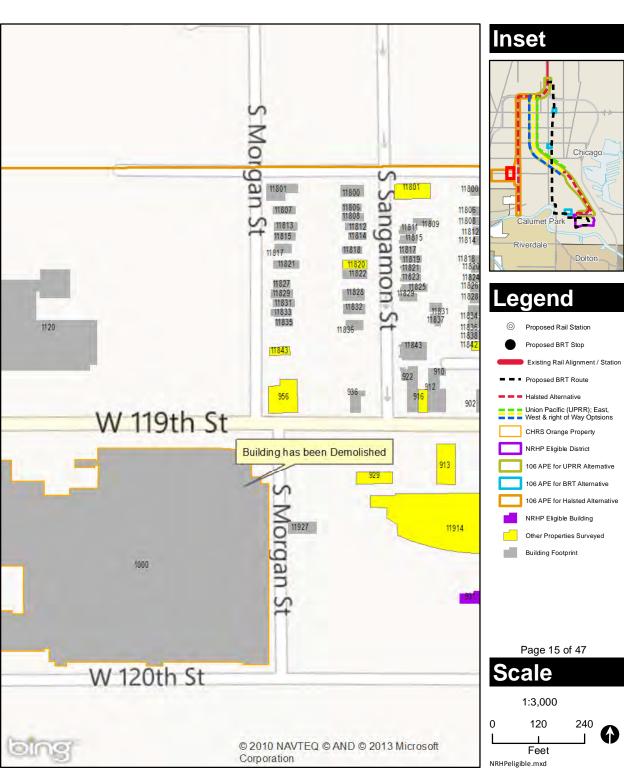

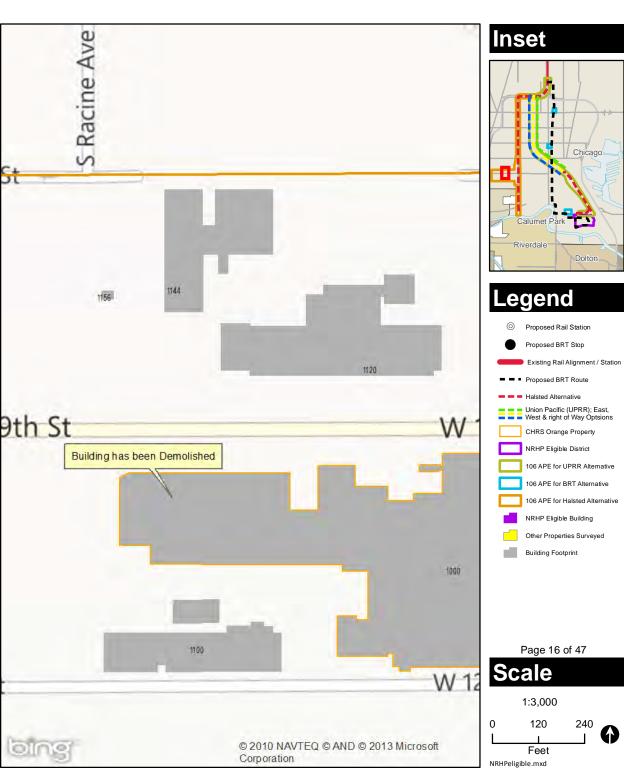







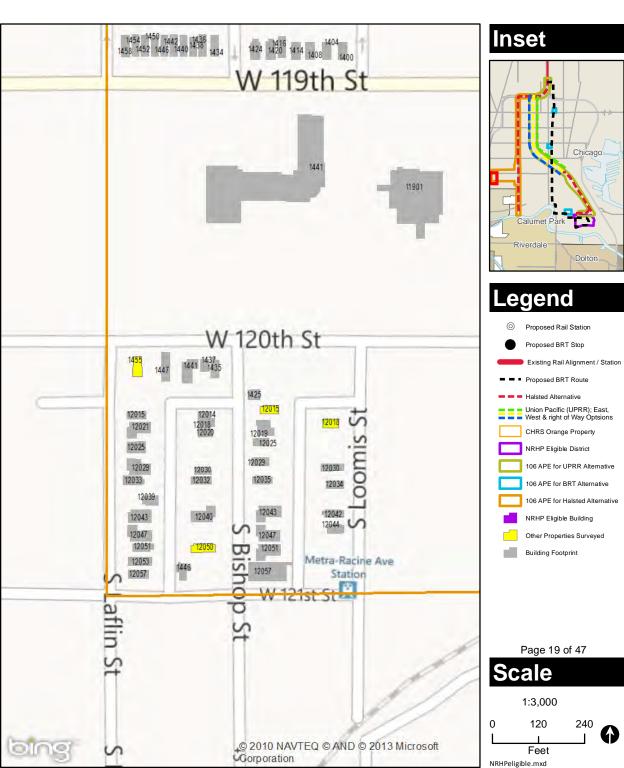





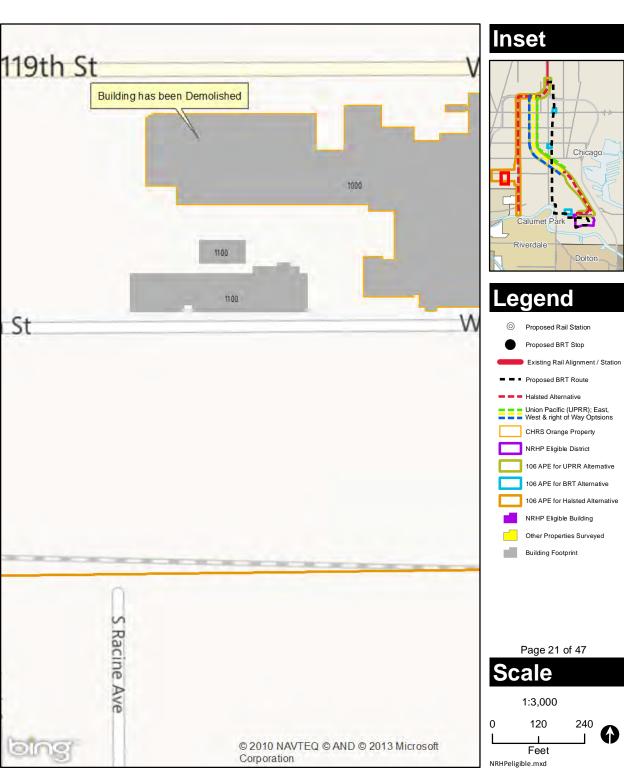




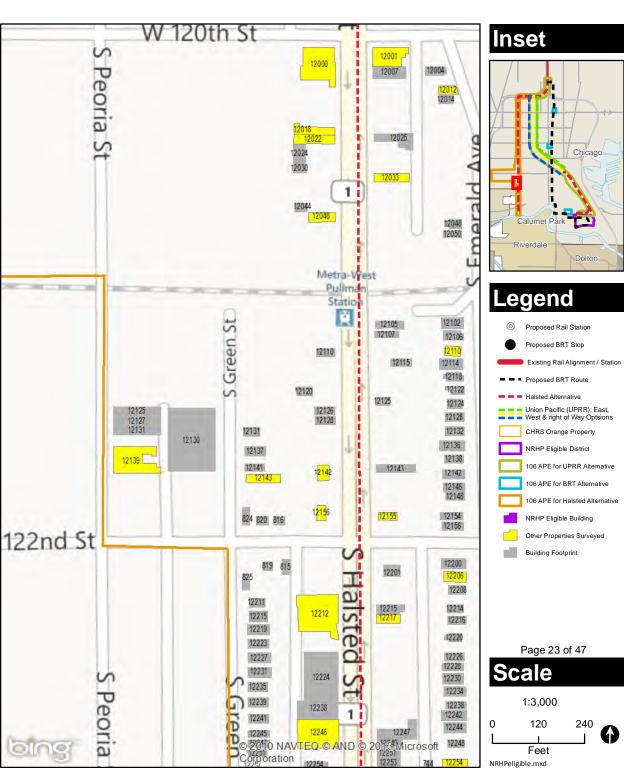

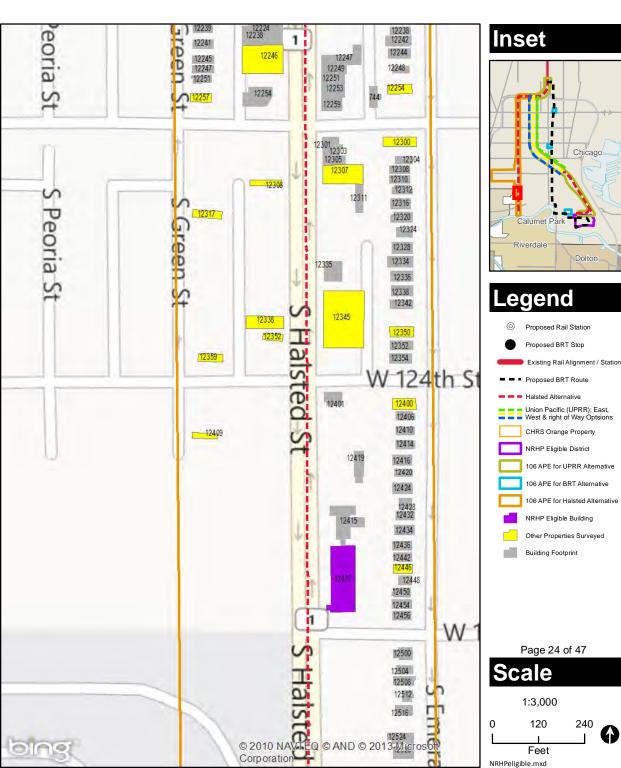

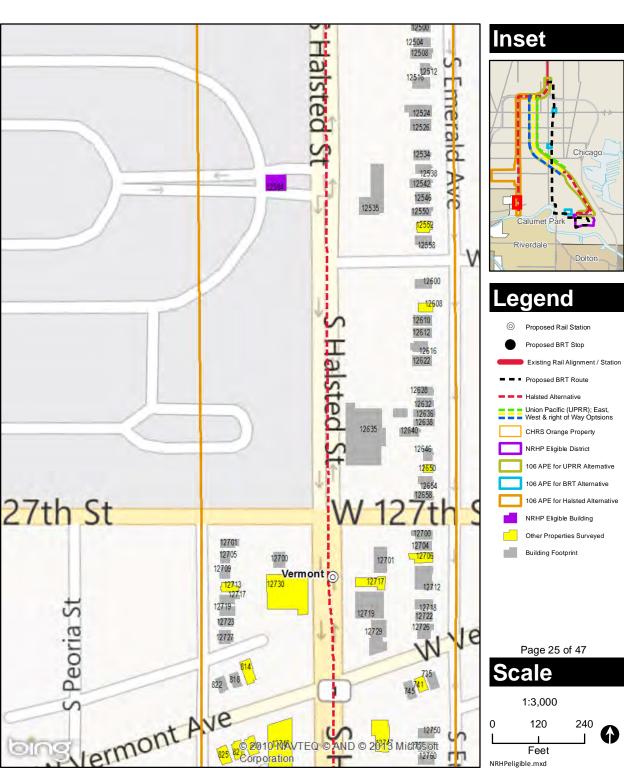

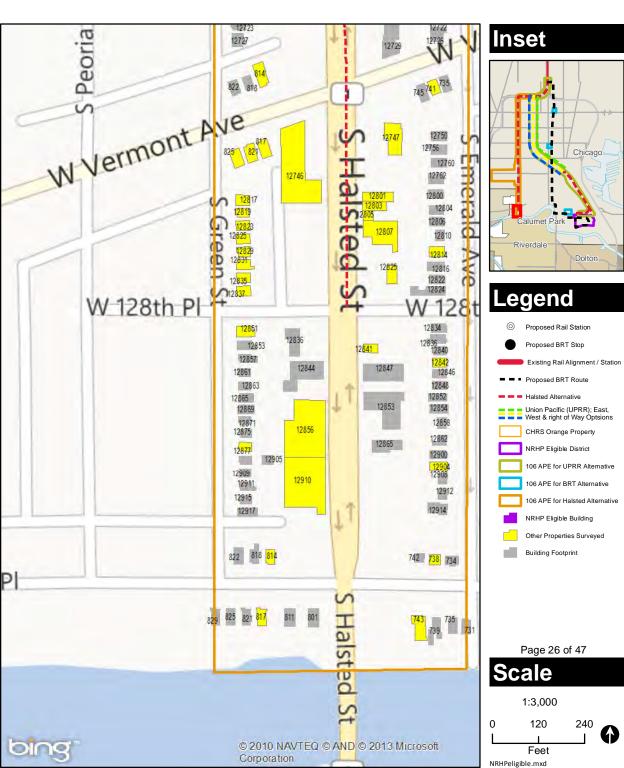






Chicago .





240

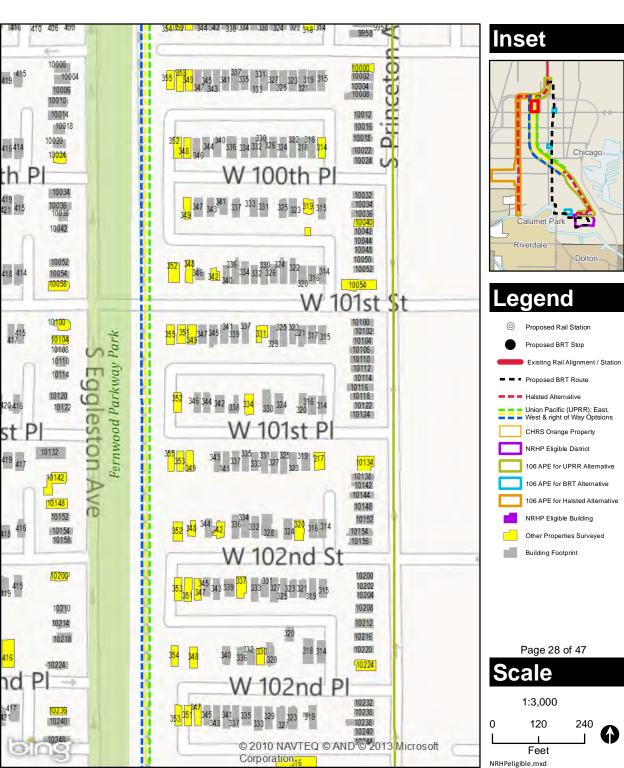


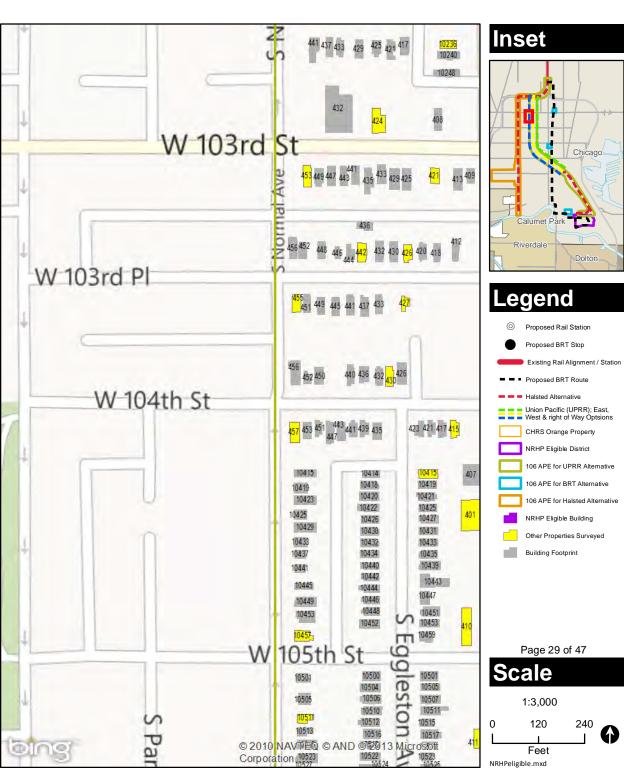


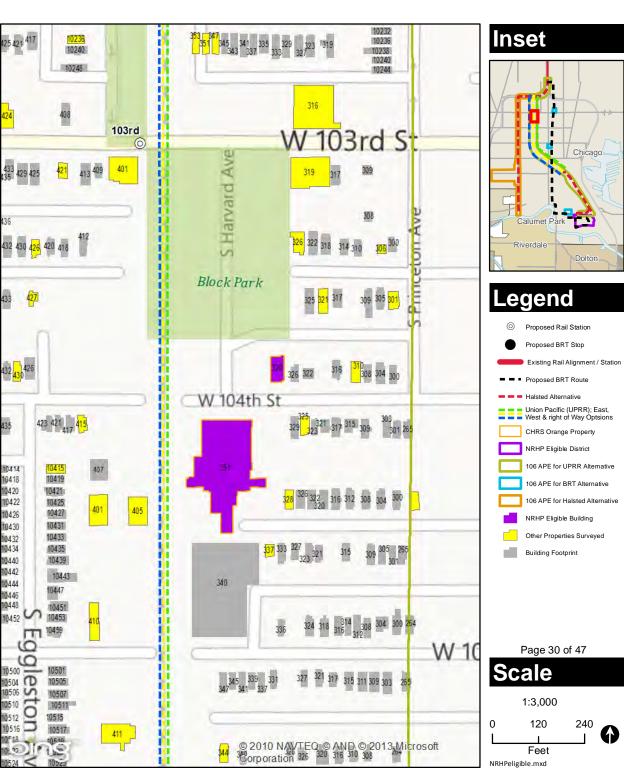


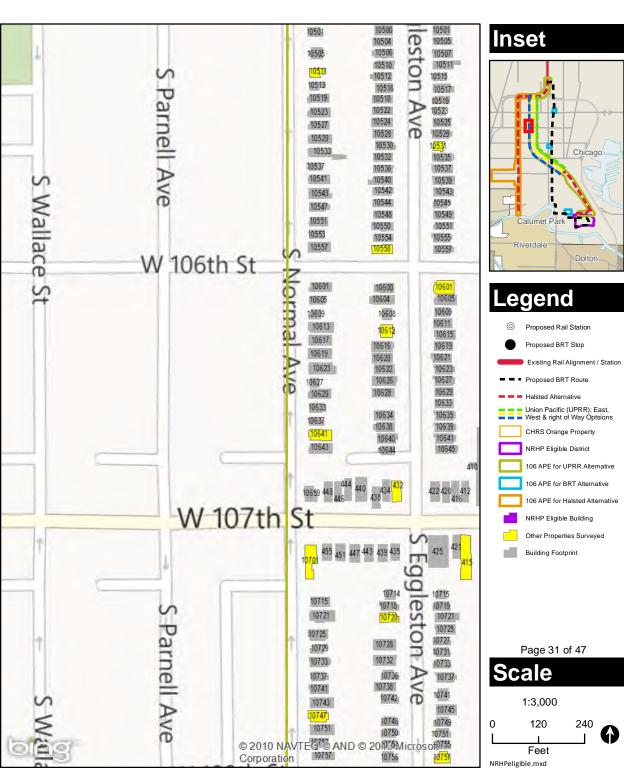


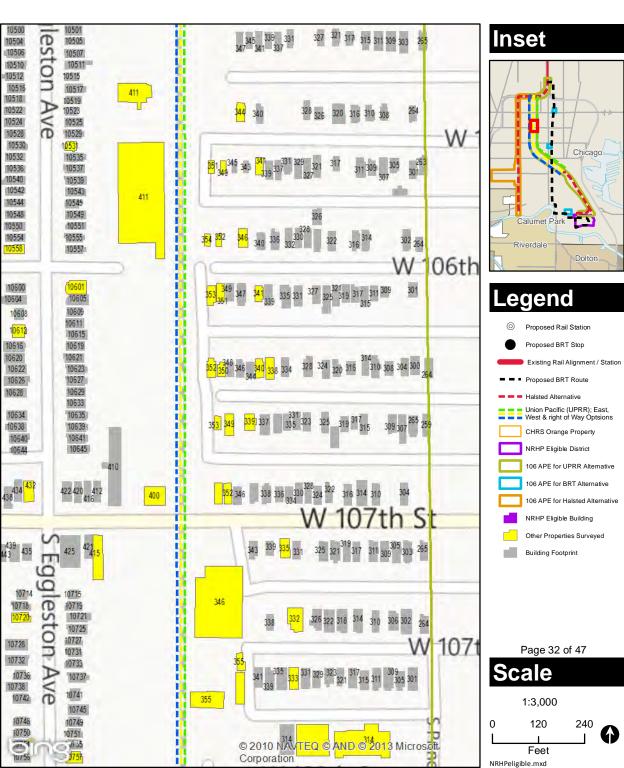


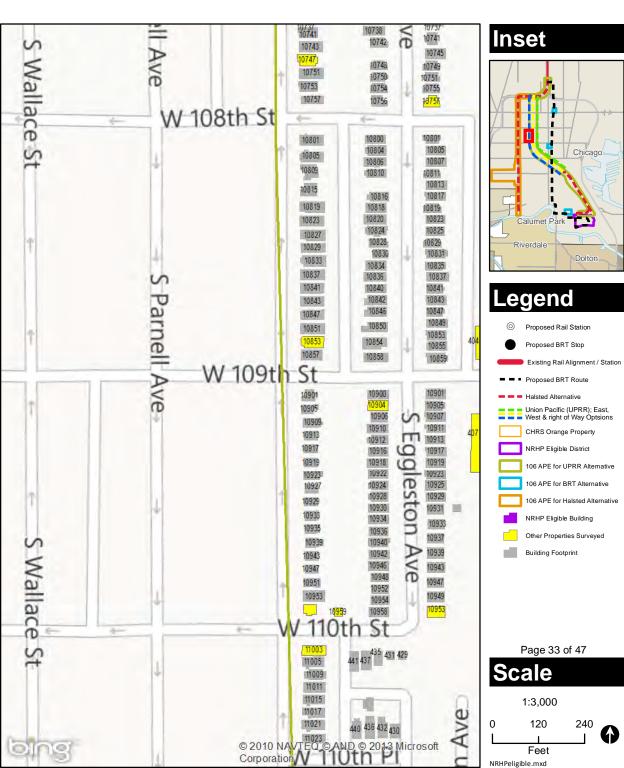

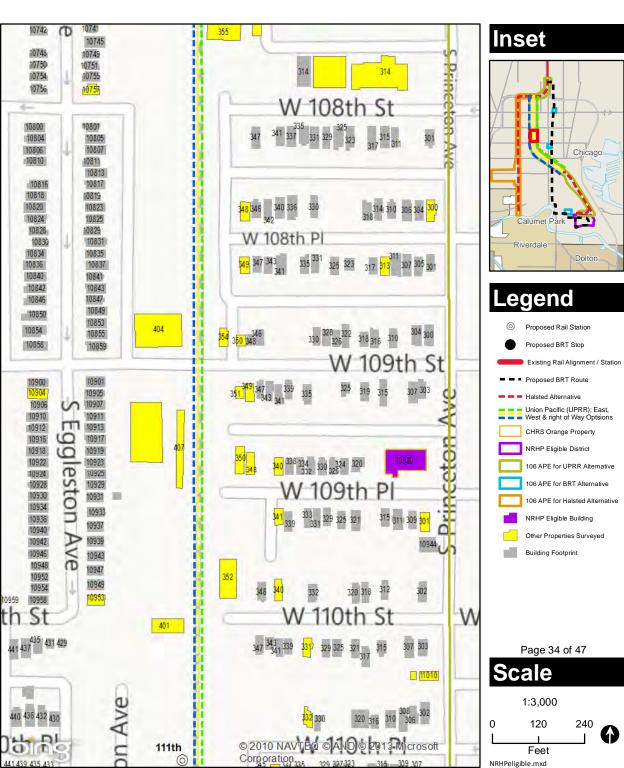

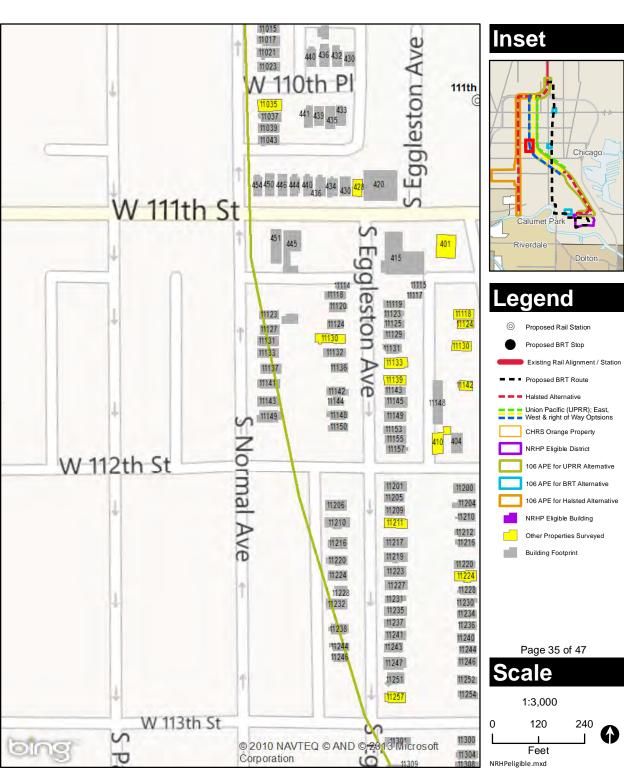

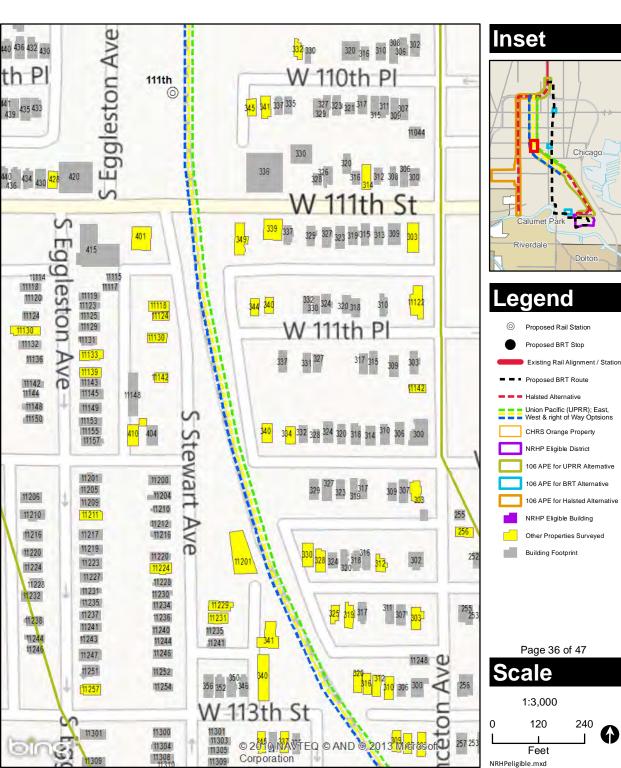

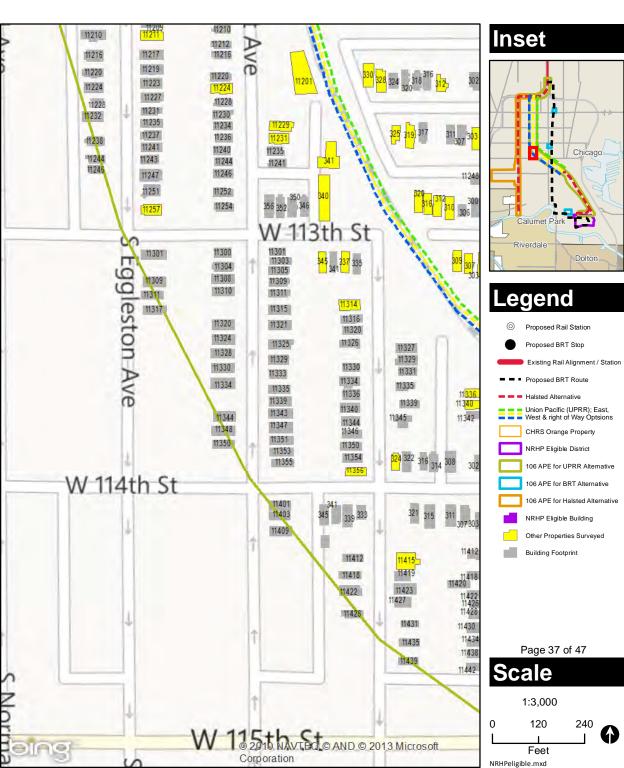













Other Properties Surveyed



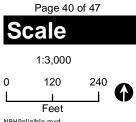

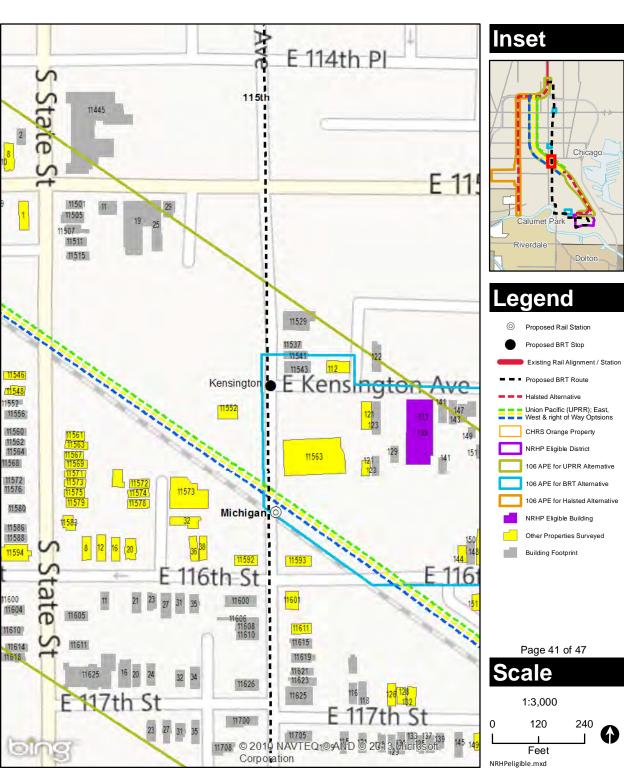


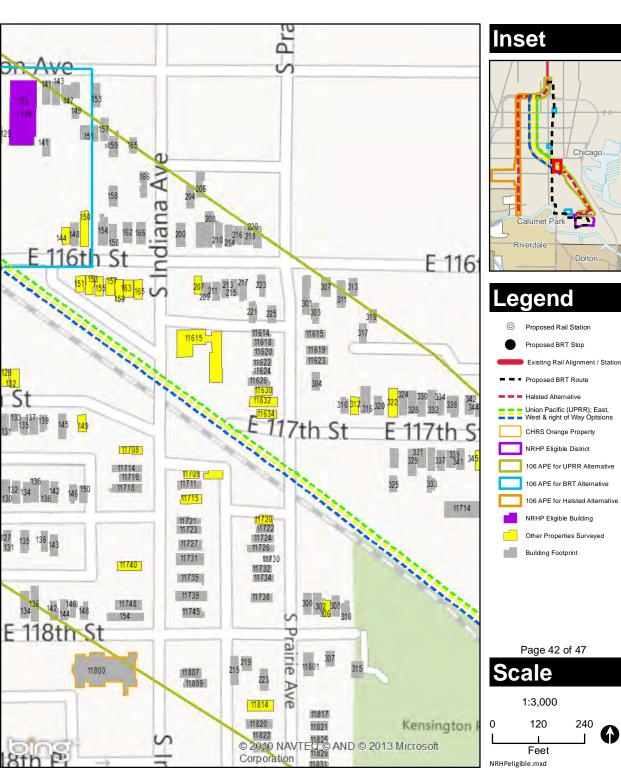


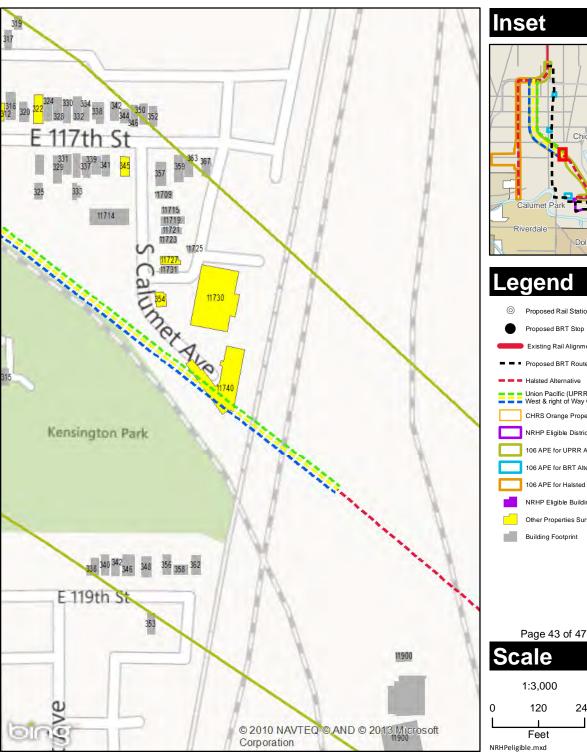







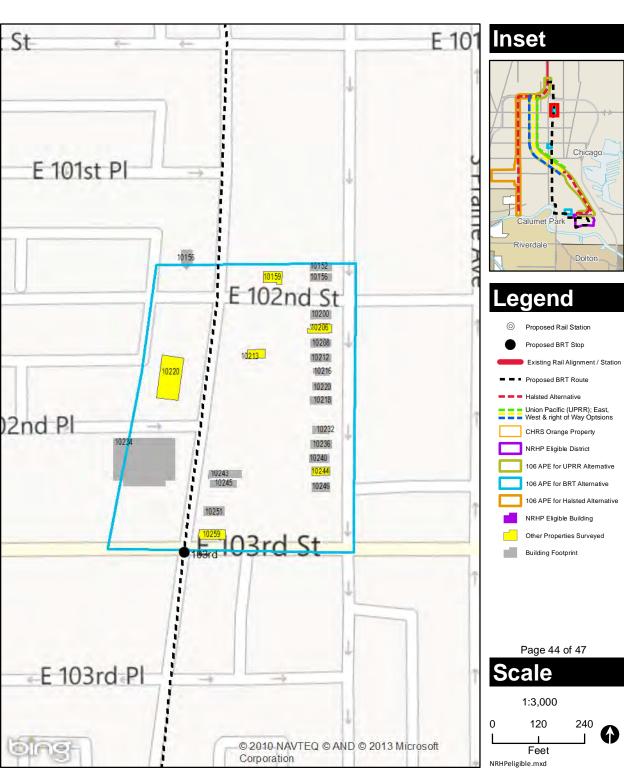

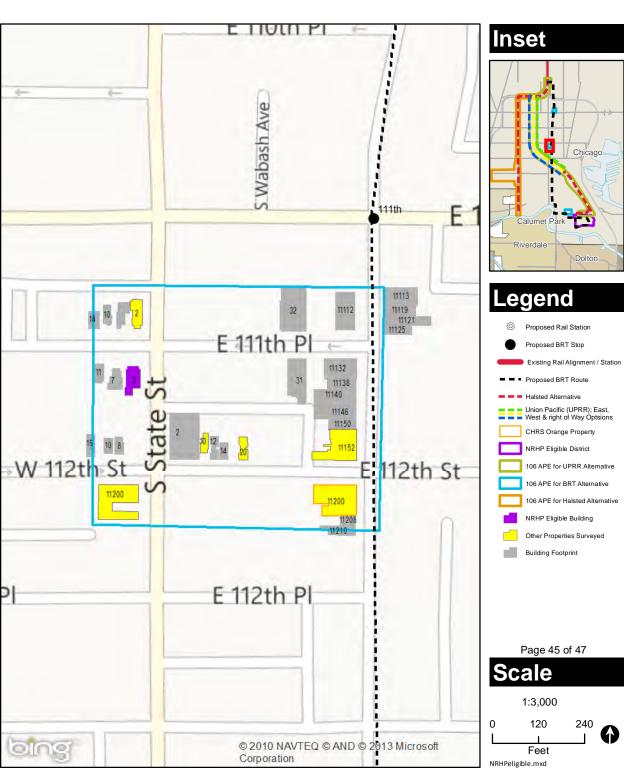

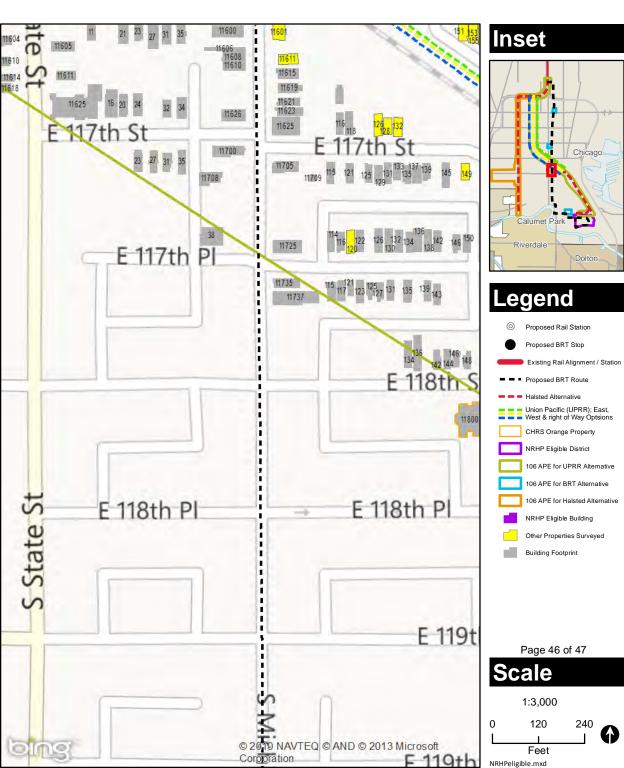

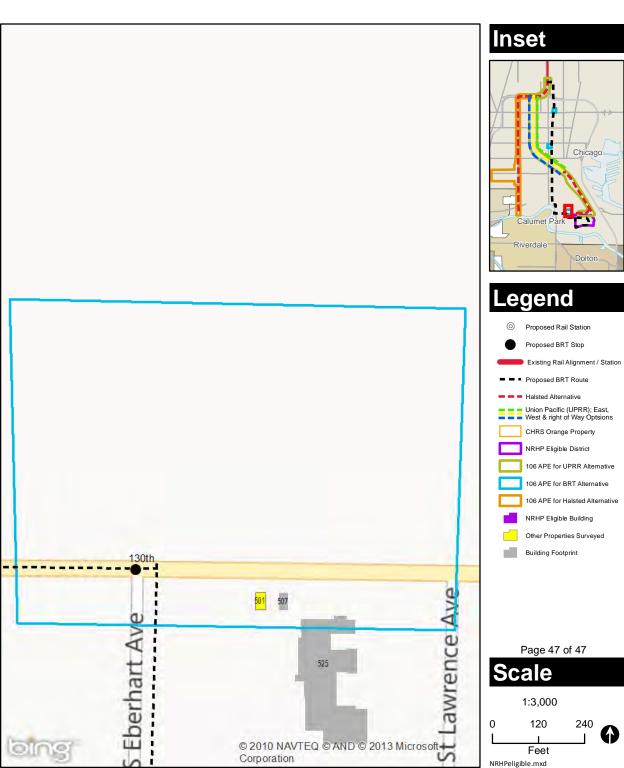



Appendix B Inventory Sheets for Properties Surveyed





Historical Resource Recordation Form

Property Name	Photos with Captions: South façade of a one-story, single family, brick residence.
Historic: Bldg. not labeled, not in CHRS	
Common/Current: Unknown	
Property Address:	
418 W. 98th Place	
HAARGIS Number:	
Not in database	
Present Owner and /or Occupant:	
Unknown	
Property Use	
Historic: Single family residence	
Current: Single family residence	
Date of Construction: 1931	
Architect's Name: Not in CHRS	
Builder/Contractor: Not in CHRS	
Architectural Style:	
Chicago Style Bungalow	
Prepared By: J. Martinez, M. C. Bird, J.	
Guarino	
Photo By: S. Katz	
Date: 31 October 2012	

Property Description:

Stories: 1

This one-story brick bungalow in the Washington Heights community is clad with tan face brick on its front elevation, common brick on its side elevations, and synthetic siding on its rear elevation. It has a steeply pitched hip roof covered with asphalt shingles and synthetic-clad, hip roof dormers with paired one-over-one windows on both the front and rear elevations. The front elevation has a recessed corner porch with round-arch opening, low brick sidewalls, and concrete steps. The residence also includes a door tucked into the side of the living room bay and four one-over-one windows, three of which are grouped together under a segmental arch. All windows are modern replacements with aluminum sashes. This house lacks distinguishing architectural features and is not individually eligible for listing on the National Register.



Structural Survey

Integrity:			Additional Notes/Descriptions
Unaltered	Slight Modification	Major Alteration	Replacement cladding and windows
Condition:			
Excellent	Good	Poor	
Additional Alteration	ons		
Structure Usage Exterior Wall Surface		Exterior Wall Surface	
Current: NA		Brick (main),	
Historic: NA		Synthetic siding (rear)	
Roof Material	Roof Features	Roof Type	
Asphalt shingle	Dormers	Hip	
Ornamental Architectural Details			Windows
Segmental arch, round arch porch opening			Double-hung
Outbuildings (Num	ber and Description)		
None			

Local Landmark	Y <u>N</u>	
National Register Historic Places	Y <u>N</u>	
National Register Historic District	Y <u>N</u>	Name:
Individually Eligible? No	A B C	Significance:



Historical Resource Recordation Form

Property Name	Photos with Captions:			
Historia: Dida not labeled not in CUDS	West façade of a brick, split-level, single family residence.			
Historic: Bldg. not labeled, not in CHRS				
Common/Current: Unknown				
Property Address:				
221 W. 98th Street				
HAARGIS Number:				
Not in database				
Present Owner and /or Occupant:				
Unknown				
Property Use				
Historic: Single family residence				
Current: Single family residence				
Date of Construction: 1964				
Architect's Name: Not in CHRS				
Builder/Contractor: Not in CHRS				
Architectural Style:				
Vernacular				
Prepared By: J. Martinez, M. C. Bird, J.				
Guarino				
Photo By: S. Katz				
Date: 9 October 2012				

Property Description:

Stories: Spilt-level

This split-level home in the Roseland community is clad with buff brick and synthetic siding, has a shed roof with exposed rafters above its one-story section and a gable roof above its two-story section. It has centrally located wood double-doors topped by two large fixed-pane windows; other windows are arranged in groups of three along its front elevation. Windows are one-over-one aluminum-sash. This split-level home does not have distinguishing architectural features and is not individually eligible for listing on the National Register.



Structural Survey

Integrity:			Additional Notes/Descriptions
Integration			
Unaltered	Slight Modification	n Major Alteration	
Condition:			
<u>Excellent</u>	Good	Poor	
Additional Alterati	ons		
Structure Usage Exterior Wall Surface			
Structu	ire Usage		
Current: NA		Brick, synthetic siding	
Historic: NA			
Roof Material	Roof Features	Roof Type	
Asphalt	None	Gable, shed	
Ornamental Architectural Details			Windows
Exposed rafters			Double-hung, fixed-pane
Outbuildings (Num	ber and Description)		
None			

Local Landmark	Y <u>N</u>	
National Register Historic Places	Y <u>N</u>	
National Register Historic District	Y <u>N</u>	Name:
Individually Eligible? No	A B C	Significance:

Additional Comments:			



Historical Resource Recordation Form

Property Name	Photos with Captions:
Historic: Bldg. not labeled, not in CHRS	South façade of a brick, one-story, single family residence.
Common/Current: Unknown	
Property Address:	
124 W. 99th Street	
HAARGIS Number:	
Not in database	
Present Owner and /or Occupant:	
Unknown	
Property Use	
Historic: Single family residence	
Current: Single family residence	
Date of Construction: 1965	
Architect's Name: Not in CHRS	
Builder/Contractor: Not in CHRS	
Architectural Style:	
Vernacular	
Prepared By: J. Martinez, M. C. Bird, J.	
Guarino	
Photo By: S. Katz	
Date: 8 October 2012	

Property Description:

Stories: 1

This one-story home in the Roseland community is situated on a raised brick basement with glass block windows, is clad with buff brick, and has a hip roof covered with asphalt shingles and overhanging eaves. Its front elevation is fronted by a faux stone planter. It has an off-center door and sidelight comprised of glass blocks, two decorative glass block inserts, a picture window flanked by one-over-one aluminum-sash windows, and concrete steps behind a low faux stone wall. An attached two-car hip roof garage clad in the same buff brick is situated along the home's rear elevation. It does not display distinguishing architectural features and is not individually eligible for listing on the National Register.



Integrity:			Additional Notes/Descriptions
<u>Unaltered</u>	Slight Modification	Major Alteration	
Condition:			
Excellent	Good	Poor	
Additional Alterati	ons		
Structu	re Usage	Exterior Wall Surface	
Current: NA		Brick	
Historic: NA			
Roof Material	Roof Features	Roof Type	
Asphalt	None	Hip	
Ornamental Archit	ectural Details		Windows
Planter, glass block inserts, faux stone wall at entry			Double-hung, fixed-pane, glass block
Outbuildings (Num	ber and Description)		
Attached two-car ga	rage.		

Local Landmark	Y <u>N</u>	
National Register Historic Places	Y <u>N</u>	
National Register Historic District	Y <u>N</u>	Name:
Individually Eligible? No	A B C	Significance:

Additional Comments:			



Historical Resource Recordation Form

Property Name	Photos with Captions: North façade of a brick, two-story, single family residence
Historic: Bldg. not labeled, not in CHRS	
Common/Current: Unknown	
Property Address:	
401 W. 99th Street	
HAARGIS Number:	
Not in database	
Present Owner and /or Occupant:	
Unknown	
Property Use	
Historic: Single family residence	
Current: Single family residence	
Date of Construction: 1942	
Architect's Name: Not in CHRS	
Builder/Contractor: Not in CHRS	
Architectural Style:	
Vernacular	
Prepared By: J. Martinez, M. C. Bird, J.	
Guarino	
Photo By: S. Katz	and the second and th
Date: 10 October 2012	

Property Description:

Stories: 2

This two-story, brick clad house in the Washington Heights community is situated on a raised brick basement with glass block windows. The house has a hip roof covered with asphalt shingles. Its front elevation has a partial-width, hip roof, brick clad, enclosed porch with a metal storm door. It has concrete steps, metal railings, a pair of windows on the first floor and two single windows on the second floor. Windows throughout the house are non-original one-over-one aluminum-sash. Detailing includes concrete sills and orange brick banding that contrasts with the brown face brick cladding. It does not feature distinguishing architectural elements and is not individually eligible for listing on the National Register.



Integrity:			Additional Notes/Descriptions
Unaltered	Slight Modification	Moior Alteration	Replacement windows
Unantered	Slight Modification	Major Alteration	Replacement while wis
Condition:			
<u>Excellent</u>	Good	Poor	
Additional Alterati	ons		
Structu	ire Usage	Exterior Wall Surface	
Current: NA		Brick	
Historic: NA			
Roof Material	Roof Features	Roof Type	
Asphalt shingle	None	Hip	
Ornamental Archit	tectural Details		Windows
Brick banding, concrete sills			Double-hung, glass block
Outbuildings (Num	ber and Description)		•
None			

Local Landmark	Y <u>N</u>	
National Register Historic Places	Y <u>N</u>	
National Register Historic District	Y <u>N</u>	Name:
Individually Eligible? No	A B C	Significance:

Additional Comments:			



Photos with Captions: Property Name South façade of split-level, single-family residence. Historic: Not labeled, not in CHRS Common/Current: Unknown **Property address:** 314 W. 100th Place **HAARGIS Number:** Not in database **Present Owner and /or Occupant:** Unknown **Property Use** Historic: Single family residence Current: Single family residence Date of Construction: 1965 Architect's Name: Not in CHRS Builder/Contractor: Not in CHRS **Architectural Style:** Vernacular Prepared By: C. Tolmie, M. C. Bird, J. Guarino Photo By: S. Katz Date: 16 September 2012

Historical Resource Recordation Form

Property Description:

Stories: Split-level

This back-split home in the Roseland community has a hip roof on both levels covered with asphalt shingles. The front elevation is clad with faux stone below the concrete sill line and brown brick above. This elevation has an off-center hollow core metal door, a picture window flanked by one-over-one aluminum-sash windows, and two decorative glass block inserts. It does not feature distinguishing architectural elements and is not individually eligible for listing on the National Register.



Integrity:			Additional Notes/Descriptions
Unaltered	Slight Modification	n Major Alteration	
Condition:			
Excellent	Good	Poor	
Additional Alterati	ons		
Structu	ire Usage	Exterior Wall Surface	
Current: NA		Brick (main),	
Historic: NA		Faux stone (lower façade)	
Roof Material	Roof Features	Roof Type	
Asphalt shingle	None	Hip	
Ornamental Archit	ectural Details		Windows
Glass block inserts			Double-hung, fixed-pane
Outbuildings (Num	ber and Description)		
Garage			

Local Landmark	Y <u>N</u>	
National Register Historic Places	Y <u>N</u>	
National Register Historic District	Y <u>N</u>	Name:
Individually Eligible? No	A B C	Significance:

Additional Comments:		



Historical Resource Recordation Form

Property Name	Photos with Captions: North façade of one-story, single-family residence.
Historic: Not labeled, not in CHRS	North façade of one-story, single-family residence.
Common/Current: Unknown	
Property address:	
319 W. 100th Place	
Alternate: 321 W. 100th Place	
HAARGIS Number:	
Not in database	
Present Owner and /or Occupant:	
Unknown	
Property Use	
Historic: Single family residence	
Current: Single family residence	
Date of Construction: 1949	
Architect's Name: Not in CHRS	
Builder/Contractor: Not in CHRS	
Architectural Style:	
Vernacular	
Prepared By: C. Tolmie, M. C. Bird	
Photo By: S. Katz	
Date: 16 September 2012	

Property Description:

Stories: 1

This one-story house in the Roseland community is situated on a raised brick basement and has a front gable roof covered with asphalt shingles. Its front elevation is clad with buff brick and has a projecting gabled living room bay. This elevation also has a centrally located entrance with a metal storm door, concrete steps, metal railings, a bracketed shed-roofed door hood, and four six-over-one windows: three on the first floor and one in the gable. This house lacks distinctive architectural features and is not individually eligible for listing on the National Register.



Integrity:			Additional Notes/Descriptions
<u>Unaltered</u>	Slight Modification	Major Alteration	
Condition:			
Excellent	Good	Poor	
Additional Alterati	ons		
Structu	ire Usage	Exterior Wall Surface	
Current: NA		Brick	
Historic: NA			
Roof Material	Roof Features	Roof Type	
Asphalt shingle	None	Gable	
Ornamental Archit	ectural Details	Windows	
Concrete sills			Double-hung
Outbuildings (Num	ber and Description)		
Garage			

Local Landmark	Y	<u>N</u>	
National Register Historic Places	Y	<u>N</u>	
National Register Historic District	Y	<u>N</u>	Name:
Individually Eligible? No	Α	B C	Significance:

Additional Comments:			



Historical Resource Recordation Form

Property Name	Photos with Captions: North façade of a brick, one-story, single family residence.
Historic: Bldg. not labeled, not in CHRS	Norm raçade of a brick, one-story, single failing residence.
Common/Current: Unknown	
Property Address:	
435 W. 100th Place	
HAARGIS Number:	
Not in database	
Present Owner and /or Occupant:	
Unknown	
Property Use	
Historic: Single family residence	
Current: Single family residence	
Date of Construction: 1942	
Architect's Name: Not in CHRS	
Builder/Contractor: Not in CHRS	
Architectural Style:	
Vernacular	
Prepared By: J. Martinez, M. C. Bird, J.	
Guarino	
Photo By: S. Katz	
Date: 10 October 2012	

Property Description:

Stories: 1

This one-story house in the Washington Heights community is clad with polychromatic brick and has a side-gabled roof covered with asphalt shingles. End gable walls are clad in aluminum siding. Its front elevation features a gabled pavilion with a strip of three non-original one-over-one aluminum-sash windows and a gabled entrance vestibule featuring a wood door with diamond pane window, concrete steps, and metal railings. A single non-original one-over-one aluminum-sash window is located in the corner of the front elevation. A small ventilating louver is situated in the gable. Detailing includes concrete sills and lintels with keystones. This house does not display distinguishing architectural features and is not individually eligible for listing on the National Register.



Integrity:			Additional Notes/Descriptions
Unaltered	Slight Modificatio	on Major Alteration	Replacement windows and siding in gable ends
Condition:			
Excellent	Good	Poor	
Additional Alteration	ons		
Structu	re Usage	Exterior Wall Surface	
Current: NA		Brick (main),	
Historic: NA		Synthetic siding (gable ends)	
Roof Material	Roof Features	Roof Type	
Asphalt shingles	None	Side gable	
Ornamental Archit	ectural Details	Windows	
Concrete sills and lir	ntels with keystones	Double-hung	
Outbuildings (Num	ber and Description)		
None			

Local Landmark	Y <u>N</u>	
National Register Historic Places	Y <u>N</u>	
National Register Historic District	Y <u>N</u>	Name:
Individually Eligible? No	A B C	Significance:

Additional Comments:			



Historical Resource Recordation Form

Property Name	Photos with Captions:
Historic: Bldg. not labeled, not in CHRS	South façade of a brick one-story, brick, single family residence.
Common/Current: Unknown	
Property Address:	
444 W. 100th Place	
HAARGIS Number:	
Not in database	
Present Owner and /or Occupant:	
Unknown	
Property Use	
Historic: Single family residence	
Current: Single family residence	
Date of Construction: 1930	
Architect's Name: Not in CHRS	
Builder/Contractor: Not in CHRS	
Architectural Style:	
Eclectic Neo-Traditional	
Prepared By: J. Martinez, M. C. Bird, J.	
Guarino	
Photo By: S. Katz	
Date: 10 October 2012	
Description Descriptions	

Property Description:

Stories: 1

This one-story house in the Washington Heights community sits on a raised basement. It is clad with polychromatic brick and has a side gabled roof covered with asphalt shingles. Its front elevation has a gabled living room bay pavilion with paired basement windows that appear to be casements. There is a group of three non-original one-over-one windows with concrete sills and brick arch lintels that are separated by colonettes with acanthus leaf capitals. A small round-arched window is located in the gable. The house has a recessed corner porch with a metal storm door, round-arch openings, a Neo-Gothic castellated top, concrete steps, and brick sidewalls. This house has very good integrity in terms of its materials and detailing, and its Eclectic Neo-Traditional ornamentation makes it stand out among the vernacular, stripped-down brick and frame bungalows and cottages that comprise the predominant building stock in the Washington Heights community. As a result, it is recommended as individually eligible for National Register listing under Criterion C for architecture.



Structural Survey

Integrity:			Additional Notes/Descriptions			
Unaltered	Slight Modification	on Major Alteration	Replacement windows			
Condition:						
<u>Excellent</u>	Good	Poor				
Additional Alterati	ions					
Structu	ıre Usage	Exterior Wall Surface				
Current: NA		Brick				
Historic: NA						
Roof Material	Roof Features	Roof Type				
Asphalt shingle	Castellated porch roofline	Gable				
Ornamental Archit	tectural Details	Windows				
	arched lintels, colonette ive brickwork, porch wit	Double-hung, fixed-pane, casement				
Outbuildings (Num	Outbuildings (Number and Description)					


None

Local Landmark	Y	<u>N</u>	
National Register Historic Places		<u>N</u>	
National Register Historic District	Y	<u>N</u>	Name:
Individually Eligible? Yes	A	в <u>с</u>	Significance: The Eclectic Neo-Traditional ornamentation stands out among the vernacular, stripped-down brick and frame residences that comprise the predominant building stock in the Washington Heights community.

Additional Comments:



Historical Resource Recordation Form

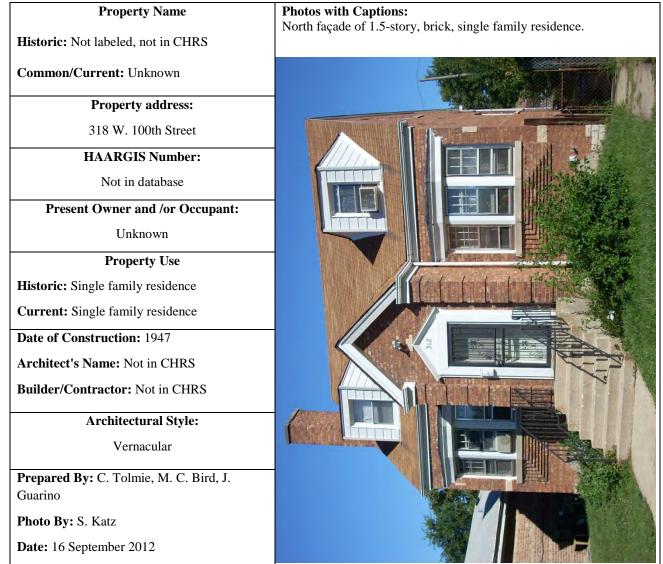

Property Description:

Stories: 1.5

This one-and-a-half-story brick-clad home has a steeply pitched side gable roof covered with asphalt shingles, an exterior brick chimney, and two aluminum-clad shed dormers, each of which has a single one-over-one aluminum-sash window (non-original). Its front elevation has a centrally located gabled front vestibule with brick quoins, a door with wood surround and pediment, and concrete steps with metal railings. The entrance is flanked by three-sided window bays, which feature six-over-one windows with decorative brick corbelling beneath. It does not feature sufficient distinguishing architectural features to qualify as individually eligible for listing on the National Register.



Structural Survey

Integrity:			Additional Notes/Descriptions
Unaltered	Slight Modification	on Major Alteration	Replacement door, dormer windows, and siding
Condition:			
Excellent	Good	Poor	
Additional Alteration	ons		
Dormers may be pos	st-construction addition.		
Structu	ıre Usage	Exterior Wall Surface	
Current: NA		Brick	
Historic: NA			
Roof Material	Roof Features	Roof Type	
Asphalt shingle	Dormer	Side gable	
Ornamental Archit	ectural Details	Windows	
Brick quoins and con	rbelling; stone quoins and	Double-hung	
Outbuildings (Num	ber and Description)		
Garage			

Local Landmark	Y	<u>N</u>	
National Register Historic Places	Y	<u>N</u>	
National Register Historic District	Y	<u>N</u>	Name:
Individually Eligible? No	A	B C	Significance:

Additional Comments:



Historical Resource Recordation Form

Property Name	Photos with Captions: South and façades of a 1.5-story, single family, frame residence.
Historic: Bldg. not labeled, not in CHRS	South and façades of a 1.5-story, single failing, frame residence.
Common/Current: Unknown	
Property Address:	
426 W. 100th Street	
HAARGIS Number:	
Not in database	
Present Owner and /or Occupant:	
Unknown	
Property Use	
Historic: Single family residence	
Current: Single family residence	
Date of Construction: 1943	
Architect's Name: Not in CHRS	
Builder/Contractor: Not in CHRS	
Architectural Style:	
Vernacular	
Prepared By: J. Martinez, M. C. Bird, J.	
Guarino	
Photo By: S. Katz	
Date: 10 October 2012	

Property Description:

Stories: 1.5

This one-and-a-half story house in the Washington Heights community is situated on a raised basement that is covered with siding and has glass block windows. The house is clad with synthetic siding and has a hip roof covered with asphalt shingles, overhanging eaves, and gable dormers on the front and side elevations. Its front elevation has an off-center hollow-core metal door and a partial-width hip-roof porch with wood steps and open metal supports. There are three windows on the first floor and two in its gabled wall dormer, all of which are non-original one-over-one aluminum-sash. This house lacks integrity, does not display distinguishing architectural features, and is not individually eligible for listing on the National Register.



Integrity:			Additional Notes/Descriptions
Unaltered	Slight Modification	Major Alteration	Replacement door, windows, and cladding
Condition:			
Excellent	Good	Poor	
Additional Alteration	ons		
Structu	re Usage	Exterior Wall Surface	
Current: NA		Synthetic siding	
Historic: NA			
Roof Material	Roof Features	Roof Type	
Asphalt shingle	Dormers	Hip	
Ornamental Architectural Details			Windows
None			Double-hung, glass block
Outbuildings (Num	ber and Description)		
None			

Local Landmark	Y <u>N</u>	
National Register Historic Places	Y <u>N</u>	
National Register Historic District	Y <u>N</u>	Name:
Individually Eligible? No	A B C	Significance:

Additional Comments:	



Historical Resource Recordation Form

Property Name	Photos with Captions:
Historic: Bldg. not labeled, not in CHRS	South and west façades of a one-story, single family residence.
Common/Current: Unknown	
Property Address:	
430 W. 100th Street	
HAARGIS Number:	
Not in database	
Present Owner and /or Occupant:	
Unknown	
Property Use	
Historic: Single family residence	
Current: Single family residence	
Date of Construction: 1919	
Architect's Name: Not in CHRS	
Builder/Contractor: Not in CHRS	
Architectural Style:	
Vernacular	
Prepared By: J. Martinez, M. C. Bird, J.	
Guarino	
Photo By: S. Katz	
Date: 10 October 2012	
Property Description:	Stories: 1

Property Description:

Stories: 1

This one-story cottage in the Washington Heights community sits on a raised basement with glass block windows. It has a hip roof covered with asphalt shingles. Its front elevation is clad with faux stone and its side and rear elevations are clad with synthetic siding and stucco. Its front elevation has a partial-width gabled porch with concrete steps and non-original open metal supports. It also has an off-center entrance with a metal storm door and two non-original one-over-one aluminum-sash windows. This house lacks integrity, does not feature distinguishing architectural elements, and is not individually eligible for listing on the National Register.



Integrity:			Additional Notes/Descriptions
Unaltered	Slight Modificatio	n Major Alteration	Replacement windows, porch supports, and cladding
Condition:			
<u>Excellent</u>	Good	Poor	
Additional Alteration	ons		
Structure Usage Exterior Wall Surface			
Current: NA		Synthetic siding (sides), faux	
Historic: NA		stone (façade), stucco (sides)	
Roof Material	Roof Features	Roof Type	
Asphalt shingle	None	Hip	
Ornamental Architectural Details			Windows
None			Double-hung, glass block
Outbuildings (Num	ber and Description)		·
None			

Local Landmark	Y <u>N</u>	
National Register Historic Places	Y <u>N</u>	
National Register Historic District	Y <u>N</u>	Name:
Individually Eligible? No	A B C	Significance:

Additional Comments:	



Historical Resource Recordation Form

Property Name	Photos with Captions: South façade of a brick, one-story, single family residence.
Historic: Bldg. not labeled, not in CHRS	South façade of a offek, one-story, single family residence.
Common/Current: Unknown	
Property Address:	
334 W. 101st Place	
HAARGIS Number:	
Not in database	
Present Owner and /or Occupant:	
Unknown	
Property Use	
Historic: Single family residence	
Current: Single family residence	
Date of Construction: 1949	
Architect's Name: Not in CHRS	
Builder/Contractor: Not in CHRS	
Architectural Style:	
Vernacular	
Prepared By: J. Martinez, M. C. Bird, J.	
Guarino	
Photo By: S. Katz	
Date: 9 October 2012	
Property Description:	Stories: 1

Property Description:

Stories: 1

This one-story house in the Roseland community has a hip roof covered with asphalt shingles and a projecting gable-roofed living room. The front elevation is clad with brownish-orange face brick. Its off-center entrance features a metal storm door and a porch with concrete steps, metal railings and open metal posts supporting a metal awning. The front elevation has a window grouping that is partially obscured by a low metal canopy but appears to be a picture window flanked by double-hung windows. The side elevations are clad with common brick. Detailing includes a brick arch with stone keystone above the front elevation window group and stone blocks surrounding the door. This house does not feature sufficient distinguishing architectural elements to be individually eligible for listing on the National Register.



Integrity:			Additional Notes/Descriptions
<u>Unaltered</u>	Slight Modification	n Major Alteration	
Condition:			
<u>Excellent</u>	Good	Poor	
Additional Alterati	ons		
Structu	ıre Usage	Exterior Wall Surface	
Current: NA		Brick	
Historic: NA			
Roof Material	Roof Features	Roof Type	
Asphalt shingle	None	Hip	
Ornamental Architectural Details			Windows
Brick arch with stone keystone, stone blocks at entrance			Double-hung, fixed-pane
Outbuildings (Num	iber and Description)		
None			

Local Landmark	Y <u>N</u>	
National Register Historic Places	Y <u>N</u>	
National Register Historic District	Y <u>N</u>	Name:
Individually Eligible? No	A B C	Significance:

Additional Comments:			



Historical Resource Recordation Form

Property Name	Photos with Captions: North façade of brick, single family residence.
Historic: Bldg. not labeled, not in CHRS	Norui façade of offek, single family festdence.
Common/Current: Unknown	
Property Address:	-
349 W. 101st Place	
HAARGIS Number:	AUT BUILDING
Not in database	
Present Owner and /or Occupant:	
Unknown	
Property Use	
Historic: Single family residence	
Current: Single family residence	349
Date of Construction: 1965	
Architect's Name: Not in CHRS	
Builder/Contractor: Not in CHRS	And and an an
Architectural Style:	
Vernacular	
Prepared By: C. Tolmie, M. C. Bird, J. Guarino	
Photo By: S. Katz	
Date: 4 September 2012	
Property Description:	Stories: 1

Property Description:

Stories: 1

This one-story house has gable front roof covered with asphalt shingles. Its front façade is sheltered by an overhang and is clad orange face brick, stone, and clapboards. A bow window with casements fronts the street façade. The off-center metal core door is accessed via a concrete stoop with metal hand rails. The side elevations are clad in common brick. This home does not have distinguishing architectural features and is not individually eligible for listing on the National Register.



Integrity:			Additional Notes/Descriptions
Unaltered	Slight Modification	Major Alteration	
Condition:			
Excellent	Good	Poor	
Additional Alteration	ons		
Structu	re Usage	Exterior Wall Surface	
Current: NA		Brick and stone (façade),	
Historic: NA		clapboard (gable end)	
Roof Material	Roof Features	Roof Type	
Asphalt shingle	None	Hip	
Ornamental Archit	ectural Details		Windows
None			Casement
Outbuildings (Num	ber and Description)		·
Garage			

Local Landmark	Y <u>N</u>	
National Register Historic Places	Y <u>N</u>	
National Register Historic District	Y <u>N</u>	Name:
Individually Eligible? No	A B C	Significance:

Additional Comments:		



Historical Resource Recordation Form

Property Name	Photos with Captions: South façade of a brick, one-story, single family residence.
Historic: Bldg. not labeled, not in CHRS	South laçade of a offek, one-story, single family residence.
Common/Current: Unknown	
Property Address:	
438 W. 101st Place	
HAARGIS Number:	
Not in database	
Present Owner and /or Occupant:	418
Unknown	
Property Use	
Historic: Single family residence	
Current: Single family residence	
Date of Construction: 1955	
Architect's Name: Not in CHRS	
Builder/Contractor: Not in CHRS	
Architectural Style:	
Vernacular	
Prepared By: J. Martinez, M. C. Bird, J.	-
Guarino	
Photo By: S. Katz	
Date: 10 October 2012	
Property Description:	Stories: 1

This one-story, brick-clad house in the Washington Heights community is situated on a raised basement with glass block windows and has a gable-on-hip roof covered with asphalt shingles. Its front elevation features an off-center hollow core metal door, concrete steps with metal railings, a projecting living room bay with a non-original picture window flanked by one-over-one aluminum-sash windows, a pent roof with bracket, and a small glass block window. It does not feature distinguishing architectural elements and is not individually eligible for listing on the National Register.



Integrity:			Additional Notes/Descriptions
Unaltered	Slight Modification	Major Alteration	Replacement door and windows
Condition:			
Excellent	Good	Poor	
Additional Alteration	ons		
Structu	re Usage	Exterior Wall Surface	
Current: NA		Brick	
Historic: NA			
Roof Material	Roof Features	Roof Type	
Asphalt shingles	None	Gable-on-hip	
Ornamental Archit	ectural Details		Windows
Bracket under pent re	oof		Double-hung, fixed-pane, glass block
Outbuildings (Num	ber and Description)		
None			

Local Landmark	Y	<u>N</u>	
National Register Historic Places	Y	<u>N</u>	
National Register Historic District	Y	<u>N</u>	Name:
Individually Eligible? No	Α	B C	Significance:

Additional Comments:			



Historical Resource Recordation Form

Property Name	Photos with Captions: North façade of one-story, single family, brick residence.
Historic: Not labeled, not in CHRS	North façade of one-story, single family, offek festdence.
Common/Current: Unknown	
Property address:	
331 W. 101st Street	
HAARGIS Number:	
Not in database	
Present Owner and /or Occupant:	
Unknown	
Property Use	
Historic: Single family residence	
Current: Single family residence	
Date of Construction: 1952	
Architect's Name: Not in CHRS	
Builder/Contractor: Not in CHRS	
Architectural Style:	
Vernacular	
Prepared By: C. Tolmie, M. C. Bird, J. Guarino	
Photo By: S. Katz	
Date: 16 September 2012	

Property Description:

Stories: 1

This one-story house in the Roseland community has a side gable roof covered with asphalt shingles. It is clad with brick on the first floor and with synthetic siding in the gables. The front elevation has a gabled projecting living room, an off-center door with concrete steps and metal railings, a picture window flanked by non-original one-over-one aluminum-sash windows, and a single non-original one-over-one aluminum-sash windows. Detailing includes stone insert blocks flanking the door and several decorative glass insert blocks. It does not display distinguishing architectural features and is not individually eligible for listing on the National Register.



Integrity:			Additional Notes/Descriptions
Unaltered	<u>Slight Modificati</u>	on Major Alteration	Replacement windows on street elevation
Condition:			
Excellent	Good	Poor	
Additional Alterati	ons		
Structu	ıre Usage	Exterior Wall Surface	
Current: NA		Brick (main),	
Historic: NA		Synthetic siding (gable ends)	
Roof Material	Roof Features	Roof Type	
Asphalt shingle	None	Side-gable	
Ornamental Archit	tectural Details		Windows
Stone insert blocks a	around door, decorative	Double-hung, fixed-pane	
Outbuildings (Num	ber and Description)	•	
Storage shed			

Local Landmark	Y <u>N</u>	
National Register Historic Places	Y <u>N</u>	
National Register Historic District	Y <u>N</u>	Name:
Individually Eligible? No	A B C	Significance:

Additional Comments:			



Historical Resource Recordation Form

Property Name	Photos with Captions:		
Historic: Not labeled, not in CHRS	South and west façades of two-story, brick, single-family residence.		
Common/Current: Unknown			
Property address:			
342 W. 101st Street			
HAARGIS Number:			
Not in database			
Present Owner and /or Occupant:			
Unknown			
Property Use			
Historic: Single family residence			
Current: Single family residence			
Date of Construction: 1948			
Architect's Name: Not in CHRS			
Builder/Contractor: Not in CHRS			
Architectural Style:			
Vernacular			
Prepared By: C. Tolmie, M. C. Bird, J. Guarino			
Photo By: S. Katz			
Date: 16 September 2012			

Property Description:

Stories: 2

This two-story house in the Roseland community is situated on a raised brick basement and has a hip roof covered with asphalt shingles. Its front elevation is clad with buff brick. This elevation has an off-center hollow core metal door, a porch with concrete steps and metal railings, open metal supports, and a metal awning roof. It has a three-sided first floor bay with central multi-light fixed-pane window flanked by non-original one-over-one aluminum-sash windows and two non-original one-over-one aluminum-sash windows and two non-original one-over-one aluminum-sash windows and faux stone insert blocks flanking the door and beneath the window bay. It does not display distinguishing architectural features and is not individually eligible for listing on the National Register.



Integrity:			Additional Notes/Descriptions	
Unaltered	Slight Modification	Major Alteration	Replacement door and windows	
Condition:				
Excellent	Good	Poor		
Additional Alterati	ons			
Structu	ire Usage	Exterior Wall Surface		
Current: NA		Brick		
Historic: NA				
Roof Material	Roof Features	Roof Type		
Asphalt shingle	None	Hip		
Ornamental Archit	ectural Details		Windows	
Brick quoins, faux	stone insert blocks		Double hung, fixed-pane	
Outbuildings (Number and Description)				
Storage shed				

Local Landmark	Y <u>N</u>	
National Register Historic Places	Y <u>N</u>	
National Register Historic District	Y <u>N</u>	Name:
Individually Eligible? No	A B C	Significance:

Additional Comments:			



Historical Resource Recordation Form

Property Name	Photos with Captions: North façade of brick, single family residence.
Historic: Not labeled, not in CHRS	North Taçade of brick, single failing festdence.
Common/Current: Unknown	
Property Address:	
349 W. 101st Street	
HAARGIS Number:	
Not in database	
Present Owner and /or Occupant:	
Unknown	
Property Use	
Historic: Single family residence	
Current: Single family residence	
Date of Construction: 1930	Alle Martin
Architect's Name: Not in CHRS	
Builder/Contractor: Not in CHRS	
Architectural Style:	
Chicago Bungalow	the the
Prepared By: C. Tolmie, M. C. Bird, J.	
Guarino	
Photo By: S. Katz	
Date: 10 September 2012	
Proporty Description.	Stariog 1

Property Description:

Stories: 1

This one-story home in the Roseland community is clad in brown face brick and common brick along its front and side elevations, respectively. It has a hip roof covered with asphalt shingles. Its front elevation has an off-center door and a porch with concrete steps, metal railings, open metal supports, and metal awning roof. The front façade features a strip of three non-original one-over-one windows with concrete sills and a gable dormer with two single-pane windows. Glass block windows provide light in the basement. This building lacks distinguishing architectural features and is not individually eligible for listing on the National Register.



Integrity:			Additional Notes/Descriptions		
Unaltered	Slight Modification	Major Alteration	Replacement windows and door		
Condition:					
Excellent	Good	Poor			
Additional Alterati	ons				
Structu	ire Usage	Exterior Wall Surface			
Current: NA		Brick			
Historic: NA					
Roof Material	Roof Features	Roof Type			
Asphalt shingle	Dormer	Hip			
Ornamental Archit	ectural Details		Windows		
Concrete sills			Double-hung, glass block		
Outbuildings (Num	Outbuildings (Number and Description)				
None					

Local Landmark	Y <u>N</u>	
National Register Historic Places	Y <u>N</u>	
National Register Historic District	Y <u>N</u>	Name:
Individually Eligible? No	A B C	Significance:

Additional Comments:			



Historical Resource Recordation Form

Property Name	Photos with Captions:
Historic: Bldg. not labeled, not in CHRS	North and west façades of a one-story, brick single family residence.
Common/Current: Unknown	
Property Address:	
351 W. 101st Street	
HAARGIS Number:	
Not in database	
Present Owner and /or Occupant:	
Unknown	
Property Use	
Historic: Single family residence	
Current: Single family residence	
Date of Construction: 1930	
Architect's Name: Not in CHRS	
Builder/Contractor: Not in CHRS	
Architectural Style:	
Chicago Bungalow	
Prepared By: C. Tolmie, M. C. Bird, J.	
Guarino	
Photo By: S.Katz	
Date: 4 September 2012	
Duomenter Descriptions	6 4 1

Property Description:

Stories: 1

This one-story house is situated on a raised basement. It has a rectangular footprint, a hip roof covered with asphalt shingles, and a hip roof dormer with paired windows. Its front façade is clad in brown face brick with concrete block inserts and has a strip of three three-over-one windows. Its off-center metal core door is accessed via a short flight of concrete steps with metal railings. The side elevations are clad in common brick. This home does not have distinguishing architectural features and is not individually eligible for listing on the National Register.



Integrity:			Additional Notes/Descriptions
<u>Unaltered</u>	Slight Modification	Major Alteration	
Condition:			
Excellent	Good	Poor	
Additional Alterati	ons		
Structu	ıre Usage	Exterior Wall Surface	
Current: NA		Brick	
Historic: NA			
Roof Material	Roof Features	Roof Type	
Asphalt shingle	Dormer	Hip	
Ornamental Archit	tectural Details		Windows
Concrete block inser	rts		Double-hung
Outbuildings (Num	ber and Description)		·
Garage			

Local Landmark	Y <u>N</u>	
National Register Historic Places	Y <u>N</u>	
National Register Historic District	Y <u>N</u>	Name:
Individually Eligible? No	A B C	Significance:

Additional Comments:			



Historical Resource Recordation Form

Property Name	Photos with Captions: South and east façades of one-story, brick story single family		
Historic: Bldg. not labeled, not in CHRS	residence.		
Common/Current: Unknown			
Property Address:			
352 W. 101st Street			
HAARGIS Number:			
Not in database			
Present Owner and /or Occupant:			
Unknown			
Property Use			
Historic: Single family residence			
Current: Single family residence			
Date of Construction: 1960			
Architect's Name: Not in CHRS			
Builder/Contractor: Not in CHRS			
Architectural Style:			
Vernacular			
Prepared By: C. Tolmie, M. C. Bird, J.			
Guarino			
Photo By: S. Katz			
Date: 4 September 2012			
Property Description:	Stories: 1		

This one-story house is situated on a raised basement. It has a rectangular footprint, a hip roof covered with asphalt shingles, and overhanging eaves. Its front façade is clad in buff face brick and has a strip of three windows, which appears to be one large picture window flanked by double-hung windows, beneath a metal awing. The off-center metal core front door is accessed via a flight of concrete steps with metal railings. Two large decorative glass blocks are situated next to the door. The side elevations are clad in common brick. This home does not have distinguishing architectural features and is not individually eligible for listing on the National Register.



Integrity:			Additional Notes/Descriptions
Unaltered	Slight Modification	Major Alteration	
Condition:			
Excellent	Good	Poor	
Additional Alteration	ons		
Structu	re Usage	Exterior Wall Surface	
Current: NA		Brick	
Historic: NA			
Roof Material	Roof Features	Roof Type	
Asphalt shingle	Gablet	Hip	
Ornamental Archit	ectural Details		Windows
None			Fixed-pane, double-hung, glass block
Outbuildings (Num	ber and Description)		
Garage			

Local Landmark	Y	<u>N</u>	
National Register Historic Places	Y	<u>N</u>	
National Register Historic District	Y	<u>N</u>	Name:
Individually Eligible? No	Α	B C	Significance:

Additional Comments:			



Historical Resource Recordation Form

Property Name	Photos with Captions:			
Historic: Bldg. not labeled, not in CHRS	South façade of a brick, one-story, single family residence.			
Common/Current: Unknown				
Property Address:				
330 W. 102nd Place				
HAARGIS Number:				
Not in database				
Present Owner and /or Occupant:				
Unknown				
Property Use				
Historic: Single family residence				
Current: Single family residence				
Date of Construction: 1930				
Architect's Name: Not in CHRS				
Builder/Contractor: Not in CHRS				
Architectural Style:				
Chicago Style Bungalow				
Prepared By: J. Martinez, M. C. Bird, J.				
Guairno	The second se			
Photo By: S. Katz				
Date: 9 October 2012				
Property Deconintion.	Starioge 1			

Property Description:

Stories: 1

This one-story bungalow in the Roseland community has a hip roof covered with asphalt shingles and a hip dormer with a non-original one-over-one aluminum-sash window. The front elevation is clad with light brown face brick and has a hip-roofed porch with brick sidewalls, concrete steps, short wood Doric columns and frieze band. This elevation also has a strip of three non-original one-over-one aluminum-sash windows. Detailing includes a stone sill course, a brick soldier course with stone insert blocks above the windows, and decorative scrolled stone brackets. This house does not feature sufficient distinguishing architectural features to qualify as individually eligible for listing on the National Register.



Integrity:			Additional Notes/Descriptions
Unaltered	Slight Modification	Major Alteration	Replacement windows
Condition:			
Excellent	Good	Poor	
Additional Alteration	ons		
Structu	re Usage	Exterior Wall Surface	
Current: NA		Brick	
Historic: NA			
Roof Material	Roof Features	Roof Type	
Asphalt shingle	Dormer	Hip	
Ornamental Archit	ectural Details	Windows	
Doric columns and frieze band, stone sill course, brick soldier course with			Double-hung
stone insert block, stone brackets			
Outbuildings (Number and Description)			
None			

Local Landmark	Y <u>N</u>	
National Register Historic Places	Y <u>N</u>	
National Register Historic District	Y <u>N</u>	Name:
Individually Eligible? No	A B C	Significance:

Additional Comments:			



Historical Resource Recordation Form

Property Name	Photos with Captions: South and west façades of one-story, single family, frame residence.
Historic: Bldg. not labeled, not in CHRS	South and west ingules of one story, single family, frame residence.
Common/Current: Unknown	
Property Address:	
348 W 102nd Place	
HAARGIS Number:	
Not in database	
Present Owner and /or Occupant:	
Unknown	
Property Use	
Historic: Single family residence	
Current: Single family residence	
Date of Construction: 1927	
Architect's Name: Not in CHRS	
Builder/Contractor: Not in CHRS	
Architectural Style:	
Vernacular	
Prepared By: J. Martinez, M. C. Bird, J.	
Guarino	
Photo By: Steve Katz	
Date: 21 September 2012	

Property Description:

Stories: 1

This one-story house in Roseland is clad in synthetic siding, sits atop a raised basement, and has a front gable roof covered with asphalt shingles. The front elevation features a projecting, enclosed, gable roofed sun porch also clad in synthetic siding with one-over-one windows and an off-center front door accessed by a flight of concrete steps with metal railings. This home does not have distinguishing architectural features and is covered with synthetic siding, both of which preclude it from individual listing on the National Register.



Integrity:			Additional Notes/Descriptions
Unaltered	Slight Modification	Major Alteration	Replacement siding
Condition:			
Excellent	Good	Poor	
Additional Alteration	ons		
Structu	re Usage	Exterior Wall Surface	
Current: NA		Vinyl siding	
Historic: NA			
Roof Material	Roof Features	Roof Type	
Asphalt	None	Gable	
Ornamental Archit	ectural Details		Windows
None			Double-hung
Outbuildings (Num	ber and Description)		
None			

Local Landmark	Y	N	
National Register Historic Places	Y	<u>N</u>	
National Register Historic District	Y	<u>N</u>	Name:
Individually Eligible? No	A B	C	Significance:

Additional Comments:



Historical Resource Recordation Form

Property Name	Photos with Captions:
Historic: Bldg. not labeled, not in CHRS	South and east façades of a brick, one-story, single family residence.
Common/Current: Unknown	
Property Address:	
416 W. 102nd Place	
HAARGIS Number:	
Not in database	
Present Owner and /or Occupant:	
Unknown	
Property Use	
Historic: Single family residence	
Current: Single family residence	
Date of Construction: 1929	
Architect's Name: Not in CHRS	
Builder/Contractor: Not in CHRS	
Architectural Style:	
Chicago Style Bungalow	
Prepared By: J. Martinez, M. C. Bird, J.	
Guairno	
Photo By: S. Katz	
Date: 10 October 2012	
Property Description:	Stories: 1

This one-story house in the Washington Heights community is situated on a raised basement with glass block windows. It is clad with brown brick and has a hip roof covered with asphalt shingles and overhanging eaves. There are hip-on-gable dormers on the front and side elevations, each of which has a strip of non-original one-over-one aluminum-sash windows. The house features a recessed corner porch with a single-light oak door, concrete steps, low brick sidewalls, and a brick corner pier. The front elevation's rounded living room bay has a series of casement windows and transoms. Detailing includes a brickwork soldier course above windows with decorative stone insert blocks and concrete sills. This is a good example of a brick Chicago Style Bungalow, a building type that was produced in the thousands throughout the city's undeveloped areas and in nearby suburbs during the 1910s and 1920s. This house does not feature sufficient distinguishing architectural features to be individually eligible for listing on the National Register.



Integrity:			Additional Notes/Descriptions
Unaltered	Slight Modification	Major Alteration	Replacement windows
Condition:			
Excellent	Good	Poor	
Additional Alterati	ons		
Structu	ire Usage	Exterior Wall Surface	
Current: NA		Brick	
Historic: NA			
Roof Material	Roof Features	Roof Type	
Asphalt shingle	Dormers	Hip	
Ornamental Archit	ectural Details		Windows
Brick soldier courses	s above windows, stone ins	ert blocks, concrete sills	Double-hung, casement, glass
			block
Outbuildings (Num	ber and Description)		
None			

Local Landmark	Y <u>N</u>	
National Register Historic Places	Y <u>N</u>	
National Register Historic District	Y <u>N</u>	Name:
Individually Eligible? No	A B C	Significance:

Additional Comments:			



Historical Resource Recordation Form

Property Name	Photos with Captions: South façade of a one-story, single family, frame residence.
Historic: Bldg. not labeled, not in CHRS	South laçade of a one story, single failing, france festellee.
Common/Current: Unknown	
Property Address:	
320 W 102nd Street	
HAARGIS Number:	
Not in database	
Present Owner and /or Occupant:	
Unknown	
Property Use	
Historic: Single family residence	
Current: Single family residence	
Date of Construction: 1929	
Architect's Name: Not in CHRS	
Builder/Contractor: Not in CHRS	
Architectural Style:	
Vernacular	
Prepared By: J. Martinez, M. C. Bird, J.	
Guarino	
Photo By: S. Katz	
Date: 9 October 2012	
Property Description:	Stories: 1

This one-story frame house in the Roseland community is situated on a raised concrete block basement with glass block windows. It is clad with synthetic siding, has a hip-on-gable roof covered with asphalt shingles, and has overhanging eaves in front with aluminum soffits. The front elevation features a recessed corner porch with wood steps, railings, and corner post. A pair of casement windows is located within the porch. There is a strip of four windows on the first floor and a pair of windows in the gable. All windows are non-original one-over-one aluminum-sash. This house does not feature sufficient integrity or distinguishing architectural features to qualify as individually eligible for listing on the National Register.



Integrity:			Additional Notes/Descriptions
Unaltered	Slight Modification	Major Alteration	Replacement windows and siding
Condition:			
Excellent	Good	Poor	
Additional Alteration	ons		
Structu	re Usage	Exterior Wall Surface	
Current: NA		Synthetic siding	
Historic: NA			
Roof Material	Roof Features	Roof Type	
Asphalt shingle	Dormer	Hip-on-gable	
Ornamental Archit	ectural Details		Windows
None			Double-hung, glass block,
			casement
Outbuildings (Num	ber and Description)		
None			

Local Landmark	Y	<u>N</u>	
National Register Historic Places	Y	<u>N</u>	
National Register Historic District	Y	<u>N</u>	Name:
Individually Eligible? No	A	B C	Significance:

Additional Comments:			



Historical Resource Recordation Form

Property Name	Photos with Captions: North façade of a 1.5-story, single family, frame residence.
Historic: Bldg. not labeled, not in CHRS	North façade of a 1.5-story, single family, france residence.
Common/Current: Unknown	
Property Address:	
337 W. 102nd Street	
HAARGIS Number:	
Not in database	
Present Owner and /or Occupant:	
Unknown	
Property Use	
Historic: Single family residence	
Current: Single family residence	
Date of Construction: 1930	
Architect's Name: Not in CHRS	
Builder/Contractor: Not in CHRS	
Architectural Style:	
Vernacular	
Prepared By: J. Martinez, M. C. Bird, J.	
Guarino	
Photo By: S. Katz	
Date: 9 October 2012	
Property Description:	Stories: 1.5

Property Description:

Stories: 1.5

This one-and-a-half-story frame house in the Roseland community is situated on a raised concrete block basement with glass block windows. It is clad with synthetic siding and has a hip-on-gable roof covered with asphalt shingles. The front elevation features a recessed porch with concrete steps, metal railings, and a corner support consisting of a faux stone pier with open metal post above. This elevation also has overhanging eaves with aluminum soffits and decorative exposed rafters, an off-center recessed door with a metal storm door, and a strip of three windows on the first floor and a pair of windows in the gable, all of which are non-original one-over-one aluminum-sash. This residence does not feature sufficient integrity or distinguishing architectural features to qualify as individually eligible for listing on the National Register.



Integrity:			Additional Notes/Descriptions
			-
Unaltered	Slight Modification	Major Alteration	Replacement windows
Condition:			
Excellent	Good	Poor	
		1001	
Additional Alteration	ons		
<u> </u>	The second se	Fritanian Wall Sumface	
Structu	re Usage	Exterior Wall Surface	
Current: NA		Synthetic siding	
Historic: NA			
Roof Material	Roof Features	Roof Type	
Asphalt shingle	Dormer	Hip-on-gable	
Ornamental Archit	ectural Details		Windows
Exposed rafters			Double-hung, glass block
Outbuildings (Num	ber and Description)		
None			

Local Landmark	Y <u>N</u>	
National Register Historic Places	Y <u>N</u>	
National Register Historic District	Y <u>N</u>	Name:
Individually Eligible? No	A B C	Significance:

Additional Comments:			



Historical Resource Recordation Form

Property Name	Photos with Captions: South façade of a brick, 1.5-story, single family residence.
Historic: Bldg. not labeled, not in CHRS	Soun raçade or a oriek, 1.5 story, single raimi y residence.
Common/Current: Unknown	
Property Address:	
342 W. 102nd Street	
HAARGIS Number:	
Not in database	
Present Owner and /or Occupant:	
Unknown	
Property Use	
Historic: Single family residence	
Current: Single family residence	
Date of Construction: 1940	
Architect's Name: Not in CHRS	
Builder/Contractor: Not in CHRS	
Architectural Style:	
Vernacular	
Prepared By: J. Martinez, M. C. Bird, J.	
Guarino	aller the second second
Photo By: S. Katz	
Date: 9 October 2012	
Property Deconintion.	Stariog 15

Property Description:

Stories: 1.5

This one-and-a-half-story house in the Roseland community has a cross-gable roof covered with asphalt shingles and is clad with brown face brick. Its front elevation has an off-center, gable roofed entrance vestibule with a metal storm door sheltered by a metal awning, concrete steps, metal railings, and paired double-hung windows on both the first and second floors that are partially obscured by low metal awnings. A one-story hip roof covered side entrance is situated along the west elevation. Detailing includes concrete sills, a keystone above the entrance, and brick soldier course lintels. This house does not feature sufficient distinguishing architectural features to qualify as individually eligible for listing on the National Register.



Integrity:			Additional Notes/Descriptions
Unaltered	Slight Modificatio	n Major Alteration	
Condition:			
Excellent	Good	Poor	
Additional Alteration	ons		
Structu	re Usage	Exterior Wall Surface	
Current: NA		Brick	
Historic: NA			
Roof Material	Roof Features	Roof Type	
Asphalt shingle	Dormer	Cross-gable	
Ornamental Archit	ectural Details	Windows	
Concrete sills, key	stone above the entrance	Double-hung	
Outbuildings (Num	ber and Description)		
None			

Local Landmark	Y	<u>N</u>	
National Register Historic Places	Y	<u>N</u>	
National Register Historic District	Y	<u>N</u>	Name:
Individually Eligible? No	Α	B C	Significance:

Additional Comments:		



Historical Resource Recordation Form

Property Name	Photos with Captions:
Historic: Bldg. not labeled, not in CHRS	South façade of brick, two-story, single family residence.
Common/Current: Unknown	
Property Address:	-
348 W 102nd Street	
HAARGIS Number:	
Not in database	
Present Owner and /or Occupant:	
Unknown	
Property Use	
Historic: Single family residence	
Current: Single family residence	
Date of Construction: 1939	
Architect's Name: Not in CHRS	
Builder/Contractor: Not in CHRS	
Architectural Style:	
Minimal Traditional	
Prepared By: J. Martinez, M. C. Bird, J.	
Guarino	
Photo By: J. Martinez	
Date: September 2012	
Property Description:	Stories: 2

This two-story, brick-clad house in Roseland has a square footprint and a hip roof covered with asphalt shingles. An off-center, projecting, gable-roofed vestibule with front door is accessed via a short flight of concrete steps with metal railings. The front elevation has a three-sided bay with a central eight-over-one window flanked by four-over-one windows, and the second floor has two one-over-one windows with wood shutters. Windows are modern replacements. Detailing includes brick banding on the second floor and concrete bands in the vestibule gable meant to simulate half-timbering. This house lacks architectural distinction; as a result, it is not individually eligible for listing on the National Register.



Integrity:			Additional Notes/Descriptions
Unaltered	Slight Modificatio	n Major Alteration	Replacement windows
Condition:			
Excellent	Good	Poor	
Additional Alteration	ons		
	-		
Structure Usage		Exterior Wall Surface	
Current: NA		Brick	
Historic: NA			
Roof Material	Roof Features	Roof Type	
Unknown	None	Hip	
Ornamental Archit	ectural Details	Windows	
Brick banding, concrete bands for half-timber look			Double-hung
Outbuildings (Num	ber and Description)		
Garage			

Local Landmark	Y <u>N</u>	
National Register Historic Places	Y <u>N</u>	
National Register Historic District	Y <u>N</u>	Name:
Individually Eligible? No	A B (Significance:

Additional Comments:			



Historical Resource Recordation Form

Property Name	Photos with Captions: South façade of one-story, single family, frame residence.
Historic: Bldg. not labeled, not in CHRS	South façade of one-story, single family, frame residence.
Common/Current: Unknown	
Property Address:	
352 W. 102nd St.	
HAARGIS Number:	
Not in database	
Present Owner and /or Occupant:	
Unknown	
Property Use	
Historic: Single family residence	
Current: Single family residence	
Date of Construction: 1930	
Architect's Name: Not in CHRS	
Builder/Contractor: Not in CHRS	
Architectural Style:	
Vernacular	
Prepared By: J. Martinez, M. C. Bird, J.	
Guarino	
Photo By: Steve Katz	
Date: 21 September 2012	
Property Description:	Stories: 1

This one-story home in the Roseland community is clad in synthetic siding and has a hipped roof with asphalt shingles and overhanging eaves. The front elevation features a centrally located front door flanked by two one-over-one aluminum-sash windows and has a hipped roof dormer with paired one-over-one windows. Windows are modern replacements; replacement windows in the dormer are smaller than the original windows. This structure lacks integrity and architectural distinction and is not individually eligible for listing on the National Register.



Integrity:			Additional Notes/Descriptions
Unaltered	Slight Modification	n Major Alteration	Replacement windows and cladding
Condition:			
<u>Excellent</u>	Good	Poor	
Additional Alterati	ons		
Structu	ire Usage	Exterior Wall Surface	
Current: NA		Vinyl siding	
Historic: NA			
Roof Material	Roof Features	Roof Type	
Asphalt	Dormer	Hip	
Ornamental Archit	ectural Details		Windows
None			Double-hung
Outbuildings (Number and Description)			
Garage			

Local Landmark	Y <u>N</u>	
National Register Historic Places	Y <u>N</u>	
National Register Historic District	Y <u>N</u>	Name:
Individually Eligible? No	A B C	Significance:

Additional Comments:	



Historical Resource Recordation Form

Property Name	Photos with Captions: South façade of a 1.5-story, single family, frame residence.
Historic: Bldg. not labeled, not in CHRS	South laçade of a 1.5-story, single failing, name residence.
Common/Current: Unknown	
Property Address:	
444 W. 102nd Street	
HAARGIS Number:	
Not in database	
Present Owner and /or Occupant:	
Unknown	
Property Use	
Historic: Single family residence	444
Current: Single family residence	
Date of Construction: 1913	
Architect's Name: Not in CHRS	
Builder/Contractor: Not in CHRS	
Architectural Style:	
Vernacular	
Prepared By: J. Martinez, M. C. Bird, J.	
Guarino	
Photo By: S. Katz	
Date: 10 October 2012	

Property Description:

Stories: 1.5

This one-and-a-half-story frame house in the Washington Heights community is situated on a raised concrete block basement. It is clad with synthetic siding and has a gable roof covered with asphalt shingles. Its front elevation features a hip-roofed full-width screened-in porch with concrete steps, metal pipe railings, a faux stone base, and supports comprised of faux stone pedestals topped by squat Doric columns. A pair of windows sheltered by a metal awning is situated in the gable. A two-story, gable-roofed, bay pavilion is situated along one of the side elevations. Windows throughout the house are non-original one-over-one aluminum-sash. This house lacks integrity, does not display distinguishing architectural features, and is not individually eligible for listing on the National Register.



Structural Survey


Integrity:			Additional Notes/Descriptions	
Unaltered	Slight Modification	Major Alteration	Replacement windows and cladding	
Condition:				
Excellent	Good	Poor		
Additional Alteration	ons			
Porch screened in				
Structu	re Usage	Exterior Wall Surface		
Current: NA		Synthetic siding		
Historic: NA				
Roof Material	Roof Features	Roof Type		
Asphalt shingle	None	Gable		
Ornamental Archite	ectural Details		Windows	
None			Double-hung, glass block	
Outbuildings (Number and Description)				
None				

Local Landmark	Y <u>N</u>	
National Register Historic Places	Y <u>N</u>	
National Register Historic District	Y <u>N</u>	Name:
Individually Eligible? No	A B C	Significance:

Additional Comments:



Historical Resource Recordation Form

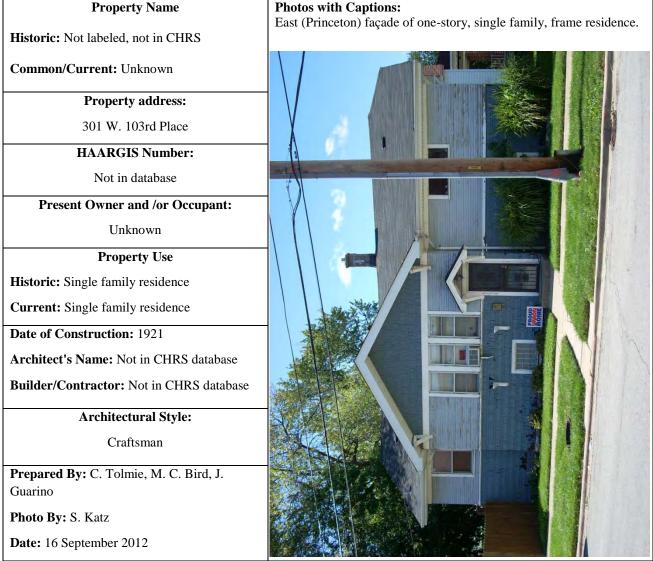

Property Description:

Stories: 1

This one-story Craftsman bungalow is situated at the southwest corner of 103rd Place and Princeton Avenue in the Roseland community. It has a hip-on-gable roof covered with asphalt shingles and overhanging eaves with decorative knee braces located on the front gable section of the roof. The central portion of the house retains its original wood clapboard siding; the areas above and below are clad with wood shingles. Its 103rd Place elevation has a strip of three one-over-one windows, a strip of three casements, and a strip of three windows in the gable that appear to be casements. Its Princeton Street elevation has a metal storm door topped by a gabled hood with two knee braces, glass block basement windows, a strip of three one-over-one windows, a single one-over-one window, and a pair of casements. This house does not have sufficient distinguishing features to qualify as individually eligible for listing on the National Register.




Integrity:			Additional Notes/Descriptions
<u>Unaltered</u>	Slight Modification	on Major Alteration	
Condition:			
Excellent	Good	Poor	
Additional Alteration	ons		
Structu	re Usage	Exterior Wall Surface	
Current: NA		Wood clapboards and shingles	
Historic: NA			
Roof Material	Roof Features	Roof Type	
Asphalt shingle	None	Hip-on-gable	
Ornamental Archit	ectural Details		Windows
Knee braces			Double-hung, casement, glass block
Outbuildings (Num	ber and Description)		
None			

Local Landmark	Y	<u>N</u>	
National Register Historic Places	Y	<u>N</u>	
National Register Historic District	Y	<u>N</u>	Name:
Individually Eligible? No	Α	B C	Significance:

Additional Comments:			



Historical Resource Recordation Form

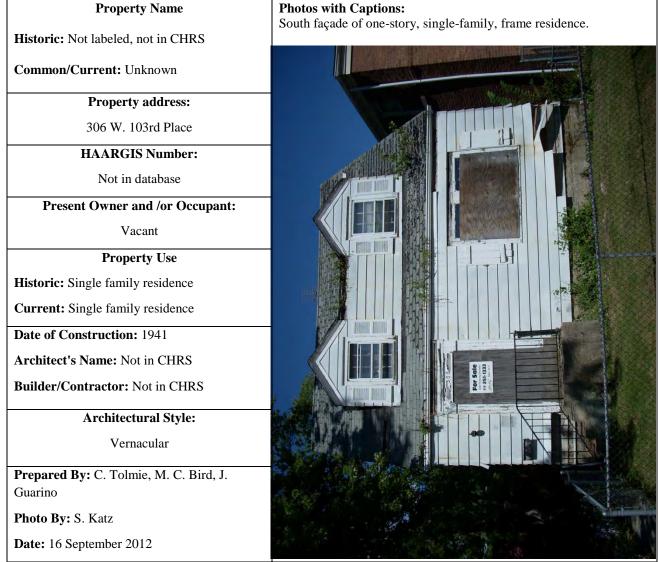

Property Description:

Stories: 1

This one-story frame cottage in the Roseland community is clad with synthetic siding, has a side-gabled roof covered with asphalt shingles, and has two gable dormers with double-hung multi-sash windows that are visually connected with aluminum siding. The front elevation has an off-center door covered with plywood and a Classical surround consisting of simple wood pilasters and unadorned entablature. The front elevation also has concrete steps with metal railings and paired windows that are covered with plywood. This home does not have distinguishing features and is not individually eligible for listing on the National Register.



Integrity:			Additional Notes/Descriptions
Unaltered	Slight Modification	Major Alteration	replacement siding and windows
Condition:			
Excellent	Good	Poor	
Additional Alterati	ons		
Structu	re Usage	Exterior Wall Surface	
Current: NA		Synthetic siding	
Historic: NA			
Roof Material	Roof Features	Roof Type	
Asphalt shingle	Dormers	Side-gable	
Ornamental Archit	ectural Details		Windows
Pilasters at surround			Double-hung, covered
Outbuildings (Number and Description)			
None			

Local Landmark	Y <u>N</u>	
National Register Historic Places	Y <u>N</u>	
National Register Historic District	Y <u>N</u>	Name:
Individually Eligible? No	A B C	Significance:

Additional Comments:			



Historical Resource Recordation Form

Property Name	Photos with Captions: North façade of a one-story, single family, frame residence.
Historic: Bldg. not labeled, not in CHRS	Notur laçade of a one-story, single family, frame residence.
Common/Current: Unknown	
Property Address:	
321 W. 103rd Place	
HAARGIS Number:	
Not in database	
Present Owner and /or Occupant:	
Unknown	
Property Use	
Historic: Single family residence	
Current: Single family residence	
Date of Construction: 1924	
Architect's Name: Not in CHRS	
Builder/Contractor: Not in CHRS	
Architectural Style:	
Craftsman	
Prepared By: J. Martinez, M. C. Bird, J.	
Guarino	
Photo By: S. Katz	
Date: 23 October 2012	

Property Description:

Stories: 1

This one-story frame house in the Roseland community is clad with synthetic siding, has a hip roof covered with asphalt shingles, and a hip dormer with three one-over-one windows beneath a metal awning. The front elevation has a recessed corner porch with concrete steps, metal railings, and an open metal corner post. It also features an off-center entrance with metal storm door, a small casement window within the porch, and a large picture window beneath a metal awning. This house does not have sufficient integrity or distinguishing features to qualify as individually eligible for listing on the National Register.



Integrity:			Additional Notes/Descriptions
Unaltered	Slight Modification	Major Alteration	Replacement cladding
Condition:			
Excellent	Good	Poor	
Additional Alteration	ons		
Structu	re Usage	Exterior Wall Surface	
Current: NA		Synthetic siding	
Historic: NA			
Roof Material	Roof Features	Roof Type	
Asphalt shingle	Dormer	Hip	
Ornamental Archit	ectural Details		Windows
None			Double-hung, fixed pane,
			casement
Outhuildings (Num	ber and Description)		
Subunungs (1100	oer and Description)		
None			

Local Landmark	Y	<u>N</u>	
National Register Historic Places	Y	<u>N</u>	
National Register Historic District	Y	<u>N</u>	Name:
Individually Eligible? No	Α	B C	Significance:

Additional Comments:			



Historical Resource Recordation Form

Property Name	Photos with Captions:
	South and west façades of 1.5-story, multi-family, frame residence.
Historic: Not labeled, not in CHRS	
Common/Current: Unknown	
Property address:	
326 W. 103rd Place	
HAARGIS Number:	
Not in database	
Present Owner and /or Occupant:	
Unknown	
Property Use	
Historic: Single family residence	
Current: Multi-family residence	
Date of Construction: 1923	
Architect's Name: Not in CHRS	
Builder/Contractor: Not in CHRS	
Architectural Style:	
Vernacular	
Prepared By: C. Tolmie, M. C. Bird, J.	
Guarino	
Photo By: S. Katz	
Date: 16 September 2012	

Property Description:

Stories: 1.5

This one-and-a-half-story frame cottage in the Roseland community is situated on a raised brick basement with glass block windows. It is clad with aluminum siding and has a side-gabled roof covered with asphalt shingles. The house also has a gable dormer with a strip of one-over-one windows and decorative knee braces. Its front elevation has a partial-width, off-center, gable-roofed, wood porch with two squat Doric column supports atop aluminum-clad sidewalls, a door with metal storm, and a picture window flanked by one-over-one windows. Its western elevation has a three-sided window bay as well as a large shed roofed addition. This house does not have sufficient integrity or distinguishing features to qualify as individually eligible for listing on the National Register.



Structural Survey


Integrity:			Additional Notes/Descriptions
Unaltered	Slight Modification	Major Alteration	Replacement siding
Condition:			
Excellent	Good	Poor	
Additional Alterati	ons		
Shed roof addition			
Structu	re Usage	Exterior Wall Surface	
Current: NA		Synthetic siding	
Historic: NA			
Roof Material	Roof Features	Roof Type	
Asphalt shingle	Dormer	Side-gable	
Ornamental Archit	ectural Details		Windows
Doric columns, knee	e braces		Double-hung, fixed-pane, glass
			block
Outbuildings (Num	ber and Description)		
Two-car garage with	hipped roof		

Local Landmark	Y <u>N</u>	
National Register Historic Places	Y <u>N</u>	
National Register Historic District	Y <u>N</u>	Name:
Individually Eligible? No	A B C	Significance:

Additional Comments:



Historical Resource Recordation Form

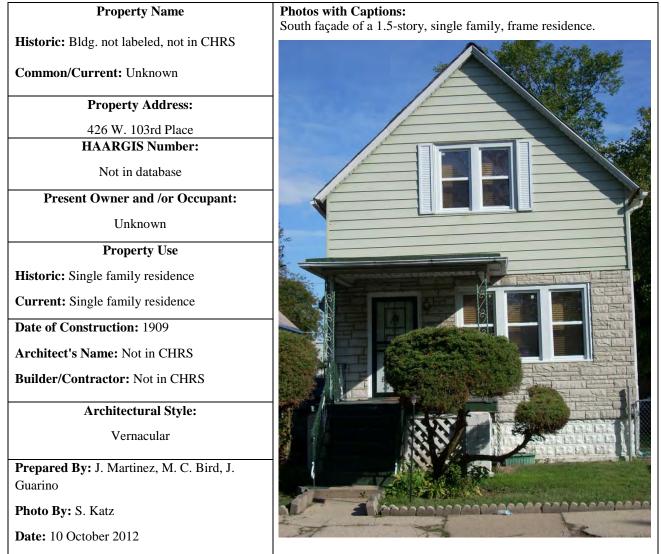

Property Description:

Stories: 1.5

This one-and-one-half-story frame house in the Roseland community is situated on a raised concrete block basement with glass block windows. It is clad with faux stone and synthetic siding and has a front gable roof covered with asphalt shingles. Its front elevation has an off-center entrance with metal storm door and a flat-roofed, partial-width porch with a wood deck, wooden steps, metal railings, and open metal posts. There is a strip of three windows on the first floor and three on the second. All windows are non-original one-over-one aluminum sash. This house does not have sufficient integrity or distinguishing features to qualify as individually eligible for listing on the National Register.



Integrity:			Additional Notes/Descriptions
Unaltered	Slight Modification	on Major Alteration	Replacement windows, door, porch, and cladding
Condition:			
<u>Excellent</u>	Good	Poor	
Additional Alterati	ons		
Structu	ire Usage	Exterior Wall Surface	
Current: NA		Synthetic siding, faux stone	
Historic: NA			
Roof Material	Roof Features	Roof Type	
Asphalt shingle	None	Gable	
Ornamental Archit	tectural Details		Windows
None			Double-hung, glass block
Outbuildings (Num	ber and Description)		·
None			

Local Landmark	Y <u>N</u>	
National Register Historic Places	Y <u>N</u>	
National Register Historic District	Y <u>N</u>	Name:
Individually Eligible? No	A B C	Significance:

Additional Comments:			



Historical Resource Recordation Form

Property Name	Photos with Captions: North façade of a 1.5-story, frame multi-family residence.
Historic: Bldg. not labeled, not in CHRS	Norm Taçade of a 1.5 story, name mani Taniny Testachee.
Common/Current: Unknown	A CARLES AND A CAR
Property Address:	
427 W. 103rd Place	
HAARGIS Number:	
Not in database	
Present Owner and /or Occupant:	
Unknown	
Property Use	
Historic: Single family residence	
Current: Multi-family residence	
Date of Construction: 1898	
Architect's Name: Not in CHRS	
Builder/Contractor: Not in CHRS	
Architectural Style:	
Vernacular	
Prepared By: J. Martinez, M. C. Bird, J. Guarino	
Photo By: S. Katz	
Date: 10 October 2012	

Property Description:

Stories: 1.5

This one-and-a-half-story frame cottage in the Roseland community is situated on a raised concrete block basement with glass block windows. It is clad with synthetic siding and has a front gable roof covered with asphalt shingles. Its front elevation has an off-center, enclosed, gabled roof vestibule with a metal storm door and concrete steps with metal railings. There is a multi-paned bow window on the first floor and a pair of non-original one-over-one aluminum-sash windows in the gable. This house does not have sufficient integrity or distinguishing features to qualify as individually eligible for listing on the National Register.



Integrity:			Additional Notes/Descriptions
Unaltered	Slight Modification	Major Alteration	Replacement windows and cladding
Condition:			
Excellent	Good	Poor	
Additional Alteration	ons		
Structu	re Usage	Exterior Wall Surface	
Current: NA		Synthetic siding	
Historic: NA			
Roof Material	Roof Features	Roof Type	
Asphalt shingle	None	Gable	
Ornamental Archit	ectural Details		Windows
None			Double-hung, fixed-pane, glass block
Outbuildings (Num	ber and Description)		
None			

Local Landmark	Y	<u>N</u>	
National Register Historic Places	Y	<u>N</u>	
National Register Historic District	Y	<u>N</u>	Name:
Individually Eligible? No	A	BC	Significance:

Additional Comments:			



Historical Resource Recordation Form

Property Name	Photos with Captions: South and east façades of a one-story, single family, frame residence.
Historic: Bldg. not labeled, not in CHRS	South and cust highers of a one story, single family, name residence.
Common/Current: Unknown	
Property Address:	
436 W. 103rd Place	
HAARGIS Number:	
Not in database	
Present Owner and /or Occupant:	
Unknown	
Property Use	
Historic: Single family residence	
Current: Single family residence	
Date of Construction: 1908	
Architect's Name: Not in CHRS	
Builder/Contractor: Not in CHRS	
Architectural Style:	
Vernacular	
Prepared By: J. Martinez, M. C. Bird, J.	
Guarino	Contraction of the second seco
Photo By: S. Katz	
Date: 30 October 2012	

Property Description:

Stories: 1

This one-story frame house in the Roseland community is situated on a raised basement with glass block windows and is covered with aluminum siding. The building has a front-gable roof covered with asphalt shingles. The front elevation has a full-width, hip-roof, wood porch with straight railings and three supports consisting of faux stone piers topped by squat, squared wood Doric columns. The residence also includes an off-center metal storm door, a three-sided bay window on the first floor and paired windows in the gable, all of which feature non-original one-over-one aluminum sashes. The door and adjacent window bay are each topped by a cornice. The west elevation has a large shed-roofed dormer and the east elevation has a three-sided window bay on the first floor topped by a gable wall dormer. This house lacks integrity and distinctive architectural features and is not individually eligible for listing on the National Register.



Integrity:			Additional Notes/Descriptions
Unaltered	Slight Modification	n Major Alteration	Replacement windows and cladding
Condition:			
<u>Excellent</u>	Good	Poor	
Additional Alterati	ons		
Structu	ire Usage	Exterior Wall Surface	
Current: NA		Synthetic siding	
Historic: NA			
Roof Material	Roof Features	Roof Type	
Asphalt shingles	Dormers	Gable	
Ornamental Archit	tectural Details		Windows
Squared columns			Double-hung, glass block
Outbuildings (Num	ber and Description)		
None			

Local Landmark	Y <u>N</u>	
National Register Historic Places	Y <u>N</u>	
National Register Historic District	Y <u>N</u>	Name:
Individually Eligible? No	A B C	Significance:

Additional Comments:	



Historical Resource Recordation Form

Property Name	Photos with Captions: South façade of a one-story, single family, frame residence.
Historic: Bldg. not labeled, not in CHRS	South laçade of a one-story, single family, frame residence.
Common/Current: Unknown	
Property Address:	
440 W. 103rd Place	
HAARGIS Number:	
Not in database	
Present Owner and /or Occupant:	
Unknown	
Property Use	
Historic: Single family residence	
Current: Single family residence	
Date of Construction: 1893	
Architect's Name: Not in CHRS	
Builder/Contractor: Not in CHRS	
Architectural Style:	
Vernacular	
Prepared By: J. Martinez, M. C. Bird, J.	
Guarino	
Photo By: S. Katz	
Date: 31 October 2012	

Property Description:

Stories: 1

This one-story house in the Roseland community is situated on a raised concrete block basement and is covered with synthetic siding. The building has a side-gabled roof covered with asphalt shingles. The front elevation has an off-center metal storm door topped by a metal awning, non-original wood steps and railings, and a pair of non-original one-over-one aluminum-sash windows. This house lacks integrity and any distinguishing architectural features and is not eligible for individual listing on the National Register.



Integrity:			Additional Notes/Descriptions
Unaltered	Slight Modification	n Major Alteration	Replacement door, windows, and cladding
Condition:			
<u>Excellent</u>	Good	Poor	
Additional Alterati	ons		
Structu	ire Usage	Exterior Wall Surface	
Current: NA		Synthetic siding	
Historic: NA			
Roof Material	Roof Features	Roof Type	
Asphalt shingle	None	Gable	
Ornamental Archit	tectural Details		Windows
None			Double-hung
Outbuildings (Num			
None			

Local Landmark	Y <u>N</u>	
National Register Historic Places	Y <u>N</u>	
National Register Historic District	Y <u>N</u>	Name:
Individually Eligible? No	A B C	Significance:

Additional Comments:			



Historical Resource Recordation Form

Property Name	Photos with Captions: North façade of a one-story, single family, frame residence.
Historic: Bldg. not labeled, not in CHRS	
Common/Current: Unknown	
Property Address:	
455 W. 103rd Place	
HAARGIS Number:	
Not in database	
Present Owner and /or Occupant:	
Unknown	
Property Use	
Historic: Single family residence	
Current: Single family residence	
Date of Construction: 1908	
Architect's Name: Not in CHRS	
Builder/Contractor: Not in CHRS	
Architectural Style:	
Vernacular	
Prepared By: J. Martinez, M. C. Bird, J.	
Guarino	
Photo By: S. Katz	
Date: 10 October 2012	

Property Description:

Stories: 1

This one-story frame cottage in the Roseland community is situated on a raised concrete block basement with glass block windows. It is clad with synthetic siding and has a gable roof covered with asphalt shingles. Its front elevation has a full-width hip-roof porch with wood steps, boxed supports, and low aluminum-clad walls. This elevation also has an off-center hollow core metal paneled door with fanlight, a strip of three windows on the first floor, and a pair of windows in the gable. All windows above the raised basement are non-original one-over-one aluminum-sash. This house does not have sufficient integrity or distinguishing features to qualify as individually eligible for listing on the National Register.



Integrity:			Additional Notes/Descriptions		
Unaltered	Slight Modification	Major Alteration	Replacement door, windows, and cladding		
Condition:					
Excellent	Good	Poor			
Additional Alteration	ons				
Structu	re Usage	Exterior Wall Surface			
Current: NA		Synthetic siding			
Historic: NA					
Roof Material	Roof Features	Roof Type			
Asphalt shingle	None	Gable			
Ornamental Archit	ectural Details	Windows			
None		Double-hung, fixed-pane, glass block			
Outbuildings (Number and Description)					
None					

Local Landmark	Y <u>N</u>	
National Register Historic Places	Y <u>N</u>	
National Register Historic District	Y <u>N</u>	Name:
Individually Eligible? No	A B C	Significance:

Additional Comments:			



Photos with Captions: Property Name South and east façades of one-story, brick supermarket. Historic: Not labeled, not in CHRS Common/Current: Unknown **Property address:** 316 W. 103rd Street HAARGIS Number: Not in database **Present Owner and /or Occupant:** Vacant **Property Use** Historic: Commercial Current: Commercial **Date of Construction:** 1962 Architect's Name: Not in CHRS Builder/Contractor: Not in CHRS **Architectural Style:** Vernacular Prepared By: C. Tolmie, M. C. Bird, J. Guarino Photo By: S. Katz Date: 16 September 2012 **Property Description:** Stories: 1

Historical Resource Recordation Form

This one-story brick-clad former supermarket in the Roseland community has a flat roof, a parapet and a strip of large fixed-pane display windows along its 103rd Street elevation. It has a pair of doors along its east elevation, which are sheltered by a nylon canopy supported by two metal I-beam posts. This building does not have any distinguishing architectural features and is not individually eligible for listing on the National Register.





Integrity:			Additional Notes/Descriptions		
<u>Unaltered</u>	Slight Modification	Major Alteration			
Condition:					
Excellent	Good	Poor			
Additional Alterati	ons				
Structu	ire Usage	Exterior Wall Surface			
Current: NA		Brick			
Historic: NA					
Roof Material	Roof Features	Roof Type			
Unknown	Parapet	Flat			
Ornamental Archit	ectural Details	Windows			
None			Fixed-pane		
Outbuildings (Number and Description)					
None					

Local Landmark	Y	<u>N</u>	
National Register Historic Places	Y	<u>N</u>	
National Register Historic District	Y	<u>N</u>	Name:
Individually Eligible? No	A]	B C	Significance:

Additional Comments:			



Historical Resource Recordation Form

Property Name	Photos with Captions: North façade of one-story, brick property
Historic: Not labeled, not in CHRS	
Common/Current: Unknown	
Property address:	
319 W. 103rd Street	
Alternate: 327 W. 103rd St	
HAARGIS Number:	
Not in database	
Present Owner and /or Occupant:	
Chazap Barber College	
Property Use	
Historic: Commercial	
Current: Educational	
Date of Construction: 1953	
Architect's Name: Not in CHRS	
Builder/Contractor: Not in CHRS	V
Architectural Style:	
Vernacular	O. ILL BOO
Prepared By: C. Tolmie, M. C. Bird, J.	In the second
Guarino	R P
Photo By: S. Katz	
Date: 16 September 2012	
Duan antu Daganin ti ana	Stariog 1

Property Description:

Stories: 1

This one-story brick-clad barber college building in the Roseland community has a flat roof and parapet. A single course of limestone surrounds its former storefront area, which has been in-filled with red brick, a recessed entrance with metal door, and a continuous strip of glass block windows. The eastern end of the building's front elevation has a metal overhead door and a single glass door. This building does not feature sufficient integrity to be individually eligible for listing on the National Register.



Integrity:			Additional Notes/Descriptions
Unaltered	Slight Modification	Major Alteration	In-filled windows, modified storefront
Condition:			
Excellent	Good	Poor	
Additional Alterati	ons		
Structu	ire Usage	Exterior Wall Surface	
Current: NA		Brick	
Historic: NA			
Roof Material	Roof Features	Roof Type	
Unknown	None	Flat	
Ornamental Archit	ectural Details		Windows
None			Glass block
Outbuildings (Num	ber and Description)		
None			

Local Landmark	Y <u>N</u>	
National Register Historic Places	Y <u>N</u>	
National Register Historic District	Y <u>N</u>	Name:
Individually Eligible? No	A B C	Significance:

Additional Comments:			



Historical Resource Recordation Form

Property Name	Photos with Captions: North façade of a brick, commercial building.
Historic: Hay, Grain & Feed (1905)	Norun laçade or a oriek, commercial bunding.
Common/Current: Unknown	
Property Address:	
403-405 W. 103rd St.	
HAARGIS Number:	
Not in database	
Present Owner and /or Occupant:	
Vacant	
Property Use	
Historic: Commercial	
Current: Commercial	
Date of Construction: 1900	
Architect's Name: Not in CHRS	
Builder/Contractor: Not in CHRS	TYDE TO THE REAL PROPERTY OF
Architectural Style:	
Vernacular	
Prepared By: J. Martinez, M. C. Bird, J.	
Guarino	
Photo By: Steve Katz	
Date: 24 September 2012	
Property Description.	Stories: 2

Property Description:

Stories: 2

The two-story commercial portion of this building is identified as a "Hay, Grain & Feed" shop in the 1905 Sanborn while the one-story portion is identified as used for related storage. The buildings were joined at a later date. Both are clad in brown face brick and have flat roofs and parapets. The two-story section has an off-center entrance with an original wood door, sidelights, transom, and a stone surround with cornice, as well as a metal cornice. The glass panes in the sidelights and door have been removed and their openings in-filled with wood. It has bay windows on the first and second floors and an additional window opening above the entrance bay. All windows are comprised of one-over-one wood-sash. Detailing includes brick banding and a stone cornice. The one-story part has altered door and window openings, including one large window opening that has been in-filled with glass blocks. Side elevations are clad in common brick. This structure lacks architectural distinction and is not individually eligible for listing on the National Register.



Structural Survey

Integrity:			Additional Notes/Descriptions
Unaltered	Slight Modification	on Major Alteration	Some window openings in-filled with wood and glass block
Condition:			
Excellent	Good	Poor	
Additional Alteration	ons		
Two buildings conne	ected after 1905		
Structu	ire Usage	Exterior Wall Surface	
Current: NA		Brick	
Historic: NA			
Roof Material	Roof Features	Roof Type	
Unknown	Parapet	Flat	
Ornamental Archit	ectural Details		Windows
Stone cornice and su	rround at entrance, brick	banding, metal cornice	Glass block, double hung
Outbuildings (Num	ber and Description)		
None			

Local Landmark	Y <u>N</u>	
National Register Historic Places	Y <u>N</u>	
National Register Historic District	Y <u>N</u>	Name:
Individually Eligible? No	A B C	Significance:

Additional Comments:



Historical Resource Recordation Form

Property Name	Photos with Captions:		
	North and east façades of 1.5-story, single family, frame residence.		
Historic: Not labeled, not in CHRS			
Common/Current: Unknown			
Property address:			
421 W. 103rd Street			
HAARGIS Number:			
Not in database			
Present Owner and /or Occupant:			
Unknown			
Property Use			
Historic: Single family residence			
Current: Single family residence			
Date of Construction: 1899			
Architect's Name: Not in CHRS			
Builder/Contractor: Not in CHRS			
Architectural Style:			
Vernacular			
Prepared By: C. Tolmie, M. C. Bird, J.			
Guarino			
Photo By: S. Katz			
Date: 16 September 2012			

Property Description:

Stories: 1.5

This one-and-a-half-story frame house in the Roseland community is situated on a raised basement with glass block windows. It is clad with synthetic siding and has a front gable roof covered with asphalt shingles. Its front elevation has an off-center door, concrete steps and metal railings, and faux stone cladding below the first floor sill line and surrounding the door. There is a three-sided window bay on the first floor and a pair of windows in the gable. Both side elevations feature shed-roofed dormers. Windows throughout the house are non-original one-over-one aluminum-sash. This house does not feature sufficient integrity to qualify as individually eligible for listing on the National Register.




Integrity:			Additional Notes/Descriptions
Unaltered	Slight Modification	Major Alteration	Replacement widows and siding
Condition:			
Excellent	Good	Poor	
Additional Alteration	ons		
Structu	re Usage	Exterior Wall Surface	
Current: NA		Synthetic siding	
Historic: NA			
Roof Material	Roof Features	Roof Type	
Asphalt shingle	Dormer	Gable	
Ornamental Archit	ectural Details		Windows
None			Double-hung
Outbuildings (Num	ber and Description)		
None			

Local Landmark	Y <u>N</u>	
National Register Historic Places	Y <u>N</u>	
National Register Historic District	Y <u>N</u>	Name:
Individually Eligible? No	A B C	Significance:

Additional Comments:			



Historical Resource Recordation Form

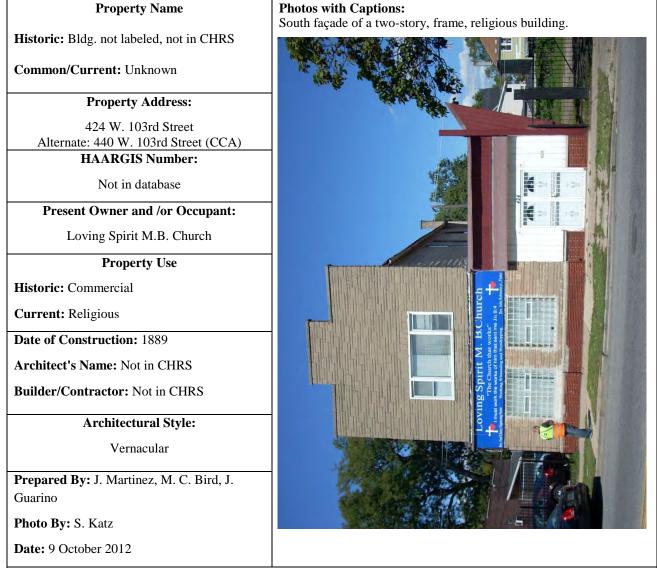

Property Description:

Stories: 2

This two-story frame building in the Washington Heights community has a gable roof covered with asphalt shingles that is obscured by a false front with faux stone siding and high stepped parapet. The first floor has two large window openings that are in-filled with glass block. The second floor has a non-original picture window flanked by one-over-one aluminum-sash windows. The building has a one-story flat-roofed wing. The wing's front elevation is clad with vertically laid wood boards above a brick base. It has a pair of non-original hollow core metal paneled doors with fanlights. The wing also features decorative modern angled wood pylons at its corner and along its side elevation. This building does not feature sufficient integrity to qualify as individually eligible for listing on the National Register.



Integrity:			Additional Notes/Descriptions
Unaltered	Slight Modification	Major Alteration	Replacement windows, doors, and cladding
Condition:			
Excellent	Good	Poor	
Additional Alterati	ons		
Structu	ire Usage	Exterior Wall Surface	
Current: NA		Synthetic siding,	
Historic: NA		brick, faux stone	
Roof Material	Roof Features	Roof Type	
Asphalt shingle	Parapet	Gable, flat	
Ornamental Archit	ectural Details		Windows
Stepped parapet			Double-hung, fixed-pane, glass block
Outbuildings (Num	ber and Description)		
None			

Local Landmark	Y <u>N</u>	
National Register Historic Places	Y <u>N</u>	
National Register Historic District	Y <u>N</u>	Name:
Individually Eligible? No	A B C	Significance:

Additional Comments:			



Historical Resource Recordation Form

Property Name	Photos with Captions:		
Historic: Not labeled, not in CHRS	North façade of one-story, frame, single-family residence.		
Common/Current: Unknown			
Property address:			
453 W. 103rd Street			
HAARGIS Number:			
Not in database			
Present Owner and /or Occupant:			
Unknown			
Property Use			
Historic: Single family residence			
Current: Single family residence			
Date of Construction: 1878			
Architect's Name: Not in CHRS			
Builder/Contractor: Not in CHRS			
Architectural Style:			
Vernacular			
Prepared By: C. Tolmie, M. C. Bird, J.			
Guarino			
Photo By: S. Katz			
Date: 16 September 2012			
	1		

Property Description:

Stories: 1

This one-story frame cottage in the Roseland community sits on a raised concrete block basement with glass block windows. It is clad with synthetic siding and has a gable roof covered with asphalt shingles. Its front elevation features a full-width wood porch with wooden steps, wooden railing, and supports consisting of faux stone piers topped by squat, square columns. It has an off-center hollow core metal door and a strip of three non-original three-over-one windows. This house does not display distinguishing architectural features and is not individually eligible for listing on the National Register.



Integrity:			Additional Notes/Descriptions
Unaltered	Slight Modification	Major Alteration	Replacement door, windows, and cladding
Condition:			
Excellent	Good	Poor	
Additional Alterati	ons		
Structu	ire Usage	Exterior Wall Surface	
Current: NA		Synthetic siding	
Historic: NA			
Roof Material	Roof Features	Roof Type	
Asphalt shingle	None	Gable	
Ornamental Archit	tectural Details		Windows
Square columns			Double-hung, glass block
Outbuildings (Num	ber and Description)		
Garage			

Local Landmark	Y <u>N</u>	
National Register Historic Places	Y <u>N</u>	
National Register Historic District	Y <u>N</u>	Name:
Individually Eligible? No	A B C	Significance:

Additional Comments:	-		



Historical Resource Recordation Form

Property Name	Photos with Captions:
Historic: Pldg not labeled not in CHPS	South façade of a brick, one-story, commercial building.
Historic: Bldg. not labeled, not in CHRS	
Common/Current: Unknown	
Property Address:	
748 W. 103rd Street	
HAARGIS Number:	
Not in database	
Present Owner and /or Occupant:	
Vacant	
Property Use	
Historic: Commercial	
Current: Commercial	
Date of Construction: 1928	
Architect's Name: Not in CHRS	
Builder/Contractor: Not in CHRS	
Architectural Style:	
Vernacular	
Prepared By: J. Martinez, M. C. Bird, J.	
Guarino	
Photo By: S. Katz	
Date: 24 October 2012	
Property Description:	Storios: 1

Property Description:

Stories: 1

This one-story brick-clad commercial building in the Washington Heights community has a flat roof and shaped parapet with concrete coping. Its front elevation has three storefronts that have been covered with plywood and three non-original glass doors with transoms that have largely been covered with plywood as well. Detailing includes brick panels with stone insert blocks. The rear elevation windows have been infilled with brick. This building lacks integrity and distinctive architectural features and is not individually eligible for listing on the National Register.



Integrity:			Additional Notes/Descriptions
Unaltered	Slight Modificat	ion Major Alteration	Rear windows in-filled
Condition:			
Excellent	Good	Poor	
Additional Alterati	ons		
Structu	re Usage	Exterior Wall Surface	
Current: NA		Brick	
Historic: NA			
Roof Material	Roof Features	Roof Type	
Unknown	Parapet	Flat	
Ornamental Archit	ectural Details		Windows
Shaped parapet with concrete coping, brick panels, stone insert blocks			Covered
Outbuildings (Num	ber and Description)		
None			

Local Landmark	Y <u>N</u>	
National Register Historic Places	Y <u>N</u>	
National Register Historic District	Y <u>N</u>	Name:
Individually Eligible? No	A B C	Significance:

Additional Comments:			



Historical Resource Recordation Form

Property Name	Photos with Captions: East and south façades of one-story, brick commercial property.
Historic: Not labeled, not in CHRS	East and south raçades of one-story, offek commercial property.
Common/Current: Unknown	
Property Address:	
814-824 W. 103rd Street	
HAARGIS Number:	
Not in database	
Present Owner and /or Occupant:	
Gee-Gees, Nu-Era, Tiquisi, Bomber	
Property Use	
Historic: Commercial	Sign of the second se
Current: Commercial	
Date of Construction: 1958	
Architect's Name: Not in CHRS	
Builder/Contractor: Not in CHRS	
Architectural Style:	
Vernacular	
Prepared By: C. Tolmie, M. C. Bird, J. Guarino	
Photo By: S. Katz	
Date: 13 September 2012	

Property Description:

Stories: 1

This one-story, brick-clad, commercial building at the corner of 103rd and Green streets in the Washington Heights community has a flat roof, parapet, and three storefronts with non-original windows and glass doors. The corner storefront has been re-clad with faux stone and has two piers flanking its glass double-doors. This building does not feature sufficient distinguishing features to qualify as eligible for individual listing on the National Register.



Integrity:			Additional Notes/Descriptions
Unaltered	Slight Modification	Major Alteration	Replacement doors, windows, cladding
Condition:			
Excellent	Good	Poor	
Additional Alterati	ons		
Structu	re Usage	Exterior Wall Surface	
Current: NA		Faux stone, brick	
Historic: NA			
Roof Material	Roof Features	Roof Type	
Unknown	Parapet	Flat	
Ornamental Archit	ectural Details		Windows
None			Fixed-pane
Outbuildings (Num	ber and Description)		
None			

Local Landmark	Y <u>N</u>	
National Register Historic Places	Y <u>N</u>	
National Register Historic District	Y <u>N</u>	Name:
Individually Eligible? No	A B C	Significance:

Additional Comments:			



Historical Resource Recordation Form

Property Name	Photos with Captions: South façade of a one-and-a-half-story, single family, frame		
Historic: Bldg. not labeled, not in CHRS	residence.		
Common/Current: Unknown	*		
Property Address:			
262 W. 104th Place			
HAARGIS Number:			
Not in database			
Present Owner and /or Occupant:			
Unknown			
Property Use			
Historic: Single family residence			
Current: Single family residence			
Date of Construction: 1910			
Architect's Name: Not in CHRS			
Builder/Contractor: Not in CHRS			
Architectural Style:			
Vernacular			
Prepared By: J. Martinez, M. C. Bird, J. Guarino			
Photo By: S. Katz			
Date: 16 October 2012			

Property Description:

Stories: 1.5

This one-and-a-half-story house in the Roseland community is situated on a raised concrete block basement with glass block windows and is clad with either synthetic siding or wide wood shingles. The building has a front gable roof covered with asphalt shingles. Its front elevation has a full-width, flat-roofed, wood porch with a frieze band and non-original straight railings and posts. There is an off-center entrance with a metal storm door and non-original windows: a strip of three double-hung windows on the first floor and paired double-hung windows in the gable. The east elevation has a gable wall dormer. This house lacks integrity and distinguishing architectural features and is not individually eligible for listing on the National Register.



Integrity:			Additional Notes/Descriptions
Unaltered	Slight Modification	Major Alteration	Replacement door and windows.
Condition:			
Excellent	Good	Poor	
Additional Alteration	ons		
Unclear whether cla	dding is original		
Structu	re Usage	Exterior Wall Surface	
Current: NA		Synthetic siding or	
Historic: NA		Wood shingles	
Roof Material	Roof Features	Roof Type	
Asphalt	Dormer	Gable	
Ornamental Archit	ectural Details		Windows
Frieze band			Double-hung, glass blok
Outbuildings (Num	ber and Description)		
None			

Local Landmark	Y <u>N</u>	
National Register Historic Places	Y <u>N</u>	
National Register Historic District	Y <u>N</u>	Name:
Individually Eligible? No	A B C	Significance:

Additional Comments:			



Historical Resource Recordation Form

Property Name	Photos with Captions: South façade of a one-story, single family, frame residence.
Historic: Bldg. not labeled, not in CHRS	South façade of a one-story, single family, frame festdence.
Common/Current: Unknown	
Property Address:	
328 W. 104th Place	
HAARGIS Number:	
Not in database	
Present Owner and /or Occupant:	
Unknown	
Property Use	
Historic: Single family residence	
Current: Single family residence	
Date of Construction: 1923	
Architect's Name: Not in CHRS	
Builder/Contractor: Not in CHRS	
Architectural Style:	
Craftsman	
Prepared By: J. Martinez, M. C. Bird, J.	
Guarino	
Photo By: S. Katz	
Date: 16 October 2012	
Property Description:	Stories: 1

This one-story Craftsman style bungalow in the Roseland community is situated on a raised basement and clad with synthetic siding. The building has a front gable roof covered with asphalt shingles and overhanging eaves with decorative rafters. Its roof overhangs to shelter the full-width wood porch with supports consisting of low square wood columns atop synthetic-clad porch walls. The front elevation has an off-center non-original hollow core metal paneled door, a strip of three non-original double-hung

windows, and an original wood casement window in the attic gable. This house lacks integrity and distinguishing architectural features and is not individually eligible for listing on the National Register.



Integrity:			Additional Notes/Descriptions
Unaltered	Slight Modification	Major Alteration	Replacement door and windows
Condition:			
Excellent	Good	Poor	
Additional Alterati	ons		
Structu	ire Usage	Exterior Wall Surface	
Current: NA		Synthetic siding	
Historic: NA			
Roof Material	Roof Features	Roof Type	
Asphalt shingles	None	Gable	
Ornamental Archit	tectural Details		Windows
Exposed rafters, squ	are columns on porch		Double-hung, casement
Outbuildings (Num	ber and Description)		
None			

Local Landmark	Y <u>N</u>	
National Register Historic Places	Y <u>N</u>	
National Register Historic District	Y <u>N</u>	Name:
Individually Eligible? No	A B C	Significance:

Additional Comments:		



Historical Resource Recordation Form

Property Name	Photos with Captions:
Historic: Bldg. not labeled, not in CHRS	North façade of a one-story, single family, frame residence.
Common/Current: Unknown	
Property Address:	
335 W 104th Place	
HAARGIS Number:	
Not in database	
Present Owner and /or Occupant:	
Unknown	
Property Use	
Historic: Single family residence	
Current: Single family residence	
Date of Construction: 1919	
Architect's Name: Not in CHRS	
Builder/Contractor: Not in CHRS	
Architectural Style:	
Vernacular	
Prepared By: J. Martinez, M. C. Bird, J.	
Guarino	
Photo By: S. Katz	
Date: 16 October 2012	

Property Description:

Stories: 1

This one-story house in the Roseland community is situated on a raised concrete block basement with glass block windows and is clad with shingles. The building has a front gable roof covered with asphalt shingles. The front elevation has an off-center door with bracketed gable hood, concrete steps with metal railings, a picture window flanked by double-hung windows, and a non-original one-over-one window in the gable. The east elevation has a three-sided bay window. This house lacks integrity and distinguishing architectural features and is not individually eligible for listing on the National Register.



Integrity:			Additional Notes/Descriptions
<u>Unaltered</u>	Slight Modification	Major Alteration	
Condition:			
Excellent	Good	Poor	
Additional Alterati	ons		
Some windows have	aluminum storms		
Structu	ire Usage	Exterior Wall Surface	
Current: NA		Wood shingles	
Historic: NA			
Roof Material	Roof Features	Roof Type	
Asphalt	None	Gable	
Ornamental Archit	ectural Details		Windows
Bracketed hood abov	ve entrance		Double-hung, glass block
Outbuildings (Num	ber and Description)		
None			

Local Landmark	Y <u>N</u>	
National Register Historic Places	Y <u>N</u>	
National Register Historic District	Y <u>N</u>	Name:
Individually Eligible? No	A B C	Significance:

Additional Comments:			



Historical Resource Recordation Form

Property Name	Photos with Captions: South façade of a one-story, single family, frame residence.
Historic: Bldg. not labeled, not in CHRS	south façade of a one-story, single failing, frame residence.
Common/Current: Unknown	
Property Address:	
310 W. 104th Street	
HAARGIS Number:	
Not in database	
Present Owner and /or Occupant:	
Unknown	
Property Use	
Historic: Single family residence	
Current: Single family residence	
Date of Construction: 1923	
Architect's Name: Not in CHRS	
Builder/Contractor: Not in CHRS	
Architectural Style:	
Craftsman	
Prepared By: J. Martinez, M. C. Bird, J.	
Guarino	
Photo By: S. Katz	
Date: 15 October 2012	
Property Description:	Stories: 1

This one-story Craftsman bungalow in the Roseland community is situated on a raised concrete block basement with glass block windows. The residence is clad with synthetic siding, has a hip roof covered with asphalt shingles, overhanging eaves, and a gable dormer with three original wood casement windows. The front elevation features a strip of four one-over-one wood-sash windows and a recessed corner porch with a hollow core metal door, an adjacent casement window, wood steps, metal railings, and a corner support consisting of a low faux stone pier topped by a short open metal post. This house lacks integrity and distinguishing architectural features and is not individually eligible for listing on the National Register.




Integrity:			Additional Notes/Descriptions
Unaltered	Slight Modification	Major Alteration	Replacement door and cladding
Condition:			
Excellent	Good	Poor	
Additional Alteration	ons		
Structu	re Usage	Exterior Wall Surface	
Current: NA		Synthetic siding	
Historic: NA			
Roof Material	Roof Features	Roof Type	
Asphalt shingle	Dormer	Hip	
Ornamental Archit	ectural Details		Windows
None			Double-hung, casement, glass block
Outbuildings (Num	ber and Description)		
None	-		

Local Landmark	Y <u>N</u>	
National Register Historic Places	Y <u>N</u>	
National Register Historic District	Y <u>N</u>	Name:
Individually Eligible? No	A B C	Significance:

Additional Comments:			



Historical Resource Recordation Form

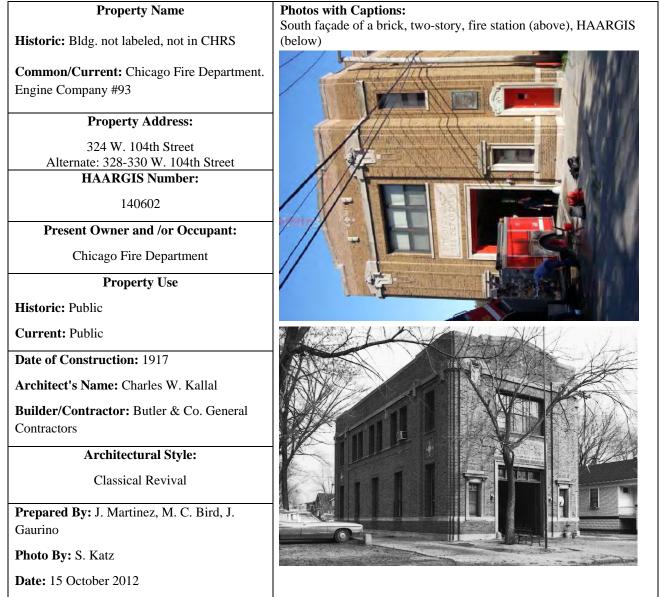

Property Description:

Stories: 2

This two-story firehouse in the Roseland community is clad with light brown face brick and has a flat roof and a parapet with concrete coping. Its front elevation has a two-story projecting pavilion, an overhead garage door, two window openings, an off-center hollow core metal door on the first floor, and a strip of three windows and a single window on the second floor. All windows are non-original one-over-one aluminum sash. The spandrel area between the garage door and the windows above features a large stone sign plate inscribed with the words, "City of Chicago Fire Department." The spandrel area between the corner door and window above has a metal plate identifying the 1917 construction date and the names of a series of people associated with the building's construction, including the mayor, alderman, city architect, and contractor. Detailing includes stone door and window surrounds on the first floor, bracketed stone window lintels, concrete belt courses, and brick pilasters topped by stone panels with the City of Chicago's "Y" motif and decorative scrolls. The "Y" motif is also situated above the off-center door. This building is



recommended as eligible for individual listing on the National Register under Criterion C for architecture. It is a rare extant example of an early twentieth-century neighborhood firehouse in Roseland, has largely retained its original building materials and detailing, and still functions as a firehouse.

Structural Survey

Integrity:			Additional Notes/Descriptions
Unaltered	Slight Modification	on Major Alteration	Replacement doors and windows
Condition:			
<u>Excellent</u>	Good	Poor	
Additional Alterati	ions		
Structu	ıre Usage	Exterior Wall Surface	
Current: NA		Brick	
Historic: NA			
Roof Material	Roof Features	Roof Type	
Unknown	Parapet	Flat	
Ornamental Archit	tectural Details		Windows
Concrete coping, sto	one sign plate, metal info	plate, bracketed stone window	Double-hung
	courses, brick pilasters v	with stone panels (including city	
motif and scrolls)			
Outbuildings (Num	ber and Description)		
None			

Local Landmark	Y <u>N</u>	
National Register Historic Places	Y <u>N</u>	
National Register Historic District	Y <u>N</u>	Name:
Individually Eligible? Yes	а в <u>с</u>	Significance: Rare example of an early twentieth century firehouse in Roseland.

Additional Comments:

CHRS coded orange: property possesses some architectural feature or historical association that made it potentially significant in the context of the surrounding community.



Photos with Captions: Property Name North façade of a one-story, single family, frame residence Historic: Bldg. not labeled, not in CHRS Common/Current: Unknown **Property Address:** 325 W. 104th Street HAARGIS Number: Not in database Present Owner and /or Occupant: Unknown **Property Use** Historic: Single family residence Current: Single family residence **Date of Construction:** 1924 Architect's Name: Not in CHRS Builder/Contractor: Not in CHRS **Architectural Style:** Vernacular Prepared By: J. Martinez, M. C. Bird, J. Guarino Photo By: S. Katz **Date:** 30 October 2012 **Property Description:** Stories: 1

Historical Resource Recordation Form

This one-story house in the Roseland community is situated on a raised concrete block basement and is clad with synthetic siding. The building has a hip-on-gable roof covered with asphalt shingles. The front elevation has a recessed corner porch with wood steps, metal railings, and an open metal corner post. Additional features include a front door tucked into the side of the living room bay, a casement window, a strip of four non-original one-over-one aluminum-sash windows on the first floor, and a strip of three single-pane casement windows in the gable. This house lacks distinctive architectural features and is not individually eligible for listing on the National Register.




Integrity:			Additional Notes/Descriptions
Unaltered	Slight Modification	n Major Alteration	Replacement windows and cladding
Condition:			
<u>Excellent</u>	Good	Poor	
Additional Alterati	ons		
Structu	ire Usage	Exterior Wall Surface	
Current: NA		Synthetic siding	
Historic: NA			
Roof Material	Roof Features	Roof Type	
Asphalt shingle	None	Hip-on-gable	
Ornamental Archit	tectural Details		Windows
None			Double-hung, casement
Outbuildings (Num	ber and Description)		
None			

Local Landmark	Y <u>N</u>	
National Register Historic Places	Y <u>N</u>	
National Register Historic District	Y <u>N</u>	Name:
Individually Eligible? No	A B C	Significance:

Additional Comments:			



Historical Resource Recordation Form

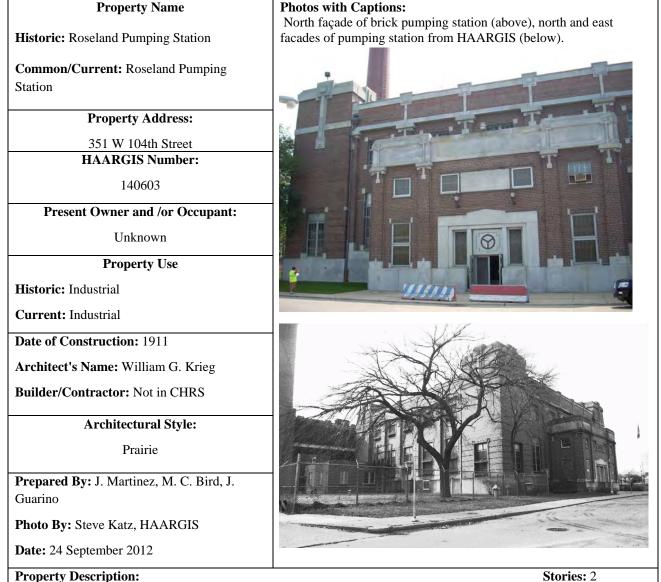

The two-story Prairie style Roseland Pumping Station is clad in brown brick. It has a high limestone watertable, a flat roof, parapet, and two square towers at the corners of the front (Roseland) elevation. The front elevation features a projecting, two-story flat-roofed entrance pavilion with a pair of centrally located glass double-doors, sidelights, and a stone panel above that features the City of Chicago's "Y" emblem in metal. The entrance has a smooth stone surround. Above the entrance is a limestone panel incised with the words: "City of Chicago Roseland Pumping Station." Detailing on the entrance pavilion includes brick pilasters with stone bases, coping, and geometric motifs. The parapet is clad in limestone and features decorative geometric motifs. The building's fenestration is largely comprised of multi-paned steel sash windows, some of which have transoms.

This is an excellent intact example of a community pumping station with fine integrity that still functions in its original use. It is recommended as individually eligible for the National Register under Criterion C for architecture as a well-preserved example of a community pumping station designed in the Prairie style.



Structural Survey

Integrity:			Additional Notes/Descriptions
integrity:			Additional Notes/Descriptions
Unaltered	Slight Modification	on Major Alteration	View of some windows obscured
			by aluminum storms; others are
			original steel sash
			original steel sash
Condition:			
Excellent	Good	Poor	
Additional Alterati	ons		
Structu	ire Usage	Exterior Wall Surface	
Current: NA		Brick	
Historic: NA			
mistorie: 101			
Roof Material	Roof Features	Roof Type	
Asphalt	Parapet	Flat	
Ornamental Archit	tectural Details		Windows
D			T , 1 1 1 1
-	-	bases, coping, cornice, banding,	Fixed-pane, double-hung
and geometric motif	S		
Outbuildings (Num	ber and Description)		
6 (1		

Local Landmark	Y	N		
National Register Historic Places	Y	N		
National Register Historic District	Y	N	•	Name:
Individually Eligible? Yes	A	В	<u>C</u>	Significance: Excellent example of a well-preserved community pumping station designed in the Prairie style that still functions in its original use.

Additional Comments:

CHRS coded orange: property possesses some architectural feature or historical association that made it potentially significant in the context of the surrounding community.



Historical Resource Recordation Form

Property Name	Photos with Captions: North façade of a one-story, single family, frame residence.
Historic: Bldg. not labeled, not in CHRS	North façade of a one-story, single family, frame residence.
Common/Current: Unknown	
Property Address:	
415 W. 104th Street	
HAARGIS Number:	
Not in database	
Present Owner and /or Occupant:	
Unknown	
Property Use	
Historic: Single family residence	
Current: Single family residence	
Date of Construction: 1923	
Architect's Name: Not in CHRS	
Builder/Contractor: Not in CHRS	
Architectural Style:	
Vernacular	The second s
Prepared By: J. Martinez, M. C. Bird, J.	
Guarino	
Photo By: S. Katz	
Date: 10 October 2012	
Property Description:	Stories: 1

Property Description:

Stories: 1

This one-story T-Plan house in the Roseland community is clad with synthetic siding and has a cross-gabled roof covered with asphalt shingles. Its front elevation has a centrally located wood door with a diamond-shaped window located in a projecting gable front bay with concrete steps with metal railings. There are two window openings on the front façade, one of which is covered with plywood. The other window is fixed-pane or casement. Side elevation window openings are also covered with plywood. This house lacks integrity, does not feature any distinguishing architectural features, and is not individually eligible for listing on the National Register.



Integrity:			Additional Notes/Descriptions
Unaltered	Slight Modification	Major Alteration	Replacement windows and cladding
Condition:			
Excellent	Good	Poor	
Additional Alteration	ons		
Structu	re Usage	Exterior Wall Surface	
Current: NA		Synthetic siding	
Historic: NA			
Roof Material	Roof Features	Roof Type	
Asphalt shingles	None	Cross-gable	
Ornamental Archit	ectural Details		Windows
None			Fixed-pane or casement; others covered with plywood
Outbuildings (Num	ber and Description)		
None			

Local Landmark	Y	<u>N</u>	
National Register Historic Places	Y	<u>N</u>	
National Register Historic District	Y	<u>N</u>	Name:
Individually Eligible? No	Α	BC	Significance:

Additional Comments:			



Historical Resource Recordation Form

Property Name	Photos with Captions:
Historic: Bldg. not labeled, not in CHRS	South façade of a brick, one-story, single family residence.
Common/Current: Unknown	
Property Address:	
430 W. 104th Street	
HAARGIS Number:	
Not in database	
Present Owner and /or Occupant:	
Unknown	
Property Use	
Historic: Single family residence	
Current: Single family residence	
Date of Construction: 1927	
Architect's Name: Not in CHRS	
Builder/Contractor: Not in CHRS	
Architectural Style:	And the second s
Chicago Style Bungalow	
Prepared By: J. Martinez, M. C. Bird, J. Guarino	the second se
Photo By: Steve Katz	
Date: 10 October 2012	

Property Description:

Stories: 1

This one-story, brick-clad house in the Roseland community is situated on a raised brick basement with glass block windows. It has a hip roof covered with asphalt shingles, an aluminum-clad front gable dormer with a pair of sliding glass windows, and a set-back synthetic-clad gable-roofed addition on the second story. The front elevation has a strip of three one-over-one aluminum-sash windows, a metal storm door, and a recessed corner porch with concrete steps, low brick side walls, and a brick corner pier support. Detailing includes decorative concrete block inserts. This house does not feature distinguishing architectural features, does not retain its integrity, and, therefore, is not individually eligible for listing on the National Register.



Structural Survey

Integrity:			Additional Notes/Descriptions
Unaltered	<u>Slight Modificati</u>	on Major Alteration	Replacement windows and new cladding
Condition:			
Excellent	Good	Poor	
Additional Alteration	ons		
Second story additio	n at rear		
Structu	re Usage	Exterior Wall Surface	
Current: NA		Brick (main), synthetic siding	
Historic: NA		(dormers)	
Roof Material	Roof Features	Roof Type	
Asphalt	Dormer	Hip, Gable	
Ornamental Archit	ectural Details		Windows
Concrete block inser	ts		Double-hung, glass block, sliding
Outbuildings (Num	ber and Description)		
None			

Local Landmark	Y <u>N</u>	
National Register Historic Places	Y <u>N</u>	
National Register Historic District	Y <u>N</u>	Name:
Individually Eligible? No	A B C	Significance:

Additional Comments:



Historical Resource Recordation Form

Property Name	Photos with Captions:
Historia: Pldg. not labeled. not in CHDS	North façade of a one-story, single family, frame residence.
Historic: Bldg. not labeled, not in CHRS	
Common/Current: Unknown	
Property Address:	
457 W. 104th Street	
HAARGIS Number:	
Not in database	
Present Owner and /or Occupant:	
Unknown	
Property Use	
Historic: Single family residence	
Current: Single family residence	
Date of Construction: 1922	
Architect's Name: Not in CHRS	
Builder/Contractor: Not in CHRS	
Architectural Style:	
Vernacular	
Prepared By: J. Martinez, M. C. Bird, J.	
Guarino	
Photo By: S. Katz	
Date: 12 October 2012	
Decementary Decements the second	<u></u>

Property Description:

Stories: 1

This one-story cottage in the Roseland community is clad with synthetic siding and has a front gable roof covered with asphalt shingles. The front elevation has a strip of three non-original one-over-one windows, a recessed corner porch with a metal storm door and adjacent casement window, wood steps, and low aluminum-clad sidewalls topped by two squat wood columns supporting the porch's gabled roof. Decorative knee braces are situated beneath the eaves of the front elevation. The pair of windows in the gable appears to be casements. This house does not have sufficient integrity or distinguishing architectural features to qualify as individually eligible for listing on the National Register.



Integrity:			Additional Notes/Descriptions
Unaltered	Slight Modification	Major Alteration	Replacement cladding and some windows
Condition:			
<u>Excellent</u>	Good	Poor	
Additional Alteration	ons		
Structu	ire Usage	Exterior Wall Surface	
Current: NA		Synthetic siding	
Historic: NA			
Roof Material	Roof Features	Roof Type	
Asphalt shingle	None	Gable	
Ornamental Archit	ectural Details		Windows
Brackets under eave	S		Double-hung, casement
Outbuildings (Num	ber and Description)		
None			

Local Landmark	Y <u>N</u>	
National Register Historic Places	Y <u>N</u>	
National Register Historic District	Y <u>N</u>	Name:
Individually Eligible? No	A B C	Significance:

Additional Comments:	



Historical Resource Recordation Form

Property Name	Photos with Captions:			
	North façade of a one-story, single family, frame residence.			
Historic: Bldg. not labeled, not in CHRS				
Common/Current: Unknown				
Property Address:				
343 W. 105th Place				
HAARGIS Number:				
Not in database				
Present Owner and /or Occupant:				
Unknown				
Property Use				
Historic: Single family residence				
Current: Single family residence				
Date of Construction: 1926				
Architect's Name: Not in CHRS				
Builder/Contractor: Not in CHRS				
Architectural Style:				
Craftsman				
Prepared By: J. Martinez, M. C. Bird, J.				
Guarino				
Photo By: S. Katz				
Date: 16 October 2012				

Property Description:

Stories: 1

This one-story, frame bungalow in the Roseland community is situated on a raised concrete block basement and is clad with synthetic siding. The building has a hip roof covered with asphalt shingles and a hip dormer with three original wood casement windows. Its front elevation has an off-center door with a metal storm door, non-original wood steps and railings, and a strip of four double-hung windows. This house lacks integrity and distinguishing architectural features and is not individually eligible for listing on the National Register.



Integrity:			Additional Notes/Descriptions
Unaltered	Slight Modification	n Major Alteration	Replacement cladding and railings
Condition:			
Excellent	Good	Poor	
Additional Alterations			
Structure Usage		Exterior Wall Surface	
Current: NA		Synthetic siding	
Historic: NA			
Roof Material	Roof Features	Roof Type	
Asphalt shingles	Dormer	Hip	
Ornamental Architectural Details			Windows
None			Double-hung, casement
Outbuildings (Num	ber and Description)		·
None			

Local Landmark	Y <u>N</u>	
National Register Historic Places	Y <u>N</u>	
National Register Historic District	Y <u>N</u>	Name:
Individually Eligible? No	A B C	Significance:

Additional Comments:			



Historical Resource Recordation Form

Property Name	Photos with Captions: South façade of a one-story, single family, frame residence.
Historic: Bldg. not labeled, not in CHRS	South luçud of a one story, single tanin'y, name testachee.
Common/Current: Unknown	
Property Address:	
344 W. 105th Place	
HAARGIS Number:	
Not in database	
Present Owner and /or Occupant:	
Unknown	
Property Use	
Historic: Single family residence	
Current: Single family residence	
Date of Construction: 1925	
Architect's Name: Not in CHRS	
Builder/Contractor: Not in CHRS	
Architectural Style:	
Craftsman	
Prepared By: J. Martinez, M. C. Bird, J.	
Guarino	
Photo By: S. Katz	
Date: 16 October 2012	
Property Description:	Staries: 1

Property Description:

Stories: 1

This one-story Craftsman bungalow in the Roseland community is situated on a raised concrete block basement with glass block windows and is clad with synthetic siding. The building has a hip roof covered with asphalt shingles, overhanging eaves, and a gable dormer with three small casement windows. Its front elevation features a strip of four non-original one-over-one aluminum-sash windows and a recessed corner porch with metal storm door, wood steps and railings, and a corner support consisting of a low faux stone pier topped by a short aluminum-clad post. This house lacks integrity and distinguishing architectural features and is not individually eligible for listing on the National Register.



Integrity:			Additional Notes/Descriptions
Unaltered	Slight Modification	Major Alteration	Replacement windows and cladding
Condition:			
Excellent	Good	Poor	
Additional Alteration	ons		
Structu	re Usage	Exterior Wall Surface	
Current: NA		Synthetic siding	
Historic: NA			
Roof Material	Roof Features	Roof Type	
Asphalt shingles	Dormer	Hip	
Ornamental Archit	ectural Details		Windows
None			Double-hung, casement, glass block
Outbuildings (Num	ber and Description)		
None			

Local Landmark	Y	<u>N</u>	
National Register Historic Places	Y	<u>N</u>	
National Register Historic District	Y	<u>N</u>	Name:
Individually Eligible? No	A	BC	Significance:

Additional Comments:			



Historical Resource Recordation Form

Property Name	Photos with Captions:
	South façade of two, brick, one-story light industrial buildings. The
Historic: Bldg. not labeled, not in CHRS	building dating to 1960 is shown in the top photo while the building
	dating to 2005 is shown in the bottom photo.
Common/Current: Unknown	
Property Address:	
411 W. 105th Street	
HAARGIS Number:	
Not in database	
Present Owner and /or Occupant:	
AT&T	
Property Use	
Historic: Industrial	
Current: Industrial	
Date of Construction: 1960/2005	
Architect's Name: Not in CHRS	
Builder/Contractor: Not in CHRS	
Architectural Style:	
Vernacular	
Prepared By: J. Martinez, M. C. Bird, J.	
Guarino	
Photo By: S. Katz	
Date: 25 September 2012	
Property Description:	Stories: 1

These one-story brick-clad flat-roofed light industrial buildings in Roseland have overhead garage doors and a hinged hollow metal door opening. The earlier building has a parapet with tile coping. Original window openings along the side elevations have been in-filled with brick or glass blocks with central casement windows. The newer building has a flat roof. These buildings lack any architectural distinction and are not individually eligible for listing on the National Register.



Integrity:			Additional Notes/Descriptions	
Unaltered	Slight Modification	Major Alteration	Bricked over windows	
Condition:				
Excellent	Good	Poor		
Additional Alterati	ons			
Structu	ire Usage	Exterior Wall Surface		
Current: NA		Brick		
Historic: NA				
Roof Material	Roof Features	Roof Type		
Unknown	Parapet	Flat		
Ornamental Archit	tectural Details		Windows	
None			Glass block	
Outbuildings (Number and Description)				
None				

Local Landmark	Y <u>N</u>	
National Register Historic Places	Y <u>N</u>	
National Register Historic District	Y <u>N</u>	Name:
Individually Eligible? No	A B C	Significance:

Additional Comments:			



Historical Resource Recordation Form

Property Name	Photos with Captions:
Historic: Bldg. not labeled, not in CHRS	South façade of a brick, two-story, mixed-use building.
Common/Current: Unknown	
Property Address:	In the second se
416 W. 105th Street	
Alternate: 410 W 105th St	
HAARGIS Number:	
Not in database	All
Present Owner and /or Occupant:	
Vacant	
Property Use	
Historic: Commercial (Warehouse, 1938)	
Current: Mixed-Use	
Date of Construction: 1929	
Architect's Name: Not in CHRS	
Builder/Contractor: Not in CHRS	
Architectural Style:	
Vernacular	
Prepared By: J. Martinez, M. C. Bird, J.	
Guarino	Million and States and All
Photo By: S. Katz	
Date: 12 October 2012	
Property Description:	Stories: 2

Property Description:

Stories: 2

This two-story building in the Roseland community, a former warehouse later converted to residential use and now abandoned, has a flat roof and shaped parapet with concrete coping. Its front elevation is clad in brown face brick and its side and rear elevations are clad with common brick. The front elevation has an off-center door opening with transom, a garage door opening, and two window openings, all of which are covered with plywood. A portion of one of these window openings is visible and reveals a multi-paned upper sash. The second floor has a pair of window openings and a strip of three window openings, all of which have had their glass panes removed. Detailing includes concrete sills and insert blocks between the first floor openings, two brick soldier courses, and brick stringcourses at the parapet level. This building does not have sufficient integrity or distinguishing architectural features to qualify as individually eligible for listing on the National Register.



Structural Survey

Integrity:			Additional Notes/Descriptions
Unaltered	Slight Modification	on Major Alteration	Abandoned building with broken windows, partially secured with plywood
G IV			
Condition:			
Excellent	Good	Poor	
Additional Alterati	ons		
Structu	ire Usage		
Current: NA		Brick	
Historic: NA			
Roof Material	Roof Features	Roof Type	
Unknown	Parapet	Flat	
Ornamental Archit	ectural Details		Windows
Concrete sills and insert blocks, brick soldier courses, and brick stringcourses, shaped parapet			Covered
Outbuildings (Num	ber and Description)		
None			

Local Landmark	Y <u>N</u>	
National Register Historic Places	Y <u>N</u>	
National Register Historic District	Y <u>N</u>	Name:
Individually Eligible? No	A B C	Significance:

Additional Comments:



Historical Resource Recordation Form

Property Name	Photos with Captions: South and east façades of a 1.5-story, single family, frame residence.
Historic: Bldg. not labeled, not in CHRS	South and east façades of a 1.3-story, single family, frame residence.
Common/Current: Unknown	
Property Address:	
338 W. 106th Place	
HAARGIS Number:	
Not in database	
Present Owner and /or Occupant:	
Unknown	
Property Use	
Historic: Single family residence	
Current: Single family residence	
Date of Construction: 1913	
Architect's Name: Not in CHRS	
Builder/Contractor: Not in CHRS	
Architectural Style:	
Vernacular	
Prepared By: J. Martinez, M. C. Bird, J. Guarino	
Photo By: S. Katz	
Date: 30 October 2012	

Property Description:

Stories: 1.5

This one-and-a-half-story frame house in the Roseland community is situated on a raised concrete block basement with glass block windows and is covered with synthetic siding. The building has a front gable roof covered with asphalt shingles. The front elevation has a full-width, hip-roof, wood porch with low, synthetic-clad walls, boxed supports, and side-facing steps. The residence also has an off-center metal storm door, a three-sided bay window on the first floor, and paired windows in the gable, all of which feature non-original one-over-one aluminum sashes. This house lacks integrity and distinctive architectural features and is not individually eligible for listing on the National Register.




Integrity:			Additional Notes/Descriptions
Unaltered	Slight Modification	Major Alteration	Replacement windows and cladding
Condition:			
Excellent	Good	Poor	
Additional Alterati	ons		
Structu	ire Usage	Exterior Wall Surface	
Current: NA		Synthetic siding	
Historic: NA			
Roof Material	Roof Features	Roof Type	
Asphalt shingle	None	Gable	
Ornamental Archit	tectural Details		Windows
None			Double-hung, glass block
Outbuildings (Num	ber and Description)		·
None			

Local Landmark	Y <u>N</u>	
National Register Historic Places	Y <u>N</u>	
National Register Historic District	Y <u>N</u>	Name:
Individually Eligible? No	A B C	Significance:

Additional Comments:



Historical Resource Recordation Form

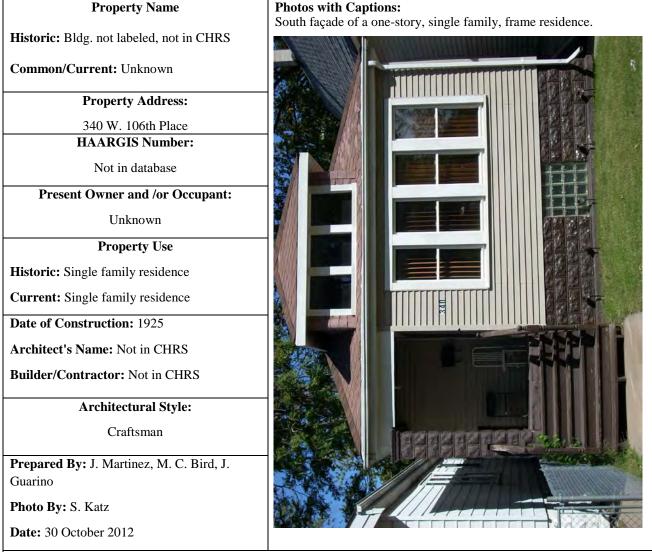

Property Description:

Stories: 1

This one-story, Craftsman style, frame bungalow in the Roseland community is situated on a raised concrete block basement with glass block windows and is covered with synthetic siding. The building has a hip roof covered with asphalt shingles, overhanging eaves, and a hip dormer with three casement windows. The front elevation has a recessed corner porch with a concrete block corner pier, a front door tucked into the north side of the living room bay, wood steps with wood railings, and a strip of non-original one-over-one aluminum-sash windows. This is an example of a frame Craftsman bungalow, a residential building type that was produced during the 1910s and 1920s. This house does not feature distinguishing architectural elements and is not individually eligible for listing on the National Register.



Integrity:			Additional Notes/Descriptions
Unaltered	Slight Modification	Major Alteration	Replacement windows and cladding
Condition:			
<u>Excellent</u>	Good	Poor	
Additional Alteration	ons		
Structu	re Usage	Exterior Wall Surface	
Current: NA		Synthetic siding	
Historic: NA			
Roof Material	Roof Features	Roof Type	
Asphalt shingles	Dormer	Hip	
Ornamental Archit	ectural Details		Windows
None			Double-hung, casement, glass block
Outbuildings (Num	ber and Description)		
None			

Local Landmark	Y	<u>N</u>	
National Register Historic Places	Y	<u>N</u>	
National Register Historic District	Y	<u>N</u>	Name:
Individually Eligible? No	A	B C	Significance:

Additional Comments:			



Historical Resource Recordation Form

Property Name	Photos with Captions: North façade of a 1.5-story, single family, frame residence.
Historic: Bldg. not labeled, not in CHRS	North façade of a 1.5-story, single family, france residence.
Common/Current: Unknown	
Property Address:	
343 W. 106th Place	
HAARGIS Number:	
Not in database	
Present Owner and /or Occupant:	
Unknown	
Property Use	
Historic: Single family residence	
Current: Single family residence	
Date of Construction: 1907	
Architect's Name: Not in CHRS	
Builder/Contractor: Not in CHRS	
Architectural Style:	
Vernacular	
Prepared By: J. Martinez, M. C. Bird, J.	
Guarino	
Photo By: S. Katz	
Date: 16 October 2012	

Property Description:

Stories: 1.5

This one-and-a-half-story house in the Roseland community is situated on a raised concrete block basement with glass block windows and is clad with synthetic siding. The building has a front gable roof covered with asphalt shingles. Its front elevation has a pent roof, off-center door with a metal storm door, concrete steps with metal railings, a large picture window on the first floor, and a pair of non-original one-over-one aluminum sash windows in the gable. Its east elevation has a three-sided window bay with a projecting gable wall dormer directly above. This house lacks integrity and distinguishing architectural features and is not individually eligible for listing on the National Register.




Integrity:			Additional Notes/Descriptions
Unaltered	Slight Modification	Major Alteration	Replacement windows, cladding, and porch railings
Condition:			
<u>Excellent</u>	Good	Poor	
Additional Alteration	ons		
Structu	re Usage	Exterior Wall Surface	
Current: NA		Synthetic siding	
Historic: NA			
Roof Material	Roof Features	Roof Type	
Asphalt shingle	None	Gable	
Ornamental Archit	ectural Details		Windows
None			Double-hung, fixed-pane, glass block
Outbuildings (Num	ber and Description)		
None			

Local Landmark	Y <u>N</u>	
National Register Historic Places	Y <u>N</u>	
National Register Historic District	Y <u>N</u>	Name:
Individually Eligible? No	A B C	Significance:

Additional Comments:			



Historical Resource Recordation Form

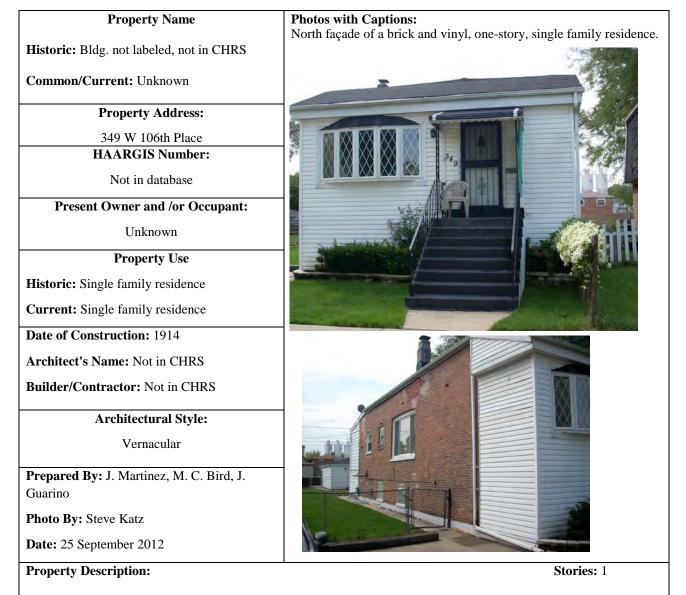

This building consists of a central, hipped-roof, brick clad structure on a raised basement that was constructed in 1914. Later, shed-roof, vinyl clad additions were constructed on the front and rear of the central brick portion. The front elevation features an off-center porch with concrete steps, metal railings and supports topped by a metal awning roof. It also has a hollow metal front door and a five-sided bow window. This home lacks both integrity and architectural distinction and is not individually eligible for listing on the National Register.



Integrity:			Additional Notes/Descriptions
Unaltered	Slight Modification	on <u>Major Alteration</u>	Replacement windows
Condition:			
Excellent	Good	Poor	
Additional Alterati	ons		
Additions to front ar	nd rear		
Structu	re Usage	Exterior Wall Surface	
Current: NA		Brick (original part),	
Historic: NA		Vinyl (front and rear additions)	
Roof Material	Roof Features	Roof Type	
Asphalt	None	Hip, shed	
Ornamental Archit	ectural Details		Windows
None			Double-hung, fixed-pane, glass
			block
Outbuildings (Num	ber and Description)		
None			

Local Landmark	Y <u>N</u>	
National Register Historic Places	Y <u>N</u>	
National Register Historic District	Y <u>N</u>	Name:
Individually Eligible? No	A B C	Significance:

Additional Comments:		



Historical Resource Recordation Form

Property Name	Photos with Captions:
Historic: Bldg. not labeled, not in CHRS	South façade of vinyl-sided, one-and-a-half-story, single-family residence.
Common/Current: Unknown	
Property Address:	
350 W 106th Place	
HAARGIS Number:	
Not in database	
Present Owner and /or Occupant:	
Unknown	
Property Use	
Historic: Single family residence	
Current: Single family residence	
Date of Construction: 1908	
Architect's Name: Not in CHRS	
Builder/Contractor: Not in CHRS	
Architectural Style:	
Vernacular	
Prepared By: J. Martinez, M. C. Bird, J.	and the second
Guarino	and the second sec
Photo By: Steve Katz	
Date: 25 September 2012	and the survey of an and the state of the state

Property Description:

Stories: 1.5

This one-and-a-half story home in the Roseland community is situated on a raised basement, is clad in aluminum siding, and has a front-gabled roof covered with asphalt shingles. Its front elevation features an off-center, gable-roofed porch with wood steps, railings, and posts. It has a front door that appears to be hollow metal, a picture window on the first floor, and paired one-over-one windows on the second floor. This home lacks both integrity and architectural distinction and is not individually eligible for listing on the National Register.



Integrity:			Additional Notes/Descriptions
Unaltered	Slight Modification	Major Alteration	Replacement siding and windows; new porch
Condition:			
Excellent	Good	Poor	
Additional Alteration	ons		
Fixed-pane picture w	vindow replaces original with	ndows	
Structu	re Usage	Exterior Wall Surface	
Current: NA		Synthetic siding	
Historic: NA			
Roof Material	Roof Features	Roof Type	
Asphalt	None	Gable	
Ornamental Archit	ectural Details		Windows
None			Fixed- pane, double-hung, glass block
Outbuildings (Num	ber and Description)		
None			

Local Landmark	Y <u>N</u>	
National Register Historic Places	Y <u>N</u>	
National Register Historic District	Y <u>N</u>	Name:
Individually Eligible? No	A B C	Significance:

Additional Comments



Historical Resource Recordation Form

Property Name	Photos with Captions: South façade of one-story, single family residence.
Historic: Bldg. not labeled, not in CHRS	South higher of one story, single fulling residence.
Common/Current: Unknown	
Property Address:	
352 W. 106th Place	
HAARGIS Number:	
Not in database	
Present Owner and /or Occupant:	
Unknown	
Property Use	
Historic: Single family residence	
Current: Single family residence	
Date of Construction: 1924	
Architect's Name: Not in CHRS	
Builder/Contractor: Not in CHRS	
Architectural Style:	a P
Vernacular	
Prepared By: J. Martinez, M. C. Bird, J.	
Guarino	
Photo By: S. Katz	
Date: 25 September 2012	
Property Description:	Stories: 1

Property Description:

Stories: 1

This one-story home in the Roseland community is situated on a raised basement and clad with stone (first floor) and synthetic siding (dormer). It has a hip roof covered with asphalt shingles and a gable-roofed dormer with three windows that appear to be casements. Its front façade features a recessed porch with concrete steps, metal railings, and a metal corner support; it also has a leaded glass casement window and a strip of four one-over-one windows. This home lacks both integrity and architectural distinction and is not individually eligible for listing on the National Register.



Integrity:			Additional Notes/Descriptions
Unaltered	Slight Modificat	ion Major Alteration	Replacement siding on dormer
Condition:			
Excellent	Good	Poor	
Additional Alteration	ons		
Structu	re Usage	Exterior Wall Surface	
Current: NA		Stone, synthetic siding (dormer)	
Historic: NA			
Roof Material	Roof Features	Roof Type	
Asphalt	Gabled dormer	Hip	
Ornamental Archit	ectural Details		Windows
None			Casement, double-hung
Outbuildings (Num	ber and Description)		
None			

Local Landmark	Y <u>N</u>	
National Register Historic Places	Y <u>N</u>	
National Register Historic District	Y <u>N</u>	Name:
Individually Eligible? No	A B C	Significance:

Additional Comments:		



Historical Resource Recordation Form

Property Name	Photos with Captions: North façade of a one-story, single family, frame residence.
Historic: Bldg. not labeled, not in CHRS	North façade of a one-story, single family, frame residence.
Common/Current: Unknown	
Property Address:	
341 W. 106th Street	
HAARGIS Number:	
Not in database	
Present Owner and /or Occupant:	
Unknown	
Property Use	
Historic: Single family residence	
Current: Single family residence	
Date of Construction: 1903	
Architect's Name: Not in CHRS	
Builder/Contractor: Not in CHRS	
Architectural Style:	
Vernacular	
Prepared By: J. Martinez, M. C. Bird, J.	
Guarino	
Photo By: S. Katz	
Date: 16 October 2012	
Property Description:	Stories: 1

This one-story cottage in the Roseland community is situated on a raised concrete block basement and is clad with synthetic siding. The building has a front gable roof covered with asphalt shingles and two large non-original flat-roofed side elevation dormers with one-over-one aluminum-sash windows. The front elevation has an off-center non-original hollow core metal door, steps obscured by foliage with metal railings, and a strip of three non-original one-over-one aluminum-sash windows. This house lacks integrity and distinguishing architectural features and is not individually eligible for listing on the National Register.



Structural Survey

Integrity:			Additional Notes/Descriptions
Unaltered	Slight Modification	Major Alteration	Replacement door, windows, and cladding
Condition:			
<u>Excellent</u>	Good	Poor	
Additional Alteration	ons		
Side dormers added			
Structu	ıre Usage	Exterior Wall Surface	
Current: NA		Synthetic siding	
Historic: NA			
Roof Material	Roof Features	Roof Type	
Asphalt shingles	None	Gable, flat	
Ornamental Archit	ectural Details		Windows
None			Double-hung
Outbuildings (Num	ber and Description)		
None			

Local Landmark	Y <u>N</u>	
National Register Historic Places	Y <u>N</u>	
National Register Historic District	Y <u>N</u>	Name:
Individually Eligible? No	A B C	Significance:

Additional Comments:



Historical Resource Recordation Form

Property Name	Photos with Captions: South façade of a brick, one-story, single family residence.
Historic: Bldg. not labeled, not in CHRS	South fuçude of a offek, one story, single family residence.
Common/Current: Unknown	
Property Address:	
346 W. 106th Street	
HAARGIS Number:	
Not in database	
Present Owner and /or Occupant:	
Unknown	
Property Use	
Historic: Single family residence	
Current: Single family residence	
Date of Construction: 1964	
Architect's Name: Not in CHRS	
Builder/Contractor: Not in CHRS	
Architectural Style:	
Vernacular	
Prepared By: J. Martinez, M. C. Bird, J.	
Guarino	
Photo By: S. Katz	
Date: 16 October 2012	
Property Description:	Stories: 1

This one-story house in the Roseland community is situated on a raised basement with glass block windows and has a hip roof covered with asphalt shingles. Its front elevation is clad with red brick on one side and buff brick on the other, has an off-center hollow core metal door, concrete steps with metal railings, and a picture window flanked by one-over-one aluminum-sash windows. Detailing includes three decorative glass blocks and concrete inserts flanking the front door. This house lacks distinguishing architectural features and is not individually eligible for listing on the National Register.



Integrity:			Additional Notes/Descriptions
<u>Unaltered</u>	Slight Modification	Major Alteration	
Condition:			
Excellent	Good	Poor	
Additional Alteration	ons		
Structu	re Usage	Exterior Wall Surface	
Current: NA		Brick	
Historic: NA			
Roof Material	Roof Features	Roof Type	
Asphalt shingle	None	Hip	
Ornamental Archit	ectural Details		Windows
Decorative glass bloc	cks, concrete inserts at entr	rance	Double-hung, fixed-pane, glass blcok
Outbuildings (Num	ber and Description)		
None			

Local Landmark	Y <u>N</u>	
National Register Historic Places	Y <u>N</u>	
National Register Historic District	Y <u>N</u>	Name:
Individually Eligible? No	A B C	Significance:

Additional Comments:			



Historical Resource Recordation Form

Property Name	Photos with Captions: North façade of a one story, single-family residence.
Historic: Bldg. not labeled, not in CHRS	North façade of a one story, single-family residence.
Common/Current: Unknown	
Property Address:	
351 W 106th Street	
HAARGIS Number:	
Not in database	
Present Owner and /or Occupant:	
Unknown	
Property Use	
Historic: Single family residence	
Current: Single family residence	
Date of Construction: 1898	
Architect's Name: Not in CHRS	
Builder/Contractor: Not in CHRS	
Architectural Style:	
Vernacular	
Prepared By: J. Martinez, M. C. Bird, J. Guarino	and the second strange with the
Photo By: Steve Katz	
Date: 24 September 2012	

Property Description:

Stories: 1

This one story home in Roseland has a front gable roof with asphalt shingles. Its front façade is clad in both vinyl and faux stone siding; it has a flat-roofed enclosed porch with an off-center entrance covered with plywood. The two first floor window openings are in-filled with wood and the gable features a pair of one-over-one aluminum-sash windows. This structure lacks integrity and architectural distinction and is not individually eligible for listing on the National Register.



Integrity:			Additional Notes/Descriptions	
Unaltered	Slight Modification	Major Alteration	Replacement doors, windows, cladding	
Condition:				
Excellent	Good	Poor		
Additional Alterati	ons			
Structu	re Usage			
Current: NA		Vinyl, faux stone		
Historic: NA				
Roof Material	Roof Features	Roof Type		
Asphalt	None	Gable		
Ornamental Archit	ectural Details		Windows	
None			Double-hung, in-filled	
Outbuildings (Number and Description)				
None				

Local Landmark	Y <u>N</u>	
National Register Historic Places	Y <u>N</u>	
National Register Historic District	Y <u>N</u>	Name:
Individually Eligible? No	A B C	Significance:

Additional Comments:	



Historical Resource Recordation Form

Property Name	Photos with Captions:
Historic: Bldg. not labeled, not in CHRS	North façade of vinyl and stone, one-story single-family residence.
Historic. Didg. not interiod, not in errich	
Common/Current: Unknown	
Property Address:	
353 W 106th Street	
Alternate: 355 W 106th Street, per Assessor	
HAARGIS Number:	
Not in database	A DATE OF A DECK AND A
Present Owner and /or Occupant:	
Unknown	
Property Use	
Historic: Single family residence	
Current: Single family residence	
Date of Construction: 1924	
Architect's Name: Not in CHRS	
Builder/Contractor: Not in CHRS	
Architectural Style:	
Vernacular	
Prepared By: J. Martinez, M. C. Bird, J.	
Guarino	
Photo By: Steve Katz	
Date: 24 September 2012	
Property Description:	Stories: 1

Property Description:

Stories: 1

This one-story home in Roseland is situated on a raised basement. It has a hip roof with asphalt shingles and a gable-roofed dormer with sliding glass windows. Its front elevation is clad in synthetic stone and features an off-center hollow metal paneled door with fanlight, accessed via a short flight of wood steps with wood railings. Its strip of three windows features a picture window flanked by one-over-one windows. The side elevations are clad in vinyl siding. Alterations include the installation of siding and replacement windows. This structure lacks integrity and architectural distinction and is not individually eligible for listing on the National Register.



Integrity:			Additional Notes/Descriptions
Unaltered	Slight Modification	Major Alteration	Replacement doors, windows, cladding
Condition:			
<u>Excellent</u>	Good	Poor	
Additional Alterati	ons		
Structu	re Usage	Exterior Wall Surface	
Current: NA		Vinyl (sides and rear),	
Historic: NA		Faux stone (façade)	
Roof Material	Roof Features	Roof Type	
Asphalt	Gabled dormer	Hip	
Ornamental Archit	ectural Details	Windows	
None			Double-hung, fixed-pane, sliding
Outbuildings (Num	ber and Description)		
None			

Local Landmark	Y <u>N</u>	
National Register Historic Places	Y <u>N</u>	
National Register Historic District	Y <u>N</u>	Name:
Individually Eligible? No	A B C	Significance:

Additional Comments:			



Historical Resource Recordation Form

Property Name	Photos with Captions: South façade of a brick, one-story, single family residence.
Historic: Bldg. not labeled, not in CHRS	
Common/Current: Unknown	
Property Address:	
332 W. 107th Place	
HAARGIS Number:	
Not in database	
Present Owner and /or Occupant:	
Unknown	
Property Use	
Historic: Single family residence	
Current: Single family residence	
Date of Construction: 1949	
Architect's Name: Not in CHRS	
Builder/Contractor: Not in CHRS	
Architectural Style:	
Vernacular	
Prepared By: J. Martinez, M. C. Bird, J.	
Guarino	
Photo By: S. Katz	
Date: 16 October 2012	

Property Description:

Stories: 1

This one-story, brick-clad house in the Roseland community sits on a raised basement with glass block windows. The building has a hip roof covered with asphalt shingles, overhanging eaves, and a large hip-roofed rear wing. Its projecting gable-roofed front wing has a recessed corner porch with low brick walls, a brick corner pier, concrete steps with metal railings, and a door tucked into the side of the living room bay. Its front elevation features two large picture windows, a glass block window, and a bulls-eye window in the gable. Other windows are non-original double-hung. Detailing includes faux stonework at the corners of the basement, concrete sills, glass blocks, and keystone-like blocks surrounding the bulls-eye window. This house lacks integrity and distinguishing architectural features and is not individually eligible for listing on the National Register.



Integrity:			Additional Notes/Descriptions
Unaltered	Slight Modification	Major Alteration	Replacement windows
Condition:			
Excellent	Good	Poor	
Additional Alterati	ons		
Structu	re Usage	Exterior Wall Surface	
Current: NA		Brick	
Historic: NA			
Roof Material	Roof Features	Roof Type	
Asphalt shingles	None	Hip	
Ornamental Archit	ectural Details		Windows
Stonework at corner	s, concrete sills, bull's eye	window with stone accents	Double-hung, fixed-pane, glass
			block
Outbuildings (Num	ber and Description)		
Detached three car g	arage.		

Local Landmark	Y <u>N</u>	
National Register Historic Places	Y <u>N</u>	
National Register Historic District	Y <u>N</u>	Name:
Individually Eligible? No	A B C	Significance:

Additional Comments:			



Historical Resource Recordation Form

Property Name	Photos with Captions:
Historic: Bldg. not labeled, not in CHRS	North façade of a one-story, single family, frame residence.
Common/Current: Unknown	
Property Address:	
333 W. 107th Place	
HAARGIS Number:	
Not in database	
Present Owner and /or Occupant:	
Unknown	
Property Use	
Historic: Single family residence	
Current: Single family residence	
Date of Construction: 1924	
Architect's Name: Not in CHRS	
Builder/Contractor: Not in CHRS	
Architectural Style:	
Craftsman	
Prepared By: J. Martinez, M. C. Bird, J.	
Guarino	
Photo By: S. Katz	
Date: 16 October 2012	
Property Description:	Stories: 1

Property Description:

Stories: 1

This one-story bungalow in the Roseland community is situated on a raised brick basement with glass block windows and is clad with synthetic siding. The building has a hip roof covered with asphalt shingles, overhanging eaves, and a hip dormer with a pair of original wood casement windows and decorative rafters. Its roof overhangs to shelter a full-width wood porch with straight railings and posts. The front elevation has an off-center non-original hollow-core metal door and a strip of three non-original one-over-one aluminum-sash windows. This house lacks integrity and distinguishing architectural features and is not individually eligible for listing on the National Register.



Integrity:			Additional Notes/Descriptions
Unaltered	Slight Modification	Major Alteration	Replacement door, windows, and cladding
Condition:			
<u>Excellent</u>	Good	Poor	
Additional Alteration	ons		
Structu	re Usage	Exterior Wall Surface	
Current: NA		Synthetic siding	
Historic: NA			
Roof Material	Roof Features	Roof Type	
Asphalt shingles	Dormer	Hip	
Ornamental Archit	ectural Details		Windows
None			Double-hung, casement, glass block
Outbuildings (Num	ber and Description)		
None			

Local Landmark	Y	<u>N</u>	
National Register Historic Places	Y	<u>N</u>	
National Register Historic District	Y	<u>N</u>	Name:
Individually Eligible? No	A	B C	Significance:

Additional Comments:			



Historical Resource Recordation Form

Property Name	Photos with Captions: South façade of a brick, one-story, single family residence.
Historic: Bldg. not labeled, not in CHRS	South fuçude of a offek, one story, single family residence.
Common/Current: Unknown	
Property Address:	
346 W. 106th Street	
HAARGIS Number:	
Not in database	
Present Owner and /or Occupant:	
Unknown	
Property Use	
Historic: Single family residence	
Current: Single family residence	
Date of Construction: 1964	
Architect's Name: Not in CHRS	
Builder/Contractor: Not in CHRS	
Architectural Style:	
Vernacular	
Prepared By: J. Martinez, M. C. Bird, J.	
Guarino	
Photo By: S. Katz	
Date: 16 October 2012	
Property Description:	Stories: 1

This one-story house in the Roseland community is situated on a raised basement with glass block windows and has a hip roof covered with asphalt shingles. Its front elevation is clad with red brick on one side and buff brick on the other, has an off-center hollow core metal door, concrete steps with metal railings, and a picture window flanked by one-over-one aluminum-sash windows. Detailing includes three decorative glass blocks and concrete inserts flanking the front door. This house lacks distinguishing architectural features and is not individually eligible for listing on the National Register.



Integrity:			Additional Notes/Descriptions
<u>Unaltered</u>	Slight Modification	Major Alteration	
Condition:			
Excellent	Good	Poor	
Additional Alteration	ons		
Structu	re Usage	Exterior Wall Surface	
Current: NA		Brick	
Historic: NA			
Roof Material	Roof Features	Roof Type	
Asphalt shingle	None	Hip	
Ornamental Archit	ectural Details		Windows
Decorative glass bloc	cks, concrete inserts at entr	rance	Double-hung, fixed-pane, glass blcok
Outbuildings (Num	ber and Description)		
None			

Local Landmark	Y <u>N</u>	
National Register Historic Places	Y <u>N</u>	
National Register Historic District	Y <u>N</u>	Name:
Individually Eligible? No	A B C	Significance:

Additional Comments:			



Historical Resource Recordation Form

Property Name	Photos with Captions: North façade of a one-story, single family, frame residence.
Historic: Bldg. not labeled, not in CHRS	North façade of a one-story, single family, frame residence.
Common/Current: Unknown	
Property Address:	
335 W. 107th Street	
HAARGIS Number:	
Not in database	
Present Owner and /or Occupant:	
Unknown	
Property Use	Com and the second s
Historic: Single family residence	
Current: Single family residence	
Date of Construction: 1899	
Architect's Name: Not in CHRS	
Builder/Contractor: Not in CHRS	
Architectural Style:	
Vernacular	
Prepared By: J. Martinez, M. C. Bird, J.	
Guarino	
Photo By: S. Katz	
Date: 16 October 2012	
Property Description.	Stories: 1

Property Description:

Stories: 1

This one-story home in the Roseland community is situated on a raised concrete block basement and is clad with synthetic siding. The building has a front gable roof covered with asphalt shingles and a shed dormer along its west elevation. It has a full-width, gable-roof, wood porch with low walls and three boxed supports all covered with aluminum siding. The front elevation has an off-center door with a metal storm door, a strip of three windows on the first floor and a pair of windows in the attic, all of which are non-original one-over-one aluminum-sash. This house lacks integrity and distinguishing architectural features and is not individually eligible for listing on the National Register.



Integrity:			Additional Notes/Descriptions
Unaltered	Slight Modification	n Major Alteration	Replacement windows and cladding
Condition:			
<u>Excellent</u>	Good	Poor	
Additional Alterati	ons		
Structu	ire Usage	Exterior Wall Surface	
Current: NA		Synthetic siding	
Historic: NA			
Roof Material	Roof Features	Roof Type	
Asphalt shingles	Dormer	Gable	
Ornamental Architectural Details			Windows
None			Double-hung
Outbuildings (Num	ber and Description)		
Garage			

Local Landmark	Y <u>N</u>	
National Register Historic Places	Y <u>N</u>	
National Register Historic District	Y <u>N</u>	Name:
Individually Eligible? No	A B C	Significance:

Additional Comments:			



Historical Resource Recordation Form

Property Name	Photos with Captions: South façade of a one-story, concrete block, light industrial building.
Historic: Bldg. not labeled, not in CHRS	soum raçade or a one-story, concrete block, right madsurar bunding.
Common/Current: Unknown	
Property Address:	
400 W 107th Street	
HAARGIS Number:	
Not in database	
Present Owner and /or Occupant:	
Unknown	
Property Use	
Historic: Industrial	
Current: Industrial	
Date of Construction: 1929	
Architect's Name: Not in CHRS	
Builder/Contractor: Not in CHRS	
Architectural Style:	
Vernacular	
Prepared By: J. Martinez, M. C. Bird, J.	
Guarino	
Photo By: Steve Katz	
Date: 25 September 2012	
Property Description:	Stories: 1

Property Description:

Stories: 1

This one-story, concrete block, light industrial building has a flat roof with parapet. Its front elevation has an off-center entrance with a non-original metal core door with surround and transom, a strip of one-overone windows, and three glass block windows. Detailing includes drip molds above the entrance and windows. This building lacks architectural distinction and is not individually eligible for listing on the National Register.



Integrity:			Additional Notes/Descriptions
integrity.			Additional Notes/Descriptions
Unaltered	Slight Modification	<u>Major Alteration</u>	Replacement door
Condition:			
Excellent	Good	Poor	
Additional Alterati	ons		
Structu	ire Usage	Exterior Wall Surface	
Current: NA		Concrete block	
Historic: NA			
Roof Material	Roof Features	Roof Type	
Unknown	Parapet	Flat	
Ornamental Archit	tectural Details		Windows
Drip molds above entrance and windows			Glass block, double-hung
Drip molds above er	itrance and windows		Glass block, double-hung
Outbuildings (Num	ber and Description)		
None			
INUITE			

Local Landmark	Y <u>N</u>	
National Register Historic Places	Y <u>N</u>	
National Register Historic District	Y <u>N</u>	Name:
Individually Eligible? No	A B C	Significance:



Property Name Photos with Captions: North and east façades of a brick, one story, commercial building. Historic: Bldg. not labeled, not in CHRS Common/Current: Unknown **Property Address:** 415 W. 107th Street **HAARGIS Number:** Not in database Present Owner and /or Occupant: Unknown **Property Use** Historic: Commercial **Current:** Commercial Date of Construction: 1920 Architect's Name: Not in CHRS Builder/Contractor: Not in CHRS **Architectural Style:** Vernacular Prepared By: J. Martinez, M. C. Bird, J. Guarino Photo By: S. Katz **Date:** 12 October 2012

Historical Resource Recordation Form

Property Description:

Stories: 1

This one-story commercial building in the Roseland community has a flat roof, castellated parapet, a brick panel at the cornice line, and concrete coping. Its front elevation is clad in yellow face brick and has a recessed, off-center hollow core metal door that is non-original. Aluminum siding has replaced this door's original transom and its original storefront has been in-filled with a strip of fixed pane windows with aluminum siding above and below. The north portion of its east elevation is also clad in yellow face brick and has been altered with the insertion of an overhead metal door that is surrounded by aluminum siding. This building lacks integrity and distinguishing architectural features and is not individually eligible for listing on the National Register.



Structural Survey

Integrity:			Additional Notes/Descriptions
Unaltered	Slight Modification <u>Major Alteration</u>		Replacement doors, windows, and cladding
Condition:			
Excellent	Good	Poor	
Additional Alterati	ons		
Garage door opening	g inserted on east facade		
Structure Usage Exterior Wall Surface			
Current: NA		Brick (main),	
Historic: NA		Synthetic siding (infill)	
Roof Material	Roof Features	Roof Type	
Unknown	Parapet	Flat	
Ornamental Archit	tectural Details	Windows	
Brick panel			Fixed-pane
Outbuildings (Num	ber and Description)		
None			

Local Landmark	Y <u>N</u>	
National Register Historic Places	Y <u>N</u>	
National Register Historic District	Y <u>N</u>	Name:
Individually Eligible? No	A B C	Significance:

Additional Comments:



Historical Resource Recordation Form

Property Name	Photos with Captions: South façade of a masonry, one-story, single family residence.
Historic: Bldg. not labeled, not in CHRS	Souri laçade of a masoniy, one story, single family residence.
Common/Current: Unknown	
Property Address:	
432 W. 107th Street	
HAARGIS Number:	
Not in database	
Present Owner and /or Occupant:	
Unknown	
Property Use	
Historic: Single family residence	
Current: Single family residence	
Date of Construction: 1962	
Architect's Name: Not in CHRS	
Builder/Contractor: Not in CHRS	and the second of the second
Architectural Style:	
Vernacular	
Prepared By: J. Martinez, M. C. Bird, J.	
Guarino	
Photo By: S. Katz	
Date: 12 October 2012	
Property Description.	Staries: 1

Property Description:

Stories: 1

This one-story home at the northwest corner of 107th Street and Eggleston Avenue in the Roseland community is situated on a raised brick basement. The building has a hip roof covered with asphalt shingles and overhanging eaves. The front elevation is clad with faux stone below the sill line and red brick above. The building has an off-center door behind a metal storm, concrete steps with metal railings, and a picture window flanked by one-over-one aluminum-sash windows. Detailing includes faux stone blocks flanking the front door and two horizontal strips of faux stone, each with a glass block, on the front elevation. The side (Eggleston) elevation is clad in red brick and has two pairs of four-over-one windows. It does not feature distinguishing architectural elements and is not individually eligible for listing on the National Register.



Integrity:			Additional Notes/Descriptions
<u>Unaltered</u>	Slight Modification	Major Alteration	
Condition:			
Excellent	Good	Poor	
Additional Alteration	ons		
Structu	re Usage	Exterior Wall Surface	
Current: NA		Brick (main),	
Historic: NA		Faux stone (below sill)	
Roof Material	Roof Features	Roof Type	
Asphalt shingle	None	Hip	
Ornamental Archit	ectural Details	Windows	
Stone panels with gl	ass blocks, stone surround a	Double-hung, fixed-pane, glass block	
Outbuildings (Num	ber and Description)		
None			

Local Landmark	Y <u>N</u>	
National Register Historic Places	Y <u>N</u>	
National Register Historic District	Y <u>N</u>	Name:
Individually Eligible? No	A B C	Significance:

Additional Comments:			



Historical Resource Recordation Form

Property Name	Photos with Captions: South façade of a one-story, single family, brick residence.
Historic: Bldg. not labeled, not in CHRS	south laçade of a one-story, single family, onex residence.
Common/Current: Unknown	
Property Address:	
744 W. 107th Street	
HAARGIS Number:	
Not in database	
Present Owner and /or Occupant:	
Unknown	
Property Use	
Historic: Single family residence	
Current: Single family residence	
Date of Construction: 1957	
Architect's Name: Not in CHRS	
Builder/Contractor: Not in CHRS	
Architectural Style:	
Vernacular	
Prepared By: J. Martinez, M. C. Bird, J.	
Guarino	
Photo By: S. Katz	
Date: 23 October 2012	

Property Description:

Stories: 1

This one-story brick-clad house in the Roseland community is situated on a raised basement with glass block windows. The building has a hip roof covered with asphalt shingles, overhanging eaves, and a projecting, gable-front pavilion that spans nearly the entire width of the front elevation. The front elevation is clad with orange brick with stone below the sill line and synthetic siding in the gable end. The gabled pavilion has a metal storm door, concrete steps with metal railings, and a non-original picture window flanked by one-over-one aluminum-sash windows. A single one-over-one aluminum-sash window is situated in the recessed corner of the front elevation. Detailing includes decorative faux stones flanking the door and two adjacent glass blocks. It does not feature distinguishing architectural elements and is not individually eligible for listing on the National Register.



Integrity:			Additional Notes/Descriptions
Unaltered	Slight Modification	on Major Alteration	Replacement windows and cladding in gable
Condition:			
Excellent	Good	Poor	
Additional Alteration	ons		
Structu	ire Usage	Exterior Wall Surface	
Current: NA		Brick (main), faux stone (below	
Historic: NA		sill), synthetic (gable end)	
Roof Material	Roof Features	Roof Type	
Asphalt shingle	None	Hip	
Ornamental Archit	ectural Details	Windows	
Decorative glass blo	cks, stone surround at en	Double-hung, fixed-pane, glass	
		block	
Outbuildings (Num	ber and Description)		
None			

Local Landmark	Y	<u>N</u>	
National Register Historic Places	Y	<u>N</u>	
National Register Historic District	Y	<u>N</u>	Name:
Individually Eligible? No	Α	B C	Significance:



Historical Resource Recordation Form

Property Name	Photos with Captions:
Historic Dide not labeled not in CUDS	South façade of a 1.5-story, single family, frame residence.
Historic: Bldg. not labeled, not in CHRS	
Common/Current: Unknown	
Property Address:	
300 W. 108th Place	
HAARGIS Number:	
Not in database	
Present Owner and /or Occupant:	
Unknown	
Property Use	
Historic: Single family residence	
Current: Single family residence	
Date of Construction: 1908	
Architect's Name: Not in CHRS	
Builder/Contractor: Not in CHRS	
Architectural Style:	
Vernacular	
Prepared By: J. Martinez, M. C. Bird, J.	-
Guarino	
Photo By: S. Katz (too much foliage), Cook	
County Assessor (2007)	
Date: 17 October 2012	

Property Description:

Stories: 1.5

This 1.5-story house at the northwest corner of 108th Street and Princeton Avenue in the Roseland community is situated on a raised brick basement and is clad with synthetic siding. The building has a gambrel roof covered with asphalt shingles. Its front (108th Street) elevation has a full-width, hip-roofed, wood porch with frieze band and supports consisting of three brick piers topped by squat wood posts. The building has an off-center door and a single double-hung window on the first floor. A pair of double-hung windows and a small casement window provide light to the attic space. Its Princeton Avenue elevation has a three-sided window bay. This house lacks integrity and distinguishing architectural features and is not individually eligible for listing on the National Register.



Integrity:			Additional Notes/Descriptions
mugniy.			-
Unaltered	Slight Modification	n Major Alteration	Replacement door and cladding;
			possibly some of the windows
Condition:			
Excellent	Good	Poor	
Additional Alterati	ons		
Structu	ire Usage	Exterior Wall Surface	
Current: NA		Synthetic siding	
Historic: NA			
Roof Material	Roof Features	Roof Type	
Asphalt	Dormer	gambrel	
Ornamental Archit	ectural Details		Windows
Frieze band			Double-hung, glass block,
			casement
Outbuildings (Num	ber and Description)		
None			

Local Landmark	Y	<u>N</u>	
National Register Historic Places	Y	<u>N</u>	
National Register Historic District	Y	<u>N</u>	Name:
Individually Eligible? No	A	B C	Significance:

Additional Comments:			



Historical Resource Recordation Form

Property Name	Photos with Captions:
	North and west façades of a 1.5-story, single family, frame
Historic: Bldg. not labeled, not in CHRS	residence.
Common/Current: Unknown	
Property Address:	
313 W. 108th Place	
HAARGIS Number:	
Not in database	
Present Owner and /or Occupant:	
Unknown	
Property Use	
Historic: Single family residence	
Current: Single family residence	
Date of Construction: 1918	
Architect's Name: Not in CHRS	
Builder/Contractor: Not in CHRS	
Architectural Style:	
Vernacular	
Prepared By: J. Martinez, M. C. Bird, J.	
Guarino	
Photo By: S. Katz	
Date: 17 October 2012	

Property Description:

Stories: 1.5

This one-and-a-half-story house in the Roseland community is situated on a raised concrete block basement with glass block windows and is clad with synthetic siding. The building has a gable roof covered with asphalt shingles. Its front elevation features an off-center non-original hollow core metal door, concrete steps with metal railings, a three-sided window bay on the first floor, and a pair of windows in the gable. Windows are non-original one-over-one aluminum-sash. The house has a shed-roofed second story addition at the rear of its west elevation and a gable dormer along its east elevation. This house lacks integrity and distinguishing architectural features and is not individually eligible for listing on the National Register.



Structural Survey

Integrity:			Additional Notes/Descriptions
Unaltered	Slight Modification	Major Alteration	Replacement door, windows, cladding, steps, and railing
Condition:			
<u>Excellent</u>	Good	Poor	
Additional Alterati	ons		
Second story shed ro	oof addition		
Structu	ire Usage	Exterior Wall Surface	
Current: NA		Synthetic siding	
Historic: NA			
Roof Material	Roof Features	Roof Type	
Asphalt shingle	Dormer	Gable	
Ornamental Archit	ectural Details		Windows
None			Double-hung, glass block
Outbuildings (Num	ber and Description)		
None			

Local Landmark	Y <u>N</u>	
National Register Historic Places	Y <u>N</u>	
National Register Historic District	Y <u>N</u>	Name:
Individually Eligible? No	A B C	Significance:

Additional Comments:



Historical Resource Recordation Form

Property Name	Photos with Captions:
Historic: Not labeled, not in CHRS	South and west façades of one-story, frame, single family residence.
Common/Current: Unknown	
Property Address:	
348 W 108th Place HAARGIS Number:	
naakgis number:	
Not in database	
Present Owner and /or Occupant:	
Unknown	
Property Use	
Historic: Single family residence	
Current: Single family residence	
Date of Construction: 1928	
Architect's Name: Not in CHRS	
Builder/Contractor: Not in CHRS	
Architectural Style:	
Vernacular	
Prepared By: C. Tolmie, M. C. Bird, J.	
Guarino	
Photo By: S. Katz	
Date: 5 September 2012	
Description of the Description of the second	C 4

Property Description:

Stories: 1

This one-story, frame home in the Roseland community is situated on a raised basement and clad with synthetic siding. It has a hip roof covered with asphalt shingles and a dormer with two one-over-one windows. Its front elevation has a projecting living room bay with replacement one-over-one windows, an off-center hollow metal door, and concrete steps with metal railing. This building lacks architectural distinction and is not individually eligible for listing on the National Register.



Integrity:			Additional Notes/Descriptions
Unaltered	Slight Modification	Major Alteration	Some replacement windows
Condition:			
Excellent	Good	Poor	
Additional Alteration	ons		
Structu	re Usage	Exterior Wall Surface	
Current: NA		Synthetic siding	
Historic: NA			
Roof Material	Roof Features	Roof Type	
Asphalt shingle	Dormer	Hip	
Ornamental Archit	ectural Details		Windows
None			Double-hung
Outbuildings (Num	ber and Description)		
None			

Local Landmark	Y <u>N</u>	
National Register Historic Places	Y <u>N</u>	
National Register Historic District	Y <u>N</u>	Name:
Individually Eligible? No	A B C	Significance:

Additional Comments:			



Historical Resource Recordation Form



This one story home in the Roseland community is situated on a raised concrete block basement, is clad with aluminum siding, and has a front-gabled roof covered with asphalt shingles. Glass blocks in-fill the window openings in the basement. The front elevation of the residence features an off-center hollow metal door topped by a bracketed gabled hood and concrete steps with metal railings. It also features paired, non-original, sliding glass windows on the first floor and a one-over-one, non-original window in the gable. This home lacks integrity and architectural distinction and is not individually eligible for listing on the National Register.



Integrity:			Additional Notes/Descriptions
Unaltered	Slight Modification	Major Alteration	Replacement siding, windows, and doors
Condition:			
<u>Excellent</u>	Good	Poor	
Additional Alterati	ons		
Structu	re Usage	Exterior Wall Surface	
Current: NA		Synthetic siding	
Historic: NA			
Roof Material	Roof Features	Roof Type	
Asphalt shingle	None	Gable	
Ornamental Archit	ectural Details		Windows
Bracketed gabled ho	od		Double-hung, sliding, glass block
Outbuildings (Num	ber and Description)		
None			

Local Landmark	Y <u>N</u>	
National Register Historic Places	Y <u>N</u>	
National Register Historic District	Y <u>N</u>	Name:
Individually Eligible? No	A B C	Significance:

Additional Comments:			



Historical Resource Recordation Form

Property Name	Photos with Captions: South façade of a brick, three-story school.
Historic: Roseland Christian School	South laçade of a blick, unce-story school.
Common/Current: Roseland Christian School	
Property Address:	- A Contract of the second sec
234 W. 108th Street Alternate: 314 W 108th St.	
HAARGIS Number:	
Not in database	
Present Owner and /or Occupant:	
Roseland Christian School	
Property Use	
Historic: Education	
Current: Education	
Date of Construction: 1928	
Architect's Name: Not in CHRS	
Builder/Contractor: Not in CHRS	
Architectural Style:	
Vernacular	
Prepared By: J. Martinez, M. C. Bird, J.	
Guarino	
Photo By: S. Katz	
Date: 17 October 2012	
Property Description:	Storios: 3

Property Description:

Stories: 3

This three-story school in the Roseland community is clad in brown face brick. The building has a flat roof, shaped parapet with concrete coping, and corner pavilions. Full height brick pilasters divide the front elevation into a series of bays, each of which contains a strip of three one-over-one windows. The main entrance features a pair of non-original hollow core metal doors topped by a stone sign plate inscribed with the words, "Roseland Christian School." Detailing includes decorative brick panels in the spandrels, concrete sills and lintels. This school lacks distinguishing architectural features and is not individually eligible for listing on the National Register.



Integrity:			Additional Notes/Descriptions
Unaltered	Slight Modification	Major Alteration	Replacement doors
Condition:			
<u>Excellent</u>	Good	Poor	
Additional Alterati	ons		
Structu	ire Usage	Exterior Wall Surface	
Current: NA		Brick	
Historic: NA			
Roof Material	Roof Features	Roof Type	
Unknown	Parapet	Flat	
Ornamental Archit	ectural Details		Windows
Parapet with concret	e coping, corner pavilions,	brick pilasters, stone sign,	Double-hung
brick panels, concret	te sills and lintels		
Outbuildings (Num	ber and Description)		
None			

Local Landmark	Y	<u>N</u>	
National Register Historic Places	Y	<u>N</u>	
National Register Historic District	Y	<u>N</u>	Name:
Individually Eligible? No	Α	B C	Significance:



Historical Resource Recordation Form

Property Name	Photos with Captions: North façade of a brick, two-story, multi-family residence.
Historic: Bldg. not labeled, not in CHRS	North Taçade of a brick, two-story, multi-failing residence.
Common/Current: Unknown	
Property Address:	
301 W. 109th Place	
HAARGIS Number:	
Not in database	
Present Owner and /or Occupant:	
Vacant	
Property Use	
Historic: Single family residence	
Current: Multi-family residence	
Date of Construction: 1905	
Architect's Name: Not in CHRS	
Builder/Contractor: Not in CHRS	
Architectural Style:	
Vernacular	
Prepared By: J. Martinez, M. C. Bird, J.	
Guarino	and the second
Photo By: S. Katz	and the second second contract.
Date: 17 October 2012	

Property Description:

Stories: 2

This two-flat residential building in the Roseland community is situated on a raised basement and is clad in red brick. The building has a flat roof and parapet. The front elevation has a full-width shed-roofed porch with wood posts and steps but no railings, an off-center door, an adjacent glass block window, and a group of three windows on the first floor. The second floor of the front elevation has a group of three windows and a single window. Nearly all windows are covered with plywood, with the exception of two non-original one-over-one aluminum-sash windows. The east elevation has a full-height window bay pavilion. Detailing includes stone sills, lintels, coping, and cornice. This building lacks integrity and distinguishing architectural features and is not individually eligible for listing on the National Register.



Integrity:			Additional Notes/Descriptions
Unaltered	Slight Modification	Major Alteration	Replacement windows
Condition:			
Excellent	Good	Poor	
Additional Alteration	ons		
Structu	ire Usage	Exterior Wall Surface	
Current: NA		Brick	
Historic: NA			
Roof Material	Roof Features	Roof Type	
Unknown	Parapet	Flat	
Ornamental Archit	ectural Details		Windows
Stone sills, lintels, co	oping, and cornice		Double-hung, glass block, covered
Outbuildings (Num	ber and Description)		
None			

Local Landmark	Y <u>N</u>	
National Register Historic Places	Y <u>N</u>	
National Register Historic District	Y <u>N</u>	Name:
Individually Eligible? No	A B C	Significance:

Additional Comments:			



Historical Resource Recordation Form

Property Name	Photos with Captions:
	South façade of a one-story, single family, frame residence.
Historic: Bldg. not labeled, not in CHRS	
Common/Current: Unknown	
Property Address:	
340 W. 109th Place	
HAARGIS Number:	
Not in database	
Present Owner and /or Occupant:	
Unknown	
Property Use	
Historic: Single family residence	
Current: Single family residence	
Date of Construction: 1925	
Architect's Name: Not in CHRS	
Builder/Contractor: Not in CHRS	
Architectural Style:	
Craftsman	
Prepared By: J. Martinez, M. C. Bird, J.	
Guarino	
Photo By: S. Katz	
Date: 17 October 2012	

Property Description:

Stories: 1

This one-story house in the Roseland community is situated on a raised concrete block basement and is covered with synthetic siding. The building has a hip-on-gable roof covered with asphalt shingles, overhanging eaves, and decorative rafters. It has a recessed corner porch with a door tucked into the side, a faux stone corner pier, and wood steps with metal railings sheltered by a flat-roofed metal canopy supported by two wood posts. Its front elevation features a casement window within the recessed porch, a strip of four double-hung wood-sash windows on the first floor, and a strip of three wood casement windows in the attic. This house lacks distinguishing architectural features and is not individually eligible for listing on the National Register.



Integrity:			Additional Notes/Descriptions
Unaltered	Slight Modification	Major Alteration	Replacement siding
Condition:			
Excellent	Good	Poor	
Additional Alterati	ons		
Structu	re Usage	Exterior Wall Surface	
Current: NA		Synthetic siding	
Historic: NA			
Roof Material	Roof Features	Roof Type	
Asphalt	None	Hip-on-gable	
Ornamental Archit	ectural Details		Windows
Exposed rafters			Double-hung, casement
Outbuildings (Num	ber and Description)		
None			

Local Landmark	Y <u>N</u>	
National Register Historic Places	Y <u>N</u>	
National Register Historic District	Y <u>N</u>	Name:
Individually Eligible? No	A B C	Significance:

Additional Comments:			



Historical Resource Recordation Form

Property Name	Photos with Captions: North façade of a 1.5- story, single family, frame residence.
Historic: Bldg. not labeled, not in CHRS	North Taşade of a Tib Story, single Taniny, Hame Testaenee.
Common/Current: Unknown	
Property Address:	
341 W. 109th Place	
HAARGIS Number:	
Not in database	
Present Owner and /or Occupant:	
Unknown	
Property Use	
Historic: Single family residence	
Current: Single family residence	
Date of Construction: 1883	
Architect's Name: Not in CHRS	
Builder/Contractor: Not in CHRS	
Architectural Style:	
Vernacular	
Prepared By: J. Martinez, M. C. Bird, J.	
Guarino	
Photo By: S. Katz	
Date: 17 October 2012	

Property Description:

Stories: 1.5

This one-and-a-half-story frame house in the Roseland community is situated on a raised concrete block basement with glass block windows and is covered with synthetic siding. The building has a cross-gable roof covered with asphalt shingles. The front elevation has an off-center door behind a metal storm door, non-original wood steps and railings, and five non-original one-over-one aluminum-sash windows: four on the first floor and one in the gable. Review of the 1938 Sanborn and the assessor's 2007 photograph suggests that while the front and rear porches are original to the house, a second story was added to the residence between 1938 and 2007. This house lacks integrity and distinguishing architectural features and is not individually eligible for listing on the National Register.



Structural Survey

Integrity:			Additional Notes/Descriptions
Unaltered	Slight Modification	Major Alteration	Replacement door, windows, cladding, and railings
Condition:			
Excellent	Good	Poor	
Additional Alterati	ons		
Second story added			
Structure Usage		Exterior Wall Surface	
Current: NA		Synthetic siding	
Historic: NA			
Roof Material	Roof Features	Roof Type	
Asphalt shingle	None	Cross-gable	
Ornamental Archit	ectural Details		Windows
None			Double-hung, glass block
Outbuildings (Num	ber and Description)		
None			

Local Landmark	Y <u>N</u>	
National Register Historic Places	Y <u>N</u>	
National Register Historic District	Y <u>N</u>	Name:
Individually Eligible? No	A B C	Significance:

Additional Comments:

Sanborn map 4228.



Historical Resource Recordation Form

Property Name	Photos with Captions: South façade of one-story, frame, single family residence.
Historic: Not labeled, not in CHRS	South laçade of one story, france, single family residence.
Common/Current: Unknown	
Property Address:	
348 W. 109th Place	
HAARGIS Number:	
Not in database	
Present Owner and /or Occupant:	
Unknown	
Property Use	
Historic: Single family residence	
Current: Single family residence	
Date of Construction: 1930	
Architect's Name: Not in CHRS	
Builder/Contractor: Not in CHRS	
Architectural Style:	
Vernacular	
Prepared By: C. Tolmie, M. C. Bird, J. Guarino	
Photo By: S. Katz	
Date: 5 September 2012	
Property Description:	Stories: 1

Property Description:

Stories: 1

This one-story home in the Roseland community is clad with synthetic siding. It has a hip roof covered with asphalt shingles and a gabled dormer with two windows that appear to be casements. Its front façade features an off-center door within a recessed porch with concrete steps, metal railings and corner support, and a picture window flanked by double-hung windows. This home lacks integrity and architectural distinction and is not individually eligible for listing on the National Register.



Integrity:			Additional Notes/Descriptions
Unaltered	Slight Modification	Major Alteration	Replacement siding
Condition:			
Excellent	Good	Poor	
Additional Alteration	ons		
Structu	re Usage	Exterior Wall Surface	
Current: NA		Synthetic siding	
Historic: NA			
Roof Material	Roof Features	Roof Type	
Asphalt shingle	Dormer	Hip	
Ornamental Archit	ectural Details		Windows
None			Fixed-pane, double-hung,
			casement
Outbuildings (Num	ber and Description)		
None			

Y <u>N</u>	
Y <u>N</u>	
Y <u>N</u>	Name:
A B C	Significance:
	Y <u>N</u> Y <u>N</u>

Additional Comments:			



Historical Resource Recordation Form

Property Name	Photos with Captions: South façade of two-story multi-family residence.
Historic: Not labeled, not in CHRS	South laçade of two story matter failing residence.
Common/Current: Unknown	
Property Address:	
350 W. 109th Place	
HAARGIS Number:	
Not in database	
Present Owner and /or Occupant:	
Unknown	
Property Use	
Historic: Single family residence	
Current: Multi-family residence	
Date of Construction: 1908	
Architect's Name: Unknown	A REAL PROPERTY AND A REAL
Builder/Contractor: Unknown	
Architectural Style:	
Vernacular	
Prepared By: C. Tolmie, M. C. Bird, J.	
Guarino	
Photo By: S. Katz	
Date: 5 September 2012	

Property Description:

Stories: 2

This two-story home in the Roseland community has "cemented" cladding material, which is original per the 1911 Sanborn map. Its front elevation has an enclosed, full-façade, flat-roofed porch with an off-center metal core door, concrete steps and metal railings, and a strip of four windows that appear to be sliding windows. The second floor of the front elevation has four one-over-one windows. This home lacks integrity and architectural distinction and is not individually eligible for listing on the National Register.



Integrity:			Additional Notes/Descriptions
Unaltered	Slight Modification	Major Alteration	Replacement windows, porch enclosed
Condition:			
Excellent	Good	Poor	
Additional Alterati	ons		
Structu	ıre Usage	Exterior Wall Surface	
Current: NA		Cement	
Historic: NA			
Roof Material	Roof Features	Roof Type	
None	Parapet	Flat	
Ornamental Archit	tectural Details		Windows
None			Sliding, double hung
Outbuildings (Number and Description)			
None			

Local Landmark	Y <u>N</u>	
National Register Historic Places	Y <u>N</u>	
National Register Historic District	Y <u>N</u>	Name:
Individually Eligible? No	A B C	Significance:

Additional Comments:		



Historical Resource Recordation Form

Property Name	Photos with Captions:
	North and west façades of 1-story, frame, single family residence.
Historic: Not labeled, not in CHRS	
Common/Current: Unknown	
Property Address:	
351 W. 109th Street	
HAARGIS Number:	
Not in database	
Present Owner and /or Occupant:	
Unknown	
Property Use	
Historic: Single family residence	
Current: Single family residence	
Date of Construction: 1889	
Architect's Name: Unknown	
Builder/Contractor: Unknown	
Architectural Style:	
Vernacular	
Prepared By: C. Tolmie, M. C. Bird, J.	
Guarino	
Photo By: S. Katz	
Date: 5 September 2012	
Property Description:	Stories: 1

Property Description:

Stories: 1

This one story home in the Roseland community is clad with aluminum siding, has a gambrel roof covered with asphalt shingles, and rests on a concrete block foundation. Its front elevation features an off-center door and porch with concrete steps, metal railings and supports, a metal awning roof, and a strip of three one-over-one windows on the first floor and a one-over-one window above. Window openings in the basement are filled with glass blocks surrounding a central, casement window. This home lacks integrity and architectural distinction and is not individually eligible for listing on the National Register.



Structural Survey

Integrity:			Additional Notes/Descriptions
Unaltered	Slight Modification	n Major Alteration	Replacement windows, doors, and cladding
Condition:			
Excellent	Good	Poor	
Additional Alteration	ons		
<u> </u>	TT.		
Structu	re Usage	Exterior Wall Surface	
Current: NA		Synthetic siding	
Historic: NA			
Roof Material	Roof Features	Roof Type	
Asphalt shingle	None	Gambrel	
Ornamental Archit	ectural Details		Windows
None			Double-hung, glass block
Outbuildings (Num	ber and Description)		
None			

Local Landmark	Y <u>N</u>	
National Register Historic Places	Y <u>N</u>	
National Register Historic District	Y <u>N</u>	Name:
Individually Eligible? No	A B C	Significance:

Additional Comments:



Historical Resource Recordation Form

Property Name	Photos with Captions: South and east façades of 1 -story, frame, single family residence.		
Historic: Not labeled, no in CHRS	South and east raçades of 1 -story, frame, single ranning residence.		
Common/Current: Unknown			
Property Address:			
354 W. 109th Street			
HAARGIS Number:			
Not in database			
Present Owner and /or Occupant:			
Unknown			
Property Use			
Historic: Single family residence			
Current: Single family residence			
Date of Construction: 1894			
Architect's Name: Not in CHRS			
Builder/Contractor: Not in CHRS			
Architectural Style:			
Vernacular			
Prepared By: C. Tolmie, M. C. Bird, J.			
Guarino			
Photo By: S. Katz			
Date: 5 September 2012			
Decementary Decementary the second			

Property Description:

Stories: 1

This one story home in the Roseland community is clad with synthetic siding, has has a front-gabled roof covered with asphalt shingles, and rests on a concrete block foundation. Its front elevation features an off-center door and porch with concrete steps, metal railings and supports, and metal awning roof. It has a strip of three one-over-one windows on the first floor and a small single-pane window in the gable. Glass blocks with a central casement infill the basement window openings. This home lacks integrity and architectural distinction and is not individually eligible for listing on the National Register.



Integrity:			Additional Notes/Descriptions
Unaltered	Slight Modification	Major Alteration	Replacement siding and windows in basement
Condition:			
<u>Excellent</u>	Good	Poor	
Additional Alteration	ons		
Structu	re Usage	Exterior Wall Surface	
Current: NA		Synthetic siding	
Historic: NA			
Roof Material	Roof Features	Roof Type	
Asphalt shingle	None	Gable	
Ornamental Archit	ectural Details		Windows
None			Fixed-pane, double-hung, glass block
Outbuildings (Num	ber and Description)		
None			

Local Landmark	Y <u>N</u>	
National Register Historic Places	Y <u>N</u>	
National Register Historic District	Y <u>N</u>	Name:
Individually Eligible? No	A B C	Significance:

Additional Comments:			



Historical Resource Recordation Form

Property Name	Photos with Captions:
	East façade of industrial, brick and metal storage shed.
Historic: South Shore Iron Works	
Common/Current: South Shore Iron Works	
Property Address:	
404-410 W. 109th Street	
HAARGIS Number:	
Not in database	
Present Owner and /or Occupant:	
Vacant	
Property Use	
Historic: Industrial	
Current: Industrial	
Date of Construction: 1965	South and east façades of industrial, brick and metal storage shed.
Architect's Name: Not in CHRS	and a state of the
Builder/Contractor: Not in CHRS	
Architectural Style:	
Vernacular	
Prepared By: C. Tolmie, M. C. Bird, J.	
Guarino	
Dhote Dyy S. Vety (ten phote phote no. 2)	
Photo By: S. Katz (top photo, photo pg. 3), CCA (bottom photo)	
Date: 5 September 2012	
Property Description:	Stories: 1

This one-story, side-gabled, metal shed on the vacated South Shore Iron Works property is partially obscured by foliage. The front elevation is clad in buff brick and contains a series of hollow metal doors, each flanked by three windows to one side; many are covered with plywood. A full width metal canopy is present on the front façade. The gable ends and rear elevation are clad in corrugated sheet metal. This building lacks architectural distinction and is not individually eligible for listing on the National Register.



Structural Survey

Integrity:			Additional Notes/Descriptions
Unaltered	Slight Modificatio	n Major Alteration	Window openings covered with boards
Condition:			Abandoned, overgrown, and
Excellent	Good	Poor	rusting
Additional Alteration	ons		
Structu	ire Usage	Exterior Wall Surface	
Current: NA		Brick (façade), metal (rear)	
Historic: NA			
Roof Material	Roof Features	Roof Type	
Metal	None	Gable	
Ornamental Archit	ectural Details		Windows
None			Unknown
Outbuildings (Num	ber and Description)		
None			

Local Landmark	Y <u>N</u>	
National Register Historic Places	Y <u>N</u>	
National Register Historic District	Y <u>N</u>	Name:
Individually Eligible? No	A B C	Significance:

Additional Comments:


Detail photo of door:







Historical Resource Recordation Form

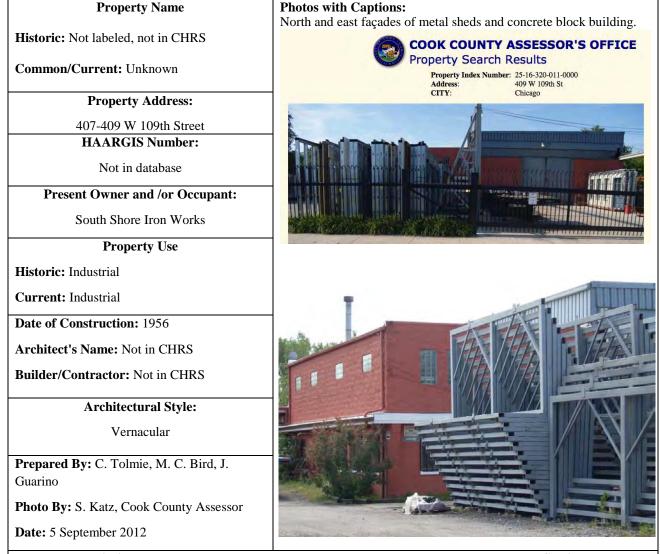

Property Description:

Stories: 2

This property includes a two story, flat-roofed concrete block building associated with South Shore Iron Works, manufacturers of structural steel. The building is difficult to see from the public right-of-way. The first floor has one-over-one windows below a metal awning and the second floor has glass block windows. Portion of the building has had its roof raised, creating more height for the interior workspace. The Cook County Assessor's photo shows large sliding metal doors on the warehouse façade. This structure lacks architectural distinction and is not individually eligible for listing on the National Register.



Integrity:			Additional Notes/Descriptions
Unaltered	Slight Modification	Major Alteration	Roof height raised
Condition:			
Excellent	Good	Poor	
Additional Alterati	ons		
Structu	ire Usage	Exterior Wall Surface	
Current: NA		Concrete block	
Historic: NA			
Roof Material	Roof Features	Roof Type	
Metal	None	Flat	
Ornamental Archit	ectural Details		Windows
None			Double-hung, glass block
Outbuildings (Num	ber and Description)		
Sheet metal storage	shed		

Local Landmark	Y <u>N</u>	
National Register Historic Places	Y <u>N</u>	
National Register Historic District	Y <u>N</u>	Name:
Individually Eligible? No	A B C	Significance:

Additional Comments:			



Historical Resource Recordation Form

Property Name	Photos with Captions:
	North façade of a one-story, single family, brick residence.
Historic: Bldg. not labeled, not in CHRS	
Common/Current: Unknown	
Property Address:	
743 W. 109th Street	
HAARGIS Number:	
Not in database	
Present Owner and /or Occupant:	
Unknown	
Property Use	
Historic: Single family residence	
Current: Single family residence	
Date of Construction: 1954	
Architect's Name: Not in CHRS	
Builder/Contractor: Not in CHRS	
Architectural Style:	
Vernacular	
Prepared By: J. Martinez, M. C. Bird, J.	
Guarino	
Photo By: S. Katz	
Date: 23 October 2012	

Property Description:

Stories: 1

This one-story house in the Roseland community has a front gable roof covered with asphalt shingles. Its front elevation is clad with brown brick and has a synthetic-clad gable, a central metal storm door with metal awning and concrete stoop. The door is flanked on either side by a pair of large windows and a strip of three smaller windows, all of which are non-original one-over-one aluminum-sash. It does not feature distinguishing architectural elements and is not individually eligible for listing on the National Register.



Integrity:			Additional Notes/Descriptions	
Unaltered	Slight Modification	Major Alteration	Replacement windows and gable cladding	
Condition:				
<u>Excellent</u>	Good	Poor		
Additional Alterati	ons			
Structu	re Usage	Exterior Wall Surface		
Current: NA		Brick (main),		
Historic: NA		Synthetic siding (gable)		
Roof Material	Roof Features	Roof Type		
Asphalt shingle	None	Gable		
Ornamental Archit	ectural Details	Windows		
None			Double-hung	
Outbuildings (Number and Description)				
None				

Local Landmark	Y <u>N</u>	
National Register Historic Places	Y <u>N</u>	
National Register Historic District	Y <u>N</u>	Name:
Individually Eligible? No	A B C	Significance:

Additional Comments:			



Historical Resource Recordation Form

Property Name	Photos with Captions: South façade of a one-story, single family, frame residence.
Historic: Bldg. not labeled, not in CHRS	south laçade of a one-story, single family, frame fesidence.
Common/Current: Unknown	
Property Address:	
332 W. 110th Place	
HAARGIS Number:	
Not in database	
Present Owner and /or Occupant:	
Unknown	
Property Use	
Historic: Single family residence	
Current: Single family residence	
Date of Construction: 1899	
Architect's Name: Not in CHRS	
Builder/Contractor: Not in CHRS	
Architectural Style:	
Vernacular	
Prepared By: J. Martinez, M. C. Bird, J.	
Guarino	
Photo By: S. Katz	
Date: 17 October 2012	

Property Description:

Stories: 1

This one-story house in the Roseland community is situated on a raised concrete block basement with glass block windows and is covered with synthetic siding. The building has a cross-gable roof covered with asphalt shingles. The front elevation has an off-center non-original hollow core metal door, a partial width, flat-roofed wood corner porch, and a non-original picture window flanked by double-hung windows. This house lacks integrity and distinguishing architectural features and is not individually eligible for listing on the National Register.



Integrity:			Additional Notes/Descriptions	
Unaltered	Slight Modification	Major Alteration	Replacement door, windows, cladding, porch rails and steps	
Condition:				
Excellent	Good	Poor		
Additional Alteration	ons			
Structu	re Usage	Exterior Wall Surface		
Current: NA		Synthetic siding		
Historic: NA				
Roof Material	Roof Features	Roof Type		
Asphalt	None	Cross-gable		
Ornamental Archit	ectural Details		Windows	
None			Double-hung, fixed-pane, glass block	
Outbuildings (Number and Description)				
None				

Local Landmark	Y	<u>N</u>	
National Register Historic Places	Y	<u>N</u>	
National Register Historic District	Y	<u>N</u>	Name:
Individually Eligible? No	A	BC	Significance:



Historical Resource Recordation Form

Property Name	Photos with Captions: North façade of a one-story, single family, stucco residence.
Historic: Bldg. not labeled, not in CHRS	North huçude of a one story, single failing, stadeo testachee.
Common/Current: Unknown	
Property Address:	
341 W. 110th Place	
HAARGIS Number:	
Not in database	
Present Owner and /or Occupant:	
Unknown	
Property Use	
Historic: Single family residence	
Current: Single family residence	
Date of Construction: 1916	
Architect's Name: Not in CHRS	
Builder/Contractor: Not in CHRS	
Architectural Style:	
Vernacular	
Prepared By: J. Martinez, M. C. Bird, J.	Standarda Martin
Guarino	
Photo By: S. Katz	
Date: 17 October 2012	

Property Description:

Stories: 1

This one-story house in the Roseland community is situated on a raised basement and is covered with stucco. The building has a gable roof with cornice returns and is covered with asphalt shingles. Its front elevation has a gable-roofed wood porch, an off-center hollow core metal door, a glass block window and a rounded window bay on the first floor, and a pair of windows in the gable end, all of which are one-over-one vinyl-sash. The east elevation has a rounded window bay and gable wall dormer. This house lacks distinguishing architectural features and is not individually eligible for listing on the National Register.



Integrity:			Additional Notes/Descriptions		
Unaltered	Slight Modification	Major Alteration	Replacement door and windows		
Condition:					
Excellent	Good	Poor			
Additional Alterati	ons				
Structu	Structure Usage Exterior Wall Surface				
Current: NA		Stucco			
Historic: NA					
Roof Material	Roof Features	Roof Type			
Asphalt shingle	Dormers	Gable			
Ornamental Archit	ectural Details	Windows			
Cornice returns			Double-hung, glass block		
Outbuildings (Number and Description)					
None					

Local Landmark	Y <u>N</u>	
National Register Historic Places	Y <u>N</u>	
National Register Historic District	Y <u>N</u>	Name:
Individually Eligible? No	A B C	Significance:

Additional Comments:			



Historical Resource Recordation Form

Property Name	Photos with Captions: North façade of a 1.5- story, single family, frame residence.
Historic: Bldg. not labeled, not in CHRS	Norun naçade of a 1.5 story, single family, name residence.
Common/Current: Unknown	
Property Address:	
347 W. 110th Place	
HAARGIS Number:	
Not in database	
Present Owner and /or Occupant:	
Unknown	
Property Use	
Historic: Single family residence	
Current: Single family residence	
Date of Construction: 1892	
Architect's Name: Not in CHRS	
Builder/Contractor: Not in CHRS	
Architectural Style:	
Vernacular	He
Prepared By: J. Martinez, M. C. Bird, J.	
Guarino	
Photo By: S. Katz	
Date: 17 October 2012	

Property Description:

Stories: 1.5

This one-and-a-half-story house in the Roseland community is situated on a raised concrete block basement and is covered with synthetic siding. The building has a front gable roof covered with asphalt shingles. Its front elevation has an off-center hollow core metal door with partial-width, gable-roofed, wood porch. There is a strip of three one-over-one wood-sash windows on the first floor and a pair of two-over-two wood-sash windows in the gable. This house lacks integrity and distinguishing architectural features and is not individually eligible for listing on the National Register.



Integrity:			Additional Notes/Descriptions
Unaltered	Slight Modification	Major Alteration	Replacement door and cladding
Condition:			
Excellent	Good	Poor	
Additional Alteration	ons		
Structu	re Usage	Exterior Wall Surface	
Current: NA		Synthetic siding	
Historic: NA			
Roof Material	Roof Features	Roof Type	
Asphalt shingle	None	Gable	
Ornamental Archit	ectural Details	Windows	
None			Double-hung
Outbuildings (Num	ber and Description)		
None			

Local Landmark	Y <u>N</u>	
National Register Historic Places	Y <u>N</u>	
National Register Historic District	Y <u>N</u>	Name:
Individually Eligible? No	A B C	Significance:

Additional Comments:		



Historical Resource Recordation Form

Property Name	Photos with Captions: South façade of a one-story, single family, frame residence.
Historic: Bldg. not labeled, not in CHRS	south façade of a one-story, single family, frame residence.
Common/Current: Unknown	
Property Address:	
301 W. 110th Street	
Alternate: 11010 S Princeton Ave	
HAARGIS Number:	
Not in database	
Present Owner and /or Occupant:	
Unknown	
Property Use	
Historic: Single family residence	
Current: Single family residence	
Date of Construction: 1903	
Architect's Name: Not in CHRS	
Builder/Contractor: Not in CHRS	
Architectural Style:	
Vernacular	
Prepared By: J. Martinez, M. C. Bird, J.	
Guarino	
Photo By: S. Katz	
Date: 17 October 2012	

Property Description:

Stories: 1

This one-story frame house in the Roseland community is situated on a raised concrete block basement with glass block windows and is covered with synthetic siding. The building has a gable roof covered with asphalt shingles. Both side elevations have wide shed dormers, each of which features three non-original one-over-one aluminum-sash windows. The front elevation has a group of three windows on both the first and second floors, all of which are non-original one-over-one aluminum-sash with the exception of the central window on the first floor. The front door is situated along the west elevation, which has wood steps and railings. This house lacks integrity and distinguishing architectural features and is not individually eligible for listing on the National Register.



Structural Survey

Integrity:			Additional Notes/Descriptions
Unaltered	Slight Modificatio	n Major Alteration	Replacement windows and cladding
Condition:			
Excellent	Good	Poor	
Additional Alterati	ons		
Dormers may be a la	ater addition		
Structu	ire Usage	Exterior Wall Surface	
Current: NA		Synthetic siding	
Historic: NA			
Roof Material	Roof Features	Roof Type	
Asphalt shingle	Dormers	Gable	
Ornamental Archit	ectural Details	Windows	
None			Double-hung, fixed pane, casement, glass block
Outbuildings (Num	ber and Description)		
None			

Local Landmark	Y <u>N</u>	
National Register Historic Places	Y <u>N</u>	
National Register Historic District	Y <u>N</u>	Name:
Individually Eligible? No	A B C	Significance:

Additional Comments:



Historical Resource Recordation Form

Property Name	Photos with Captions: North façade of a one-story, single family, frame residence.		
Historic: Bldg. not labeled, not in CHRS	North raçade of a one-story, single ranniny, france residence.		
Common/Current: Unknown			
Property Address:			
331 W. 110th Street			
HAARGIS Number:			
Not in database			
Present Owner and /or Occupant:			
Unknown			
Property Use			
Historic: Single family residence			
Current: Single family residence			
Date of Construction: 1909			
Architect's Name: Not in CHRS			
Builder/Contractor: Not in CHRS			
Architectural Style:			
Vernacular			
Prepared By: J. Martinez, M. C. Bird, J.			
Guarino			
Photo By: S. Katz			
Date: 17 October 2012			

Property Description:

Stories: 1

This one-story frame house in the Roseland community is situated on a raised basement with glass block windows and is covered with synthetic siding. The building has a front gable roof covered with asphalt shingles. The front elevation has a pent roof, off-center door, wood steps with wood railings, and single windows on the first floor and in the attic, both of which are non-original one-over-one aluminum-sash. The east elevation has a three-sided window bay with a gable wall dormer above. This house lacks integrity and distinguishing architectural features and is not individually eligible for listing on the National Register.



Integrity:			Additional Notes/Descriptions
Unaltered	Slight Modification	n Major Alteration	Replacement windows and cladding
Condition:			
<u>Excellent</u>	Good	Poor	
Additional Alterati	ons		
Structu	ire Usage	Exterior Wall Surface	
Current: NA		Synthetic siding	
Historic: NA			
Roof Material	Roof Features	Roof Type	
Asphalt shingle	Dormers	Gable	
Ornamental Archit	tectural Details		Windows
None			Double-hung, glass block
Outbuildings (Num	ber and Description)		·
None			

Local Landmark	Y <u>N</u>	
National Register Historic Places	Y <u>N</u>	
National Register Historic District	Y <u>N</u>	Name:
Individually Eligible? No	A B C	Significance:

Additional Comments:		



Historical Resource Recordation Form

Property Name	Photos with Captions: South façade of a 1.5- story, multi-family, frame residence.
Historic: Bldg. not labeled, not in CHRS	
Common/Current: Unknown	
Property Address:	
340 W. 110th Street	
HAARGIS Number:	
Not in database	
Present Owner and /or Occupant:	
Unknown	
Property Use	
Historic: Single family residence	- And A Divertilly Manual State
Current: Multi-family residence	
Date of Construction: 1909	
Architect's Name: Not in CHRS	
Builder/Contractor: Not in CHRS	- WIN-NING -
Architectural Style:	
Vernacular	
Prepared By: J. Martinez, M. C. Bird, J.	The second
Guarino	
Photo By: S. Katz	9.2
Date: 17 October 2012	
Description of the Description of the second	

Property Description:

Stories: 1.5

This one-and-a-half story frame house in the Roseland community is situated on a raised concrete block basement with glass block windows and is covered with synthetic siding. The building has a gable roof with cornice returns and is covered with asphalt shingles. The front elevation has a pent roof with scalloped trim, an off-center door, and wood steps with wood railings. There is a group of windows on the first floor (fixed-pane flanked by four-over-four), and a pair of non-original four-over-four windows in the gable end. This house lacks integrity and distinguishing architectural features and is not individually eligible for listing on the National Register.



Integrity:			Additional Notes/Descriptions
Unaltered	Slight Modification	n Major Alteration	Replacement windows and cladding
Condition:			
Excellent	Good	Poor	
Additional Alterati	ons		
Structu	ire Usage	Exterior Wall Surface	
Current: NA		Synthetic siding	
Historic: NA			
Roof Material	Roof Features	Roof Type	
Asphalt shingle	None	Gable	
Ornamental Archit	tectural Details	Windows	
Cornice returns, scalloped trim			Double-hung, glass block
Outbuildings (Num	ber and Description)		
None			

Local Landmark	Y <u>N</u>	
National Register Historic Places	Y <u>N</u>	
National Register Historic District	Y <u>N</u>	Name:
Individually Eligible? No	A B C	Significance:

Additional Comments:			



Historical Resource Recordation Form

Property Name	Photos with Captions: South and east façades of a brick, three-story apartment building.
Historic: Bldg. not labeled, not in CHRS	South and east laçades of a brick, three-story apartment building.
Common/Current: Unknown	THE REAL PROPERTY OF THE PROPERTY OF THE REAL PROPE
Property Address:	
Two W. 111th Place	
HAARGIS Number:	
Not in database	
Present Owner and /or Occupant:	
Unknown	
Property Use	
Historic: Apartment building	
Current: Apartment building	
Date of Construction: 1922	Detail of stone surround on east façade.
Architect's Name: Not in CHRS	Detail of stolle sufformed on east raçade.
Builder/Contractor: Not in CHRS	
Architectural Style:	
Vernacular	
Prepared By: J. Martinez, M. C. Bird, J.	
Guarino	
Photo By: S. Katz	
Date: 30 October 2012	
Property Description:	Stories: 3

This three-story apartment building at the northwest corner of 111th Place and State Street in the Roseland community is situated on a raised basement and is clad with brown face brick on its two street elevations. The building has a flat roof and a shaped parapet above the three-story enclosed full-height sun porch pavilion along its south (111th Place) elevation. Each floor on this elevation has a window group comprising a picture window flanked by one-over-one windows. The front (State Street) elevation has a hollow core metal door with a stone surround; each floor has a series of single one-over-one aluminum-sash windows. The door and windows are non-original. Detailing includes concrete sills, sill courses, insert blocks, and coping. This building lacks distinctive architectural features and is not individually eligible for listing on the National Register.



Integrity:			Additional Notes/Descriptions
Unaltered	Slight Modification	n Major Alteration	Replacement door and windows
Condition:			
Excellent	Good	Poor	
Additional Alterati	ons		
Structu	ire Usage	Exterior Wall Surface	
Current: NA		Brick	
Historic: NA			
Roof Material	Roof Features	Roof Type	
Unknown	Parapet	Flat	
Ornamental Archit	tectural Details		Windows
Concrete sills, sill courses, coping, insert blocks, stone door surround			Double-hung, fixed-pane
Outbuildings (Num	ber and Description)		
None			

Local Landmark	Y <u>N</u>	
National Register Historic Places	Y <u>N</u>	
National Register Historic District	Y <u>N</u>	Name:
Individually Eligible? No	A B C	Significance:

Additional Comments:			



Historical Resource Recordation Form

Property Name	Photos with Captions:
	East façade of a brick, two-story, single family residence (above) and
Historic: Bldg. not labeled, not in CHRS	one-story wing (below).
Common/Current: Unknown	State Harris Contraction
Property Address:	the second se
3 W. 111th Place	A SHERE AND A SHERE AND A
HAARGIS Number:	
Not in database	
Present Owner and /or Occupant:	
Unknown	
Property Use	
Historic: Single family residence	
Current: Single family residence	
Date of Construction: 1934	
Architect's Name: Not in CHRS	
Builder/Contractor: Not in CHRS	
Architectural Style:	
Craftsman, Gothic Revival wing	
Prepared By: J. Martinez, M. C. Bird, J.	
Guarino	
Photo By: S. Katz	
Date: 30 October 2012, 8 March 2013	
D	

Property Description:

Stories: 2

This Craftsman house at the southwest corner of 111th Place and State Street in the Roseland community sits on a raised basement and is clad with brown face brick. The building has a hip roof covered with asphalt shingles, overhanging eaves with knee braces, and a hip dormer along the 111th Place elevation. The main block of the house has two additions: a one-story Gothic Revival style east wing with a flat roof and battlemented parapet and a one-story hipped-roof sun porch to the west that is surrounded by double-hung windows. Both wings are also clad in brown face brick. The home's front elevation (111th Place) has a centrally-located single-light wood door with sidelights, brick piers, concrete steps with low brick sidewalls, and a flat-roofed wood canopy. The front entrance is flanked on either side by a group of three windows: a picture window flanked by double-hung windows. The second floor of the front elevation features a series of double-hung windows. The front elevation of the Gothic Revival style wing has an off-center metal storm door with slit windows on either side, as well as a picture window flanked by double-hung windows. The door and window group have stone quoins and drip molding. Detailing also includes stone insert blocks.



residence is recommended as individually eligible for National Register listing under Criterion B due to its association with Reverend Harry J. Hager (1899-1983), a pioneer in media evangelism in Chicago during the mid-twentiethcentury. Rev. Hager served as pastor of the adjacent Bethany Reformed Church for 44 years (1929-1975). He was a pioneer in the emerging media ministry, beginning in 1933 with the weekly Bethany Bible Broadcast on the FM station WHIP. Starting in 1944, Rev. Hager's preaching reached a national audience when Chicago's high-powered AM station WCFL began broadcasting his Sunday evening services across America.

Structural Survey

		Additional Notes/Descriptions
Slight Modification	on Major Alteration	
Good	Poor	
ons		
re Usage	Exterior Wall Surface	
	Brick	
Roof Features	Roof Type	
Dormer	Hip	
ectural Details		Windows
ented parapet; stone quo	ins, inserts, and drip molding	Double-hung, fixed-pane, glass block
ber and Description)		
	Good ons re Usage Roof Features Dormer ectural Details ented parapet; stone quo	Good Poor ons Exterior Wall Surface re Usage Exterior Wall Surface Brick Brick Roof Features Roof Type Dormer Hip extural Details ented parapet; stone quoins, inserts, and drip molding

Local Landmark	Y	<u>N</u>	
National Register Historic Places	Y	<u>N</u>	
National Register Historic District	Y	N	Name:
Individually Eligible? Yes	A	<u>B</u> C	Significance: Associated with Rev. Harry J. Hager, a pioneer in media evangelism in Chicago during the Mid-Century.

Additional Comments:



Historical Resource Recordation Form



Property Description:

Stories: 2

This two-story house in the Roseland community is situated on a raised concrete block basement with glass block windows and is covered with synthetic siding. The building has a flat roof and parapet. Its front elevation has a full-width hipped-roof wood porch with square wood posts and a straight railing balustrade. The porch sits atop piers of rusticated concrete block. The porch also features an off-center door with a metal storm door. There are two slightly rounded window bays—one on the first floor and one on the second—and an additional single window on the second floor. Windows are non-original one-over-one aluminum sash. Detailing includes an aluminum-covered cornice. This house lacks integrity and distinguishing architectural features and is not individually eligible for listing on the National Register.



Midwest Archaeological Research Services, Inc. 505 North State Street Marengo, Illinois 60152 Phone (815) 568- 0680

Integrity:			Additional Notes/Descriptions
Unaltered	Slight Modification	Major Alteration	Replacement windows, cladding, and porch rails, posts, and steps
Condition:			
Excellent	Good	Poor	
Additional Alterati	ons		
Structu	ire Usage	Exterior Wall Surface	
Current: NA		Synthetic siding	
Historic: NA			
Roof Material	Roof Features	Roof Type	
Unknown	Parapet	Flat	
Ornamental Archit	tectural Details		Windows
Cornice			Double-hung, glass block
Outbuildings (Num	ber and Description)		
None			

Local Landmark	Y <u>N</u>	
National Register Historic Places	Y <u>N</u>	
National Register Historic District	Y <u>N</u>	Name:
Individually Eligible? No	A B C	Significance:

Additional Comments:			



Historical Resource Recordation Form

Property Name	Photos with Captions:		
Historic: Not labeled, not in CHRS	South and east façades of one-story, frame, single family residence.		
Common/Current: Unknown			
Property Address:			
344 W 111th Place			
HAARGIS Number:			
Not in database			
Present Owner and /or Occupant:			
Unknown			
Property Use			
Historic: Single family residence			
Current: Single family residence			
Date of Construction: 1913			
Architect's Name: Not in CHRS			
Builder/Contractor: Not in CHRS			
Architectural Style:			
Vernacular			
Prepared By: C. Tolmie, M. C. Bird, J.			
Guarino			
Photo By: S. Katz			
Date: 6 September 2012			

Property Description:

Stories: 1

This one story home in the Roseland community is situated on a raised basement, is clad with synthetic siding, and has a gambrel roof covered with asphalt shingles with wall dormers. Its front elevation features a non-original, flat-roofed, full-façade wood porch with straight railings and posts. The home also features an off-center door, a three-sided window bay on the first floor, and paired casement windows on the second floor. This home lacks integrity and architectural distinction and is not individually eligible for listing on the National Register.



Integrity:			Additional Notes/Descriptions
Unaltered	Slight Modification	Major Alteration	Replacement windows, doors, siding, and porch
Condition:			
Excellent	Good	Poor	
Additional Alterations			
Structure Usage Exterior Wall Surface			
Current: NA		Synthetic siding	
Historic: NA			
Roof Material	Roof Features	Roof Type	
Asphalt Shingles	Dormers	Gambrel	
Ornamental Archit	ectural Details		Windows
None			Double-hung, casement
Outbuildings (Num	ber and Description)		
None			

Local Landmark	Y <u>N</u>	
National Register Historic Places	Y <u>N</u>	
National Register Historic District	Y <u>N</u>	Name:
Individually Eligible? No	A B C	Significance:

Additional Comments:			



Historical Resource Recordation Form

Property Name	Photos with Captions:
	North and west façades of a one-story, single family, frame
Historic: Bldg. not labeled, not in CHRS	residence.
Common/Current: Unknown	
Property Address:	
303 W. 111th Street	
HAARGIS Number:	
Not in database	
Present Owner and /or Occupant:	
Unknown	
Property Use	
Historic: Single family residence	
Current: Single family residence	
Date of Construction: 1923	
Architect's Name: Not in CHRS	
Builder/Contractor: Not in CHRS	
Architectural Style:	
Craftsman	
Prepared By: J. Martinez, M. C. Bird, J.	
Guarino	
Photo By: S. Katz	
Date: 22 October 2012	
Property Description:	Stories: 1

This one-story Craftsman style house in the Roseland community is situated on a raised concrete block basement and is covered with synthetic siding and wood shingles. The building has a side hip-on-gable roof, overhanging eaves. There are decorative wood brackets and a hip-on-gable dormer with bracketed, overhanging eaves. There are three double-hung wood-sash windows with aluminum storms in the gable. Asphalt shingles clad the roof and the dormer. The roof has a wide overhang that serves as the roof for a full-width wood porch that has faux stone piers and wood railings, but no steps. The front elevation has a centrally located door that appears to be oak with a glass pane, which is flanked by three windows on either side, all of which are double-hung wood-sash with aluminum storms. This house lacks distinguishing architectural features and is not individually eligible for listing on the National Register.



Midwest Archaeological Research Services, Inc. 505 North State Street Marengo, Illinois 60152 Phone (815) 568- 0680

Integrity:			Additional Notes/Descriptions
Unaltered	Slight Modification	Major Alteration	Aluminum storms added, replacement siding on lower level
Condition:			
Excellent	Good	Poor	
Additional Alteration	ons		
Structu	re Usage	Exterior Wall Surface	
Current: NA	U III	Synthetic siding (lower),	
Historic: NA		Wood shingles (upper), Asphalt shingles (dormer)	
Roof Material	Roof Features	Roof Type	
Asphalt shingle	Dormer	Side hip-on-gable	
Ornamental Archit	ectural Details		Windows
Bracketed eaves			Double-hung
Outbuildings (Num	ber and Description)		
None			

Local Landmark	Y <u>N</u>	
National Register Historic Places	Y <u>N</u>	
National Register Historic District	Y <u>N</u>	Name:
Individually Eligible? No	A B C	Significance:

Additional Comments:			



Historical Resource Recordation Form

Property Name	Photos with Captions: South façade of a two-story, multi-family, frame residence.
Historic: Bldg. not labeled, not in CHRS	South laçade of a two story, main failing, france residence.
Common/Current: Unknown	
Property Address:	
316 W. 111th St.	
HAARGIS Number:	the state of the s
Not in database	
Present Owner and /or Occupant:	
Vacant	
Property Use	
Historic: Single family residence	
Current: Multi-family residence	
Date of Construction: 1893	
Architect's Name: Not in CHRS	
Builder/Contractor: Not in CHRS	
Architectural Style:	
Vernacular	
Prepared By: J. Martinez, M. C. Bird, J.	CARGON LA CONTRACT AND A CONTRACT AN
Guarino	
Photo By: S. Katz	
Date: 17 October 2012	

Property Description:

Stories: 2

This two-story house in the Roseland community is situated on a raised concrete block basement and is covered with synthetic siding. The building has a hip roof covered with asphalt shingles and overhanging eaves. Its front elevation has an off-center entrance with metal storm door and concrete steps with metal railing. Sidelights and a window group on the first floor are covered with plywood. There are five double-hung windows on the second floor, arranged in a pair and in a group of three. This house lacks integrity and distinguishing architectural features and is not individually eligible for listing on the National Register.



Integrity:			Additional Notes/Descriptions
Unaltered	Slight Modification	n Major Alteration	Replacement cladding, steps and railing
Condition:			
Excellent	Good	Poor	
Additional Alterations			
Structu	ire Usage	Exterior Wall Surface	
Current: NA		Synthetic siding	
Historic: NA			
Roof Material	Roof Features	Roof Type	
Asphalt shingle	None	Hip	
Ornamental Archit	tectural Details		Windows
None			Double-hung
Outbuildings (Num	ber and Description)		
None			

Local Landmark	Y <u>N</u>	
National Register Historic Places	Y <u>N</u>	
National Register Historic District	Y <u>N</u>	Name:
Individually Eligible? No	A B C	Significance:

Additional Comments:			



Historical Resource Recordation Form

Property Name	Photos with Captions:
Historic: Bldg. not labeled, not in CHRS	North façade of a brick, two-story, mixed-use building.
Common/Current: St. Mary Church of Prayer	
Property Address:	
339-341 W. 111th Street HAARGIS Number:	But demiced
HAAKGIS Number:	
Not in database	
Present Owner and /or Occupant:	
St. Mary Church of Prayer	
Property Use	
Historic: Commercial (Tin Shop, 1938)	
Current: Mixed-Use	
Date of Construction: 1924	
Architect's Name: Not in CHRS	
Builder/Contractor: Not in CHRS	
Architectural Style:	
Vernacular	
Prepared By: J. Martinez, M. C. Bird, J.	
Guarino	
Photo By: S. Katz	
Date: 17 October 2012	
Property Description:	Stories: 2

Property Description:

Stories: 2

This two-story former commercial building (now a storefront church) in the Roseland community is clad with painted brick and has a flat roof and a stepped parapet. The first floor of the front elevation has two storefronts with strips of single-pane windows and non-original doors with transoms. The second floor has two groups of picture windows flanked by one-over-one windows and two pairs of one-over-one aluminumsash windows. Detailing includes concrete coping and sills, a brick stringcourse, and a brick panel along the cornice line. This building lacks integrity and distinguishing architectural features and is not individually eligible for listing on the National Register.



Integrity:			Additional Notes/Descriptions	
Unaltered	Slight Modification	on Major Alteration	Replacement windows and doors	
Condition:				
Excellent	Good	Poor		
Additional Alterati	ons			
Structu	ıre Usage	Exterior Wall Surface		
Current: NA		Brick		
Historic: NA				
Roof Material	Roof Features	Roof Type		
Unknown	Parapet	Flat		
Ornamental Archit	tectural Details	Windows		
Concrete sills and coping, brick stringcourse, brick panel			Double-hung, fixed pane	
Outbuildings (Number and Description)				
None				

Local Landmark	Y <u>N</u>	
National Register Historic Places	Y <u>N</u>	
National Register Historic District	Y <u>N</u>	Name:
Individually Eligible? No	A B C	Significance:

Additional Comments:			



Historical Resource Recordation Form

Property Name	Photos with Captions: South façade of two-flat greystone residential building.
Historic: Not labeled, not in CHRS	, in the second s
Common/Current: Unknown	
Property Address:	
349 W 111th Street	and the second sec
HAARGIS Number:	
Not in database	
Present Owner and /or Occupant:	
Unknown	
Property Use	
Historic: Flat	
Current: Flat	
Date of Construction: 1917	
Architect's Name: Not in CHRS	
Builder/Contractor: Not in CHRS	
Architectural Style:	
Vernacular	
Prepared By: C. Tolmie, M. C. Bird, J. Guarino	
Photo By: S. Katz	
Date: 6 September 2012	

Property Description:

Stories: 2

This two-flat greystone residential building in the Roseland community has a flat roof and parapet. Its front elevation features a full-height window bay pavilion with fenestration comprised of one-over-one replacement windows. It has an off-center porch with two entrances that feature non-original wood doors, stone steps, metal and stone railings, and wood columns supporting a flat wood roof with dentil molding. Detailing includes a stone sill courses, lintels, beltcourses, and cornice.

The City of Chicago has recognized this building type through its Historic Greystone Initiative, which promotes the preservation of Chicago's ornate, limestone-clad homes by offering technical assistance and financial resources to property owners. Although this is an example of the greystone residential building type, it does not possess sufficient distinguishing architectural characteristics to qualify as individually eligible for listing on the National Register.



Integrity:			Additional Notes/Descriptions	
Unaltered	Slight Modificatio	on Major Alteration	Replacement windows	
Condition:				
Excellent	Good	Poor		
Additional Alterati	ons			
Structu	ıre Usage	Exterior Wall Surface		
Current: NA		Stone		
Historic: NA				
Roof Material	Roof Features	Roof Type		
Unknown	None	Flat		
Ornamental Archit	tectural Details	Windows		
Stone sill courses, lintels, beltcourses, cornice, and railings			Double hung	
Outbuildings (Number and Description)				
None				

Local Landmark	Y <u>N</u>	
National Register Historic Places	Y <u>N</u>	
National Register Historic District	Y <u>N</u>	Name:
Individually Eligible? No	A B C	Significance:

Additional Comments:			



Photos with Captions: Property Name South and east façades of one-story, brick garage. Historic: Not labeled, not in CHRS Common/Current: Unknown **Property Address:** 401 W 111th Street **HAARGIS Number:** Not in database Present Owner and /or Occupant: Roseland Tune-Up Center **Property Use** Historic: Commercial Current: Commercial Date of Construction: 1964 Architect's Name: Not in CHRS Builder/Contractor: Not in CHRS **Architectural Style:** Vernacular Prepared By: C. Tolmie, M. C. Bird, J. Guarino Photo By: S. Katz Date: 6 September 2012

Historical Resource Recordation Form

Property Description:

Stories: 1

This one-story, brick-clad garage in the Roseland neighborhood has a flat roof and a front elevation that features three garage door openings with metal overhead doors. The fourth bay features an off-center plate glass door with transom in-filled with wood and flanking single-pane windows. This building does not feature sufficient distinguishing architectural features to qualify as individually eligible for listing on the National Register.



Integrity:			Additional Notes/Descriptions
Unaltered	Slight Modification	Major Alteration	Transom in-filled with wood
Condition:			
Excellent	Good	Poor	
Additional Alterati	ons		
Structu	ire Usage	Exterior Wall Surface	
Current: NA		Brick	
Historic: NA			
Roof Material	Roof Features	Roof Type	
Unknown	None	Flat	
Ornamental Archit	ectural Details		Windows
None			Fixed-pane
Outbuildings (Num	ber and Description)		·
None			

Local Landmark	Y <u>N</u>	
National Register Historic Places	Y <u>N</u>	
National Register Historic District	Y <u>N</u>	Name:
Individually Eligible? No	A B C	Significance:

Additional Comments:			



Historical Resource Recordation Form

Property Name	Photos with Captions: South façade of one-story, brick, single family residence.
Historic: Not labeled, not in CHRS	South laçade of one-story, offek, single failing festdence.
Common/Current: Unknown	
Property address:	
428 W. 111th Street	
HAARGIS Number:	
Not in database	
Present Owner and /or Occupant:	
Unknown	
Property Use	
Historic: Single family residence	
Current: Single family residence	
Date of Construction: 1960	
Architect's Name: Not in CHRS	
Builder/Contractor: Not in CHRS	
Architectural Style:	
Vernacular	
Prepared By: C. Tolmie, M. C. Bird, J. Guarino	
Photo By: S. Katz	
Date: 16 September 2012	

Property Description:

Stories: 1

This one-story house in the Roseland community is clad with buff brick on its front elevation and common brick on its side and rear elevations. The building has a raised basement and a hip roof covered with asphalt shingles. Its front elevation has a projecting three-sided living room bay with a picture window flanked by one-over-one aluminum-sash windows, an off-center entrance with a metal storm door, and concrete steps with metal railings. The gable's cladding material has been removed. Detailing includes two decorative glass blocks adjacent to the front door. It does not display distinctive architectural features and is not individually eligible for listing on the National Register.




Integrity:			Additional Notes/Descriptions
Unaltered	Slight Modification	Major Alteration	Replacement windows; cladding removed from the gable
Condition:			
Excellent	Good	Poor	
Additional Alterati	ons		
Structure Usage Exterior Wall Surface			
Current: NA		Brick	
Historic: NA			
Roof Material	Roof Features	Roof Type	
Asphalt shingle	None	Hip	
Ornamental Architectural Details			Windows
Decorative glass blocks			Double-hung, fixed-pane
Outbuildings (Number and Description)			
None			

Local Landmark	Y <u>N</u>	
National Register Historic Places	Y <u>N</u>	
National Register Historic District	Y <u>N</u>	Name:
Individually Eligible? No	A B C	Significance:

dditional Comments:			



Historical Resource Recordation Form

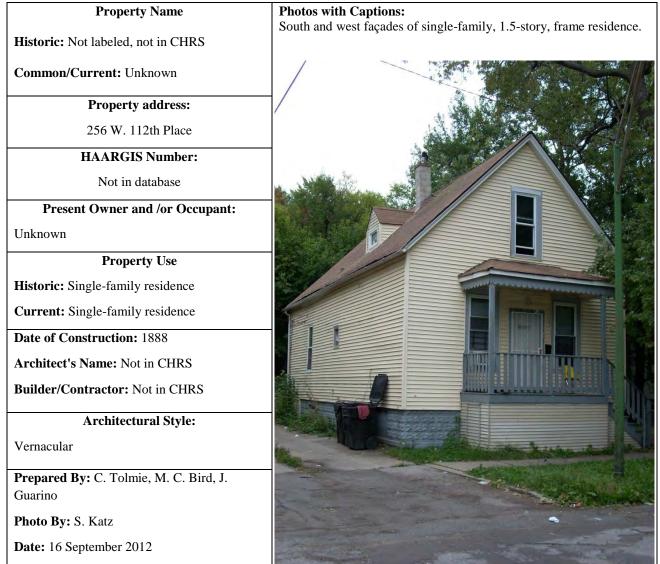

Property Description:

Stories: 1.5

This one-and-a-half-story house in the Roseland community is situated on a raised concrete block basement with glass block windows and is covered with synthetic siding. The building has a front gable roof with asphalt shingles and a small dormer. The front elevation has a centrally located, partial-width, hipped-roof porch with scallop detailing at the roofline, an aluminum-clad base, straight wood posts and railings (non-original), and steps on the side. It has a centrally located entrance with a metal storm door flanked by a window on either side and has a single window in the gable. Windows are non-original one-over-one aluminum-sash. This house lacks integrity and distinguishing architectural features and is not individually eligible for listing on the National Register.



Integrity:			Additional Notes/Descriptions
Unaltered	Slight Modification	n Major Alteration	Some replacement windows, cladding, and porch rails and posts
Condition:			
Excellent	Good	Poor	
Additional Alterati	ons		
Structu	ire Usage	Exterior Wall Surface	
Current: NA		Synthetic siding	
Historic: NA			
Roof Material	Roof Features	Roof Type	
Asphalt shingle	Dormer	Gable	
Ornamental Architectural Details			Windows
Scallop detailing on porch roofline			Double-hung, glass block
Outbuildings (Num	ber and Description)		
None			

Local Landmark	Y <u>N</u>	
National Register Historic Places	Y <u>N</u>	
National Register Historic District	Y <u>N</u>	Name:
Individually Eligible? No	A B C	Significance:

Additional Comments:		



Photos with Captions: Property Name North façade of 1.5-story, single-family, brick residence. Historic: Not labeled, not in CHRS Common/Current: Unknown **Property address:** 303 W. 112th Place **HAARGIS Number:** Not in database **Present Owner and /or Occupant:** Unknown **Property Use** Historic: Single-family residence Current: Single-family residence Date of Construction: 1909 Architect's Name: Not in CHRS Builder/Contractor: Not in CHRS **Architectural Style:** Vernacular Prepared By: C. Tolmie, M. C. Bird, J. Guarino Photo By: S. Katz Date: 16 September 2012

Historical Resource Recordation Form

Property Description:

Stories: 1.5

This one-and-a-half-story house at the southwest corner of 112th Place and Princeton Avenue is situated on a raised concrete block basement with glass block windows and is clad with light brown face brick. The building has a front gable roof covered with asphalt shingles. Its front elevation has a partial-width, flat-roofed porch with wood steps and open metal railings, an off-center door with transom, and a three sided bay window on the first floor. The upper floor of the front elevation has a pair of windows and two single windows. Windows are non-original one-over-one aluminum-sash. The home's east elevation has a three-sided, full-height window bay pavilion and its west elevation has a gable wall dormer. This house lacks distinguishing architectural features and is not individually eligible for listing on the National Register.



Integrity:			Additional Notes/Descriptions
integrity.			
Unaltered	Slight Modification	Major Alteration	Replacement windows
Condition:			
Excellent	Good	Poor	
Additional Alterati	ons		
Structu	ire Usage	Exterior Wall Surface	
Current: NA		Brick	
Historic: NA			
Roof Material	Roof Features	Roof Type	
Asphalt shingle	Dormer	Gable	
Ornamental Archit	ectural Details		Windows
None			Double-hung, glass block
Outbuildings (Num	ber and Description)		•
Two garages			

Local Landmark	Y <u>N</u>	
National Register Historic Places	Y <u>N</u>	
National Register Historic District	Y <u>N</u>	Name:
Individually Eligible? No	A B C	Significance:

Additional Comments			



Historical Resource Recordation Form

Property Name	Photos with Captions:
Historic: Not labeled, not in CHRS	South and east façades of single story, single-family, frame residence.
Common/Current: Unknown	
Property address:	
312 W. 112th Place	
HAARGIS Number:	
Not in database	
Present Owner and /or Occupant:	
Vacant	
Property Use	
Historic: Single-family residence	
Current: Single family residence	
Date of Construction: 1914	
Architect's Name: Not in CHRS	
Builder/Contractor: Not in CHRS	
Architectural Style:	
Vernacular	
Prepared By: C. Tolmie, M. C. Bird, J.	
Guarino	
Photo By: S .Katz	
Date: 16 September 2012	

Property Description:

Stories: 1

This one-story house in the Roseland community is situated on a raised concrete block basement with casement windows. The building has original wood clapboard siding and a cross-gambrel roof with asphalt shingles. The roof extends forward to serve as the roof over the full-façade wood porch with supports consisting of faux stone piers topped by wood columns. The front elevation has an off-center wood door and a window covered with plywood on the first floor. There are two one-over-one windows on the second floor. Above the basement, windows are one-over-one, some with aluminum storms. This house lacks distinguishing architectural features and is not individually eligible for listing on the National Register.



Integrity:			Additional Notes/Descriptions
Unaltered	Slight Modification	Major Alteration	Some windows have aluminum
			storms
Condition:			
Excellent	Good	Poor	
Additional Alterati	ons		
Structu	re Usage	Exterior Wall Surface	
Current: NA		Wood siding	
Historic: NA			
Roof Material	Roof Features	Roof Type	
Asphalt shingle	None	Cross-gambrel	
Ornamental Archit	ectural Details		Windows
None			Double-hung, casement
Outbuildings (Num	ber and Description)		
None			

Local Landmark	Y <u>N</u>	
National Register Historic Places	Y <u>N</u>	
National Register Historic District	Y <u>N</u>	Name:
Individually Eligible? No	A B C	Significance:

Additional Comments:			



Historical Resource Recordation Form



Property Description:

Stories: 2

This two-story, multi-family home in the Roseland community is situated on a raised concrete block basement with a glass block window. It is clad with synthetic siding and has a gambrel roof with cornice returns, covered with asphalt shingles. Its full-width hip-roof wood porch has cast concrete pier supports. The first floor has two doors and a three-sided bay with non-original one-over-one windows. The second floor has four one-over-one windows and the attic level has a pair of single-pane windows that may be casements. This home lacks integrity and does not have sufficient distinguishing architectural features to qualify as individually eligible for listing on the National Register.



Integrity:			Additional Notes/Descriptions
Unaltered	Slight Modification	n Major Alteration	Replacement windows & cladding
Condition:			
Excellent	Good	Poor	
Additional Alteration	ons		
Conversion from sin	gle family to multi-family	y residence after 1939 (Sanborn)	
Structu	ire Usage	Exterior Wall Surface	
Current: NA		Synthetic siding	
Historic: NA			
Roof Material	Roof Features	Roof Type	
Asphalt	None	Gambrel	
Ornamental Archit	ectural Details		Windows
Cornice returns			Double-hung, casement, glass
			block
Outbuildings (Num	ber and Description)		
None			

Local Landmark	Y <u>N</u>	
National Register Historic Places	Y <u>N</u>	
National Register Historic District	Y <u>N</u>	Name:
Individually Eligible? No	A B C	Significance:

Additional Comments:	



Historical Resource Recordation Form

Property Name	Photos with Captions: North façade of one-story, single family, frame residence.
Historic: Bldg. not labeled, not in CHRS	North laçade of one-story, single family, frame residence.
Common/Current: Unknown	
Property Address:	
325 W 112th Place	
HAARGIS Number:	
Not in database	
Present Owner and /or Occupant:	
Unknown	
Property Use	
Historic: Single family residence	
Current: Single family residence	
Date of Construction: 1899	
Architect's Name: Not in CHRS	
Builder/Contractor: Not in CHRS	
Architectural Style:	
Vernacular	
Prepared By: J. Martinez, M. C. Bird, J.	
Guarino	
Photo By: S. Katz	
Date: 26 September 2012	
Property Description.	Stariaat 1

Property Description:

Stories: 1

This one-story home in the Roseland community is situated on a raised basement with glass block windows. It is clad with aluminum siding and has a gable roof covered with asphalt shingles. The front elevation has a partial-width hip roof concrete porch with metal railings and open metal supports. An off-center door with transom and a three-sided bay comprised of non-original one-over-one windows are also included on the front elevation. A single one-over-one window is situated in the gable. This building does not have sufficient distinguishing architectural features to qualify as individually eligible for listing on the National Register.




Integrity:			Additional Notes/Descriptions
Unaltered	Slight Modification	n Major Alteration	Replacement windows, door, cladding
Condition:			
<u>Excellent</u>	Good	Poor	
Additional Alterati	ons		
Structu	re Usage	Exterior Wall Surface	
Current: NA		Synthetic siding	
Historic: NA			
Roof Material	Roof Features	Roof Type	
Asphalt	None	Gable	
Ornamental Archit	ectural Details		Windows
None			Double-hung
Outbuildings (Num	ber and Description)		
None			

Local Landmark	Y <u>N</u>	
National Register Historic Places	Y <u>N</u>	
National Register Historic District	Y <u>N</u>	Name:
Individually Eligible? No	A B C	Significance:

Additional Comments:			



Historical Resource Recordation Form

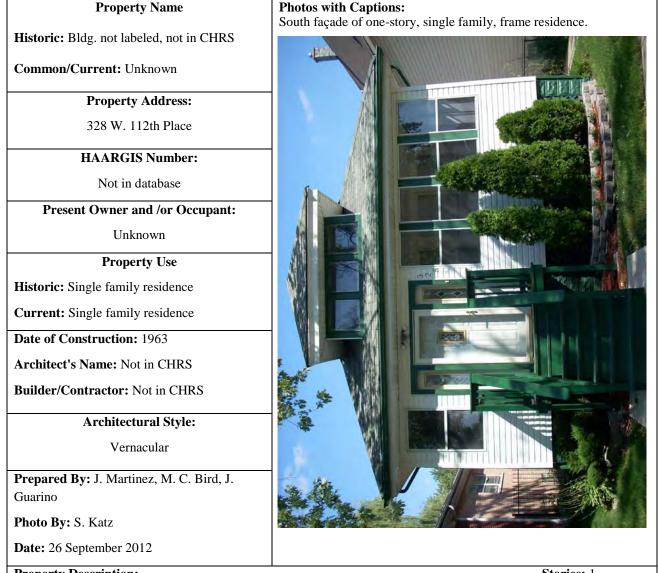

Property Description:

Stories: 1

This one-story house in the Roseland community is situated on a raised concrete block basement and clad with aluminum siding above. It has a hip roof covered with asphalt shingles and a hip dormer with three, single-pane, casement windows. Glass block windows provide light for the basement. The front elevation has an off-center hollow metal panel door with sidelights, wood steps and railings, and four one-over-one windows. This building does not feature sufficient distinguishing architectural features to qualify as individually eligible for listing on the National Register.




Integrity:			Additional Notes/Descriptions
<u>Unaltered</u>	Slight Modification	Major Alteration	
Condition:			
Excellent	Good	Poor	
Additional Alterati	ons		
Structu	re Usage	Exterior Wall Surface	
Current: NA		Synthetic siding	
Historic: NA			
Roof Material	Roof Features	Roof Type	
Asphalt	Hipped dormer	Hip	
Ornamental Archit	ectural Details		Windows
None			Double-hung, casement, fixed- pane, glass block
Outbuildings (Num	ber and Description)		·

Local Landmark	Y	<u>N</u>	
National Register Historic Places	Y	<u>N</u>	
National Register Historic District	Y	<u>N</u>	Name:
Individually Eligible? No	Α	B C	Significance:

Additional Comments:			



Historical Resource Recordation Form

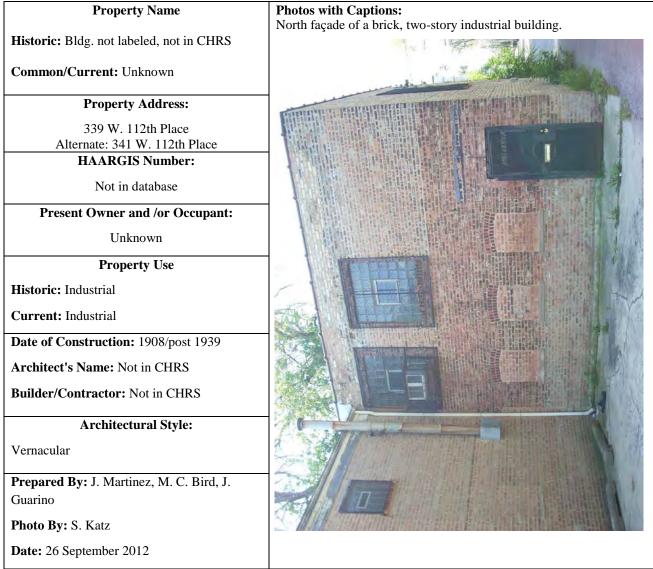

Property Description:

Stories: 2

This two-story, brick-clad, light industrial building in the Roseland community has a flat roof, parapet with coping, and a T-shaped footprint. The front segment of the building was a one-story building erected in 1908. Sometime after 1939, a second story and a rear wing were added. The original segment has an off-center door and the outline of three former window openings (with brick arched lintels and stone sills) that have been in-filled with brick. The second floor and the rear wing have glass block window openings with small ventilating louvers. This building lacks integrity and distinguishing architectural features; it is not individually eligible for listing on the National Register.



Structural Survey


Integrity:			Additional Notes/Descriptions
Unaltered	Slight Modification	on <u>Major Alteration</u>	Windows in-filled with brick (front segment)
Condition:			
<u>Excellent</u>	Good	Poor	
Additional Alterati	ons		
Addition to rear and	second story added after	r 1939	
Structu	ire Usage	Exterior Wall Surface	
Current: NA		Brick	
Historic: NA			
Roof Material	Roof Features	Roof Type	
Unknown	Parapet	Flat	
Ornamental Archit	tectural Details	Windows	
Brick arched lintels			Glass-block with central casement
Outbuildings (Num	ber and Description)		
None			

Local Landmark	Y <u>N</u>	
National Register Historic Places	Y <u>N</u>	
National Register Historic District	Y <u>N</u>	Name:
Individually Eligible? No	A B C	Significance:

Additional Comments:



Historical Resource Recordation Form

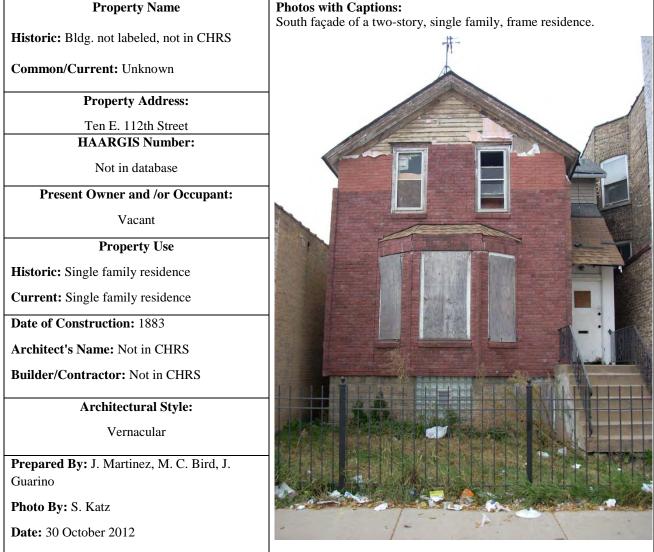

Property Description:

Stories: 2

This vacant, two-story house in the Roseland community is situated on a raised concrete block basement with glass block windows. The building has a front gable roof covered with asphalt shingles. Its front elevation is largely faced with faux brick over original wood clapboard siding, which is visible near the apex of the gable. Other portions are also clad in clapboard siding. The front elevation features a three-sided window bay on the first floor; window openings are covered with plywood. Two non-original one-over-one windows are present on the second floor. This elevation also has a non-original front door with a shed-roofed canopy that is situated in a recessed, side-gabled, full-height pavilion. The front door is accessed via concrete steps with metal railings. This building lacks integrity and distinctive architectural features and is not individually eligible for listing on the National Register.



Structural Survey


Integrity:			Additional Notes/Descriptions
Unaltered	Slight Modificatio	on Major Alteration	Replacement cladding, windows, door, and rails
Condition:			
Excellent	Good	Poor	
Additional Alterati	ons		
Hoods over second s	story windows removed.		
Structu	re Usage	Exterior Wall Surface	
Current: NA		Synthetic siding over wood	
Historic: NA		clapboards	
Roof Material	Roof Features	Roof Type	
Asphalt shingle	None	Gable	
Ornamental Archit	ectural Details	Windows	
None		Double-hung, glass block, covered	
Outbuildings (Num	ber and Description)		
None			

Local Landmark	Y <u>N</u>	
National Register Historic Places	Y <u>N</u>	
National Register Historic District	Y <u>N</u>	Name:
Individually Eligible? No	A B C	Significance:

Additional Comments:



Historical Resource Recordation Form

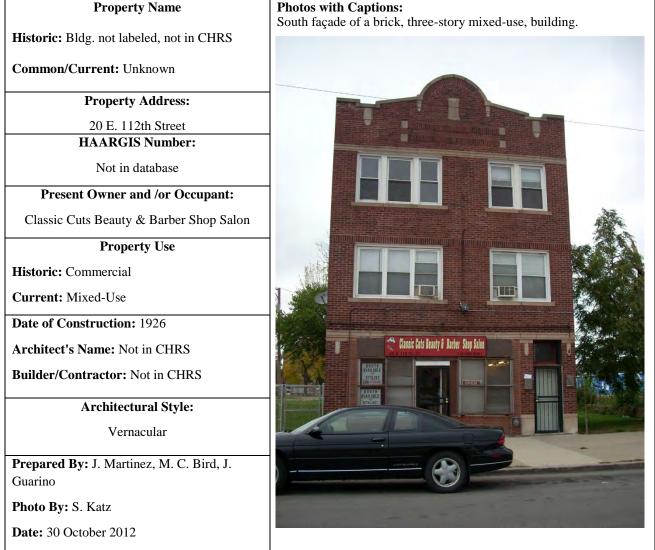

Property Description:

Stories: 3

This three-story commercial building in the Roseland community is clad with face brick on its front elevation and common brick along its side and rear elevations. The building has a flat roof and a parapet that is rounded at the center. The front elevation has a non-original storefront comprised of a metal storm door flanked by paired one-over-one windows, as well as an off-center hollow core metal door with a transom that provides access to the upper floors. The second and third floors each feature five non-original one-over-one aluminum sash windows, arranged on each floor in a group of three and in pairs. Detailing includes concrete sills, belt courses, and decorative insert blocks at the parapet level. This building lacks integrity and distinctive architectural features and is not individually eligible for listing on the National Register.



Integrity:			Additional Notes/Descriptions
Unaltered	Slight Modification	n Major Alteration	Replacement doors and windows
Condition:			
<u>Excellent</u>	Good	Poor	
Additional Alterati	ons		
Structu	ire Usage	Exterior Wall Surface	
Current: NA		Brick	
Historic: NA			
Roof Material	Roof Features	Roof Type	
Unknown	Parapet	Flat	
Ornamental Archit	tectural Details		Windows
Concrete sills, belt c	ourses, insert blocks, and	Double-hung	
Outbuildings (Num	ber and Description)		
None			

Local Landmark	Y <u>N</u>	
National Register Historic Places	Y <u>N</u>	
National Register Historic District	Y <u>N</u>	Name:
Individually Eligible? No	A B C	Significance:

Additional Comments:			



Historical Resource Recordation Form

Property Name	Photos with Captions:
Historic: Not labeled, not in CHRS	North façade of 1.5-story, single-family, frame residence.
Common/Current: Unknown	
Property address:	
303 W. 112th Street	
HAARGIS Number:	
Not in database	
Present Owner and /or Occupant:	
Unknown	
Property Use	
Historic: Single-family residence	
Current: Single-family residence	
Date of Construction: 1908	
Architect's Name: Not in CHRS	
Builder/Contractor: Not in CHRS	
Architectural Style:	
Vernacular	
Prepared By: C. Tolmie, M. C. Bird, J.	
Guarino	
Photo By: S. Katz	Distant Party Part
Date: 16 September 2012	

Property Description:

Stories: 1.5

This one-and-a-half-story house in the Roseland community is situated on a raised concrete block basement with glass block windows and is covered with synthetic siding. The building has a hip-on-gable roof with asphalt shingles. The front elevation has a gable-roofed full-width porch, half of which is enclosed, covered with synthetic siding, and surrounded by non-original multi-paned aluminum-sash windows with some original wood-sash windows. The open corner of the porch has a wood post, wood steps and railings (non-original), and an entrance with a metal storm door that is surrounded by faux stone siding. The hip-gable area has a strip of three double-hung windows. Both side elevations have shed-roofed wall dormers. This house lacks integrity and distinguishing architectural features and is not individually eligible for listing on the National Register.



Integrity:			Additional Notes/Descriptions
Unaltered	Slight Modification	on Major Alteration	Some replacement windows & cladding
Condition:			
<u>Excellent</u>	Good	Poor	
Additional Alterati	ons		
Structu	re Usage	Exterior Wall Surface	
Current: NA		Synthetic siding, faux stone	
Historic: NA			
Roof Material	Roof Features	Roof Type	
Asphalt shingle	Dormers	Hip-on-gable	
Ornamental Archit	ectural Details		Windows
None			Double-hung, glass block
Outbuildings (Num	ber and Description)		
Detached two-car ga	rage		

Local Landmark	Y <u>N</u>	
National Register Historic Places	Y <u>N</u>	
National Register Historic District	Y <u>N</u>	Name:
Individually Eligible? No	A B C	Significance:

Additional Comments:			



Historical Resource Recordation Form

Property Name	Photos with Captions: South and west façades of 1.5-story, single-family, frame residence.
Historic: Not labeled, not in CHRS	south and west façades of 1.5-story, single-failing, frame residence.
Common/Current: Unknown	
Property address:	
334 W. 112th Street	
HAARGIS Number:	
Not in database	
Present Owner and /or Occupant:	
Unknown	
Property Use	
Historic: Single-family residence	
Current: Single-family residence	
Date of Construction: 1912	
Architect's Name: Not in CHRS	
Builder/Contractor: Not in CHRS	
Architectural Style:	
Vernacular	
Prepared By: C. Tolmie, M. C. Bird, J. Guarino	
Photo By: S. Katz	
Date: 16 September 2012	

Property Description:

Stories: 1.5

This one-and-a-half story house in the Roseland community is situated on a raised concrete block basement with glass block windows and is covered with synthetic siding. The building has a front gable roof with asphalt shingles. The front elevation has a gable-roofed full-width porch, half of which has been enclosed with synthetic siding and is surrounded by non-original multi-paned aluminum-sash windows. The open corner of the porch has a wood post, wood steps and railings (non-original), and an entrance with a metal storm door. There is a pair of non-original one-over-one aluminum-sash windows in the gable. This house lacks integrity and distinguishing architectural features and is not individually eligible for listing on the National Register.



Integrity:			Additional Notes/Descriptions
Unaltered	Slight Modification	Major Alteration	Replacement windows, cladding, and porch posts, rails, and steps
Condition:			
Excellent	Good	Poor	
Additional Alterati	ons		
Structu	ire Usage	Exterior Wall Surface	
Current:N/A		Synthetic siding	
Historic: N/A			
Roof Material	Roof Features	Roof Type	
Asphalt shingle	None	Gable	
Ornamental Archit	tectural Details		Windows
None			Double-hung, glass block
Outbuildings (Num	ber and Description)		
None			

Local Landmark	Y <u>N</u>	
National Register Historic Places	Y <u>N</u>	
National Register Historic District	Y <u>N</u>	Name:
Individually Eligible? No	A B C	Significance:

Additional Comments:			



Historical Resource Recordation Form

Property Name	Photos with Captions: South façade of a brick, two-story, multi-family residence.
Historic: Bldg. not labeled, not in CHRS	South Regard of a breek, two story, main rampy residence.
Common/Current: Unknown	
Property Address:	
340 W. 112th Street	
HAARGIS Number:	
Not in database	
Present Owner and /or Occupant:	
Vacant	
Property Use	
Historic: Flat	
Current: Flat	
Date of Construction: 1964	
Architect's Name: Not in CHRS	
Builder/Contractor: Not in CHRS	
Architectural Style:	
Vernacular	
Prepared By: J. Martinez, M. C. Bird, J.	
Guarino	
Photo By: S. Katz	
Date: 26 September 2012	
Property Description:	Starias: 2

Property Description:

Stories: 2

This two-flat apartment building is situated on a raised basement and has a hip roof covered with asphalt shingles. Its front façade is clad in buff brick and has an off-center metal door, a vertical strip of decorative glass blocks above the porch hood, and six window openings: two each in the basement, first, and second floors. All window openings are covered with metal panels. This building does not feature sufficient distinguishing architectural features to qualify as individually eligible for listing on the National Register.




Integrity:			Additional Notes/Descriptions
Unaltered	Slight Modification	Major Alteration	Opening covered with metal panels
Condition:			
Excellent	Good	Poor	
Additional Alteration	ons		
Structu	ire Usage	Exterior Wall Surface	
Current: NA		Brick	
Historic: NA			
Roof Material	Roof Features	Roof Type	
Asphalt	None	Hip	
Ornamental Archit	ectural Details		Windows
Contrasting colored	brick panels		NA
Outbuildings (Num	ber and Description)		
None			

Local Landmark	Y <u>N</u>	
National Register Historic Places	Y <u>N</u>	
National Register Historic District	Y <u>N</u>	Name:
Individually Eligible? No	A B C	Significance:

Additional Comments:		



Historical Resource Recordation Form

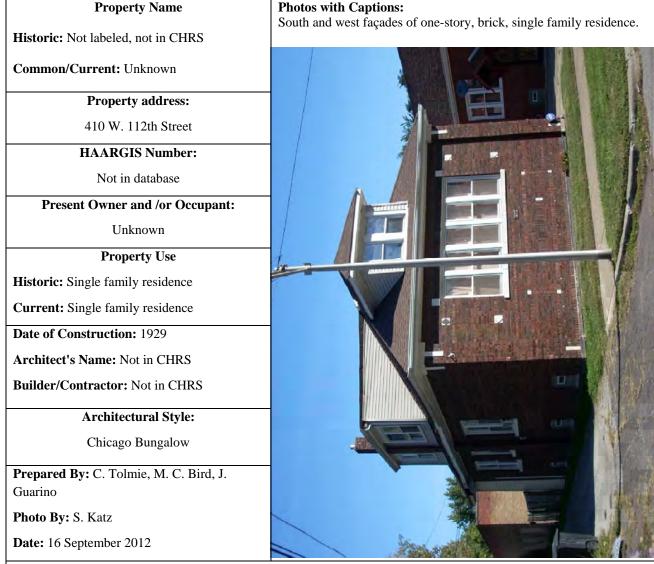

Property Description:

Stories: 1

This one-story brick bungalow in the Roseland community is situated on a raised basement with glass block windows and is clad with brown face brick. The building has a hip roof covered with asphalt shingles, a hip dormer with two windows on its front elevation, and a shed dormer with three windows on its west elevation. Both dormers are covered with synthetic siding. The front elevation has a strip of five windows. Windows throughout the house are non-original one-over-one aluminum-sash of varying sizes with the exception of a casement window along the east elevation. The main entrance is situated along the east elevation and consists of a hollow core metal door topped by a bracketed wood gabled hood. Detailing includes brick corner pilasters, concrete sills, and decorative square insert blocks. This house lacks distinctive architectural features and is not individually eligible for listing on the National Register.




Integrity:			Additional Notes/Descriptions
Unaltered	Slight Modification	on Major Alteration	Replacement windows and doors
Condition:			
<u>Excellent</u>	Good	Poor	
Additional Alterati	ons		
Shed dormer is a late	er addition		
Structu	ıre Usage	Exterior Wall Surface	
Current: NA		Brick (main),	
Historic: NA		Synthetic siding (shed dormer)	
Roof Material	Roof Features	Roof Type	
Asphalt shingle	Dormer	Hip	
Ornamental Archit	tectural Details		Windows
Bracketed hood, brid	ck corner pilasters, concr	rete sills and insert blocks	Double-hung, glass block,
			casement
Outbuildings (Num	ber and Description)		
Garage			

Local Landmark	Y <u>N</u>	
National Register Historic Places	Y <u>N</u>	
National Register Historic District	Y <u>N</u>	Name:
Individually Eligible? No	A B C	Significance:

Additional Comments:		



Historical Resource Recordation Form

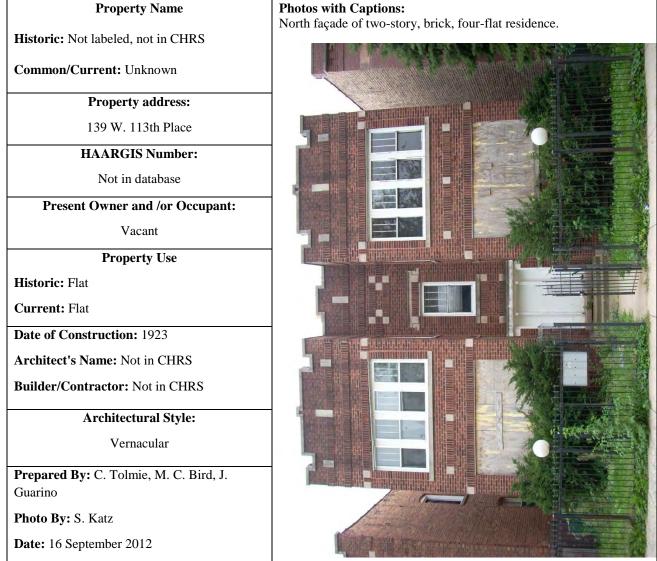

Property Description:

Stories: 2

This two-story four-flat apartment building in the Roseland community has a flat roof and castellated parapet with concrete coping. The front elevation is clad with brown face brick, has two full-height enclosed sun porch pavilions, and a centrally located entrance with sidelights that have been boarded over. The first floor windows have been covered with plywood. Second floor fenestration features two strips of three-over-one wood-sash windows. An additional three-over-one wood-sash window is situated above the entrance. Detailing includes brick soldier courses with stone coping and insert blocks. This building lacks sufficient distinguishing architectural features to qualify as individually eligible for listing on the National Register.



Integrity:			Additional Notes/Descriptions
Unaltered	Slight Modificatio	n Major Alteration	
Condition:			
Excellent	Good	Poor	
Additional Alterati	ons		
Structu	ire Usage	Exterior Wall Surface	
Current: NA		Brick	
Historic: NA			
Roof Material	Roof Features	Roof Type	
Unknown	Parapet	Flat	
Ornamental Architectural Details			Windows
Stone coping and insert blocks, brick soldier courses			Double-hung
Outbuildings (Number and Description)			•
None			

Local Landmark	Y <u>N</u>	
National Register Historic Places	Y <u>N</u>	
National Register Historic District	Y <u>N</u>	Name:
Individually Eligible? No	A B C	Significance:

Additional Comments:			



Historical Resource Recordation Form

Property Name	Photos with Captions:
Historia: Not labeled not in CUDS	South façade of 1.5-story, single-family, frame residence.
Historic: Not labeled, not in CHRS	
Common/Current: Unknown	
Property address:	
228 W. 113th Street	
HAARGIS Number:	
Not in database	
Present Owner and /or Occupant:	
Vacant	
Property Use	
Historic: Single-family residence	
Current: Single family residence	
Date of Construction: 1890	
Architect's Name: Not in CHRS	
Builder/Contractor: Not in CHRS	
Architectural Style:	
Vernacular	
Prepared By: C. Tolmie, M. C. Bird, J.	
Guarino	
Photo By: S. Katz	
Date: 16 September 2012	TURILLING STREET

Property Description:

Stories: 1.5

This one-and-a-half-story frame house in the Roseland community is situated on a raised concrete block basement and is covered with synthetic siding. The building has a gambrel roof covered with asphalt shingles that overhangs the side elevations. The front elevation has a gable-roofed full-width porch, most of which is enclosed and covered with synthetic siding. Windows on all three sides of the house are covered with plywood. The off-center door is also covered with plywood and accessed via concrete steps with metal railings. There is a synthetic-clad addition on the rear elevation. This house lacks integrity and distinguishing architectural features and is not individually eligible for listing on the National Register.



Integrity:			Additional Notes/Descriptions
Unaltered	Slight Modification	Major Alteration	Replacement cladding
Condition:			
Excellent	Good	Poor	
Additional Alterati	ons		
Porch enclosed, rear	addition		
Structu	ıre Usage	Exterior Wall Surface	
Current: NA		Synthetic siding	
Historic: NA			
Roof Material	Roof Features	Roof Type	
Asphalt shingle	None	Gambrel	
Ornamental Architectural Details			Windows
None			Covered
Outbuildings (Num	ber and Description)		
None			

Local Landmark	Y <u>N</u>	
National Register Historic Places	Y <u>N</u>	
National Register Historic District	Y <u>N</u>	Name:
Individually Eligible? No	A B (Significance:

Additional Comments:			



Historical Resource Recordation Form

Property Name	Photos with Captions:
Historic: Not labeled, not in CHRS	North façade of 1.5-story, single-family, frame residence.
Common/Current: Unknown	
Property address:	
235 W. 113th Street	
HAARGIS Number:	
Not in database	
Present Owner and /or Occupant:	
Unknown	
Property Use	
Historic: Single family residence	
Current: Single family residence	
Date of Construction: 1905	
Architect's Name: Not in CHRS	
Builder/Contractor: Not in CHRS	
Architectural Style:	
Vernacular	
Prepared By: C. Tolmie, M. C. Bird, J.	
Guarino	
Photo By: S. Katz	
Date: 16 September 2012	

Property Description:

Stories: 1.5

This one-and-a-half-story frame house at the southwest corner of 113th Street and Yale Avenue in the Roseland community is situated on a raised concrete block basement with glass block windows and is covered with synthetic siding. The building has a front gable roof with asphalt shingles. The front elevation has a gable-roofed full-width porch, most of which is enclosed with synthetic siding and surrounded on all three sides by one-over-one aluminum-sash windows. The off-center entrance with metal storm door is set within the open corner of the porch. The open part of the porch has a non-original wood support, steps and railings. A pair of windows is situated in the gable. Windows throughout the house are non-original one-over-one aluminum sash. The east elevation has a first floor window bay and both shed and gable wall dormers. The west elevation has a shed wall dormer. This house lacks integrity and distinguishing architectural features and is not individually eligible for listing on the National Register.




Integrity:			Additional Notes/Descriptions
Unaltered	Slight Modification	n Major Alteration	Replacement door, windows, cladding, and porch rails
Condition:			
Excellent	Good	Poor	
Additional Alterati	ons		
Structu	ire Usage	Exterior Wall Surface	
Current: NA		Synthetic siding	
Historic: NA			
Roof Material	Roof Features	Roof Type	
Asphalt shingle	Dormers	Gable	
Ornamental Archit	tectural Details	Windows	
None			Double-hung, glass block
Outbuildings (Num	ber and Description)		
None			

Local Landmark	Y <u>N</u>	
National Register Historic Places	Y <u>N</u>	
National Register Historic District	Y <u>N</u>	Name:
Individually Eligible? No	A B C	Significance:

Additional Comments:			



Historical Resource Recordation Form

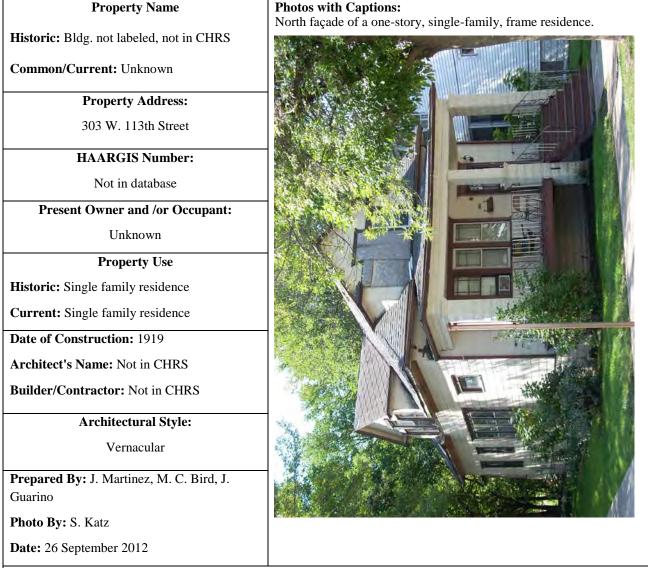

Property Description:

Stories: 1

This one-story home in the Roseland community is situated on a raised concrete block basement and clad with wood siding. It has a hip roof covered with asphalt shingles and gable dormers. It has a full-width, hip-roof, wood porch with metal railings, an unadorned frieze band, and supports consisting of two faux stone corner piers and one low faux stone pedestal topped by a square wood pier. Its front façade has an off-center door and a strip of three non-original double-hung windows. Both the front and side dormers each feature a strip of three windows, although those on the front façade dormer are covered with plywood. This home lacks integrity and does not have sufficient distinguishing architectural features to qualify as individually eligible for listing on the National Register.



Integrity:			Additional Notes/Descriptions
Unaltered	Slight Modification	Major Alteration	Replacement windows, some in- filled with plywood
Condition:			
Excellent	Good	Poor	
Additional Alteration	ons		
Structu	re Usage	Exterior Wall Surface	
Current: NA		Wood	
Historic: NA			
Roof Material	Roof Features	Roof Type	
Asphalt	Gable dormers	Hip	
Ornamental Archit	ectural Details		Windows
None			Double-hung
Outbuildings (Num	ber and Description)		
None			

Local Landmark	Y <u>N</u>	
National Register Historic Places	Y <u>N</u>	
National Register Historic District	Y <u>N</u>	Name:
Individually Eligible? No	A B C	Significance:

Additional Comments:			



Historical Resource Recordation Form



Property Description:

Stories: 2

This multi-family residential building in the Roseland community is clad with synthetic siding and has a flat roof and parapet. Its front façade has an off-center door with a sidelight in-filled with plywood. It has strips of three, non-original, single-pane windows on the first and second floors that appear to be casements and a single one-over-one window on the second floor, directly above the entrance. Doric columns support the hip roof of the porch. The wood rails and steps do not appear to be original. A plain wood cornice is situated directly above the second floor windows. This home lacks integrity and does not have sufficient distinguishing architectural features to qualify as individually eligible for listing on the National Register.



Integrity:			Additional Notes/Descriptions
Unaltered	Slight Modification	n Major Alteration	Replacement door, cladding, and windows
Condition:			
Excellent	Good	Poor	
Additional Alterati	ons		
Structure Usage Exterior Wall Surface			
Current: NA		Synthetic siding	
Historic: NA			
Roof Material	Roof Features	Roof Type	
Asphalt	Parapet	Flat	
Ornamental Archit	tectural Details		Windows
Doric columns on porch			Double-hung, casement
Outbuildings (Num	ber and Description)		
None			

Local Landmark	Y <u>N</u>	
National Register Historic Places	Y <u>N</u>	
National Register Historic District	Y <u>N</u>	Name:
Individually Eligible? No	A B C	Significance:

Additional Comments:		



Historical Resource Recordation Form

Property Name	Photos with Captions: North façade a two-story, multi-family, frame residence.
Historic: Bldg. not labeled, not in CHRS	
Common/Current: Unknown	
Property Address:	
309 W. 113th Street	
HAARGIS Number:	
Not in database	
Present Owner and /or Occupant:	· · · · · · · · · · · · · · · · · · ·
Unknown	
Property Use	
Historic: Single family residence	
Current: Multi-family residence	
Date of Construction: 1904	
Architect's Name: Not in CHRS	
Builder/Contractor: Not in CHRS	
Architectural Style:	1
Vernacular	
Prepared By: J. Martinez, M. C. Bird, J. Guarino	
Photo By: S. Katz	
Date: 26 September 2012	

Property Description:

Stories: 2

This two-story house in the Roseland community is clad with synthetic siding. It has a hip-on-gable roof covered with asphalt shingles and side elevations with gable wall dormers. It has a full-width, gabled-roof wood porch with supports consisting of wood posts atop faux stone pedestals. The front elevation has an off-center non-original, hollow core, paneled, metal door with fanlight. There are a pair of non-original one-over-one windows on the first floor and three non-original one-over-one windows on the second floor, including two that are paired. This home lacks integrity and does not have sufficient distinguishing architectural features to qualify as individually eligible for listing on the National Register.




Integrity:			Additional Notes/Descriptions
Unaltered	Slight Modification	n Major Alteration	Replacement door, windows, cladding
Condition:			
<u>Excellent</u>	Good	Poor	
Additional Alteration	ons		
Structu	ire Usage	Exterior Wall Surface	
Current: NA		Synthetic siding	
Historic: NA			
Roof Material	Roof Features	Roof Type	
Asphalt	Dormer	Hipped gable	
Ornamental Archit	tectural Details		Windows
None			Double-hung
Outbuildings (Num	ber and Description)		
None			

Local Landmark	Y <u>N</u>	
National Register Historic Places	Y <u>N</u>	
National Register Historic District	Y <u>N</u>	Name:
Individually Eligible? No	A B C	Significance:

Additional Comments:			



Historical Resource Recordation Form

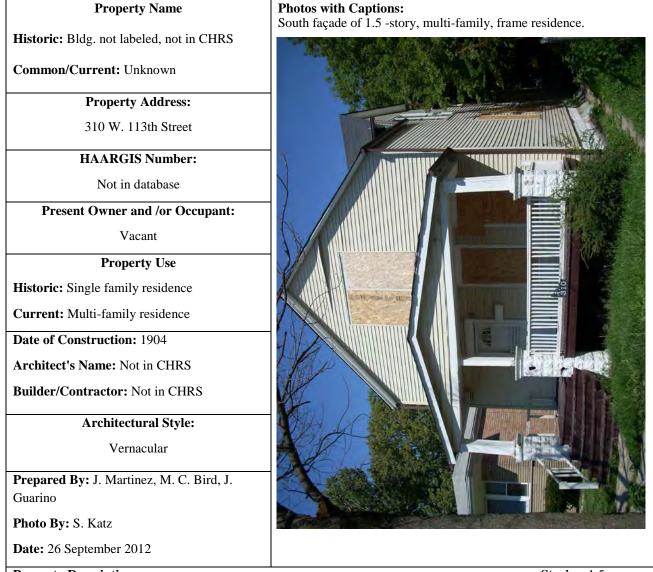

Property Description:

Stories: 1.5

This one and a half-story house in the Roseland community is clad with synthetic siding and has a crossgabled roof covered with asphalt shingles. It has a full-width, gable-roofed, wood porch with supports consisting of low faux stone pedestals topped by square wood piers. The front elevation also features an off-center hollow core paneled metal door with fanlight, two window openings on the first floor and paired windows on the second floor. All front elevation window openings have been covered with plywood. This home is in deteriorated condition, lacks integrity, and does not have sufficient distinguishing architectural features to qualify as individually eligible for listing on the National Register.



Integrity:			Additional Notes/Descriptions
Unaltered	Slight Modification	Major Alteration	Replacement door & cladding, windows covered with plywood
Condition:			
Excellent	Good	Poor	
Additional Alteration	ons		
Structu	re Usage	Exterior Wall Surface	
Current: NA		Synthetic siding	
Historic: NA			
Roof Material	Roof Features	Roof Type	
Asphalt	None	Cross-Gable	
Ornamental Archit	ectural Details		Windows
None			Unknown
Outbuildings (Num	ber and Description)		·
None			

Local Landmark	Y <u>N</u>	
National Register Historic Places	Y <u>N</u>	
National Register Historic District	Y <u>N</u>	Name:
Individually Eligible? No	A B C	Significance:

Additional Comments:			



Historical Resource Recordation Form

Property Name	Photos with Captions:
Historic: Bldg. not labeled, not in CHRS	South façade of a brick, one-story, single family residence.
Common/Current: Unknown	
Property Address:	
312 W 113th Street	
HAARGIS Number:	
Not in database	
Present Owner and /or Occupant:	
Unknown	
Property Use	
Historic: Single family residence	
Current: Single family residence	
Date of Construction: 1962	
Architect's Name: Not in CHRS	
Builder/Contractor: Not in CHRS	
Architectural Style:	
Vernacular	
Prepared By: J. Martinez, M. C. Bird, J.	
Guarino	
Photo By: S. Katz	
Date: 26 September 2012	
Description of the Description	

Property Description:

Stories: 1

This one-story house in the Roseland community is situated on a raised basement and has a hip roof covered with asphalt shingles and a front overhang. Its front elevation is clad in buff brick, has an off-center door with concrete steps and metal railings, and features a picture window flanked by one-over-one windows. Glass block windows provide light to the basement. Contrasting orange-colored brick trims the entrance. This building does not feature sufficient distinguishing architectural features to qualify as individually eligible for listing on the National Register.




Integrity:			Additional Notes/Descriptions
<u>Unaltered</u>	Slight Modification	Major Alteration	
Condition:			
Excellent	Good	Poor	
Additional Alterati	ons		
Structu	ire Usage	Exterior Wall Surface	
Current: NA		Brick	
Historic: NA			
Roof Material	Roof Features	Roof Type	
Asphalt	None	Hip	
Ornamental Archit	ectural Details		Windows
None			Double-hung, fixed-pane, glass block
Outbuildings (Num	ber and Description)		
None			

Local Landmark	Y <u>N</u>	
National Register Historic Places	Y <u>N</u>	
National Register Historic District	Y <u>N</u>	Name:
Individually Eligible? No	A B C	Significance:

Additional Comments:			



Historical Resource Recordation Form

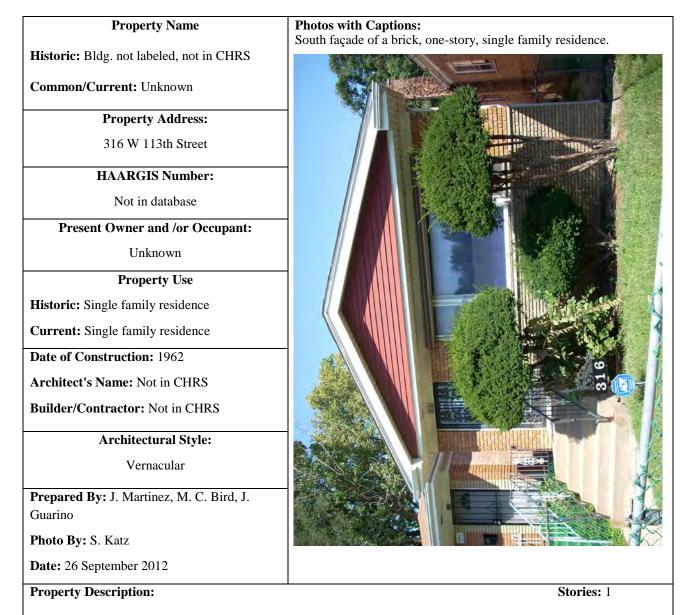

This one-story house in the Roseland community is situated on a raised basement, has a front gable roof covered with asphalt shingles, and a front overhang. Its front elevation is clad in buff brick below the sill line and orange brick above. It has an off-center door with concrete steps and metal railings and a picture window flanked by one-over-one windows. This building does not feature sufficient distinguishing architectural features to qualify as individually eligible for listing on the National Register.



Integrity:			Additional Notes/Descriptions
<u>Unaltered</u>	Slight Modification	Major Alteration	
Condition:			
Excellent	Good	Poor	
Additional Alterati	ons		
Structu	ire Usage	Exterior Wall Surface	
Current: NA		Brick	
Historic: NA			
Roof Material	Roof Features	Roof Type	
Asphalt	None	Gable	
Ornamental Archit	ectural Details		Windows
None			Double-hung, fixed-pane
Outbuildings (Num	ber and Description)		·
None			

Local Landmark	Y <u>N</u>	
National Register Historic Places	Y <u>N</u>	
National Register Historic District	Y <u>N</u>	Name:
Individually Eligible? No	A B C	Significance:



Historical Resource Recordation Form

Property Name	Photos with Captions:
	South façade of a brick, one-story, single family residence.
Historic: Bldg. not labeled, not in CHRS	
Common/Current: Unknown	
Property Address:	
320 W 113th Street	
HAARGIS Number:	
Not in database	
Present Owner and /or Occupant:	
Unknown	
Property Use	
Historic: Single family residence	
Current: Single family residence	
Date of Construction: 1962	
Architect's Name: Not in CHRS	
Builder/Contractor: Not in CHRS	
Architectural Style:	
Vernacular	
Prepared By: J. Martinez, M. C. Bird, J.	
Guarino	
Photo By: S. Katz	
Date: 26 September 2012	

Property Description:

Stories: 1

This one-story house in the Roseland community is situated on a raised basement and has a hip roof covered with asphalt shingles and a front overhang. Its front elevation is clad with orange face brick, has an off-center door with concrete steps and metal railings, and a picture window flanked by one-over-one windows. This building does not feature sufficient distinguishing architectural features to qualify as individually eligible for listing on the National Register.



Integrity:			Additional Notes/Descriptions
<u>Unaltered</u>	Slight Modification	Major Alteration	
C			
Condition:			
Excellent	Good	Poor	
Additional Alterati	ons		
Structu	ire Usage	Exterior Wall Surface	
Current: NA		Brick	
Historic: NA			
Roof Material	Roof Features	Roof Type	
Asphalt	None	Hip	
Ornamental Archit	ectural Details		Windows
None			Double-hung, fixed-pane
Outbuildings (Num	ber and Description)		
None			

Local Landmark	Y <u>N</u>	
National Register Historic Places	Y <u>N</u>	
National Register Historic District	Y <u>N</u>	Name:
Individually Eligible? No	A B C	Significance:

Additional Comments:			



Historical Resource Recordation Form

Property Name	Photos with Captions: North and east façades of 1.5-story, frame, single-family residence.
Historic: Not labeled, not in CHRS	North and east façades of 1.5-story, frame, single-family residence.
Common/Current: Unknown	
Property address:	
337 W. 113th Street	
HAARGIS Number:	
Not in database	
Present Owner and /or Occupant:	
Unknown	
Property Use	
Historic: Single family residence	
Current: Single family residence	
Date of Construction: 1910	
Architect's Name: Not in CHRS	
Builder/Contractor: Not in CHRS	
Architectural Style:	
Vernacular	
Prepared By: C. Tolmie, M. C. Bird, J.	
Guarino	
Photo By: S. Katz	
Date: 16 September 2012	

Property Description:

Stories: 1.5

This one-and-a-half-story house in the Roseland community is situated on a raised concrete block basement with glass block windows and is clad with synthetic siding. The building has a gable roof covered with asphalt shingles. The front elevation has a hip-roof, full-width porch with faux stone piers topped by squat squared wood column supports, wood steps and straight wood railings. It also has an off-center entrance with a metal storm door, a strip of three windows on the first floor, and two windows on the second. Windows throughout the house are non-original one-over-one aluminum-sash. The east elevation has a three-sided bay window on the first floor with a gable wall dormer above. This house lacks integrity and distinctive architectural features and is not individually eligible for listing on the National Register.




Integrity:			Additional Notes/Descriptions
Unaltered	Slight Modification	n Major Alteration	Replacement windows and cladding
Condition:			
Excellent	Good	Poor	
Additional Alterati	ions		
Structu	ıre Usage	Exterior Wall Surface	
Current: NA		Synthetic siding	
Historic: NA			
Roof Material	Roof Features	Roof Type	
Asphalt shingle	Dormer	Gable	
Ornamental Archit	tectural Details		Windows
Squat, square colum	ins on porch		Double-hung, glass block
Outbuildings (Num	iber and Description)		·
Garage			

Local Landmark	Y <u>N</u>	
National Register Historic Places	Y <u>N</u>	
National Register Historic District	Y <u>N</u>	Name:
Individually Eligible? No	A B C	Significance:

Additional Comments:		



Historical Resource Recordation Form

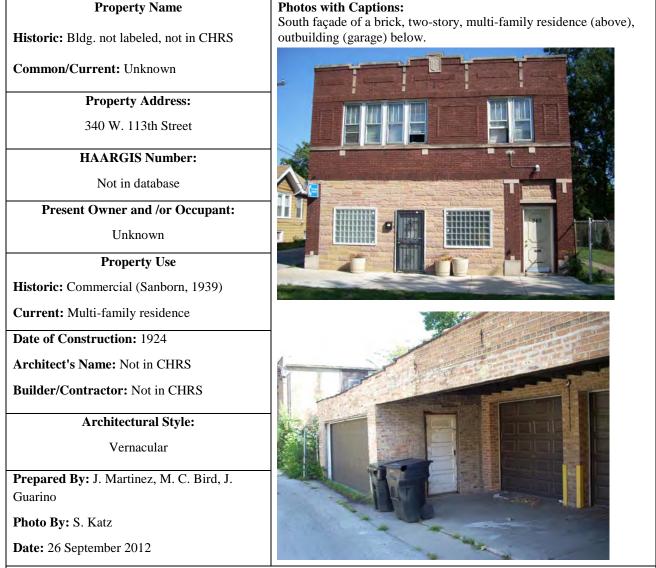

Property Description:

Stories: 2

This two-story residential building in the Roseland community has a flat roof and crenellated parapet with concrete coping. Its front elevation is clad in brown face brick and its side elevations are clad in common brick. The front elevation features two hollow core metal doors, the outline of a former storefront that has been in-filled with faux stone and two glass block windows, and six three-over-one wood-sash windows on the second floor. The original off-center entrance that provides access to the second floor apartment has a transom that is in-filled with faux stone. Detailing includes a concrete sill course, inset brick panels, and a parapet that features small decorative concrete insert blocks and a centrally located stone panel with shield. This building lacks integrity and does not have sufficient distinguishing architectural features to qualify as individually eligible for listing on the National Register.



Integrity:			Additional Notes/Descriptions
Unaltered	Slight Modification	Major Alteration	Replacement door, storefront
			windows in-filled, transom in-
			filled
Condition:			
<u>Excellent</u>	Good	Poor	
Additional Alteration	ons		
None			
Structu	re Usage	Exterior Wall Surface	
Current: NA		Brick	
Historic: NA			
Roof Material	Roof Features	Roof Type	
Unknown	Parapet	Flat	
Ornamental Archite	ectural Details		Windows
	insert blocks and stone par	nel with shield on parapet	Double-hung, fixed-pane, glass block
Outbuildings (Num	ber and Description)		
One-story brick garage	ge with parapet (tile coping	g)	

Local Landmark	Y <u>N</u>	
National Register Historic Places	Y <u>N</u>	
National Register Historic District	Y <u>N</u>	Name:
Individually Eligible? No	A B C	Significance:

Additional Comments:			



Historical Resource Recordation Form

Property Name	Photos with Captions:
	North and west façades of 1.5-story, single family, frame residence.
Historic: Not labeled, not in CHRS	
Common/Current: Unknown	
Property address:	
345 W. 113th Street	
HAARGIS Number:	
Not in database	
Present Owner and /or Occupant:	
Unknown	
Property Use	
Historic: Single family residence	
Current: Single family residence	
Date of Construction: 1911	
Architect's Name: Not in CHRS	
Builder/Contractor: Not in CHRS	
Architectural Style:	
Vernacular	
Prepared By: C. Tolmie, M. C. Bird, J.	
Guarino	
Photo By: S. Katz	
Date: 16 September 2012	

Property Description:

Stories: 1.5

This one-and-a-half-story house in the Roseland community is situated on a raised concrete block basement with glass block windows and is clad with synthetic siding. The building has a front gable roof covered with asphalt shingles. The front elevation has a hip-roof full-width porch with faux stone piers beneath the wood deck, squared wood column supports, wood steps, and straight wood railings. There is an off-center non-original hollow core metal door, a strip of three windows on the first floor, and two windows on the second. Windows are non-original one-over-one aluminum-sash. This house lacks integrity and distinctive architectural features and is not individually eligible for listing on the National Register.



Integrity:			Additional Notes/Descriptions
Unaltered	Slight Modification	Major Alteration	Replacement windows, cladding, porch rails and supports
Condition:			
Excellent	Good	Poor	
Additional Alterati	ons		
Structu	ire Usage	Exterior Wall Surface	
Current: NA		Synthetic siding	
Historic: NA			
Roof Material	Roof Features	Roof Type	
Asphalt shingle	None	Gable	
Ornamental Archit	tectural Details		Windows
None			Double-hung, glass block
Outbuildings (Num	ber and Description)		
Garage			

Local Landmark	Y <u>N</u>	
National Register Historic Places	Y <u>N</u>	
National Register Historic District	Y <u>N</u>	Name:
Individually Eligible? No	A B C	Significance:

Additional Comments:		



Historical Resource Recordation Form

Property Name	Photos with Captions:
Historic: Bldg. not labeled, not in CHRS	North façade of a 1.5-story, single family, frame residence.
Historic. Didg. not labeled, not in Critks	
Common/Current: Unknown	
Property Address:	
41 W. 114th Place	
HAARGIS Number:	
Not in database	
Present Owner and /or Occupant:	
Unknown	
Property Use	
Historic: Single family residence	
Current: Single family residence	
Date of Construction: 1889	
Architect's Name: Not in CHRS	
Builder/Contractor: Not in CHRS	
Architectural Style:	
Vernacular	
Prepared By: J. Martinez, M. C. Bird, J.	
Guarino	
Photo By: S. Katz	
Date: 22 October 2012	

Property Description:

Stories: 1.5

This one-and-a-half-story frame house in the Roseland community is situated on a raised concrete block basement and is covered with synthetic siding. The building has a front gable roof covered with asphalt shingles and a second story rear shed-roof addition. It has a full-width, gable-roof sun porch, half of which is enclosed and has three non-original one-over-one aluminum-sash windows on the front elevation. The open half of the porch is accessed via concrete steps with metal railings. A pair of non-original one-overone aluminum-sash windows is situated in the gable. This house lacks integrity and distinctive architectural features and is not individually eligible for listing on the National Register.



Structural Survey

Integrity:			Additional Notes/Descriptions
Unaltered	Slight Modification	Major Alteration	Replacement windows, cladding, and porch rails
Condition:			
Excellent	Good	Poor	
Additional Alteration	ons		
Shed roof addition to	o rear of building.		
Structu	ire Usage	Exterior Wall Surface	
Current: NA		Synthetic siding	
Historic: NA			
Roof Material	Roof Features	Roof Type	
Asphalt shingle	None	Gable	
Ornamental Archit	ectural Details		Windows
None			Double-hung
Outbuildings (Num	ber and Description)		
None			

Local Landmark	Y	<u>N</u>	
National Register Historic Places	Y	<u>N</u>	
National Register Historic District	Y	<u>N</u>	Name:
Individually Eligible? No	A	B C	Significance:

Additional Comments:



Property Name Photos with Captions: South façade of a one-story, single family, frame residence. Historic: Bldg. not labeled, not in CHRS Common/Current: Unknown **Property Address:** 62 W. 114th Place HAARGIS Number: Not in database Present Owner and /or Occupant: Vacant **Property Use** Historic: Single family residence Current: Single family residence **Date of Construction:** Architect's Name: Not in CHRS Builder/Contractor: Not in CHRS **Architectural Style:** Craftsman Prepared By: J. Martinez, M. C. Bird, J. Guarino Photo By: S. Katz **Date:** 22 October 2012 **Property Description:** Stories: 1

Historical Resource Recordation Form

This vacant one-story, frame bungalow in the Roseland community is situated on a raised concrete block basement and is covered with synthetic siding. The building has a front gable roof covered with asphalt shingles. The front elevation has a recessed wood corner porch with a faux stone corner pier topped by a squat, squared wood column. the door and first floor windows are covered with plywood. There are two original wood casement windows in the attic. This house lacks integrity and distinctive architectural features and is not individually eligible for listing on the National Register.



Integrity:			Additional Notes/Descriptions
			-
Unaltered	Slight Modification	Major Alteration	Replacement cladding
Condition:			
Excellent	Good	Poor	
Additional Alterati	ons		
Structu	ire Usage	Exterior Wall Surface	
Current: NA		Synthetic siding	
Historic: NA			
Roof Material	Roof Features	Roof Type	
Asphalt shingles	None	Gable	
Ornamental Archit	tectural Details		Windows
Squat, square colum	ns		Casement, covered
Outbuildings (Num	ber and Description)		
None			

Local Landmark	Y <u>N</u>	
National Register Historic Places	Y <u>N</u>	
National Register Historic District	Y <u>N</u>	Name:
Individually Eligible? No	A B C	Significance:

Additional Comments:			



Historical Resource Recordation Form

Property Name	Photos with Captions: North façade of one-story, single family, frame residence.
Historic: Bldg. not labeled, not in CHRS	Torui laçade of one story, single family, frame restacted.
Common/Current: Unknown	
Property Address:	
131 W. 114th Street	
HAARGIS Number:	
Not in database	
Present Owner and /or Occupant:	
Unknown	
Property Use	
Historic: Single family residence	
Current: Single family residence	
Date of Construction: 1903	
Architect's Name: Not in CHRS	
Builder/Contractor: Not in CHRS	
Architectural Style:	
Vernacular	
Prepared By: J. Martinez, M. C. Bird, J.	
Guarino	
Photo By: S. Katz	and the second
Date: 1 October 2012	

Property Description:

Stories: 1

This one-story home in the Roseland community is situated on a raised concrete block basement, is clad in synthetic siding, and has a side gable roof covered with asphalt shingles. The peaks of the side gables are clad in wood board-and-batten. The front façade of the home has a projecting gabled entrance vestibule with a small casement window, concrete steps with metal railings, and a larger window opening that is partially obscured by a low metal awning. Non-original double-hung windows are used elsewhere. Scalloped verge boards frame the projecting gable. A rear, dormer addition is visible from the street. This building lacks sufficient integrity and distinguishing architectural features to qualify as individually eligible for listing on the National Register.




Integrity:			Additional Notes/Descriptions
Unaltered	Slight Modification	Major Alteration	Replacement siding and windows
	-	·	
Condition:			
Excellent	Good	Poor	
Additional Alterati	ons		
Rear dormer addition	n		
Structu	ire Usage	Exterior Wall Surface	
Current: NA		Synthetic siding	
Historic: NA			
Roof Material	Roof Features	Roof Type	
Asphalt	Dormer	Gable	
Ornamental Archit	ectural Details		Windows
None			Double-hung, fixed-pane,
			casement
Outbuildings (Num	ber and Description)		
None			

Local Landmark	Y <u>N</u>	
National Register Historic Places	Y <u>N</u>	
National Register Historic District	Y <u>N</u>	Name:
Individually Eligible? No	A B C	Significance:

Additional Comments:			



Historical Resource Recordation Form

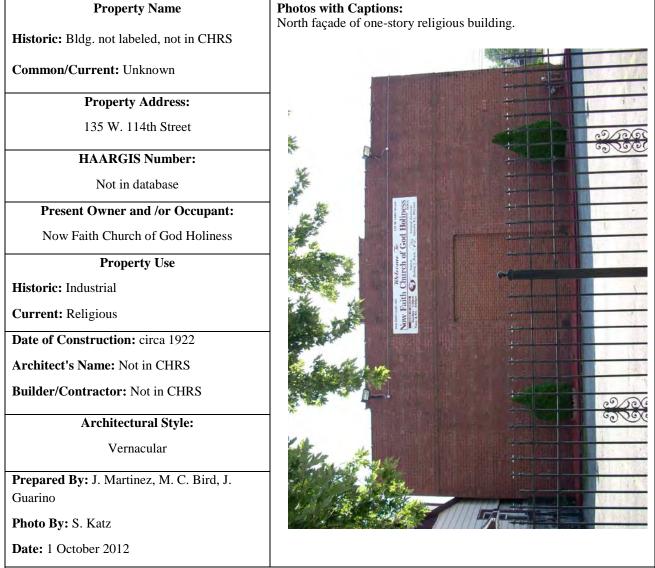

Property Description:

Stories: 1

This one-story, brick-clad, former industrial building in the Roseland community has a flat roof and a stepped parapet with tile coping. The front façade displays the outline of a former overhead door opening that has been in-filled with brick. One of the side elevations features three metal core doors that provide access to the Now Faith of God Holiness Church, the building's current occupant. Decorative details include brick stringcourses. This building lacks sufficient integrity and distinguishing architectural features to qualify as individually eligible for listing on the National Register.



Integrity:			Additional Notes/Descriptions
Unaltered	Slight Modification	on Major Alteration	Brick in-fills old service garage entrance
Condition:			
<u>Excellent</u>	Good	Poor	
Additional Alterati	ons		
Structu	ire Usage	Exterior Wall Surface	
Current: NA		Brick	
Historic: NA			
Roof Material	Roof Features	Roof Type	
Unknown	Parapet	Flat	
Ornamental Architectural Details			Windows
Stepped parapet with tile coping, brick stringcourses.			NA
Outbuildings (Num	ber and Description)		
None			

Local Landmark	Y <u>N</u>	
National Register Historic Places	Y <u>N</u>	
National Register Historic District	Y <u>N</u>	Name:
Individually Eligible? No	A B C	Significance:

Additional Comments:		



Historical Resource Recordation Form

Property Name	Photos with Captions: South façade of a one-story, single family, frame residence.
Historic: Bldg. not labeled, not in CHRS	
Common/Current: Unknown	
Property Address:	
138 W. 114th Street	
HAARGIS Number:	
Not in database	
Present Owner and /or Occupant:	
Unknown	
Property Use	
Historic: Single family residence	
Current: Single family residence	
Date of Construction: 1909	
Architect's Name: Not in CHRS	
Builder/Contractor: Not in CHRS	
Architectural Style:	
Vernacular	
Prepared By: J. Martinez, M. C. Bird, J.	
Guarino	
Photo By: S. Katz	
Date: 22 October 2012	A REAL PROPERTY OF A REAL PROPER

Property Description:

Stories: 1

This one-story house in the Roseland community is situated on a raised concrete block basement and is covered with synthetic siding. The building has a front gable roof covered with asphalt shingles. Its front elevation has a full-width hip-roof wood porch with non-original straight posts and railings, an off-center entrance with a metal storm door, and two non-original one-over-one aluminum-sash windows. A small ventilating louver is situated in the attic gable. This house lacks integrity and distinctive architectural features and is not individually eligible for listing on the National Register.



Integrity:			Additional Notes/Descriptions
Unaltered	Slight Modification	n Major Alteration	Replacement windows, cladding, and porch rails and posts
Condition:			
<u>Excellent</u>	Good	Poor	
Additional Alterati	ons		
Structu	ire Usage	Exterior Wall Surface	
Current: NA		Synthetic siding	
Historic: NA			
Roof Material	Roof Features	Roof Type	
Asphalt shingle	None	Gable	
Ornamental Archit	tectural Details		Windows
None			Double-hung
Outbuildings (Num	ber and Description)		
None			

Local Landmark	Y <u>N</u>	
National Register Historic Places	Y <u>N</u>	
National Register Historic District	Y <u>N</u>	Name:
Individually Eligible? No	A B C	Significance:

Additional Comments:	



Historical Resource Recordation Form

Property Name	Photos with Captions: North façade of a brick, one-story, single family residence.
Historic: Bldg. not labeled, not in CHRS	Norm raçade of a brick, one story, single raimly residence.
Common/Current: Unknown	
Property Address:	
235 W. 114th Street	
HAARGIS Number:	
Not in database	
Present Owner and /or Occupant:	
Unknown	
Property Use	
Historic: Single family residence	
Current: Single family residence	
Date of Construction: 1964	
Architect's Name: Not in CHRS	
Builder/Contractor: Not in CHRS	
Architectural Style:	
Vernacular	
Prepared By: J. Martinez, M. C. Bird, J.	
Guarino	
Photo By: S. Katz	
Date: 22 October 2012	
Property Description:	Stories: 1

Property Description:

Stories: 1

This one-story house at the southwest corner of 114th Street and Yale Avenue in the Roseland community is situated on a raised brick basement and is clad with yellow face brick along its street elevations. The building has a hip roof covered with asphalt shingles and overhanging eaves. The front elevation has a picture window flanked by one-over-one aluminum-sash windows and an off-center door. This elevation also has a partial-width porch with open metal posts covered by the wide roof overhang, concrete steps, and metal railings. Detailing includes stones flanking the front door and decorative glass blocks on both street elevations. This house lacks distinctive architectural features and is not individually eligible for listing on the National Register.



Integrity:			Additional Notes/Descriptions
<u>Unaltered</u>	Slight Modification	Major Alteration	
Condition:			
<u>Excellent</u>	Good	Poor	
Additional Alteration	ons		
Structu	re Usage	Exterior Wall Surface	
Current: NA		Brick	
Historic: NA			
Roof Material	Roof Features	Roof Type	
Asphalt shingle	None	Hip	
Ornamental Archit	ectural Details		Windows
Decorative glass blocks, stone flanking entrance			Double-hung, fixed-pane, glass block
Outbuildings (Num	ber and Description)		
None			

Local Landmark	Y	<u>N</u>	
National Register Historic Places	Y	<u>N</u>	
National Register Historic District	Y	<u>N</u>	Name:
Individually Eligible? No	A	B C	Significance:



Historical Resource Recordation Form

Property Name	Photos with Captions: South and west façades of a 1.5-story, multi-family, frame residence.
Historic: Bldg. not labeled, not in CHRS	South and west façades of a 1.5-story, multi-family, mane residence.
Common/Current: Unknown	
Property Address:	
324 W. 114th Street	
HAARGIS Number:	
Not in database	
Present Owner and /or Occupant:	
Unknown	
Property Use	
Historic: Single family residence	
Current: Multi-family residence	
Date of Construction: 1907	
Architect's Name: Not in CHRS	
Builder/Contractor: Not in CHRS	
Architectural Style:	
Vernacular	
Prepared By: J. Martinez, M. C. Bird, J.	
Guarino	
Photo By: S. Katz	
Date: 22 October 2012	

Property Description:

Stories: 1.5

This one-and-a-half-story house in the Roseland community is situated on a raised concrete block basement with casement windows and is covered with synthetic siding. The building has a cross-gable roof covered with asphalt shingles. Its front elevation has two off-center doors and a partial-width shed-roof porch with wood steps, metal railings and open metal supports. It also has a three-sided bay window on the first floor and a pair of windows in the gable. Windows are non-original one-over-one aluminum-sash. The central window of the bay features a transom. This house lacks integrity and distinctive architectural features and is not individually eligible for listing on the National Register.




Integrity:			Additional Notes/Descriptions
Unaltered	Slight Modificati	on Major Alteration	Replacement doors, windows, and cladding
Condition:			
Excellent	Good	Poor	
Additional Alteration	ons		
Converted from sing	le family to multi-famil	y after 1938 (Sanborn).	
Structu	re Usage	Exterior Wall Surface	
Current: NA		Synthetic siding	
Historic: NA			
Roof Material	Roof Features	Roof Type	
Asphalt shingle	None	Cross-gable roof	
Ornamental Archit	ectural Details		Windows
None			Double-hung, fixed-pane
			(transom), casement
Outbuildings (Num	ber and Description)		
None			

Local Landmark	Y <u>N</u>	
National Register Historic Places	Y <u>N</u>	
National Register Historic District	Y <u>N</u>	Name:
Individually Eligible? No	A B C	Significance:

ments:



Historical Resource Recordation Form

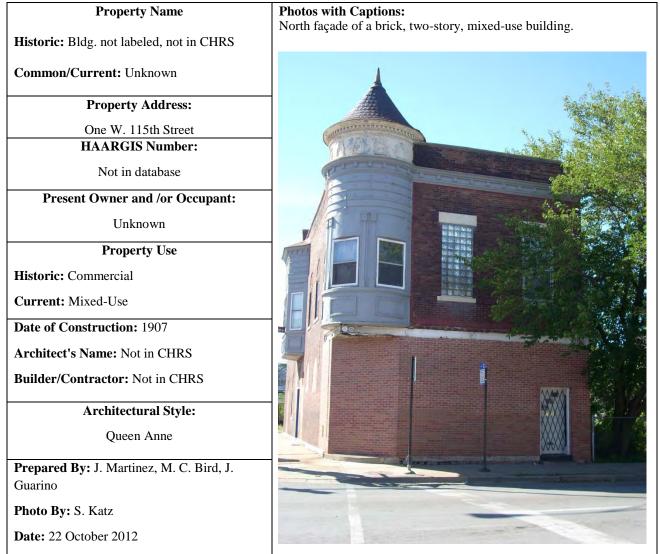

Property Description:

Stories: 2

This two-story Queen Anne style commercial building at the southwest corner of 115th and State streets in the West Pullman community is clad with brick and has a flat roof and parapet. The first floor of both street elevations has been drastically altered by the removal of the corner storefront and the infill of virtually all door, window, and round-arch transom openings with brick. The first floor of the front (115th Street) elevation currently features a single, non-original, off-center hollow core metal door. The first floor of the State Street elevation has a centrally-located non-original hollow core metal door and a single non-original one-over-one aluminum-sash window. The second floor, however, retains its original metal corner turret with conical roof and a three-sided metal window bay on the State Street elevation. Both bays have rectangular panels at their bases and dentil molding, and the turret features decorative pilasters. However, the windows in both the bay and turret are non-original. The second floor of the 115th street elevation has a non-original glass block window and an aluminum-sash window, both of which have stone sills and lintels. The second floor of the State Street elevation has a series of non-original one-over-one aluminum-sash windows with rounded transoms that have been in-filled with brick. This building lacks integrity and is not



individually eligible for listing on the National Register.

Structural Survey

Integrity:			Additional Notes/Descriptions
Unaltered	Slight Modification	on Major Alteration	Replacement windows, storefronts, openings in-filled
Condition:			
Excellent	Good	Poor	
Additional Alterati	ons		
Structu	ire Usage	Exterior Wall Surface	
Current: NA		Brick	
Historic: NA			
Roof Material	Roof Features	Roof Type	
Unknown	Parapet	Flat	
Ornamental Archit	tectural Details	Windows	
Metal turret with conical roof and pilasters, metal bays with panels and dentil molding, stone lintels and sills, cornice			Double-hung, glass block
Outbuildings (Num	ber and Description)		
None			

Local Landmark	Y <u>N</u>	
National Register Historic Places	Y <u>N</u>	
National Register Historic District	Y <u>N</u>	Name:
Individually Eligible? No	A B C	Significance:

Additional Comments:



Historical Resource Recordation Form

Property Name	Photos with Captions:
Historia Dillo and bland in CUDS	South façade of a greystone, two-flat residence.
Historic: Bldg. not labeled, not in CHRS	
Common/Current: Unknown	
Property Address:	
8 W. 115th Street	
HAARGIS Number:	
Not in database	
Present Owner and /or Occupant:	
Unknown	
Property Use	
Historic: Single family residence	
Current: Flat	
Date of Construction: 1903	
Architect's Name: Not in CHRS	
Builder/Contractor: Not in CHRS	
Architectural Style:	
Vernacular	
Prepared By: J. Martinez, M. C. Bird, J.	
Guarino	
Photo By: S. Katz	to the second se
Date: 22 October 2012	

Property Description:

Stories: 2

This two-flat residential building in the Roseland community is situated on a raised basement and is clad with rusticated limestone on its front elevation and common brick along its side and rear elevations. The building has a flat roof and parapet. Its front elevation has a full-height three-sided window bay pavilion, a partial-width stone porch with Corinthian columns and balustrade, and an off-center entrance with metal storm door. There is a secondary entrance to the lower level. The first floor window bay has a non-original central fixed-pane window with multiple lights and flanking nine-over-one windows. The second floor of the front elevation has four non-original one-over-one aluminum-sash windows—three on the bay and one above the entrance. Casement windows provide light to the basement. Detailing includes smooth stone sill courses, belt courses, and a cornice with dentil molding.

This is an example of a greystone, a building type that the City of Chicago has recognized through its Historic Greystone Initiative. However, there are thousands of greystone residential buildings in Chicago and this particular example does not stand out among the city's stock of this residential building type. As a result, it does not qualify as



individually eligible for listing on the National Register.

Structural Survey

Integrity:			Additional Notes/Descriptions
Unaltered	Slight Modification	n Major Alteration	Replacement windows & door
Condition:			
Excellent	Good	Poor	
Additional Alterati	ons		
Structu	ire Usage	Exterior Wall Surface	
Current: NA		Stone (façade),	
Historic: NA		Brick (sides and rear)	
Roof Material	Roof Features	Roof Type	
Unknown	Parapet	Flat	
Ornamental Archit	tectural Details		Windows
Corinthian columns cornice with dentils	and stone balustrade, ston	Double-hung, fixed-pane	
Outbuildings (Num	ber and Description)		
None			

Local Landmark	Y <u>N</u>	
National Register Historic Places	Y <u>N</u>	
National Register Historic District	Y <u>N</u>	Name:
Individually Eligible? No	A B C	Significance:

Additional Comments:



Historical Resource Recordation Form

Property Name	Photos with Captions: North and east façades of two-flat greystone residence.
Historic: Not labeled, not in CHRS	North and east raçades of two-flat greystone residence.
Common/Current: Unknown	
Property Address:	
17 W. 115th Street	
HAARGIS Number:	
Not in database	
Present Owner and /or Occupant:	
Unknown	
Property Use	
Historic: Single family residence	
Current: Flat	
Date of Construction: 1897	
Architect's Name: Not in CHRS	
Builder/Contractor: Not in CHRS	
Architectural Style:	
Vernacular	
Prepared By: C. Tolmie, M. C. Bird, J.	
Guarino	
Photo By: S. Katz	
Date: 10 September 2012	

Property Description:

Stories: 2

This two-flat residential building in the West Pullman community is situated on a raised basement and has a front façade clad with limestone; common brick cover both the sides and rear. The building has a full-height three-sided window bay pavilion, flat roof, and a shaped parapet with a pediment above the bay. Its off-center, flat-roofed porch has concrete steps, metal railings, Doric columns, and a non-original metal door with transom. Windows are non-original one-over-one and those on the second floor feature transoms. Detailing includes continuous banding in rusticated limestone and a metal cornice.

This is an example of a greystone, a popular historic residential building type that the City of Chicago has recognized through its Historic Greystone Initiative, which offers technical assistance and financial resources to property owners to encourage their preservation. This building does not possess sufficient distinguishing architectural characteristics to qualify for individual listing on the National Register.



Integrity:			Additional Notes/Descriptions
Unaltered	Slight Modification	n Major Alteration	Replacement door and windows
Condition:			
Excellent	Good	Poor	
Additional Alterati	ons		
Structu	ire Usage	Exterior Wall Surface	
Current: NA		Stone (façade),	
Historic: NA		Brick (sides and rear)	
Roof Material	Roof Features	Roof Type	
Unknown	Parapet	Flat	
Ornamental Archit	tectural Details	Windows	
Metal cornice, stone banding, Doric columns on porch			Double-hung
Outbuildings (Num	ber and Description)		
None			

Local Landmark	Y <u>N</u>	
National Register Historic Places	Y <u>N</u>	
National Register Historic District	Y <u>N</u>	Name:
Individually Eligible? No	A B C	Significance:

Additional Comments:			



Photos with Captions: Property Name North façade of a 1.5-story, single family, frame residence. Historic: Not labeled, not in CHRS Common/Current: Unknown **Property Address:** 23 W. 115th Street HAARGIS Number: Not in database **Present Owner and /or Occupant:** Vacant **Property Use** Historic: Single family residence **Current:** Single family residence Date of Construction: 1883 Architect's Name: Not in CHRS Builder/Contractor: Not in CHRS Architectural Style: Vernacular Prepared By: C. Tolmie, M. C. Bird, J. Guarino Photo By: S. Katz Date: 10 September 2012

Historical Resource Recordation Form

Property Description:

Stories: 1.5

This one-and-a-half-story house in the West Pullman community is clad with synthetic siding, has a limestone foundation, and has a gable front roof crossed by hip-on-gable sides. The front elevation has a full-width hip roof porch, a portion of which is enclosed. A shed roof dormer is visible on a side elevation. The open portion of the porch has wood steps and railings, a wood post, and a door opening covered with plywood. Windows are one-over-one aluminum-sash, some of which are covered with plywood. This house does not feature sufficient integrity or distinguishing architectural features to qualify as individually eligible for listing on the National Register.



Integrity:			Additional Notes/Descriptions
Unaltered	Slight Modification	n Major Alteration	Replacement siding and windows, enclosed porch
Condition:			
<u>Excellent</u>	Good	Poor	
Additional Alterati	ons		
Structu	ire Usage	Exterior Wall Surface	
Current: NA		Synthetic siding	
Historic: NA			
Roof Material	Roof Features	Roof Type	
Asphalt shingle	Dormer	Gable/Hipped gable	
Ornamental Archit	tectural Details		Windows
None			Double-hung
Outbuildings (Num	ber and Description)		
None			

Local Landmark	Y <u>N</u>	
National Register Historic Places	Y <u>N</u>	
National Register Historic District	Y <u>N</u>	Name:
Individually Eligible? No	A B C	Significance:

Additional Comments:		



Historical Resource Recordation Form

Property Name	Photos with Captions: North façade of one-story, sheet metal and brick clad, commercial		
Historic: Not labeled, not in CHRS	building.		
Common/Current: Unknown			
Property Address:			
35 W. 115th Street			
HAARGIS Number:			
Not in database			
Present Owner and /or Occupant:			
Donald's Auto Repairs			
Property Use			
Historic: Commercial			
Current: Commercial			
Date of Construction: 1936			
Architect's Name: Not in CHRS			
Builder/Contractor: Not in CHRS			
Architectural Style:			
Vernacular			
Prepared By: C. Tolmie, M. C. Bird, J.			
Guarino			
Photo By: S. Katz			
Date: 10 September 2012			

Property Description:

Stories: 1

This one-story auto repair building at the corner of 115th Street and Lafayette Avenue in the West Pullman community has a flat roof and a V-shaped footprint. Its street elevations are clad with white sheet metal and its rear elevations are clad in common brick. Overhead metal garage doors are situated on either end of the building while the bent front elevation along 115th Street features two metal doors and a series of fixed-pane steel sash windows. Windows along the rear of the building are covered with corrugated metal. This building does not feature sufficient distinguishing architectural features to qualify as individually eligible for listing on the National Register.




Integrity:			Additional Notes/Descriptions
Unaltered	Slight Modification	Major Alteration	Replacement doors; rear windows covered
Condition:			
Excellent	Good	Poor	
Additional Alteration	ons		
Structu	re Usage	Exterior Wall Surface	
Current: NA		Metal (front and sides),	
Historic: NA		Brick (rear)	
Roof Material	Roof Features	Roof Type	
Unknown	None	Flat	
Ornamental Archit	ectural Details		Windows
None			Fixed-pane
Outbuildings (Num	ber and Description)		
None			

Local Landmark	Y <u>N</u>	
National Register Historic Places	Y <u>N</u>	
National Register Historic District	Y <u>N</u>	Name:
Individually Eligible? No	A B C	Significance:

Additional Comments:			



Historical Resource Recordation Form

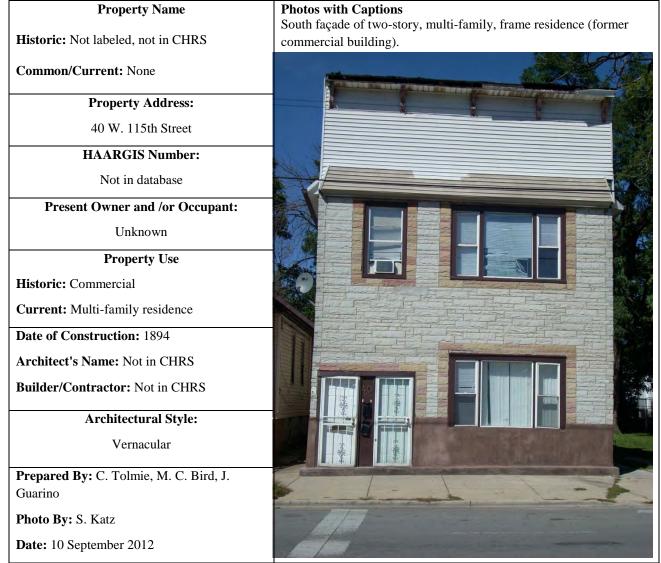

Property Description:

Stories: 2

This two-story residential building in the Roseland community has a flat roof and parapet. Its front façade is mostly clad in synthetic faux stone siding with contrasting colors around the doors and windows. The lowest portion of the façade is covered in stucco; the upper portion is clad in synthetic siding. The front elevation has two hollow metal core doors, Chicago-style windows on the first and second floors, and a single one-over-one window on the second floor. A pent roof is situated above the second floor windows and a bracketed wood cornice is situated at the parapet level. This building lacks integrity, does not have sufficient distinguishing architectural features, and is not individually eligible for listing on the National Register.



Structural Survey

Integrity:			Additional Notes/Descriptions
Unaltered	Slight Alterations	s Major Alterations	Replacement doors, windows, and cladding
Condition:			
<u>Excellent</u>	Good	Poor	
Additional Alterati	ons		
Converted from com	nmercial building to resid		
Structu	ıre Usage	Exterior Wall Surface	
Current: NA		Synthetic siding, faux stone,	
Historic: NA		stucco	
Roof Material	Roof Features	Roof Type	
Unknown	Parapet	Flat	
Ornamental Archit	ectural Details	Windows	
Bracketed cornice			Double-hung, fixed-pane
Outbuildings (Num	nber and Description)		
None			

Local Landmark	Y <u>N</u>	
National Register Historic Places	Y <u>N</u>	
National Register Historic District	Y <u>N</u>	Name:
Individually Eligible? No	A B C	Significance:

Additional Comments:



Photos with Captions Property Name South and west façades of one-story, single family, frame residence. Historic: Not labeled, not in CHRS Common/Current: Unknown **Property Address:** 42 W. 115th Street HAARGIS Number: Not in database **Present Owner and /or Occupant:** Unknown **Property Use** Historic: Single family residence **Current:** Single family residence Date of Construction: 1899 Architect's Name: Not in CHRS Builder/Contractor: Not in CHRS Architectural Style: Vernacular Prepared By: C. Tolmie, M. C. Bird, J. Guarino Photo By: S. Katz Date: 10 September 2012

Historical Resource Recordation Form

Property Description:

Stories: 1

This one-story home in the Roseland community is situated on a raised concrete block basement with glass block windows. The home is clad with synthetic siding and has a front gable roof covered with asphalt shingles. It has a full-width hip-roof wood porch with wood slat railings, and supports consisting of three concrete block piers topped by open metal posts. Its front façade has an off-center door with transom, a picture window flanked by one-over-one windows, and a single-pane window in the dormer. This home lacks integrity, does not have distinguishing architectural features, and is not individually eligible for listing on the National Register.



Integrity:			Additional Notes/Descriptions
Unaltered	Slight Alterations	Major Alterations	New porch columns & rails, replacement cladding
Condition:			
<u>Excellent</u>	Good	Poor	
Additional Alterati	ons		
Structu	ire Usage	Exterior Wall Surface	
Current: NA		Synthetic siding	
Historic: NA			
Roof Material	Roof Features	Roof Type	
Asphalt shingle	None	Gable	
Ornamental Archit	ectural Details		Windows
None			Double-hung, fixed-pane, glass block
Outbuildings (Num	ber and Description)		
None			

Local Landmark	Y	<u>N</u>	
National Register Historic Places	Y	<u>N</u>	
National Register Historic District	Y	<u>N</u>	Name:
Individually Eligible? No	A	BC	Significance:

Additional Comments:			



Photos with Captions: Property Name South façade of one-story, brick industrial building. Historic: Not labeled, not in CHRS Common/Current: Unknown **Property Address:** 112 W. 115th Street HAARGIS Number: Not in database **Present Owner and /or Occupant:** Unknown **Property Use** Historic: Industrial **Current:** Industrial Date of Construction: 1927 Architect's Name: Not in CHRS Builder/Contractor: Not in CHRS Architectural Style: Vernacular Prepared By: C. Tolmie, M. C. Bird, J. 7. 7.8 24 Guarino Photo By: S. Katz

Historical Resource Recordation Form

Property Description:

Date: 10 September 2012

Stories: 1

This one-story industrial building in the Roseland community has a flat roof and stepped parapet. Its front elevation is clad with red face brick and has a concrete water table, a wide overhead metal garage door, entrance that has been replaced with a non-original hollow core metal door and plywood, and a window opening that has been covered with plywood and replacement windows. Detailing in cream-colored terra cotta includes coping and geometric panels on either end of the parapet that feature foliate motifs. This building does not feature sufficient integrity or distinguishing architectural features to qualify as individually eligible for listing on the National Register.



Integrity:			Additional Notes/Descriptions
Unaltered	Slight Modification	on Major Alteration	Replacement windows and garage door; openings in-filled
Condition:			
Excellent	Good	Poor	
Additional Alteration	ons		
Structu	ire Usage	Exterior Wall Surface	
Current: NA		Brick	
Historic: NA			
Roof Material	Roof Features	Roof Type	
Unknown	Parapet	Flat	
Ornamental Archit	ectural Details	Windows	
Stepped parapet with	h terra-cotta coping and d	Fixed-pane	
Outbuildings (Num	ber and Description)		·
None			

Local Landmark	Y <u>N</u>	
National Register Historic Places	Y <u>N</u>	
National Register Historic District	Y <u>N</u>	Name:
Individually Eligible? No	A B C	Significance:

Additional Comments:			



Historical Resource Recordation Form



Property Description:

Stories: 2

This two-story, multi-family residential building in the Roseland community is clad with synthetic siding, is situated on a raised limestone foundation, and has a flat roof with an overhanging eave. Its front elevation features a non-original, partial width wood porch with metal railings, open metal supports, and a metal awning roof. It has a full-height three-sided pavilion with non-original one-over-one windows and a single, non-original, one-over-one window on the second floor directly above the entrance. This building lacks sufficient integrity and distinguishing architectural features to qualify as individually eligible for listing on the National Register.




Integrity:			Additional Notes/Descriptions
Unaltered	Slight Modification	Major Alteration	Replacement windows and siding
Condition:			
Excellent	Good	Poor	
Additional Alteration	ons		
Structu	re Usage	Exterior Wall Surface	
Current: N A		Synthetic siding	
Historic: NA			
Roof Material	Roof Features	Roof Type	
Unknown	None	Flat	
Ornamental Archit	ectural Details		Windows
None			Double-hung
Outbuildings (Num	ber and Description)		·
None			

Local Landmark	Y <u>N</u>	
National Register Historic Places	Y <u>N</u>	
National Register Historic District	Y <u>N</u>	Name:
Individually Eligible? No	A B C	Significance:

Additional Comments:		



Historical Resource Recordation Form

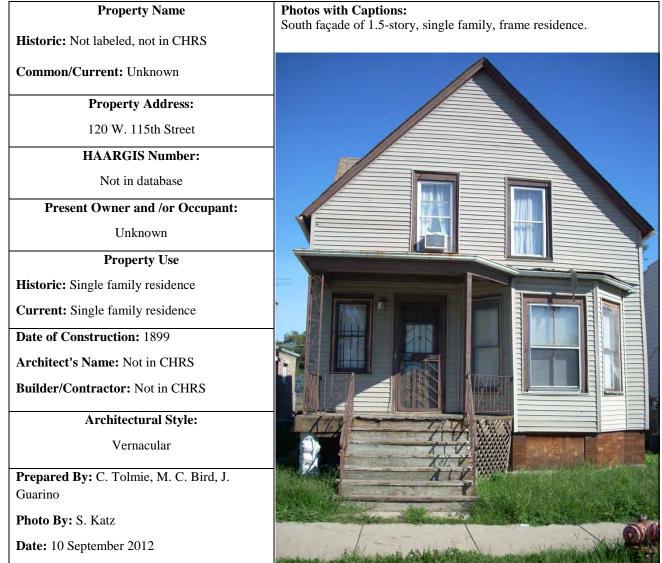

Property Description:

Stories: 1.5

This one-and-half-story home in the Roseland community is situated on a raised brick basement, clad with synthetic siding, and has a gable roof covered with asphalt shingles. The front façade has a partial-width flat-roofed porch with non-original metal railings open metal supports and an off-center door. Windows are non-original one-over-one: there is a three-sided bay on the first floor and are two additional windows centered on the second floor. One of the side elevations has a three-sided bay window and gable wall dormer above. This building lacks sufficient integrity and distinguishing architectural features to qualify as individually eligible for listing on the National Register.



Integrity:			Additional Notes/Descriptions
Unaltered	Slight Modification	Major Alteration	Replacement windows, porch, & cladding
Condition:			
Excellent	Good	Poor	
Additional Alterati	ons		
Structu	re Usage	Exterior Wall Surface	
Current: NA		Synthetic siding	
Historic: NA			
Roof Material	Roof Features	Roof Type	
Asphalt shingle	Dormer	Gable	
Ornamental Archit	ectural Details		Windows
None			Double hung
Outbuildings (Num	ber and Description)		
None			

Local Landmark	Y <u>N</u>	
National Register Historic Places	Y <u>N</u>	
National Register Historic District	Y <u>N</u>	Name:
Individually Eligible? No	A B C	Significance:

Additional Comments:		



Historical Resource Recordation Form

Property Name	Photos with Captions:
	North façade of a two-story, single family, frame residence.
Historic: Bldg. not labeled, not in CHRS	
Common/Current: Unknown	
Property Address:	
143 W. 115th Street	
HAARGIS Number:	
Not in database	
Present Owner and /or Occupant:	
Unknown	
Property Use	
Historic: Single family residence	
Current: Single family residence	
Date of Construction: 1911	
Architect's Name: Not in CHRS	
Builder/Contractor: Not in CHRS	
Architectural Style:	
Vernacular	
Prepared By: J. Martinez, M. C. Bird, J.	
Guarino	
Photo By: S. Katz	
Date: 22 October 2012	and the second

Property Description:

Stories: 2

This two-story house in the West Pullman community is situated on a raised concrete block basement with glass block windows and is covered with synthetic siding. The building has a front gable roof with a wall dormer on the side elevation. The house has a two-story hip-roof front addition. The front elevation has an off-center recessed entrance with a metal storm door, a non-original picture window flanked by one-over-one aluminum-sash windows on the first floor, and a single non-original one-over-one aluminum-sash window on the second floor addition. This house lacks integrity and distinctive architectural features and is not individually eligible for listing on the National Register.



Structural Survey

Integrity:			Additional Notes/Descriptions
Unaltered	Slight Modification	Major Alteration	Replacement door, windows, and cladding
Condition:			
Excellent	Good	Poor	
Additional Alterati	ons		
Addition to front of	building		
Structu	re Usage	Exterior Wall Surface	
Current: NA		Synthetic siding	
Historic: NA			
Roof Material	Roof Features	Roof Type	
Asphalt	Dormer	Gable	
Ornamental Archit	ectural Details		Windows
None			Double-hung, fixed-pane, glass block
Outbuildings (Num	ber and Description)		
None			

Local Landmark	Y <u>N</u>	
National Register Historic Places	Y <u>N</u>	
National Register Historic District	Y <u>N</u>	Name:
Individually Eligible? No	A B C	Significance:

Additional Comments:



Historical Resource Recordation Form

Property Name	Photos with Captions:
Historic: Bldg. not labeled, not in CHRS	South façade of a one-story, single family, frame residence.
Common/Current: Unknown	
Property Address:	
738 W. 116th Place	
HAARGIS Number:	
Not in database	
Present Owner and /or Occupant:	
Unknown	
Property Use	
Historic: Single family residence	
Current: Single family residence	
Date of Construction: 1925	
Architect's Name: Not in CHRS	
Builder/Contractor: Not in CHRS	
Architectural Style:	
Craftsman	
Prepared By: J. Martinez, M. C. Bird, J.	
Guarino	
Photo By: S. Katz	
Date: 24 October 2012	
Property Description:	Stories: 1

This one-story frame bungalow in the West Pullman community has a hip roof covered with asphalt shingles, overhanging eaves with exposed rafters, and a hip dormer with a single-pane window. Its front elevation is clad with a stone veneer and has six non-original one-over-one aluminum-sash windows, arranged in two groups of three. Synthetic siding clads the sides and rear of the building. The front door is located along one of the side elevations. This home lacks integrity and distinguishing architectural features and is not individually eligible for listing on the National Register.



Integrity:			Additional Notes/Descriptions
Unaltered	Slight Modification	on Major Alteration	Replacement windows
Condition:			
<u>Excellent</u>	Good	Poor	
Additional Alteration	ons		
Structu	re Usage	Exterior Wall Surface	
Current: NA		Faux stone (façade),	
		Synthetic siding (sides and rear)	
Historic: NA			
Roof Material	Roof Features	Roof Type	
Asphalt shingle	Dormer	Hip	
Ornamental Archit	ectural Details		Windows
Exposed rafters			Double-hung, fixed-pane
Outbuildings (Num	ber and Description)		
None			

Local Landmark	Y <u>N</u>	
National Register Historic Places	Y <u>N</u>	
National Register Historic District	Y <u>N</u>	Name:
Individually Eligible? No	A B C	Significance:

Additional Comments:			



Historical Resource Recordation Form



Property Description:

Stories: 1

This one-story house in the West Pullman community is situated on a raised concrete block basement that features multi-pane casement windows. It is clad with brick painted white and has a gable roof covered with asphalt shingles. It front elevation features a full-width, hip roof, wood porch with concrete steps, metal railings, and brick pier supports. It has an off-center door and one-over-one windows with aluminum storms: a strip of three on the first floor and one in the gable. This house lacks sufficient distinguishing architectural features to qualify as individually eligible for listing on the National Register.



Integrity:			Additional Notes/Descriptions
Unaltered	Slight Modification	Major Alterations	Aluminum storms
Condition:			
<u>Excellent</u>	Good	Poor	
Additional Alterati	ons		
Structu	ire Usage	Exterior Wall Surface	
Current: NA		Brick	
Historic: NA			
Roof Material	Roof Features	Roof Type	
Asphalt shingle	None	Gable	
Ornamental Archit	ectural Details		Windows
			Double-hung, casement
Outbuildings (Num	ber and Description)		
None			

Local Landmark	Y <u>N</u>	
National Register Historic Places	Y <u>N</u>	
National Register Historic District	Y <u>N</u>	Name:
Individually Eligible? No	A B C	Significance:

Additional Comments:			



Historical Resource Recordation Form

Property Name	Photos with Captions:
Historic: Not labeled, not in CHRS	North façade of two-story, multi-family, frame residence.
Common/Current: Unknown	
Property Address:	
12 E. 116th Street	
HAARGIS Number:	
Not in database	
Present Owner and /or Occupant:	
Unknown	
Property Use	
Historic: Single family residence	
Current: Multi-family residence	
Date of Construction: 1913	
Architect's Name: Not in CHRS	
Builder/Contractor: Not in CHRS	
Architectural Style:	
Vernacular	
Prepared By: C. Tolmie, M. C. Bird, J. Guarino	
Photo By: S. Katz	
Date: 10 September 2012	

Property Description:

Stories: 2

This two-story house in the West Pullman community is situated on a raised concrete block basement, is clad with synthetic siding, and has cornice returns and a cross-gable roof covered with asphalt shingles. It front elevation features a full-width, flat roof, wood porch with non-original slat railing, thin wood posts, and an off-center door. There is a three-sided bay with one-over-one double-hung windows on the first floor and a strip of three single-pane windows on the second floor that may be sliding glass. This house lacks sufficient integrity or distinguishing architectural features to qualify as individually eligible for listing on the National Register.



Integrity:			Additional Notes/Descriptions	
Unaltered	Slight Modification	Major Alterations	Replacement windows, door, cladding	
Condition:				
<u>Excellent</u>	Good	Poor		
Additional Alterati	ons			
Structu	ire Usage	Exterior Wall Surface		
Current: NA		Synthetic siding		
Historic: NA				
Roof Material	Roof Features	Roof Type		
Asphalt shingle	None	Gable		
Ornamental Archit	tectural Details	Windows		
Cornice returns			Double-hung, sliding	
Outbuildings (Number and Description)				
None				

Local Landmark	Y <u>N</u>	
National Register Historic Places	Y <u>N</u>	
National Register Historic District	Y <u>N</u>	Name:
Individually Eligible? No	A B C	Significance:

Additional Comments:			



Historical Resource Recordation Form

Property Name	Photos with Captions:
Historic: Not labeled, not in CHRS	North façade of one-story, single family, frame residence.
Historic. Not labeled, not in CritKS	
Common/Current: Unknown	
Property Address:	
16 E. 116th Street	
HAARGIS Number:	
Not in database	
Present Owner and /or Occupant:	
Unknown	
Property Use	
Historic: Single family residence	
Current: Single family residence	
Date of Construction: 1902	
Architect's Name: Not in CHRS	
Builder/Contractor: Not in CHRS	
Architectural Style:	
Vernacular	
Prepared By: C. Tolmie, M. C. Bird, J.	
Guarino	
Photo By: S. Katz	
Date: 10 September 2012	
Property Decemintion.	Stariog 1

Property Description:

Stories: 1

This one-story house in the West Pullman community is situated on a raised concrete block basement, is clad with synthetic siding, and has a gable roof covered with asphalt shingles. Its front elevation features a full-width, hip roof, wood porch with faux stone pier supports and replacement wood railing. The front also has an off-center front door and a strip of three one-over-one windows. This house lacks sufficient integrity and distinguishing architectural features to qualify as individually eligible for listing on the National Register.



Integrity:			Additional Notes/Descriptions
Unaltered	Slight Modification	Major Alterations	Replacement door, new porch rails, cladding
Condition:			
Excellent	Good	Poor	
Additional Alteration	ons		
Structu	re Usage	Exterior Wall Surface	
Current: NA		Synthetic siding	
Historic: NA			
Roof Material	Roof Features	Roof Type	
Asphalt shingle	None	Gable	
Ornamental Archit	ectural Details		Windows
None			Double-hung
Outbuildings (Num	ber and Description)		
Garage behind reside	ence		

Local Landmark	Y <u>N</u>	
National Register Historic Places	Y <u>N</u>	
National Register Historic District	Y <u>N</u>	Name:
Individually Eligible? No	A B C	Significance:

Additional Comments:			



Historical Resource Recordation Form

Property Name	Photos with Captions: North façade of two-story, single-family, frame residence.
Historic: Not labeled, not in CHRS	North façade of two-story, single-family, frame residence.
Common/Current: Unknown	
Property Address:	
20 E. 116th Street	
HAARGIS Number:	
Not in database	
Present Owner and /or Occupant:	
Unknown	
Property Use	
Historic: Single family residence	
Current: Single family residence	
Date of Construction: 1893	
Architect's Name: Not in CHRS	
Builder/Contractor: Not in CHRS	
Architectural Style:	
Queen Anne	
Prepared By: C. Tolmie, M. C. Bird, J.	
Guarino	
Photo By: S. Katz	
Date: 10 September 2012	

Property Description:

Stories: 2

This two-story Queen Anne style house in the West Pullman community is situated on a raised concrete block basement, is clad with synthetic siding, has full-height window bay pavilions with pediment and gable dormers on its front elevation and side elevations, and has a hip roof covered with asphalt shingles. The front elevation has a shed-roofed partial-width wood porch with pediment and metal hollow core paneled door. Fenestration is non-original on the front elevation bays and features fixed-pane windows with multiple lights, multi-paned double-hung windows, and a single one-over-one window on the second floor, directly above the porch. This house lacks sufficient integrity and distinguishing architectural features to qualify as individually eligible for listing on the National Register.




Integrity:			Additional Notes/Descriptions
Unaltered	Slight Modification	n Major Alterations	Replacement windows, door, and cladding
Condition:			
<u>Excellent</u>	Good	Poor	
Additional Alterati	ons		
Structu	ire Usage	Exterior Wall Surface	
Current: NA		Synthetic siding	
Historic: NA			
Roof Material	Roof Features	Roof Type	
Asphalt shingle	Dormer	Hipped	
Ornamental Archit	tectural Details		Windows
Pediments at gables			Double-hung, fixed-pane
Outbuildings (Num			
None			

Local Landmark	Y <u>N</u>	
National Register Historic Places	Y <u>N</u>	
National Register Historic District	Y <u>N</u>	Name:
Individually Eligible? No	A B C	Significance:

Additional Comments:		



Historical Resource Recordation Form

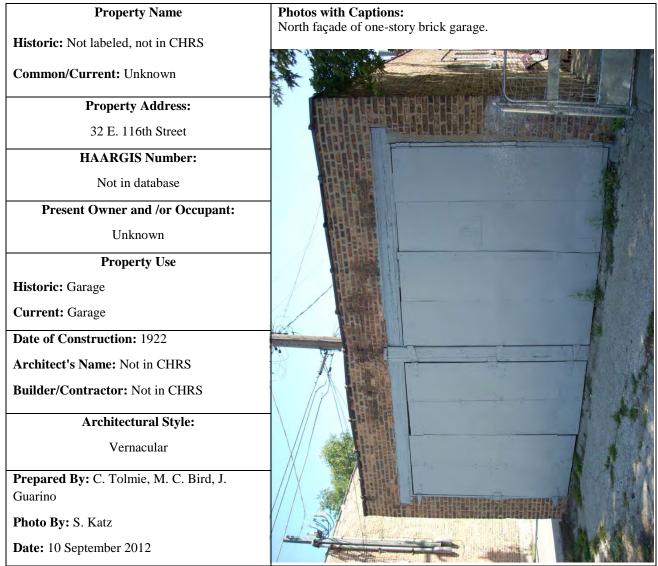

Property Description:

Stories: 1

This one-story, four-car garage building in the West Pullman community is clad in common brick and features two pairs of hinged metal garage doors with a continuous wooden lintel along its front elevation. A side (alley) elevation displays the outlines of dormer door openings that have been in-filled with brick as well as a hinged metal garage door. This building does not feature sufficient integrity or distinguishing architectural features to qualify as individually eligible for listing on the National Register.



Integrity:			Additional Notes/Descriptions
Unaltered	Slight Modification	Major Alterations	Windows in-filled, metal doors
Condition:			
Excellent	Good	Poor	
Additional Alterati	ons		
Structu	ire Usage	Exterior Wall Surface	
Current: NA		Brick	
Historic: NA			
Roof Material	Roof Features	Roof Type	
Unknown	None	Flat	
Ornamental Archit	ectural Details		Windows
None			NA
Outbuildings (Num	ber and Description)		
None			

Local Landmark	Y <u>N</u>	
National Register Historic Places	Y <u>N</u>	
National Register Historic District	Y <u>N</u>	Name:
Individually Eligible? No	A B C	Significance:

Additional Comments:			



Historical Resource Recordation Form

Property Name	Photos with Captions:
	East façade of brick, two-flat residence.
Historic: Not labeled, not in CHRS	
Common/Current: Unknown	
Property Address:	
36 E. 116th Street	
HAARGIS Number:	
Not in database	
Present Owner and /or Occupant:	
Unknown	
Property Use	
Historic: Flat	
Current: Flat	
Date of Construction: 1918	
Architect's Name: Not in CHRS	
Builder/Contractor: Not in CHRS	
Architectural Style:	
Vernacular	
Prepared By: C. Tolmie, M. C. Bird, J.	
Guarino	
Photo By: S. Katz	
Date: 10 September 2012	A REAL PROPERTY AND A REAL

Property Description:

Stories: 2

This two-flat residential building in the West Pullman community is situated on a raised basement and has a front façade clad with orange face brick. It has a full-height three-sided window bay pavilion, flat roof, and parapet. Its off-center flat-roofed porch has concrete steps, brick piers, and a single-light oak door with sidelight. Fenestration is comprised of one-over-one windows. Detailing includes stone sill courses, beltcourse, a cornice, as well as decorative brickwork on the parapet. This building does not feature sufficient distinguishing architectural features to qualify as individually eligible for listing on the National Register.




Integrity:			Additional Notes/Descriptions	
<u>Unaltered</u>	Slight Modificatio	n Major Alteration		
Condition:				
Excellent	Good	Poor		
Additional Alterati	ons			
Structu	ire Usage	Exterior Wall Surface		
Current: NA		Brick		
Historic: NA				
Roof Material	Roof Features	Roof Type		
Unknown	Parapet	Flat		
Ornamental Archit	tectural Details		Windows	
Stone sill courses, b	eltcourse, cornice, decora	Double-hung		
Outbuildings (Number and Description)				
None				

Local Landmark	Y <u>N</u>	
National Register Historic Places	Y <u>N</u>	
National Register Historic District	Y <u>N</u>	Name:
Individually Eligible? No	A B C	Significance:

Additional Comments:			



Historical Resource Recordation Form

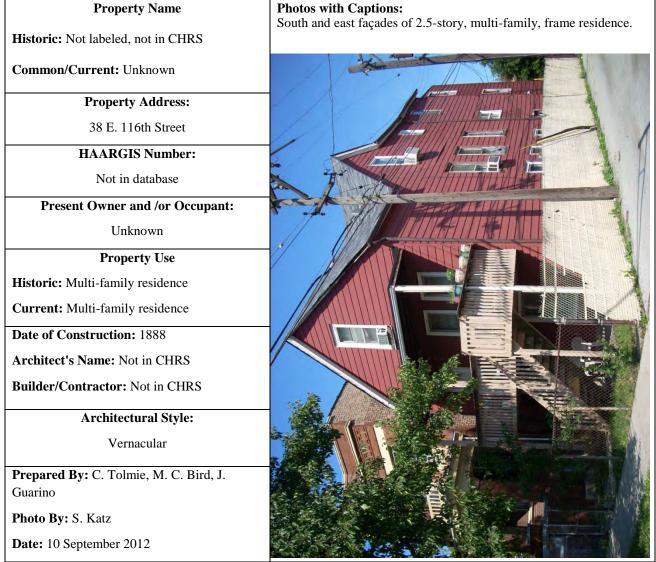

Property Description:

Stories: 2.5

This two-and-a-half-story, multi-family house in the West Pullman community is clad with synthetic siding and has a cross gable roof covered with asphalt shingles. Its front elevation has off-center doors on the first and second floors and an elevated, flat-roofed, full-width, non-original wood porch with straight railings and posts. Fenestration on the front and side elevations is comprised of one-over-one windows. This house does not feature sufficient integrity or distinguishing architectural features to qualify as individually eligible for listing on the National Register.



Integrity:			Additional Notes/Descriptions		
Unaltered	Slight Modification	Major Alterations	Replacement windows, doors, porch, & cladding		
Condition:					
<u>Excellent</u>	Good	Poor			
Additional Alterati	ons				
Structu	ire Usage	Exterior Wall Surface			
Current: NA		Synthetic siding			
Historic: NA					
Roof Material	Roof Features	Roof Type			
Asphalt shingle	None	Cross Gable			
Ornamental Archit	tectural Details		Windows		
None			Double-hung		
Outbuildings (Num	Outbuildings (Number and Description)				
None					

Local Landmark	Y <u>N</u>	
National Register Historic Places	Y <u>N</u>	
National Register Historic District	Y <u>N</u>	Name:
Individually Eligible? No	A B C	Significance:

Additional Comments:			



Historical Resource Recordation Form

Property Name	Photos with Captions: South façade of a two-story, single family, frame residence.
Historic: Bldg. not labeled, not in CHRS	South façade of a two-story, single failing, frame residence.
Common/Current: Unknown	
Property Address:	
144 E. 116th Street	
HAARGIS Number:	
Not in database	
Present Owner and /or Occupant:	
Unknown	
Property Use	
Historic: Single family residence	
Current: Single family residence	
Date of Construction: 1888	
Architect's Name: Not in CHRS	
Builder/Contractor: Not in CHRS	
Architectural Style:	
Vernacular	
Prepared By: J. Martinez, M. C. Bird, J.	
Guarino	
Photo By: S. Katz	
Date: 30 October 2012	and the second

Property Description:

Stories: 2

This two-story frame residential building in the West Pullman community is situated on a raised concrete block basement and is covered with synthetic siding. The building has a front gable roof covered with asphalt shingles. Both floors of the front elevation are partially obscured by a full-width wood porch with exterior steps leading to a second floor balcony. Both floors also have a hollow core metal door and non-original double-hung windows: three on the first floor and two on the second. A third window on the second floor has been in-filled. There is a single-pane window in the gable. This house lacks integrity and distinguishing architectural features and is not individually eligible for listing on the National Register.



Structural Survey

Integrity:			Additional Notes/Descriptions
Unaltered	Slight Modification	Major Alteration	Replacement doors, windows, and cladding
Condition:			
Excellent	Good	Poor	
Additional Alteration	ons		
Exterior stairs are no	ot original		
Structure Usage Exterior Wall Surface			
Current: NA		Synthetic siding	
Historic: NA			
Roof Material	Roof Features	Roof Type	
Asphalt shingle	None	Gable	
Ornamental Archit	ectural Details		Windows
None			Double-hung, fixed-pane
Outbuildings (Num	ber and Description)		
None			

Local Landmark	Y <u>N</u>	
National Register Historic Places	Y <u>N</u>	
National Register Historic District	Y <u>N</u>	Name:
Individually Eligible? No	A B C	Significance:

Additional Comments:



Historical Resource Recordation Form

Property Name	Photos with Captions:
Historic: Bldg. not labeled, not in CHRS	South and east façades of a one-story, single family, frame residence.
Common/Current: Unknown	
Property Address:	
150 E. 116th Street	
HAARGIS Number:	
Not in database	
Present Owner and /or Occupant:	
Unknown	
Property Use	
Historic: Single family residence	
Current: Single family residence	
Date of Construction: 1891	
Architect's Name: Not in CHRS	
Builder/Contractor: Not in CHRS	
Architectural Style:	
Vernacular	
Prepared By: J. Martinez, M. C. Bird, J.	
Guarino	
Photo By: S. Katz	
Date: 30 October 2012	

Property Description:

Stories: 1

This one-story frame cottage in the West Pullman community sits on a raised concrete block basement and is covered with synthetic siding. The building has a front gable roof covered with asphalt shingles. The front elevation has a full-width hip-roof porch with wood steps, metal railings, and open metal posts. The off-center hollow core metal door is non-original as is the strip of three one-over-one windows on the first floor. There is an in-filled window opening in the attic, above which is a small ventilating louver. This house lacks integrity and distinguishing architectural features and is not individually eligible for listing on the National Register.



Integrity:			Additional Notes/Descriptions
Unaltered	Slight Modification	n Major Alteration	Replacement door, windows, cladding, and porch rails
Condition:			
<u>Excellent</u>	Good	Poor	
Additional Alterati	ons		
Structu	ire Usage	Exterior Wall Surface	
Current: NA		Synthetic siding	
Historic: NA			
Roof Material	Roof Features	Roof Type	
Asphalt shingle	None	Gable	
Ornamental Archit	tectural Details		Windows
None			Double-hung
Outbuildings (Num	ber and Description)		
None			

Local Landmark	Y <u>N</u>	
National Register Historic Places	Y <u>N</u>	
National Register Historic District	Y <u>N</u>	Name:
Individually Eligible? No	A B C	Significance:

Additional Comments:			



Historical Resource Recordation Form

Property Name	Photos with Captions: North façade of a two-story, multi-family, frame residence.
Historic: Bldg. not labeled, not in CHRS	form haçade of a two story, mant fanniy, france residence.
Common/Current: Unknown	
Property Address:	
151 E. 116th Street	
HAARGIS Number:	
Not in database	
Present Owner and /or Occupant:	
Unknown	
Property Use	
Historic: Single family residence	
Current: Multi-family residence	
Date of Construction: 1898	
Architect's Name: Not in CHRS	
Builder/Contractor: Not in CHRS	
Architectural Style:	K
Vernacular	
Prepared By: J. Martinez, M. C. Bird, J. Guarino	
Photo By: S. Katz	
Date: 1 October 2012	

Property Description:

Stories: 2

This two-story frame house in the West Pullman community is on a raised concrete block basement and is clad with rolled asphalt shingle siding. The building has a front gable roof covered with asphalt shingles. The front elevation has a hip roof porch with concrete steps, metal railings and open metal posts. It also features an off-center non-original door and one-over-one windows: three each on the first and second floors. This house lacks integrity, does not have distinguishing architectural features, and is not individually eligible for listing on the National Register.




Integrity:			Additional Notes/Descriptions
Unaltered	Slight Modification	Major Alteration	Replacement door and cladding
Condition:			
Excellent	Good	Poor	
Additional Alterati	ons		
Structu	ire Usage	Exterior Wall Surface	
Current: NA		Asphalt shingle siding	
Historic: NA			
Roof Material	Roof Features	Roof Type	
Asphalt	None	Gable	
Ornamental Archit	ectural Details		Windows
None			Double-hung
Outbuildings (Num	ber and Description)		
None			

Local Landmark	Y <u>N</u>	
National Register Historic Places	Y <u>N</u>	
National Register Historic District	Y <u>N</u>	Name:
Individually Eligible? No	A B C	Significance:

Additional Comments:			



Historical Resource Recordation Form

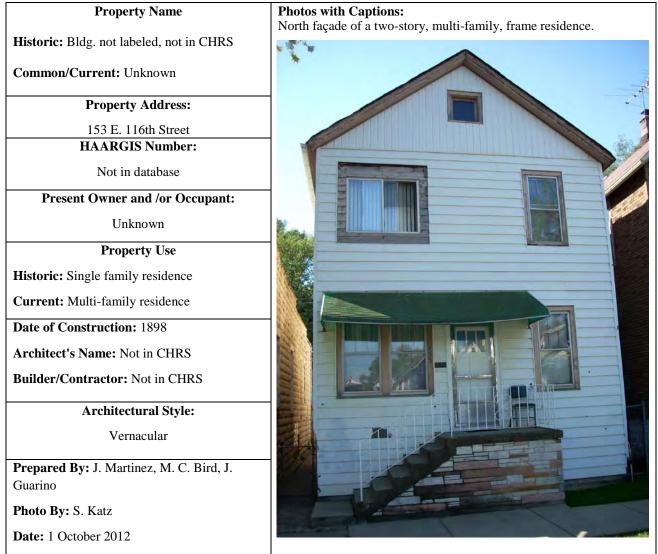

Property Description:

Stories: 2

This two-story frame house in the West Pullman community is clad with synthetic siding and has a front gable roof covered with asphalt shingles. Its front elevation has a centrally located door with concrete steps and metal railings. It has non-original three-over-one windows: three on the first floor and one on the second, plus an additional pair of sliding glass windows on the second floor and a small single-pane window in the gable. This house lacks integrity, does not have distinguishing architectural features, and is not individually eligible for listing on the National Register.



Integrity:			Additional Notes/Descriptions
Unaltered	Slight Modification	Major Alteration	Replacement siding and windows
Condition:			
Excellent	Good	Poor	
Additional Alterati	ons		
Structu	ire Usage	Exterior Wall Surface	
Current: NA		Synthetic siding	
Historic: NA			
Roof Material	Roof Features	Roof Type	
Asphalt	None	Gable	
Ornamental Archit	ectural Details		Windows
None			Double-hung, casement, sliding
Outbuildings (Num	ber and Description)		•
None			

Local Landmark	Y <u>N</u>	
National Register Historic Places	Y <u>N</u>	
National Register Historic District	Y <u>N</u>	Name:
Individually Eligible? No	A B C	Significance:

Additional Comments:			



Historical Resource Recordation Form

Property Name	Photos with Captions:
	North façade of a one-story, single-family, concrete block residence.
Historic: Bldg. not labeled, not in CHRS	
Common/Current: Unknown	
Property Address:	
155 E. 116th Street	
HAARGIS Number:	
Not in database	
Present Owner and /or Occupant:	
Unknown	
Property Use	
Historic: Single family residence	
Current: Single family residence	
Date of Construction: 1903	
Architect's Name: Not in CHRS	
Builder/Contractor: Not in CHRS	
Architectural Style:	
Vernacular	
Prepared By: J. Martinez, M. C. Bird, J.	
Guarino	A CONTRACTOR OF THE OWNER
Photo By: S. Katz	
Date: 1 October 2012	
Property Description:	Stories: 1

This one-story house in the West Pullman community is clad with rusticated concrete block and has a flat roof and parapet with a stringcourse along the cornice. Its front elevation features a three-sided bay with non-original one-over-one windows and a flat-roof, partial width porch with concrete steps, metal railings, and open metal posts. The hollow core metal door is non-original. This house lacks integrity, does not have distinguishing architectural features, and is not individually eligible for listing on the National Register.



Integrity:			Additional Notes/Descriptions
Unaltered	Slight Modification	Major Alteration	Replacement door and windows
Condition:			
Excellent	Good	Poor	
Additional Alteration	ons		
Structu	re Usage	Exterior Wall Surface	
Current: NA		Concrete block	
Historic: NA			
Roof Material	Roof Features	Roof Type	
Unknown	Parapet	Flat	
Ornamental Archit	ectural Details		Windows
Stringcourse			Double-hung
Outbuildings (Num	ber and Description)		
None			

Local Landmark	Y <u>N</u>	
National Register Historic Places	Y <u>N</u>	
National Register Historic District	Y <u>N</u>	Name:
Individually Eligible? No	A B C	Significance:

Additional Comments:			



Historical Resource Recordation Form

Property Name	Photos with Captions: North façade of a two-story, multi-family, frame residence.
Historic: Bldg. not labeled, not in CHRS	North façade of a two-story, multi-family, frame residence.
Common/Current: Unknown	
Property Address:	
157 E. 116th Street	
HAARGIS Number:	
Not in database	
Present Owner and /or Occupant:	
Unknown	
Property Use	
Historic: Single family residence	
Current: Multi-family residence	
Date of Construction: 1898	
Architect's Name: Not in CHRS	
Builder/Contractor: Not in CHRS	
Architectural Style:	
Vernacular	
Prepared By: J. Martinez, M. C. Bird, J. Guarino	
Photo By: S. Katz	The second s
Date: 1 October 2012	and the second

Property Description:

Stories: 2

This two-story frame house in the West Pullman community is clad with synthetic siding and has a front gable roof covered with asphalt shingles. The front elevation has a flat-roofed, full-width porch with concrete steps, metal railings, and open metal posts. It also has an off-center hollow metal core door, two non-original Chicago-style windows (one on each floor), and an additional one-over-one window on the second floor. This house lacks integrity, does not have distinguishing architectural features, and is not individually eligible for listing on the National Register.



Integrity:			Additional Notes/Descriptions
Unaltered	Slight Modification	n Major Alteration	Replacement door, windows, and siding
Condition:			
<u>Excellent</u>	Good	Poor	
Additional Alterati	ons		
Structu	re Usage	Exterior Wall Surface	
Current: NA		Synthetic siding	
Historic: NA			
Roof Material	Roof Features	Roof Type	
Asphalt	None	Gable	
Ornamental Archit	ectural Details		Windows
None			Double-hung, fixed-pane
Outbuildings (Num	ber and Description)		
None			

Local Landmark	Y <u>N</u>	
National Register Historic Places	Y <u>N</u>	
National Register Historic District	Y <u>N</u>	Name:
Individually Eligible? No	A B C	Significance:

Additional Comments:			



Historical Resource Recordation Form

Property Name	Photos with Captions: North façade of a one-story, single family, frame residence.
Historic: Bldg. not labeled, not in CHRS	North Regade of a one story, single ranny, frame residence.
Common/Current: Unknown	
Property Address:	
159 E. 116th Street	
HAARGIS Number:	
Not in database	
Present Owner and /or Occupant:	
Unknown	
Property Use	
Historic: Single family residence	
Current: Single family residence	
Date of Construction: 1903	
Architect's Name: Not in CHRS	
Builder/Contractor: Not in CHRS	
Architectural Style:	the second s
Vernacular	
Prepared By: J. Martinez, M. C. Bird, J.	
Guarino	and the second sec
Photo By: S. Katz	and the second of the second s
Date: 1 October 2012	Alter Alter
Duan autre Daganin tions	

Property Description:

Stories: 1

This one-story house in the West Pullman community is situated on a raised concrete block basement, is clad with synthetic siding, and has a front gable roof covered with asphalt shingles. Its front elevation features a full-width hipped-roof wood porch, a three-sided bow window with non-original casements, and an off-center door. This house lacks integrity, does not have distinguishing architectural features, and is not individually eligible for listing on the National Register.



Integrity:			Additional Notes/Descriptions
Unaltered	Slight Modification	Major Alteration	Replacement windows, cladding
0.14			
Condition:			
<u>Excellent</u>	Good	Poor	
Additional Alterati	ons		
Structu	re Usage	Exterior Wall Surface	
Current: NA		Synthetic siding	
Historic: NA			
Roof Material	Roof Features	Roof Type	
Asphalt	None	Gable	
Ornamental Archit	ectural Details		Windows
None			Casement
Outbuildings (Num	ber and Description)		·
None			

Local Landmark	Y <u>N</u>	
National Register Historic Places	Y <u>N</u>	
National Register Historic District	Y <u>N</u>	Name:
Individually Eligible? No	A B C	Significance:

Additional Comments:			



Historical Resource Recordation Form

Property Name	Photos with Captions: North façade of a 1.5-story, multi-family, frame residence.
Historic: Bldg. not labeled, not in CHRS	
Common/Current: Unknown	A CONTRACT OF A CONTRACT
Property Address:	
163 E. 116th Street	
HAARGIS Number:	
Not in database	
Present Owner and /or Occupant:	
Unknown	
Property Use	
Historic: Single family residence	
Current: Multi-family residence	
Date of Construction: 1898	
Architect's Name: Not in CHRS	
Builder/Contractor: Not in CHRS	
Architectural Style:	
Vernacular	
Prepared By: J. Martinez, M. C. Bird, J.	
Guarino	
Photo By: S. Katz	
Date: 1 October 2012	

Property Description:

Stories: 1.5

This one-and-one-half-story frame house in the West Pullman community is clad with synthetic siding and has a gable roof covered with asphalt shingles. The front elevation has a hip-roofed partial-width wood porch with wood posts and railings. It has an off-center non-original hollow metal core door and a pair of non-original one-over-one windows on both the first and second floors. This house lacks integrity, does not have distinguishing architectural features, and is not individually eligible for listing on the National Register.



Integrity:			Additional Notes/Descriptions
Unaltered	Slight Modification	n Major Alteration	Replacement door, windows, cladding
Condition:			
<u>Excellent</u>	Good	Poor	
Additional Alterati	ons		
Structu	ire Usage	Exterior Wall Surface	
Current: NA		Synthetic siding	
Historic: NA			
Roof Material	Roof Features	Roof Type	
Asphalt	None	Gable	
Ornamental Archit	tectural Details		Windows
None			Double-hung
Outbuildings (Num	ber and Description)		
None			

Local Landmark	Y <u>N</u>	
National Register Historic Places	Y <u>N</u>	
National Register Historic District	Y <u>N</u>	Name:
Individually Eligible? No	A B C	Significance:

Additional Comments:	



Historical Resource Recordation Form

Property Name	Photos with Captions: North façade of a one-story, single family, frame residence.		
Historic: Bldg. not labeled, not in CHRS	Norm raçade of a one story, single ranny, name residence.		
Common/Current: Unknown			
Property Address:			
165 E 116th Street			
HAARGIS Number:			
Not in database			
Present Owner and /or Occupant:			
Unknown			
Property Use			
Historic: Single family residence			
Current: Single family residence			
Date of Construction: 1898			
Architect's Name: Not in CHRS			
Builder/Contractor: Not in CHRS			
Architectural Style:			
Vernacular			
Prepared By: J. Martinez, M. C. Bird, J.			
Guarino			
Photo By: S. Katz			
Date: 1 October 2012			

Property Description:

Stories: 1

This one-story house in the West Pullman community is situated on a raised concrete block basement, is clad with synthetic siding, and has a gable roof covered with asphalt shingles. Its front elevation features a partial-width porch with concrete steps, metal railings, and open metal posts supporting a metal canopy roof. It has a centrally located door and four non-original one-over-one windows: three on the first floor and one in the gable. This house lacks integrity, does not have distinguishing architectural features, and is not individually eligible for listing on the National Register.




Integrity:			Additional Notes/Descriptions
Unaltered	Slight Modification	n Major Alteration	Replacement door, windows, cladding
Condition:			
<u>Excellent</u>	Good	Poor	
Additional Alterati	ons		
Structu	ire Usage	Exterior Wall Surface	
Current: NA		Synthetic siding	
Historic: NA			
Roof Material	Roof Features	Roof Type	
Asphalt	None	Gable	
Ornamental Archit	ectural Details		Windows
None			Double-hung
Outbuildings (Num	ber and Description)		
None			

Local Landmark	Y <u>N</u>	
National Register Historic Places	Y <u>N</u>	
National Register Historic District	Y <u>N</u>	Name:
Individually Eligible? No	A B C	Significance:

Additional Comments:			



Historical Resource Recordation Form

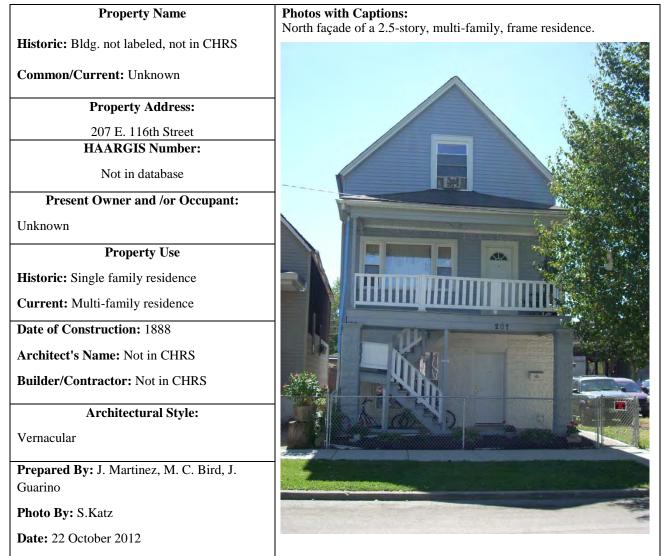

Property Description:

Stories: 2.5

This two-and-a-half-story frame house in the West Pullman community is clad in rusticated concrete bock on the first floor and in synthetic siding above. The building has a front gable roof with asphalt shingles. It has a two-story full-width, hip-roof wood porch/balcony with faux stone piers and wood posts as supports on the first and second floors, respectively. A non-original stairway leads to the second floor balcony. Both first and second floors have off-center non-original hollow core metal doors. Windows on the front elevation are non-original and include one on the first floor that is obscured by the staircase, a picture window flanked by one-over-one aluminum-sash windows on the second floor, and a single one-over-one aluminum-sash window in the gable. This house lacks integrity and distinctive architectural features and is not individually eligible for listing on the National Register.



Structural Survey

Integrity:			Additional Notes/Descriptions
Unaltered	Slight Modification	Major Alteration	Replacement doors, windows, and cladding
Condition:			
Excellent	Good	Poor	
Additional Alterati	ons		
External stairway ad	ded during conversion from	n single family home.	
Structu	ire Usage	Exterior Wall Surface	
Current: NA		Concrete block (lower),	
Historic: NA		Synthetic siding (upper)	
Roof Material	Roof Features	Roof Type	
Asphalt shingle	None	Gable	
Ornamental Archit	ectural Details		Windows
None			Double-hung, fixed-pane
Outbuildings (Num	ber and Description)		
None			

Local Landmark	Y <u>N</u>	
National Register Historic Places	Y <u>N</u>	
National Register Historic District	Y <u>N</u>	Name:
Individually Eligible? No	A B C	Significance:

Additional Comments:



Historical Resource Recordation Form

Property Name	Photos with Captions:
Historic: Bldg. not labeled, not in CHRS	South façade of a one-story, single family, frame residence.
Common/Current: Unknown	
Property Address:	
742 W. 116th Street	
HAARGIS Number:	
Not in database	
Present Owner and /or Occupant:	
Unknown	
Property Use	
Historic: Single family residence	
Current: Single family residence	
Date of Construction: 1919	
Architect's Name: Not in CHRS	
Builder/Contractor: Not in CHRS	- ATT ATT
Architectural Style:	
Vernacular	
Prepared By: J. Martinez, M. C. Bird, J.	
Guarino	
Photo By: S. Katz	
Date: 24 October 2012	of the first state of the state

Property Description:

Stories: 1

This one-story frame house in the West Pullman community is covered with synthetic siding and has a front gable roof covered with asphalt shingles. Its front elevation has a bracketed pent roof, an off-center hollow core metal door, concrete steps with metal railings. Windows are non-original and include a picture window flanked by six-over-one aluminum-sash windows and a one-over-one aluminum-sash window in the gable. This home lacks integrity and distinguishing architectural features and is not individually eligible for listing on the National Register.




Integrity:			Additional Notes/Descriptions
Unaltered	Slight Modification	n Major Alteration	Replacement door, windows, and cladding
Condition:			
<u>Excellent</u>	Good	Poor	
Additional Alterati	ons		
Structu	ire Usage	Exterior Wall Surface	
Current: NA		Synthetic siding	
Historic: NA			
Roof Material	Roof Features	Roof Type	
Asphalt shingle	None	Gable	
Ornamental Archit	tectural Details		Windows
None			Double-hung, fixed-pane
Outbuildings (Number and Description)			
None			

Local Landmark	Y <u>N</u>	
National Register Historic Places	Y <u>N</u>	
National Register Historic District	Y <u>N</u>	Name:
Individually Eligible? No	A B C	Significance:

Additional Comments:			



Historical Resource Recordation Form

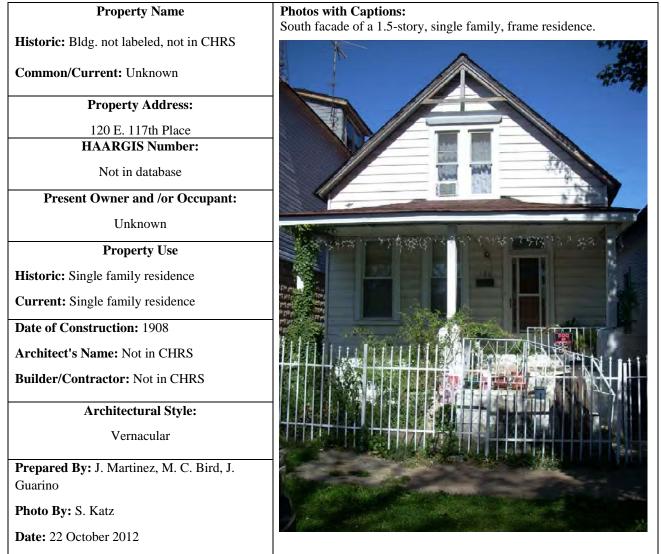

Property Description:

Stories: 1.5

This one-and-a-half-story frame cottage in the West Pullman community is situated on a raised concrete block basement and is covered with synthetic siding. The building has a front gable roof covered with asphalt shingles. Its front elevation has a full-width hip-roof wood porch with straight posts and an off-center entrance with a metal storm door. It has two windows on the first floor and a pair of windows in the gable, all of which are non-original one-over-one aluminum sash. A decorative wood truss is situated in the gable. This house lacks integrity and distinctive architectural features and is not individually eligible for listing on the National Register.



Structural Survey

Integrity:			Additional Notes/Descriptions
Unaltered	Slight Modification	Major Alteration	Replacement windows and cladding
Condition:			
Excellent	Good	Poor	
Additional Alteration	ons		
Structure Usage Exterior Wall Surface			
Current: NA		Synthetic siding	
Historic: NA			
Roof Material	Roof Features	Roof Type	
Asphalt shingle	None	Gable	
Ornamental Archit	ectural Details		Windows
Wood truss			Double-hung
Outbuildings (Num	ber and Description)		
None			

Local Landmark	Y <u>N</u>	
National Register Historic Places	Y <u>N</u>	
National Register Historic District	Y <u>N</u>	Name:
Individually Eligible? No	A B C	Significance:

Additional Comments:



Historical Resource Recordation Form

Property Name	Photos with Captions: South façade of a one-story, single family, brick residence.
Historic: Bldg. not labeled, not in CHRS	bount laçade of a one bory, ongre failing, orient residence.
Common/Current: Unknown	
Property Address:	
736 W. 117th Place	
HAARGIS Number:	
Not in database	
Present Owner and /or Occupant:	
Unknown	
Property Use	
Historic: Single family residence	
Current: Single family residence	
Date of Construction: 1946	
Architect's Name: Not in CHRS	
Builder/Contractor: Not in CHRS	
Architectural Style:	
Vernacular	
Prepared By: J. Martinez, M. C. Bird, J.	
Guarino	
Photo By: S. Katz	
Date: 24 October 2012	

Property Description:

Stories: 1

This one-story brick-clad cottage in the West Pullman community has a side-gabled roof covered with asphalt shingles. Its front elevation has a central, gabled, brick-clad vestibule with a non-original hollow core metal door topped by a bracketed gabled hood and concrete steps with metal railings. There are two pairs of six-over-one wood sash windows. Detailing includes a vertical strip of three glass blocks on either side of the front door. It does not display distinguishing architectural features and is not individually eligible for listing on the National Register.



Integrity:			Additional Notes/Descriptions	
Unaltered	Slight Modification	Major Alteration	Replacement door	
Condition:				
Excellent	Good	Poor		
Additional Alterati	ons			
Structu	ire Usage	Exterior Wall Surface		
Current: NA		Brick		
Historic: NA				
Roof Material	Roof Features	Roof Type		
Asphalt shingle	None	Gable		
Ornamental Archit	tectural Details	Windows		
Bracketed hood, decorative glass blocks			Double-hung, glass block	
Outbuildings (Number and Description)				
Detached, two-car, frame garage				

Local Landmark	Y <u>N</u>	
National Register Historic Places	Y <u>N</u>	
National Register Historic District	Y <u>N</u>	Name:
Individually Eligible? No	A B C	Significance:

Additional Comments:			



Historical Resource Recordation Form

Property Name	Photos with Captions: South façade of a 1.5-story, multi-family, frame residence.
Historic: Bldg. not labeled, not in CHRS	South laçade of a 1.3-story, multi-family, manie residence.
Common/Current: Unknown	
Property Address:	
126 E. 117th Street	
HAARGIS Number:	
Not in database	
Present Owner and /or Occupant:	
Unknown	
Property Use	
Historic: Single family residence	
Current: Multi-family residence	
Date of Construction: 1898	
Architect's Name: Not in CHRS	Caller and the Pathonese
Builder/Contractor: Not in CHRS	
Architectural Style:	
Vernacular	
Prepared By: J. Martinez, M. C. Bird, J.	
Guarino	
Photo By: S. Katz	
Date: 2 October 2012	

Property Description:

Stories: 1.5

This one-and-a-half-story frame house in the West Pullman community is situated on a raised concrete block basement with glass block windows. It is clad with synthetic materials and has a gable roof covered with asphalt shingles and gable dormers along the side elevations. The front elevation has a strip of three windows on the first floor and one in the gable, all of which are non-original one-over-one aluminum-sash. The front door has been moved to the side elevation. This house lacks integrity, does not have distinguishing architectural features, and is not individually eligible for listing on the National Register.



Structural Survey

Integrity:			Additional Notes/Descriptions
Unaltered	Slight Modification	Major Alteration	Replacement front door and windows
Condition:			
Excellent	Good	Poor	
Additional Alteration	ons		
Entrance moved to s	ide elevation		
Structure Usage Exterior Wall Surface			
Current: NA		Synthetic siding	
Historic: NA			
Roof Material	Roof Features	Roof Type	
Asphalt	Dormers	Gable	
Ornamental Archit	ectural Details		Windows
None			Double-hung, glass block
Outbuildings (Num	ber and Description)		
None			

Local Landmark	Y <u>N</u>	
National Register Historic Places	Y <u>N</u>	
National Register Historic District	Y <u>N</u>	Name:
Individually Eligible? No	A B C	Significance:

Additional Comments:



Historical Resource Recordation Form

Property Name	Photos with Captions: South façade of a one-and-a-half-story, single family, frame
Historic: Bldg. not labeled, not in CHRS	residence.
Common/Current: Unknown	
Property Address:	
128 E 117th Street	
HAARGIS Number:	
Not in database	
Present Owner and /or Occupant:	
Unknown	
Property Use	
Historic: Single family residence	
Current: Single family residence	
Date of Construction: 1908	
Architect's Name: Not in CHRS	
Builder/Contractor: Not in CHRS	
Architectural Style:	
Vernacular	
Prepared By: J. Martinez, M. C. Bird, J. Guarino	
Photo By: S. Katz	
Date: 2 October 2012	

Property Description:

Stories: 1.5

This one-and-a-half-story frame house in the West Pullman community is situated on a raised concrete block basement, is clad with synthetic siding, and has a front gable roof covered with asphalt shingles. The front elevation has a non-original, full-width, flat-roofed, wood porch and a non-original off-center hollow core metal panel door with a fanlight. There is a large non-original picture window flanked by double-hung windows on the first floor and a pair of non-original one-over-one aluminum-sash windows in the gable. This house lacks integrity, does not have any distinguishing architectural features, and is not individually eligible for listing on the National Register.



Structural Survey

Integrity:			Additional Notes/Descriptions	
Unaltered	Slight Modification	Major Alteration	Replacement door, windows, porch, and cladding	
Condition:				
Excellent	Good	Poor		
Additional Alteration	ons			
Structu	Structure Usage Exterior Wall Surface			
Current: NA		Synthetic siding		
Historic: NA				
Roof Material	Roof Features	Roof Type		
Asphalt	Dormer	Gable		
Ornamental Archit	ectural Details		Windows	
None			Double-hung, fixed-pane	
Outbuildings (Num	ber and Description)			
None				

Local Landmark	Y <u>N</u>	
National Register Historic Places	Y <u>N</u>	
National Register Historic District	Y <u>N</u>	Name:
Individually Eligible? No	A B C	Significance:

Additional Comments:



Historical Resource Recordation Form

Property Name	Photos with Captions: South and east façades of a one-story, single-family, frame
Historic: Bldg. not labeled, not in CHRS	residence.
Common/Current: Unknown	
Property Address:	
132 E. 117th Street	
HAARGIS Number:	
Not in database	
Present Owner and /or Occupant:	
Unknown	
Property Use	
Historic: Single family residence	
Current: Single family residence	**
Date of Construction: 1908	
Architect's Name: Not in CHRS	
Builder/Contractor: Not in CHRS	
Architectural Style:	
Vernacular	
Prepared By: J. Martinez, M. C. Bird, J.	
Guairno	
Photo By: S. Katz	
Date: 2 October 2012	

Property Description:

Stories: 1

This one-story frame house in the West Pullman community is on a raised concrete block basement with glass block windows, is clad with synthetic materials (possibly fiberboard), has a gable roof covered with asphalt shingles, and has gable dormers along the side elevations. The front elevation has a strip of three windows on the first floor and one in the gable, all of which are non-original one-over-one aluminum-sash. The front door has been moved to the side elevation. This house lacks integrity, does not have distinguishing architectural features, and is not individually eligible for listing on the National Register.



Integrity:			Additional Notes/Descriptions
Unaltered	Slight Modification	Major Alteration	Replacement windows and siding
Condition:			
Excellent	Good	Poor	
Additional Alteration	ons		
Entrance relocated to	o side elevation		
Structure Usage Exterior Wall Surface			
Current: NA		Synthetic siding	
Historic: NA		(possibly fiberboard)	
Roof Material	Roof Features	Roof Type	
Asphalt	Dormers	Gable	
Ornamental Archit	ectural Details	Windows	
None		Double-hung, glass block	
Outbuildings (Number and Description)			
None			

Local Landmark	Y <u>N</u>	
National Register Historic Places	Y <u>N</u>	
National Register Historic District	Y <u>N</u>	Name:
Individually Eligible? No	A B C	Significance:

Additional Comments:			



Historical Resource Recordation Form

Property Name	Photos with Captions: North façade of a one-story, single family, frame residence.
Historic: Bldg. not labeled, not in CHRS	Norm façade of a one story, single failing, france festionee.
Common/Current: Unknown	
Property Address:	
149 E. 117th Street	
HAARGIS Number:	
Not in database	
Present Owner and /or Occupant:	
Unknown	
Property Use	
Historic: Single family residence	
Current: Single family residence	A Constant of the second of th
Date of Construction: 1908	
Architect's Name: Not in CHRS	
Builder/Contractor: Not in CHRS	
Architectural Style:	
Craftsman	
Prepared By: J. Martinez, M. C. Bird, J.	
Guarino	
Photo By: S. Katz	
Date: 22 October 2012	

Property Description:

Stories: 1

This one-story house in the West Pullman community is situated on a raised concrete block basement with glass block windows and is covered with synthetic siding. The building has a front gable roof covered with asphalt shingles. Its front elevation has a full-width hip-roof porch with side-facing concrete steps, metal railings, and open metal posts. This elevation also has an off-center metal storm door, a non-original picture window flanked by one-over-one aluminum-sash windows on the first floor, and a single-pane window in the attic. This house lacks integrity and distinctive architectural features and is not individually eligible for listing on the National Register.



Integrity:			Additional Notes/Descriptions
Unaltered	Slight Modification	Major Alteration	Replacement door, windows, and cladding
Condition:			
<u>Excellent</u>	Good	Poor	
Additional Alteration	ons		
Structu	re Usage	Exterior Wall Surface	
Current: NA		Synthetic siding	
Historic: NA			
Roof Material	Roof Features	Roof Type	
Asphalt shingle	None	Gable	
Ornamental Archit	ectural Details		Windows
None			Double-hung, fixed-pane, glass block
Outbuildings (Num	ber and Description)		
None			

Local Landmark	Y	<u>N</u>	
National Register Historic Places	Y	<u>N</u>	
National Register Historic District	Y	<u>N</u>	Name:
Individually Eligible? No	A	B C	Significance:

Additional Comments:			



Historical Resource Recordation Form

Property Name	Photos with Captions: South façade of a 1.5-story, single family, frame residence.
Historic: Bldg. not labeled, not in CHRS	south façade of a 1.5-story, single family, frame residence.
Common/Current: Unknown	
Property Address:	
312 E. 117th Street	
HAARGIS Number:	
Not in database	
Present Owner and /or Occupant:	
Unknown	
Property Use	
Historic: Single family residence	
Current: Single family residence	
Date of Construction: 1891	
Architect's Name: Not in CHRS	
Builder/Contractor: Not in CHRS	
Architectural Style:	
Vernacular	
Prepared By: J. Martinez, M. C. Bird, J.	
Guarino	
Photo By: S. Katz	
Date: 22 October 2012	

Property Description:

Stories: 1.5

This one-and-a-half-story frame cottage in the West Pullman community sits on a raised concrete block basement and is covered with synthetic siding. The building has a front gable roof covered with asphalt shingles. Its front elevation has an off-center metal storm door, concrete steps with metal railings, a picture window flanked by one-over-one aluminum-sash windows on the first floor, and a pair of one-over-one aluminum-sash windows in the gable, all of which are non-original. This house lacks integrity and distinctive architectural features and is not individually eligible for listing on the National Register.



Integrity:			Additional Notes/Descriptions
Unaltered	Slight Modification	n Major Alteration	Replacement windows, cladding, and porch rails
Condition:			
<u>Excellent</u>	Good	Poor	
Additional Alterati	ons		
Structu	ire Usage	Exterior Wall Surface	
Current: NA		Synthetic siding	
Historic: NA			
Roof Material	Roof Features	Roof Type	
Asphalt shingle	None	Gable	
Ornamental Archit	tectural Details		Windows
None			Double-hung, fixed-pane
Outbuildings (Num	ber and Description)		
None			

Local Landmark	Y <u>N</u>	
National Register Historic Places	Y <u>N</u>	
National Register Historic District	Y <u>N</u>	Name:
Individually Eligible? No	A B C	Significance:

Additional Comments:			



Historical Resource Recordation Form

Historie: Bldg. not labeled, not in CHRSCommon/Current: UnknownProperty Address: 322 E. 117th StreetMata RGIS Number: Not in databaseNot in databasePresent Owner and /or Occupant: UnknownUnknownProperty UseHistorie: Single family residenceCurrent: Single family residenceCurrent: Single family residenceDate of Construction: 1878Architect's Name: Not in CHRSBuilder/Contractor: Not in CHRSBuilder/Contractor: Not in CHRSDate of Construction: 1878Architectural Style: VernacularPrepared By: J. Martinez, M. C. Bird, J. GuarinoPhoto By: S. KatzDate: 22 October 2012	Property Name	Photos with Captions:
Common/Current: UnknownProperty Address: 322 E. 117th StreetHAARGIS Number: Not in databaseNot in databasePresent Owner and /or Occupant: UnknownUnknownProperty UseHistorie: Single family residenceCurrent: Single family residenceCurrent: Single family residenceDate of Construction: 1878Architectr's Name: Not in CHRSBuilder/Contractor: Not in CHRSDate of Construction: 1878Architectral Style: VernacularPrepared By: J. Martinez, M. C. Bird, J. GuarinoPhoto By: S. Katz	Historic: Bldg. not labeled. not in CHRS	South façade of a brick, one-story, single family residence.
322 E. 117th StreetHAARGIS Number:Not in databasePresent Owner and /or Occupant:UnknownProperty UseHistoric: Single family residenceCurrent: Single family residenceDate of Construction: 1878Architectural Style:VernacularPrepared By: J. Martinez, M. C. Bird, J.GuarinoPhoto By: S. Katz		
HAARGIS Number:Not in databasePresent Owner and /or Occupant:UnknownProperty UseHistoric: Single family residenceCurrent: Single family residenceDate of Construction: 1878Architect's Name: Not in CHRSBuilder/Contractor: Not in CHRSBuilder/Contractor: Not in CHRSPrepared By: J. Martinez, M. C. Bird, J.GuarinoPhoto By: S. Katz	Property Address:	
Not in databasePresent Owner and /or Occupant:UnknownProperty UseHistoric: Single family residenceCurrent: Single family residenceDate of Construction: 1878Architect's Name: Not in CHRSBuilder/Contractor: Not in CHRSHarchitectural Style:VernacularPrepared By: J. Martinez, M. C. Bird, J. GuarinoPhoto By: S. Katz	322 E. 117th Street	
Present Owner and /or Occupant:UnknownProperty UseHistoric: Single family residenceCurrent: Single family residenceDate of Construction: 1878Architect's Name: Not in CHRSBuilder/Contractor: Not in CHRSBuilder/Contractor: Not in CHRSPrepared By: J. Martinez, M. C. Bird, J. GuarinoPrepared By: S. Katz	HAARGIS Number:	
UnknownProperty UseHistoric: Single family residenceCurrent: Single family residenceDate of Construction: 1878Architect's Name: Not in CHRSBuilder/Contractor: Not in CHRSBuilder/Contractor: Not in CHRSPrepared By: J. Martinez, M. C. Bird, J. GuarinoProba By: S. Katz	Not in database	
Property UseHistoric: Single family residenceCurrent: Single family residenceDate of Construction: 1878Architect's Name: Not in CHRSBuilder/Contractor: Not in CHRSDate of SystemVernacularPrepared By: J. Martinez, M. C. Bird, J.GuarinoPhoto By: S. Katz	Present Owner and /or Occupant:	
Historic: Single family residenceCurrent: Single family residenceDate of Construction: 1878Architect's Name: Not in CHRSBuilder/Contractor: Not in CHRSLuderVernacularPrepared By: J. Martinez, M. C. Bird, J. GuarinoPhoto By: S. Katz	Unknown	
Current: Single family residenceDate of Construction: 1878Architect's Name: Not in CHRSBuilder/Contractor: Not in CHRSArchitectural Style: VernacularVernacularPrepared By: J. Martinez, M. C. Bird, J. GuarinoPhoto By: S. Katz	Property Use	
Date of Construction: 1878Architect's Name: Not in CHRSBuilder/Contractor: Not in CHRSArchitectural Style: VernacularVernacularPrepared By: J. Martinez, M. C. Bird, J. GuarinoPhoto By: S. Katz	Historic: Single family residence	
Architect's Name: Not in CHRSBuilder/Contractor: Not in CHRSArchitectural Style: VernacularPrepared By: J. Martinez, M. C. Bird, J. GuarinoPhoto By: S. Katz	Current: Single family residence	
Builder/Contractor: Not in CHRSArchitectural Style: VernacularPrepared By: J. Martinez, M. C. Bird, J. GuarinoPhoto By: S. Katz	Date of Construction: 1878	
Architectural Style: VernacularImage: Compared By: J. Martinez, M. C. Bird, J. GuarinoImage: Compared By: S. KatzPhoto By: S. KatzImage: Compared By: S. Katz	Architect's Name: Not in CHRS	
Vernacular Prepared By: J. Martinez, M. C. Bird, J. Guarino Photo By: S. Katz	Builder/Contractor: Not in CHRS	
Prepared By: J. Martinez, M. C. Bird, J. Guarino Photo By: S. Katz	Architectural Style:	
Guarino Photo By: S. Katz	Vernacular	
Photo By: S. Katz	Prepared By: J. Martinez, M. C. Bird, J.	
	Guarino	
Date: 22 October 2012	Photo By: S. Katz	
	Date: 22 October 2012	

Property Description:

Stories: 1

This one-story cottage in the West Pullman community is situated on a raised brick basement and has a hipon-gable roof covered with asphalt shingles. Its front elevation is clad with brown face brick and has a central hollow core metal door flanked by a pair of one-over-one aluminum sash windows on one side and a strip of three casement windows on the other. The gable has a pair of one-over-one aluminum-sash windows. This elevation also has side-facing concrete steps faced with faux stone and metal railings. Detailing includes brick pilasters flanking the door, concrete sills, flat arch window lintels with square stone inserts, and a lintel above the door that reads: "FAM.TOVALIN.E.322." This house lacks distinctive architectural features and is not individually eligible for listing on the National Register.



Integrity:			Additional Notes/Descriptions
Unaltered	Slight Modification	Major Alteration	Replacement door and windows
Condition:			
Excellent	Good	Poor	
Additional Alterati	ons		
Structu	re Usage	Exterior Wall Surface	
Current: NA		Brick	
Historic: NA			
Roof Material	Roof Features	Roof Type	
Asphalt shingle	Dormers	Hip-on-gable	
Ornamental Archit	ectural Details		Windows
Brick pilasters, conc	rete sills, flat arch window	lintels with stone inserts,	Double-hung, casement
inscribed lintel abov	e entrance		
Outbuildings (Num	ber and Description)		
None			

Local Landmark	Y <u>N</u>	
National Register Historic Places	Y <u>N</u>	
National Register Historic District	Y <u>N</u>	Name:
Individually Eligible? No	A B C	Significance:

Additional Comments:			



Historical Resource Recordation Form

Property Name	Photos with Captions: North façade of a one-story, single family, frame residece.
Historic: Bldg. not labeled, not in CHRS	Norm raçade of a one story, single ranny, france residece.
Common/Current: Unknown	
Property Address:	
345 E. 117th Street	
HAARGIS Number:	
Not in database	
Present Owner and /or Occupant:	
Unknown	
Property Use	
Historic: Single family residence	
Current: Single family residence	
Date of Construction: 1903	
Architect's Name: Not in CHRS	
Builder/Contractor: Not in CHRS	
Architectural Style:	
Vernacular	
Prepared By: J. Martinez, M. C. Bird, J.	
Guarino	
Photo By: S. Katz	
Date: 23 October 2012	

Property Description:

Stories: 1

This one-story frame cottage in the West Pullman community is situated on a raised concrete block basement and is covered with synthetic siding. The building has a front gable roof covered with asphalt shingles. Its front elevation has an off-center wood door with wood steps, metal railings, and a metal awning. This elevation also has a rounded bow window with four casements on the first floor and a pair of small casement windows in the attic, each with four lights. A small triangular ventilating louver is located at the apex of the gable. This house lacks integrity and distinctive architectural features and is not individually eligible for listing on the National Register.



Integrity:			Additional Notes/Descriptions	
Unaltered	Slight Modification	Major Alteration	Replacement cladding	
Condition:				
Excellent	Good	Poor		
Additional Alterati	ons			
Structu	ire Usage	Exterior Wall Surface		
Current: NA		Synthetic siding		
Historic: NA				
Roof Material	Roof Features	Roof Type		
Asphalt shingle	None	Gable		
Ornamental Archit	ectural Details		Windows	
None			Casement	
Outbuildings (Number and Description)				
None				

Local Landmark	Y <u>N</u>	
National Register Historic Places	Y <u>N</u>	
National Register Historic District	Y <u>N</u>	Name:
Individually Eligible? No	A B C	Significance:

Additional Comments:			



Historical Resource Recordation Form

Property Name	Photos with Captions: South façade of a one-story, single family, frame residence.
Historic: Bldg. not labeled, not in CHRS	South façade of a one-story, single failing, frame residence.
Common/Current: Unknown	
Property Address:	
742 W. 117th Street	
Alternate: 722 W. 117th Street (per CCA)	
HAARGIS Number:	
Not in database	
Present Owner and /or Occupant:	
Unknown	
Property Use	
Historic: Single family residence	
Current: Single family residence	
Date of Construction: 1925	
Architect's Name: Not in CHRS	
Builder/Contractor: Not in CHRS	
Architectural Style:	
Craftsman	
Prepared By: J. Martinez, M. C. Bird, J.	
Guarino	
Photo By: S. Katz	
Date: 24 October 2012	
Property Decemintion.	Storiog 1

Property Description:

Stories: 1

This one-story frame bungalow in the West Pullman community sits on a raised concrete block basement with sliding windows and is covered with synthetic siding. The building has a hip roof covered with asphalt shingles, a gable dormer, and overhanging eaves. The front elevation has a recessed corner porch with low synthetic-clad sidewalls, a squat wood post supporting the corner, and wood steps. The front door is on the west wall of the living room bay. Windows on the front elevation are non-original and include four one-over-one aluminum-sash—a strip of three in the living room bay and one in the recessed porch—and a strip of four single-pane windows in the gable dormer. The east elevation has a gabled through-the-cornice wall dormer. This house lacks integrity and distinctive architectural features and is not individually eligible for listing on the National Register.



Integrity:			Additional Notes/Descriptions
Unaltered	Slight Modification	n Major Alteration	Replacement door, windows, and cladding
Condition:			
<u>Excellent</u>	Good	Poor	
Additional Alterati	ons		
Structure Usage Exterior Wall Surface			
Current: NA		Synthetic siding	
Historic: NA			
Roof Material	Roof Features	Roof Type	
Asphalt shingle	Dormers	Hip	
Ornamental Architectural Details			Windows
None			Double-hung, casement, sliding
Outbuildings (Number and Description)			
None			

Local Landmark	Y <u>N</u>	
National Register Historic Places	Y <u>N</u>	
National Register Historic District	Y <u>N</u>	Name:
Individually Eligible? No	A B C	Significance:

Additional Comments:			



Historical Resource Recordation Form

Property Name	Photos with Captions: South façade of a one-story, single family, frame residence.
Historic: Bldg. not labeled, not in CHRS	South laçade of a one-story, single family, frame residence.
Common/Current: Unknown	
Property Address:	
306 E. 118th Street	
HAARGIS Number:	
Not in database	
Present Owner and /or Occupant:	
Unknown	
Property Use	
Historic: Single family residence	
Current: Single family residence	
Date of Construction: 1898	
Architect's Name: Not in CHRS	
Builder/Contractor: Not in CHRS	
Architectural Style:	
Vernacular	
Prepared By: J. Martinez, M. C. Bird, J.	
Guarino	
Photo By: S. Katz	
Date: 23 October 2012	
Deres and Deres for the sec	

Property Description:

Stories: 1

This one-story frame cottage in the West Pullman community is situated on a raised concrete block basement with glass block windows and is covered with synthetic siding. The building has a front gable roof covered with asphalt shingles. It has a full-width flat-roof porch, half of which is enclosed and features a single one-over-one aluminum-sash window. The open portion of the porch has a door, a pair of nonoriginal sliding windows, wood posts, steps, and railings. This house lacks integrity and distinctive architectural features and is not individually eligible for listing on the National Register.



Integrity:			Additional Notes/Descriptions
Unaltered	Slight Modification	Major Alteration	Replacement windows, cladding, and porch rails
Condition:			
Excellent	Good	Poor	
Additional Alterati	ons		
Structu	ire Usage	Exterior Wall Surface	
Current: NA		Synthetic siding	
Historic: NA			
Roof Material	Roof Features	Roof Type	
Asphalt shingle	None	Gable	
Ornamental Archit	ectural Details		Windows
None			Double-hung, glass block, sliding
Outbuildings (Num	ber and Description)		
None			

Local Landmark	Y <u>N</u>	
National Register Historic Places	Y <u>N</u>	
National Register Historic District	Y <u>N</u>	Name:
Individually Eligible? No	A B C	Significance:

Additional Comments:	



Historical Resource Recordation Form

Property Name	Photos with Captions: North and west façades of two-story, single-family, frame residence.
Historic: Bldg. not labeled, not in CHRS	North and west fuçudes of two story, single family, frame festidence.
Common/Current: Unknown	
Property Address:	
354 E. 118th Street	
HAARGIS Number:	
Not in database	
Present Owner and /or Occupant:	
Unknown	
Property Use	
Historic: Single family residence	
Current: Single family residence	
Date of Construction: 1886	
Architect's Name: Not in CHRS	
Builder/Contractor: Not in CHRS	
Architectural Style:	
Vernacular	
Prepared By: J. Martinez, M. C. Bird, J. Guarino	
Photo By: Steve Katz	
Date: 2 October 2012	

Property Description:

Stories: 2

This two-story frame house in the West Pullman community is situated on a raised concrete block basement with glass block windows, is clad with synthetic siding, and has a gable roof with asphalt shingles. The fenestration pattern has been altered with the moving of the main entrance from the 118th Street elevation and the windows, which feature non-original casements and one-over-one non-original aluminum varieties on both the first and second floors. This house lacks integrity, does not have visible distinguishing architectural features, and is not individually eligible for listing on the National Register.



Structural Survey

Integrity:			Additional Notes/Descriptions
Unaltered	Slight Modification	on Major Alteration	Replacement door, windows, and siding
Condition:			
Excellent	Good	Poor	
Additional Alteration	ons		
Structure Usage Exterior Wall Surface			
Current: NA		Synthetic siding	
Historic: NA			
Roof Material	Roof Features	Roof Type	
Asphalt	None	Gable	
Ornamental Archit	ectural Details	Windows	
None			Double-hung, casement
Outbuildings (Num	ber and Description)		
Detached two-car ga	rage with pyramidal roo	of and vinyl siding.	

Local Landmark	Y <u>N</u>	
National Register Historic Places	Y <u>N</u>	
National Register Historic District	Y <u>N</u>	Name:
Individually Eligible? No	A B C	Significance:

Additional Comments:



Historical Resource Recordation Form

Property Name	Photos with Captions:
	North (118th) façade of a brick, two story, multi-family residence.
Historic: Bldg. not labeled, not in CHRS	
Common/Current: Unknown	
Property Address:	
737 W. 118th Street	
HAARGIS Number:	
Not in database	
Present Owner and /or Occupant:	
Unknown	
Property Use	
Historic: Single family residence	
Current: Multi-family residence	East (Emerald) façade of the residence.
Date of Construction: 1897	
Architect's Name: Not in CHRS	
Builder/Contractor: Not in CHRS	
Architectural Style:	
Vernacular	
Prepared By: J. Martinez, M. C. Bird, J.	
Guarino	
Photo By: S. Katz	
Date: 24 October 2012	
Property Description:	Stories: 2
	rner of 118th Street and Emerald Avenue in the West Pullman
community is clad with orange-brown fa	ce brick and is situated on a raised basement with glass block

This two-story house at the southwest corner of 118th Street and Emerald Avenue in the West Pullman community is clad with orange-brown face brick and is situated on a raised basement with glass block windows. The building has a gable-on-hip roof covered with asphalt shingles. Its front elevation has a full-width shed-roof porch with brick piers. The areas between the piers have been in-filled with synthetic siding and non-original single-pane windows. A non-original hollow core metal door with metal awning is located on the wood-covered north side of this porch and accessed via concrete steps. The second floor of the front elevation has two one-over-one windows and an additional window is located in the synthetic-clad gable. The east elevation has a full-height rounded window bay pavilion topped by a conical roof. Side elevation windows are non-original one-over-one aluminum-sash. A stringcourse with brick dentils is situated near the roofline and extends around the building. This house lacks integrity and distinguishing architectural features and is not individually eligible for listing on the National Register.



Integrity:			Additional Notes/Descriptions
Unaltered	Slight Modification	n Major Alteration	Replacement door and windows; porch enclosed
Condition:			
Excellent	Good	Poor	
Additional Alterati	ons		
Structu	re Usage	Exterior Wall Surface	
Current: NA		Brick, synthetic (gable)	
Historic: NA			
Roof Material	Roof Features	Roof Type	
Asphalt shingle	None	Gable-on-hip	
Ornamental Archit	ectural Details		Windows
Bay pavilion with co	onical roof, brick stringcou	rse with dentils	Double-hung, fixed pane, glass block
Outbuildings (Num	ber and Description)		
None			

Local Landmark	Y	<u>N</u>	
National Register Historic Places	Y	<u>N</u>	
National Register Historic District	Y	<u>N</u>	Name:
Individually Eligible? No	A	B C	Significance:

Additional Comments:			



Historical Resource Recordation Form

Property Name	Photos with Captions: South façade of a one-story, single family, frame residence.
Historic: Bldg. not labeled, not in CHRS	Bouin façade of a one story, single failing, france residence.
Common/Current: Unknown	
Property Address:	
834 W. 118th Street	
HAARGIS Number:	
Not in database	
Present Owner and /or Occupant:	
Unknown	
Property Use	
Historic: Single family residence	
Current: Single family residence	
Date of Construction: 1909	
Architect's Name: Not in CHRS	
Builder/Contractor: Not in CHRS	
Architectural Style:	
Vernacular	
Prepared By: J. Martinez, M. C. Bird, J.	
Guarino	
Photo By: S. Katz	The second s
Date: 24 October 2012	
Decementary Decementary the second	

Property Description:

Stories: 1

This one-story house in the West Pullman community is covered with synthetic siding and has a gable roof covered with asphalt shingles. Its front elevation has a partial-width hip-roof porch with metal posts and a hollow core metal door. Windows are non-original and include a picture window flanked by one-over-one aluminum-sash windows on the first floor, and a pair of one-over-one aluminum-sash windows in the gable. Both sets of windows are partially obscured by low metal awnings. The porch steps and railings are obscured by foliage. This house lacks integrity and distinguishing architectural features and is not individually eligible for listing on the National Register.



Integrity:			Additional Notes/Descriptions
Unaltered	Slight Modification	Major Alteration	Replacement windows and cladding
Condition:			
Excellent	Good	Poor	
Additional Alterati	ons		
Structu	ire Usage	Exterior Wall Surface	
Current: NA		Synthetic siding	
Historic: NA			
Roof Material	Roof Features	Roof Type	
Asphalt shingle	None	Gable	
Ornamental Archit	tectural Details		Windows
None			Double-hung, fixed-pane
Outbuildings (Num	ber and Description)		·
None			

Local Landmark	Y <u>N</u>	
National Register Historic Places	Y <u>N</u>	
National Register Historic District	Y <u>N</u>	Name:
Individually Eligible? No	A B C	Significance:

Additional Comments:			



Historical Resource Recordation Form

Property Name	Photos with Captions: South façade of a brick, two-story building.
Historic: Bldg. not labeled, not in CHRS	
Common/Current: Unknown	
Property Address:	
738 W. 119th Street	
HAARGIS Number:	
Not in database	
Present Owner and /or Occupant:	
Unknown	
Property Use	
Historic: Commercial	and a state of the
Current: Multi-family residence	
Date of Construction: 1893	
Architect's Name: Not in CHRS	
Builder/Contractor: Not in CHRS	
Architectural Style:	
Vernacular	
Prepared By: J. Martinez, M. C. Bird, J. Guarino	
Photo By: S. Katz	
Date: 24 October 2012	

Property Description:

Stories: 2

This two-story brick-clad building in the West Pullman community has a flat roof and parapet. Its storefront area has been in-filled with faux stone, a non-original door, and a small window. A secondary off-center non-original hollow core metal door that provides access to the second floor apartments is flanked by original buttresses and topped by small arches, the interiors of which have been in-filled with wood. The second floor has two pairs of windows that appear to be casements. Detailing includes a belt course, cornice, finial-like molding flanking the second story windows, and a continuous arcade across the parapet level, the openings of which have been in-filled with wood. This building lacks integrity and distinguishing architectural features and is not individually eligible for listing on the National Register.



Structural Survey

Integrity:			Additional Notes/Descriptions	
Unaltered	<u>Slight Modificati</u>	on Major Alteration	Replacement door and windows; storefronts and arcades in-filled with wood	
Condition:				
Excellent	Good	Poor		
Additional Alteration	ons			
Converted from com	mercial to apartments a	fter 1938 (Sanborn).		
Structure Usage Exterior Wall Surface				
Current: NA		Brick (main),		
Historic: NA		Faux stone (storefront)		
Roof Material	Roof Features	Roof Type		
Unknown	Parapet	Flat		
Ornamental Architectural Details			Windows	
Buttresses, arches, arcade, belt course, cornice, finial-like molding		Double-hung, casement		
Outbuildings (Num	Outbuildings (Number and Description)			
None				

Local Landmark	Y <u>N</u>	
National Register Historic Places	Y <u>N</u>	
National Register Historic District	Y <u>N</u>	Name:
Individually Eligible? No	A B C	Significance:

Additional Comments:



Historical Resource Recordation Form

Property Name	Photos with Captions: South façade of a brick, one-story, industrial building.
Historic: Bldg. not labeled, not in CHRS	South façade of a offick, one-story, industrial oundring.
Common/Current: Unknown	
Property Address:	
846 W. 119th Street	
HAARGIS Number:	
Not in database	
Present Owner and /or Occupant:	
Weinberg Plumbing Co. Inc.	
Property Use	
Historic: Industrial (Steam Laundry, 1938)	
Current: Industrial	
Date of Construction: 1915	
Architect's Name: Not in CHRS	
Builder/Contractor: Not in CHRS	
Architectural Style:	
Vernacular	
Prepared By: J. Martinez, M. C. Bird, J.	
Guarino	
Photo By: S. Katz	
Date: 24 October 2012	
Property Description:	Stories: 1

Property Description:

Stories: 1

This one-story commercial building in the West Pullman community has a flat roof, parapet, and a pent roof across the length of the front elevation. The front façade is clad with white glazed brick on its east side and in pale yellow brick on its west side. The front elevation features a series of tall windows that are trimmed in green brick and have been in-filled, some with glass block and some with brick. The windows are topped by decorative round-arches of green bricks with stone keystones. The building has a hollow core metal double-door with a Classical stone surround comprising fluted pilasters and entablature. Two non-original overhead garage doors have also been inserted into the front elevation, one of which has replaced two window openings. This building lacks integrity and distinguishing architectural features and is not individually eligible for listing on the National Register.



Integrity:			Additional Notes/Descriptions	
Unaltered	Slight Modification	n Major Alteration	In-filled windows	
Condition:				
Excellent	Good	Poor		
Additional Alterati	ons			
Structu	ire Usage	Exterior Wall Surface		
Current: NA		Brick		
Historic: NA				
Roof Material	Roof Features	Roof Type		
Asphalt	None	Flat		
Ornamental Archit	tectural Details		Windows	
Green brick trim on arches, keystones, Classical surround at entrance			Glass block	
Outbuildings (Num	Outbuildings (Number and Description)			
None				

Local Landmark	Y <u>N</u>	
National Register Historic Places	Y <u>N</u>	
National Register Historic District	Y <u>N</u>	Name:
Individually Eligible? No	A B C	Significance:

Additional Comments:			



Historical Resource Recordation Form

Property Name	Photos with Captions: South façade of a brick, two-story, multi-family residence.
Historic: Bldg. not labeled, not in CHRS	bouth laçade of a brick, two story, main faining residence.
Common/Current: Unknown	
Property Address:	
918 W. 119th Street	
HAARGIS Number:	
Not in database	
Present Owner and /or Occupant:	
Unknown	
Property Use	
Historic: Commercial	
Current: Multi-family residence	
Date of Construction: 1925	Organizer Res Renge a
Architect's Name: Not in CHRS	
Builder/Contractor: Not in CHRS	
Architectural Style:	
Vernacular	
Prepared By: J. Martinez, M. C. Bird, J. Guarino	
Photo By: S. Katz	and the second
Date: 24 October 2012	

Property Description:

Stories: 2

This two-story former commercial building in the West Pullman community has a front elevation that is clad with brown face brick. The building includes a concrete water table, flat roof, and a shaped parapet with concrete coping. Its former storefront has a recessed door with an in-filled transom, and its flanking windows and wall area have been covered with wood boards and tile, respectively. Original first floor cladding is extant in the corner piers, including those with stone coping that flank the off-center entrance. The entrance has an aluminum-core metal door and transom that provides access to the upper level apartment. The second floor has non-original one-over-one aluminum-sash windows arranged in a group of three and in a pair. Detailing includes concrete sills, coping, panel and diamond-shaped insert blocks at the parapet level, brick panels and soldier course lintels. This building lacks integrity and distinguishing architectural features and is not individually eligible for listing on the National Register.




Integrity:			Additional Notes/Descriptions
Unaltered	Slight Modification Major Alteration		Replacement doors, windows, cladding (1 st floor)
Condition:			
Excellent	<u>Good</u> <u>Poor</u>		
Additional Alterati	ions		
Converted from con remodeling as well.	nmercial to residential po	ost 1938 (Sanborn); ongoing	
Structu	ire Usage	Exterior Wall Surface	
Current: NA		Brick, tile	
Historic: NA			
Roof Material	Roof Features	Roof Type	
Unknown	Parapet	Flat	
Ornamental Archi	tectural Details		Windows
Concrete coping, piers with stone coping, panel, and insert blocks, concrete			Double-hung
sills; brick panels ar	nd soldier course lintels		
Outbuildings (Num	iber and Description)		
None			

Local Landmark	Y <u>N</u>	
National Register Historic Places	Y <u>N</u>	
National Register Historic District	Y <u>N</u>	Name:
Individually Eligible? No	A B C	Significance:

Additional Comments:			



Historical Resource Recordation Form

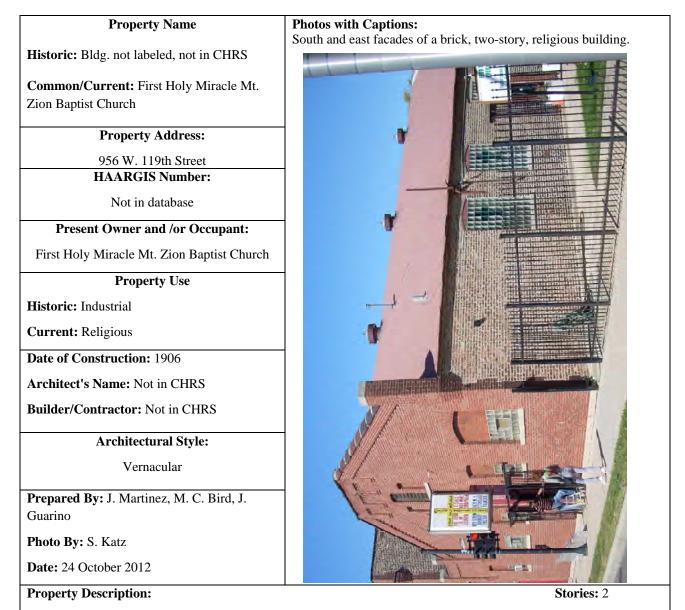

This two-story former light industrial building in the West Pullman community is clad with face brick on its front elevation and common brick on its side and rear elevations. The building has a gable roof. The front elevation has a raised, truncated-gabled parapet with clay tile coping and corbelling. It features a centrally located pair of glass double doors and five segmental-arched window openings that have been in-filled with glass block and brick. The second floor of the front elevation has a group of three window openings that feature wood louvers and brick infill. The parapet level features decorative brickwork while brick piers flank the building's façade. Side elevation windows are in-filled with glass block. This building lacks sufficient integrity and distinguishing architectural features to qualify for individual listing on the National Register.



Integrity:			Additional Notes/Descriptions
Unaltered	Slight Modificat	tion Major Alteration	Replacement windows and infill
Condition:			
Excellent	Good	Poor	
Additional Alterati	ons		
Converted from indu	strial production to reli	gious services.	
Structu	re Usage	Exterior Wall Surface	
Current: NA		Brick	
Historic: NA			
Roof Material	Roof Features	Roof Type	
Asphalt	Parapet	Gable	
Ornamental Archit	ectural Details		Windows
Clay tile coping, seg	mental arched windows	s, decorative brickwork including	Glass block
corbelling and piers			
Outbuildings (Num	ber and Description)		
None			

Local Landmark	Y <u>N</u>	
National Register Historic Places	Y <u>N</u>	
National Register Historic District	Y <u>N</u>	Name:
Individually Eligible? No	A B C	Significance:

Additional Comments:			



Historical Resource Recordation Form

Property Name	Photos with Captions: South façade of two-story, brick fire house.
Historic: Fire Department	South raçade of two-story, offer file house.
Common/Current: Fire Department Engine House 115 (Sanborn, 1911)	
Property Address:	
931 W. 120th Street	
HAARGIS Number:	
Not in database	
Present Owner and /or Occupant:	
Chicago Fire Department	
Property Use	
Historic: Public	
Current: Public	
Date of Construction: 1897-1911	
Architect's Name: Not in CHRS database	
Builder/Contractor: Not in CHRS database	
Architectural Style:	
Vernacular	
Prepared By: C. Tolmie, M. C. Bird, J.	
Guarino	
Photo By: S. Katz	
Date: 13 September 2012	
Property Description:	Stories: 2

This two-story firehouse in the West Pullman community has a flat roof and parapet. Its front elevation is clad in brown face brick and has a centrally located overhead metal door flanked by single one-over-one windows on the first floor. Four one-over-one windows (non-original) are situated on the second floor. The overhead opening for the station's fire truck features a Classical stone surround with Ionic columns atop low pedestals, a frieze band incised with the words "Fire Department," and a pediment. Detailing includes a circular motif in stone, stone sills, sill courses, and a metal cornice. This is an excellent example of a neighborhood fire station that still functions in its original use and has very good integrity. It is individually eligible for listing on the National Register.



Integrity:			Additional Notes/Descriptions
Unaltered	Slight Modification	n Major Alteration	Replacement windows
Condition:			
Excellent	Good	Poor	
Additional Alterati	ons		
Structu	ıre Usage	Exterior Wall Surface	
Current: NA		Brick, stone	
Historic: NA			
Roof Material	Roof Features	Roof Type	
Unknown	Parapet	Flat	
Ornamental Archit	tectural Details		Windows
Stone circular motif.	sills, sill courses: metal c	cornice, pediment, columns,	Double-hung
frieze band reading		, , , , , , , , , , , , , , , , , , ,	
Outbuildings (New	ber and Description)		
Guidunungs (Num	iver unu Description)		
None			

Local Landmark	Y	N	
National Register Historic Places	Y	N	
National Register Historic District	Y	<u>N</u>	Name:
Individually Eligible? Yes	A	в <u>с</u>	Significance: This building has excellent integrity and is a rare surviving example of an early 20th century fire station in West Pullman.

Additional Comments:		



Historical Resource Recordation Form

Property Name	Photos with Captions: North façade of a 1.5-story, single family, frame residence.
Historic: Bldg. not labeled, not in CHRS	Norui raçade or a 1.5-story, single raininy, frame residence.
Common/Current: Unknown	
Property Address:	
1455 W. 120th Street	
HAARGIS Number:	
Not in database	
Present Owner and /or Occupant:	
Unknown	
Property Use	
Historic: Single family residence	RESERVED PARKING PERMIT 20144
Current: Single family residence	
Date of Construction: 1919	
Architect's Name: Not in CHRS	
Builder/Contractor: Not in CHRS	
Architectural Style:	
Vernacular	
Prepared By: J. Martinez, M. C. Bird, J.	
Guarino	Marine Carlos Company and Carlos
Photo By: S. Katz	
Date: 30 October 2012	

Property Description:

Stories: 1.5

This one-and-a-half-story frame cottage in the West Pullman community is situated on a raised concrete block basement and is covered with synthetic siding. The building has a front gable roof covered with asphalt shingles. Its front elevation has a full-width, hip roof, synthetic-clad enclosed porch with a metal storm door, wood steps and railings, and three non-original double-hung aluminum-sash windows. Two non-original windows are located in the gable—a large picture window and an adjacent small single-pane window. This house lacks integrity and distinguishing architectural features and is not individually eligible for listing on the National Register.



Integrity:			Additional Notes/Descriptions
Unaltered	Slight Modification	Major Alteration	Replacement windows, cladding, and porch rails
Condition:			
<u>Excellent</u>	Good	Poor	
Additional Alterati	ons		
Structu	ire Usage	Exterior Wall Surface	
Current: NA		Synthetic siding	
Historic: NA			
Roof Material	Roof Features	Roof Type	
Asphalt shingles	None	Gable	
Ornamental Archit	ectural Details		Windows
None			Double-hung, fixed pane
Outbuildings (Num	ber and Description)		
None			

Local Landmark	Y <u>N</u>	
National Register Historic Places	Y <u>N</u>	
National Register Historic District	Y <u>N</u>	Name:
Individually Eligible? No	A B C	Significance:

Additional Comments:			



Historical Resource Recordation Form

Property Name	Photos with Captions: South façade of a one-story, brick, single story residence.			
Historic: Bldg. not labeled, not in CHRS	South Inçuite of a one story, oriek, single story residence.			
Common/Current: Unknown				
Property Address:				
738 W. 129th Place				
HAARGIS Number:				
Not in database				
Present Owner and /or Occupant:				
Unknown				
Property Use				
Historic: Single family residence				
Current: Single family residence				
Date of Construction: 1951				
Architect's Name: Not in CHRS				
Builder/Contractor: Not in CHRS				
Architectural Style:				
Vernacular				
Prepared By: J. Martinez, M. C. Bird, J.				
Guarino				
Photo By: S. Katz				
Date: 29 October 2012				

Property Description:

Stories: 1

This one-story house in the West Pullman community is clad with tan face brick on its front elevation and common brick on its side and rear elevations. The building has a side-gabled roof covered with asphalt shingles. The front elevation has a centrally located metal storm door with a concrete surround, concrete steps with metal railings, and a projecting living room bay. The façade includes a picture window flanked by casements, and a single window that is obscured by a low metal awning and shrubs. A pent roof spans the door and living room bay. It does not feature distinguishing architectural elements and is not individually eligible for listing on the National Register.



Integrity:			Additional Notes/Descriptions
<u>Unaltered</u>	Slight Modification	Major Alteration	
<u> </u>			
Condition:			
Excellent	Good	Poor	
Additional Alterati	ons		
Structu	ire Usage	Exterior Wall Surface	
Current: NA		Brick	
Historic: NA			
Roof Material	Roof Features	Roof Type	
Asphalt shingle	None	Gable	
Ornamental Archit	ectural Details		Windows
Concrete door surro	und		Fixed-pane, casement
Outbuildings (Num	ber and Description)		
None			

Local Landmark	Y	<u>N</u>	
National Register Historic Places	Y	<u>N</u>	
National Register Historic District	Y	<u>N</u>	Name:
Individually Eligible? No	Α	B C	Significance:

Additional Comments:		



Historical Resource Recordation Form

Property Name	Photos with Captions: North façade of a one-story, single family, brick residence.			
Historic: Bldg. not labeled, not in CHRS	North façade of a one-story, single failing, onek residence.			
Common/Current: Unknown				
Property Address:				
743 W. 129th Place				
HAARGIS Number:				
Not in database				
Present Owner and /or Occupant:				
Unknown				
Property Use				
Historic: Single family residence				
Current: Single family residence				
Date of Construction: 1952				
Architect's Name: Not in CHRS				
Builder/Contractor: Not in CHRS				
Architectural Style:				
Vernacular				
Prepared By: J. Martinez, M. C. Bird, J.				
Guarino				
Photo By: S. Katz				
Date: 29 October 2012				

Property Description:

Stories: 1

This one-story house in the West Pullman community sits on a raised basement and is clad with tan brick on its front elevation and common brick on its side and rear elevations. The building has a hip roof covered with asphalt shingles and overhanging eaves. A one-story addition extends the living room to the west. The front elevation has an off-center metal storm door, a concrete porch with metal railings, two picture windows (one with a stone lintel), and a bulls-eye window with stone accents. The projecting living room bay has a synthetic-clad front-facing gable that extends over adjacent the living room bay addition. It does not feature sufficient integrity or distinguishing architectural features to be individually eligible for listing on the National Register.



Integrity:			Additional Notes/Descriptions
Unaltered	Slight Modification	on Major Alteration	Replacement cladding (gable end)
Condition:			
Excellent	Good	Poor	
Additional Alteration	ons		
Living room addition	n		
Structure Usage Exte		Exterior Wall Surface	
Current: NA		Brick (main),	
Historic: NA		Synthetic siding (gable end)	
Roof Material	Roof Features	Roof Type	
Asphalt shingle	None	Hip	
Ornamental Archit	ectural Details		Windows
Bulls eye window with stone accents, stone lintel			Double-hung, fixed-pane
Outbuildings (Num	ber and Description)		
None			

Local Landmark	Y <u>N</u>	
National Register Historic Places	Y <u>N</u>	
National Register Historic District	Y <u>N</u>	Name:
Individually Eligible? No	A B C	Significance:

Additional Comments:			



Historical Resource Recordation Form

Property Name	Photos with Captions: South façade of a one-story, single family, brick residence.
Historic: Bldg. not labeled, not in CHRS	South laçade of a one-story, single family, offek festdenee.
Common/Current: Unknown	
Property Address:	
814 W. 129th Place	
HAARGIS Number:	
Not in database	
Present Owner and /or Occupant:	
Unknown	
Property Use	
Historic: Single family residence	
Current: Single family residence	
Date of Construction: 1953	
Architect's Name: Not in CHRS	
Builder/Contractor: Not in CHRS	
Architectural Style:	
Vernacular	
Prepared By: J. Martinez, M. C. Bird, J.	
Guarino	
Photo By: S. Katz	
Date: 29 October 2012	

Property Description:

Stories: 1

This one-story house in the West Pullman community is clad with tan brick on its front elevation and common brick on its side and rear elevations. The building has a gable-on-hip roof covered with asphalt shingles and a projecting living room bay. The front elevation has an off-center metal storm door, an adjacent glass block window, wood steps with straight wood railings, and a picture window flanked by one-over-one wood-sash windows. A pent roof spans the door and living room bay and decorative stones flank the door. Bricks in the gable end are painted. It does not feature distinguishing architectural elements and is not individually eligible for listing on the National Register.



Integrity:			Additional Notes/Descriptions
<u>Unaltered</u>	Slight Modification	Major Alteration	
Condition:			
Excellent	Good	Poor	
Additional Alteration	ons		
Structu	re Usage	Exterior Wall Surface	
Current: NA		Brick	
Historic: NA			
Roof Material	Roof Features	Roof Type	
Asphalt shingle	None	Gable-on-hip	
Ornamental Archit	ectural Details		Windows
Decorative stones at	entrance		Double-hung, fixed-pane, glass block
Outbuildings (Num	ber and Description)		
None			

Local Landmark	Y	<u>N</u>	
National Register Historic Places	Y	<u>N</u>	
National Register Historic District	Y	<u>N</u>	Name:
Individually Eligible? No	A	B C	Significance:

Additional Comments:			



Historical Resource Recordation Form

Property Name	Photos with Captions: North façade of a one-story, single family, brick residence.
Historic: Bldg. not labeled, not in CHRS	North façade of a one-story, single family, orick residence.
Common/Current: Unknown	
Property Address:	
817 W. 129th Place	
HAARGIS Number:	
Not in database	
Present Owner and /or Occupant:	
Unknown	
Property Use	
Historic: Single family residence	
Current: Single family residence	
Date of Construction: 1956	
Architect's Name: Not in CHRS	
Builder/Contractor: Not in CHRS	
Architectural Style:	
Vernacular	
Prepared By: J. Martinez, M. C. Bird, J.	
Guarino	
Photo By: S. Katz	
Date: 29 October 2012	
Duon ontre Dogonin tions	Starian 1

Property Description:

Stories: 1

This one-story house in the West Pullman community is clad with tan brick and synthetic siding on its front elevation and common brick on its side and rear elevations. The building has a front gable roof covered with asphalt shingles and overhanging eaves along its side elevations. The front elevation has a partial-width pent roof, a centrally located metal storm door, concrete steps with metal railings, a pair of casement windows in one corner, and a pair of two vertically-oriented picture windows in the other. The residence does not display distinguishing architectural features and is not individually eligible for listing on the National Register.



Integrity:			Additional Notes/Descriptions
integrity.			-
Unaltered	Slight Modification	on Major Alteration	Replacement cladding
Condition:			
Excellent	Good	Poor	
Additional Alteration	ons		
Structu	re Usage	Exterior Wall Surface	
Current: NA		Brick (main), synthetic siding	
		(gable end and partial façade)	
Historic: NA			
Roof Material	Roof Features	Roof Type	
Asphalt shingles	None	Gable	
Ornamental Archit	ectural Details		Windows
None			Casement, fixed pane
Outbuildings (Num	ber and Description)		
None			

Local Landmark	Y <u>N</u>	
National Register Historic Places	Y <u>N</u>	
National Register Historic District	Y <u>N</u>	Name:
Individually Eligible? No	A B C	Significance:

Additional Comments:			



Historical Resource Recordation Form

Property Name	Photos with Captions: West façade of a single story, single family, frame residence.
Historic: Bldg. not labeled, not in CHRS	west raçade of a single story, single ranning, france residence.
Common/Current: Unknown	
Property Address:	
12015 S. Bishop Street	
HAARGIS Number:	
Not in database	
Present Owner and /or Occupant:	
Unknown	
Property Use	
Historic: Single family residence	
Current: Single family residence	
Date of Construction: 1914	
Architect's Name: Not in CHRS	
Builder/Contractor: Not in CHRS	
Architectural Style:	
Vernacular	
Prepared By: J. Martinez, M. C. Bird, J.	
Guarino	
Photo By: S. Katz	
Date: 30 October 2012	
Property Description:	Stories: 1

Property Description:

Stories: 1

This one- story cottage in the West Pullman community is situated on a raised concrete block basement and is clad with wood boards laid vertically. The building has a front gable roof covered with asphalt shingles. The front elevation has a full-width, hip-roof wood porch with straight railings and squared posts, a hollow core metal door, and three non-original one-over-one aluminum-sash windows—two on the first floor and one in the gable. This house lacks distinguishing architectural features and is not individually eligible for listing on the National Register.



Integrity:			Additional Notes/Descriptions
Unaltered	Slight Modification	Major Alteration	Replacement door, windows, cladding, and porch
			C, T, F, T,
Condition:			
Excellent	Good	Poor	
Additional Alterati	ons		
Structu	ire Usage	Exterior Wall Surface	
Current: NA		Wood siding	
Historic: NA			
Roof Material	Roof Features	Roof Type	
Asphalt shingle	None	Gable	
Ornamental Archit	tectural Details		Windows
None			Double-hung
Outbuildings (Num	ber and Description)		
None			

Local Landmark	Y <u>N</u>	
National Register Historic Places	Y <u>N</u>	
National Register Historic District	Y <u>N</u>	Name:
Individually Eligible? No	A B C	Significance:

Additional Comments:			



Historical Resource Recordation Form

Property Name	Photos with Captions:
Historic: Bldg. not labeled, not in CHRS	East and north façades of a one-story, single family, frame residence.
Common/Current: Unknown	
Property Address:	
12050 S. Bishop Street	
HAARGIS Number:	
Not in database	
Present Owner and /or Occupant:	
Unknown	
Property Use	
Historic: Single family residence	
Current: Single family residence	
Date of Construction: 1889	
Architect's Name: Not in CHRS	
Builder/Contractor: Not in CHRS	
Architectural Style:	
Vernacular	
Prepared By: J. Martinez, M. C. Bird, J.	
Guarino	
Photo By: S. Katz	
Date: 30 October 2012	
Property Description:	Stories: 1

Property Description:

Stories: 1

This one-story frame cottage in the West Pullman community sits on a raised concrete block basement and is covered with synthetic siding. The building has a front gable roof covered with asphalt shingles. The front elevation has a full-width hip-roof porch with four squared column supports, straight wood railings, a metal storm door, and three non-original one-over-one windows: two on the first floor and one in the gable. This house lacks integrity and distinguishing architectural features and is not individually eligible for listing on the National Register.



Integrity:			Additional Notes/Descriptions
Unaltered	Slight Modification	Major Alteration	Replacement door, windows, and cladding
Condition:			
Excellent	Good	Poor	
Additional Alterati	ons		
Structu	ire Usage	Exterior Wall Surface	
Current: NA		Synthetic siding	
Historic: NA			
Roof Material	Roof Features	Roof Type	
Asphalt shingle	None	Gable	
Ornamental Archit	tectural Details		Windows
None			Double-hung
Outbuildings (Num	ber and Description)		
None			

Local Landmark	Y <u>N</u>	
National Register Historic Places	Y <u>N</u>	
National Register Historic District	Y <u>N</u>	Name:
Individually Eligible? No	A B C	Significance:

Additional Comments:			



Historical Resource Recordation Form

Property Name	Photos with Captions: West façade of a one-story, single family, stucco residence.
Historic: Bldg. not labeled, not in CHRS	west higher of a one story, single failing, stated festenee.
Common/Current: Unknown	
Property Address:	
11727 S. Calumet Avenue	
HAARGIS Number:	
Not in database	
Present Owner and /or Occupant:	
Unknown	
Property Use	
Historic: Single family residence	
Current: Single family residence	
Date of Construction: 1893	
Architect's Name: Not in CHRS	
Builder/Contractor: Not in CHRS	
Architectural Style:	
Vernacular	
Prepared By: J. Martinez, M. C. Bird, J.	
Guarino	
Photo By: S. Katz	
Date: 23 October 2012	

Property Description:

Stories: 1

This one-story frame cottage in the West Pullman community is situated on a raised basement and is covered with stucco. The building has a front gable roof covered with asphalt shingles and a gable dormer along its south elevation. It has a partial-width flat-roofed porch that appears to be concrete, with solid sidewalls, straight posts, and a stepped parapet. Its front elevation has an off-center non-original hollow core metal door and a three-sided window bay with single-pane window and transom in the center flanked by one-over-one aluminum-sash windows. There is a pair of sliding aluminum-sash windows in the gable with a lunette fixed-pane window above. Windows are modern replacements. While the stucco cladding is somewhat unusual for this community's housing stock, this particular house lacks integrity as well as architectural features that are distinctive enough to merit individual inclusion on the National Register.




Integrity:			Additional Notes/Descriptions
Unaltered	Slight Modificati	ion Major Alteration	Replacement door and windows
Condition:			
Excellent	Good	Poor	
Additional Alteration	ons		
Structu	re Usage	Exterior Wall Surface	
Current: NA		Stucco	
Historic: NA			
Roof Material	Roof Features	Roof Type	
Asphalt shingle	Dormer	Gable	
Ornamental Architectural Details			Windows
Lunette window, stepped parapet, decorative accent blocks			Double-hung, fixed-pane, sliding
Outbuildings (Number and Description)			
None			

Local Landmark	Y <u>N</u>	
National Register Historic Places	Y <u>N</u>	
National Register Historic District	Y <u>N</u>	Name:
Individually Eligible? No	A B C	Significance:

Additional Comments:			



Historical Resource Recordation Form

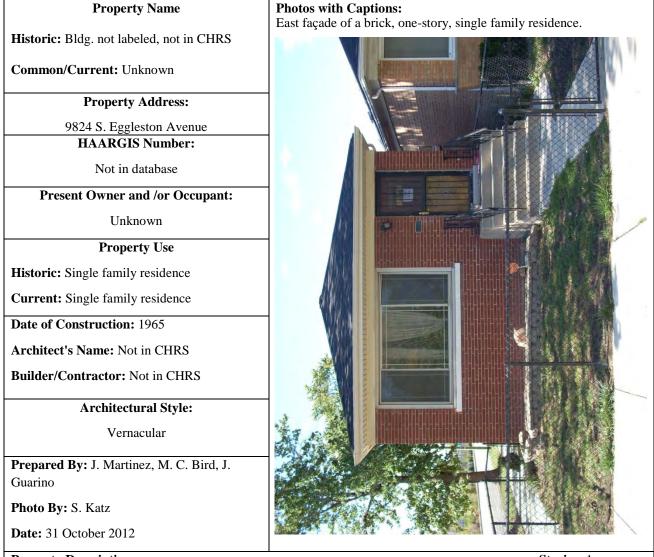

Property Description:

Stories: 1

This one-story house at the northwest corner of Eggleston Avenue and Fernwood Parkway in the Washington Heights community is situated on a raised basement and is clad with red face brick on its two street elevations. The building has a hip roof covered with asphalt shingles and overhanging eaves. The front (Eggleston) elevation has an off-center metal storm door, concrete steps with metal railings, and a picture window flanked by casements. The Fernwood Parkway elevation has both casements and glass block windows. It lacks distinguishing architectural features and is not individually eligible for listing on the National Register.



Integrity:			Additional Notes/Descriptions
<u>Unaltered</u>	Slight Modification	Major Alteration	
Condition:			
Excellent	Good	Poor	
Additional Alteration	ons		
Structu	re Usage	Exterior Wall Surface	
Current: NA		Brick	
Historic: NA			
Roof Material	Roof Features	Roof Type	
Asphalt shingle	None	Hip	
Ornamental Archit	ectural Details		Windows
None			Casements, fixed-pane, glass block
Outbuildings (Num	ber and Description)		
None			

Local Landmark	Y <u>N</u>	
National Register Historic Places	Y <u>N</u>	
National Register Historic District	Y <u>N</u>	Name:
Individually Eligible? No	A B C	Significance:



Historical Resource Recordation Form

Property Name	Photos with Captions: East façade of a two-story, brick and frame, single family residence.
Historic: Bldg. not labeled, not in CHRS	Last façade of a two story, offek and frame, single family residence.
Common/Current: Unknown	
Property Address:	
10024 S. Eggleston Avenue	
HAARGIS Number:	
Not in database	
Present Owner and /or Occupant:	
Unknown	
Property Use	
Historic: Single family residence	
Current: Single family residence	
Date of Construction: 1943	
Architect's Name: Not in CHRS	
Builder/Contractor: Not in CHRS	
Architectural Style:	
Vernacular	
Prepared By: J. Martinez, M. C. Bird	
Photo By: S. Katz	
Date: 10 October 2012	
Property Decemintion.	Stariage 2

Property Description:

Stories: 2

This two-story cottage in the Washington Heights community has a gable roof covered with asphalt shingles and large, non-original, flat-roofed, aluminum-clad dormers on both side elevations transforming the original one-story building into a two-story residence. The front elevation is clad with orange face brick, the gables are clad with aluminum siding, and the lower side elevations are clad with common brick. The front elevation has a centrally located hollow core metal paneled door with fanlight, three concrete steps with metal railings, two pairs of windows on the first floor and a single window in the gable. Windows are non-original one-over-one aluminum sash. The front door and windows are sheltered by metal awnings. Detailing includes concrete sills and brick lintel arches. This house does not feature distinguishing architectural elements or sufficient integrity to be individually eligible for listing on the National Register.



Structural Survey


Integrity:			Additional Notes/Descriptions
Unaltered	Slight Modificat	ion <u>Major Alteration</u>	Replacement front door and windows
Condition:			
<u>Excellent</u>	Good	Poor	
Additional Alterati	ons		
Dormers added to ex	xpand the home into two	o stories	
Structu			
Current: NA		Brick (lower), synthetic siding	
Historic: NA		(gable ends and dormers)	
Roof Material	Roof Features	Roof Type	
Asphalt	Dormers	Flat, gable	
Ornamental Archit	tectural Details	Windows	
Concrete sills, brick	lintel arches	Double-hung	
Outbuildings (Num	ber and Description)		
None			

Local Landmark	Y <u>N</u>	
National Register Historic Places	Y <u>N</u>	
National Register Historic District	Y <u>N</u>	Name:
Individually Eligible? No	A B C	Significance:

Additional Comments:



Historical Resource Recordation Form

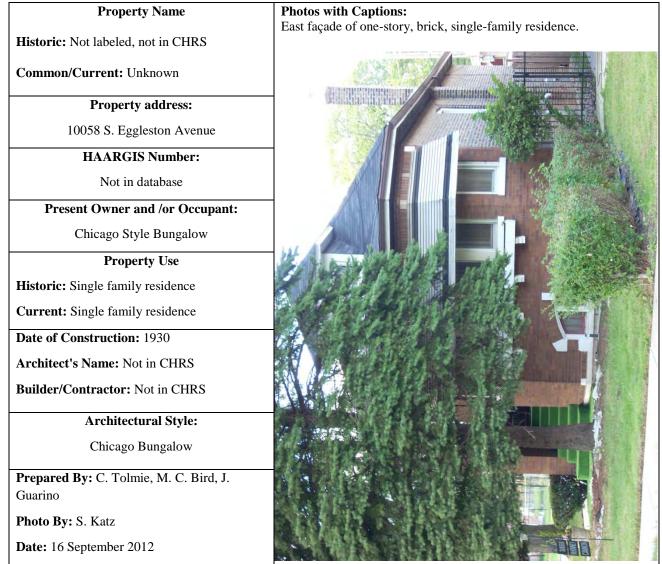

Property Description:

Stories: 1

This one-story bungalow at the northwest corner of Eggleston and 101st Street in the Washington Heights community is situated on a raised basement and is clad with brown face brick along its two street elevations. It has a hip roof covered with asphalt shingles and hip dormers along both its front and rear elevations. Its front elevation has a curved window group in the basement level with frosted glass casement windows. It has a recessed corner porch with carpeted concrete steps and corner brick pier support, a metal storm door, and a projecting living room bay with one-over-one windows that are partially obscured by a low metal awning. Detailing includes stone block inserts and a planter box. Its 101st Street elevation has glass block basement windows and one-over-one windows on the first floor. This house does not have sufficient distinguishing features to qualify as individually eligible for listing on the National Register.



Integrity:			Additional Notes/Descriptions		
Unaltered	Slight Modification	Major Alteration	Replacement windows in basement		
Condition:					
<u>Excellent</u>	Good	Poor			
Additional Alterati	ons				
Structu	Structure Usage Exterior Wall Surface				
Current: NA		Brick			
Historic: NA					
Roof Material	Roof Features	Roof Type			
Asphalt shingle	Dormers	Hip			
Ornamental Archit	tectural Details		Windows		
Stone block inserts, planter box with brackets Casement, glass block					
Outbuildings (Number and Description)					
Garage					

Local Landmark	Y <u>N</u>	
National Register Historic Places	Y <u>N</u>	
National Register Historic District	Y <u>N</u>	Name:
Individually Eligible? No	A B C	Significance:

Additional Comments:			



Historical Resource Recordation Form

Property Name	Photos with Captions:
Historic: Not labeled, not in CHRS	East façade of two-story, single family, frame residence.
Historic. Not labeled, not in errich	
Common/Current: Unknown	
Property address:	
10100 S. Eggleston Avenue	
HAARGIS Number:	
Not in database	
Present Owner and /or Occupant:	
Unknown	
Property Use	
Historic: Single family residence	
Current: Single family residence	
Date of Construction: 1894	
Architect's Name: Not in CHRS	Renard Renard Contraction
Builder/Contractor: Not in CHRS	
Architectural Style:	
Vernacular	
Prepared By: C. Tolmie, M. C. Bird, J.	A CONTRACTOR OF THE OWNER
Guarino	
Photo By: S. Katz	
Date: 16 September 2012	
Duenentry Descriptions	

Property Description:

Stories: 2

This two-story frame house at the southwest corner of Eggleston and 101st Street in the Washington Heights community is situated on a raised stone block basement with glass block windows. It is clad with synthetic siding and has a cross-gable roof covered with asphalt shingles. Its front elevation has a metal storm door and a partial-width porch with concrete steps, metal railings, and open metal posts supporting a metal awning roof. Windows are non-original double-hung and come in varying sizes. Both side elevations feature window bays. This house does not have sufficient integrity or distinguishing features to qualify as individually eligible for listing on the National Register.



Integrity:			Additional Notes/Descriptions
Unaltered	Slight Modification	n Major Alteration	Replacement windows, door, siding, and porch
Condition:			
Excellent	Good	Poor	
Additional Alterati	ons		
Structu	ire Usage	Exterior Wall Surface	
Current: NA		Synthetic siding	
Historic: NA			
Roof Material	Roof Features	Roof Type	
Asphalt shingle	None	Cross gable	
Ornamental Archit	tectural Details		Windows
None			Double-hung, glass block
Outbuildings (Num	ber and Description)		·
Garage			

Local Landmark	Y <u>N</u>	
National Register Historic Places	Y <u>N</u>	
National Register Historic District	Y <u>N</u>	Name:
Individually Eligible? No	A B C	Significance:

Additional Comments:			



Historical Resource Recordation Form

Property Name	Photos with Captions: East façade of a two-story, frame, single family residence.
Historic: Bldg. not labeled, not in CHRS	East façade of a two-story, frame, single family residence.
Common/Current: Unknown	
Property Address:	
10104 S. Eggleston Avenue	
HAARGIS Number:	
Not in database	
Present Owner and /or Occupant:	
Unknown	
Property Use	
Historic: Single family residence	
Current: Single family residence	
Date of Construction: 1904	
Architect's Name: Not in CHRS	
Builder/Contractor: Not in CHRS	
Architectural Style:	
Vernacular	
Prepared By: J. Martinez, M. C. Bird, J.	
Guarino	
Photo By: S. Katz	
Date: 9 October 2012	

Property Description:

Stories: 2

This two-story frame house in the Washington Heights community is situated on a raised concrete block basement, is clad with synthetic siding, and has a cross-gabled roof covered with asphalt shingles. The front elevation has a hip-roofed, enclosed corner vestibule at its south end with a hollow core metal door. It also has a non-original shed-roofed wood porch with straight railings and posts and two pairs of nonoriginal one-over-one aluminum-sash windows: one on the first floor and one on the second. This house does not have sufficient integrity or distinguishing features to qualify as individually eligible for listing on the National Register.




Integrity:			Additional Notes/Descriptions		
Unaltered	Slight Modification	n Major Alteration	Replacement windows, door, porch, and cladding		
Condition:					
Excellent	Good	Poor			
Additional Alteration	ons				
Structu	Structure Usage Exterior Wall Surface				
Current: NA		Synthetic siding			
Historic: NA					
Roof Material	Roof Features	Roof Type			
Asphalt shingles	None	Cross-gabled			
Ornamental Archit	ectural Details		Windows		
None			Double-hung		
Outbuildings (Num	ber and Description)				
None					

Local Landmark	Y <u>N</u>	
National Register Historic Places	Y <u>N</u>	
National Register Historic District	Y <u>N</u>	Name:
Individually Eligible? No	A B C	Significance:

Additional Comments:			



Historical Resource Recordation Form

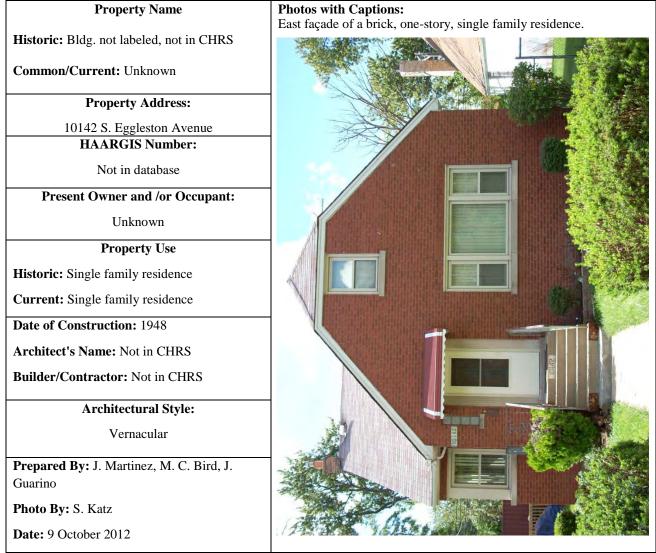

Property Description:

Stories: 1

This one-story house in the Washington Heights community is situated on a raised brick basement with glass block windows. It has a cross-gable roof with asphalt shingles; the front wing features a hip-on-gable. The front elevation is clad with red face brick and the side elevations are clad with common brick. The first floor of the front elevation has an off-center entrance with a metal storm door, metal awning, concrete steps and railings. The first floor also has a one-over-one window and a picture window flanked by one-over-one windows. A single one-over-one window is situated in the gable. All double-hung windows are non-original aluminum-sash. Detailing features concrete sills and a vertical strip of four glass blocks adjacent to the front door. This house does not have sufficient integrity or distinguishing features to qualify as individually eligible for listing on the National Register.




Integrity:			Additional Notes/Descriptions
Unaltered	Slight Modification	Major Alteration	Replacement windows
Condition:			
Excellent	Good	Poor	
Additional Alterati	ons		
Structu	re Usage	Exterior Wall Surface	
Current: NA		Brick	
Historic: NA			
Roof Material	Roof Features	Roof Type	
Asphalt	Hip-on-gable	Cross gable,	
Ornamental Archit	ectural Details		Windows
Decorative glass blo	cks, concrete sills		Double-hung, fixed-pane, glass block
Outbuildings (Num	ber and Description)		
None			

Local Landmark	Y <u>N</u>	
National Register Historic Places	Y <u>N</u>	
National Register Historic District	Y <u>N</u>	Name:
Individually Eligible? No	A B C	Significance:

Additional Comments:		



Historical Resource Recordation Form

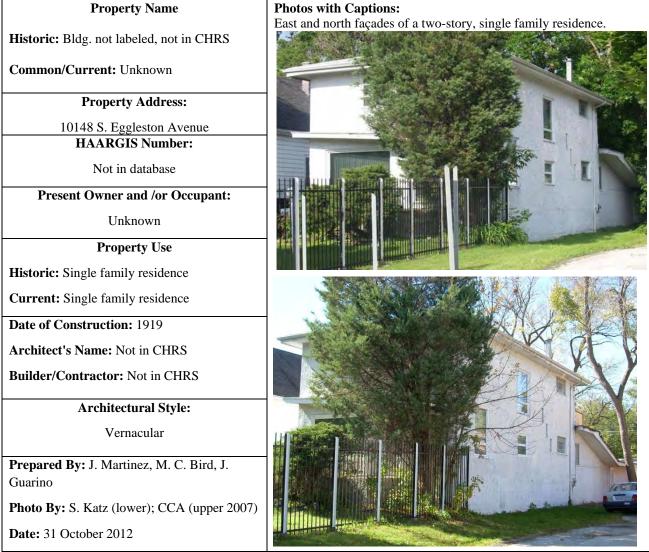

Property Description:



This two-story house in the Washington Heights community is clad with stucco and has a hip roof covered in asphalt shingles with overhanging eaves. Its front elevation has a large picture window, an off-center door with concrete steps, and a pair of windows on the second floor. Glass block and non-original doublehung windows are visible on the side elevation. The second story and rear one-story addition with a shed roof represent later additions. This house lacks integrity and distinctive architectural features and is not individually eligible for listing on the National Register.



Integrity:			Additional Notes/Descriptions
	Clickt Madificati	Maine Alternetion	Replacement windows
Unaltered	Slight Modification	ion Major Alteration	Replacement windows
Condition:			
Excellent	Good	Poor	
Additional Alterati	ons		
Second story added	after 1938 (Sanborn). Ro	ear addition also post-dates 1938.	
Structu	re Usage	Exterior Wall Surface	
Current: NA		Stucco	
Historic: NA			
Roof Material	Roof Features	Roof Type	
Asphalt shingle	None	Hip	
Ornamental Archit	ectural Details		Windows
None			Double-hung, fixed-pane, glass
			block
Outbuildings (Num	ber and Description)		
Detached garage.			

Local Landmark	Y <u>N</u>	
National Register Historic Places	Y <u>N</u>	
National Register Historic District	Y <u>N</u>	Name:
Individually Eligible? No	A B C	Significance:

Additional Comments:		



Historical Resource Recordation Form

Historic: Bldg. not labeled, not in CHRS	st façade of a one-story, single family, frame residence.
Common/Current: Unknown	
Property Address:	
10200 S. Eggleston Avenue	
HAARGIS Number:	
Not in database	
Present Owner and /or Occupant:	
Unknown	
Property Use	
Historic: Single family residence	
Current: Single family residence	
Date of Construction: 1888	
Architect's Name: Not in CHRS	
Builder/Contractor: Not in CHRS	
Architectural Style:	
Vernacular	
Prepared By: J. Martinez, M. C. Bird, J.	
Guarino	
Photo By: Steve Katz	
Date: 10 October 2012	

Property Description:

Stories: 1

This one-story frame house on the southwest corner of Eggleston and 102nd Street in the Washington Heights community is situated on a raised concrete block basement with glass block windows. It is clad with synthetic siding and has a front gable roof covered with asphalt shingles. Its front elevation has a gabled roof, enclosed porch with a hollow core metal core, wood steps and railings, five windows on the first floor and one in the gable, all of which are non-original one-over-one aluminum-sash. This house lacks integrity, does not feature distinguishing architectural elements, and is not individually eligible for listing on the National Register.



Integrity:			Additional Notes/Descriptions
Unaltered	Slight Modification	Major Alteration	Replacement door, windows, and cladding
Condition:			
<u>Excellent</u>	Good	Poor	
Additional Alteration	ons		
Structu	re Usage	Exterior Wall Surface	
Current: NA		Synthetic siding	
Historic: NA			
Roof Material	Roof Features	Roof Type	
Asphalt shingles	None	Gable	
Ornamental Archit	ectural Details		Windows
None			Double-hung, glass block
Outbuildings (Num	ber and Description)		
None			

Local Landmark	Y <u>N</u>	
National Register Historic Places	Y <u>N</u>	
National Register Historic District	Y <u>N</u>	Name:
Individually Eligible? No	A B C	Significance:

Additional Comments:			



Historical Resource Recordation Form

Property Name	Photos with Captions: East façade of a one-story, frame, single family residence.
Historic: Bldg. not labeled, not in CHRS	Last lique of a one story, name, single taminy residence.
Common/Current: Unknown	
Property Address:	
10236 S. Eggleston Ave.	
HAARGIS Number:	
Not in database	Markey - House States
Present Owner and /or Occupant:	
Unknown	
Property Use	
Historic: Single family residence	
Current: Single family residence	
Date of Construction: 1913	
Architect's Name: Not in CHRS	
Builder/Contractor: Not in CHRS	
Architectural Style:	
Vernacular	
Prepared By: J. Martinez, M. C. Bird, J.	
Guarino	
Photo By: S. Katz	
Date: 10 October 2012	
Property Description:	Stories: 1

Property Description:

Stories: 1

This one-story frame cottage in the Washington Heights community is situated on a raised concrete block basement with glass block windows. It is clad with wood boards laid vertically and has a gable roof covered with asphalt shingles. There is decorative vertical stickwork in the gable. The residence has a recessed corner porch with a hollow-core metal paneled door, concrete steps, and non-original wood railings and posts. A picture window is on the front elevation and one-over-one aluminum-sash windows on the side elevations (non-original). This house does not feature distinguishing architectural features and is not individually eligible for listing on the National Register.




Integrity:			Additional Notes/Descriptions
Unaltered	<u>Slight Modificati</u>	on Major Alteration	Replacement door, windows, siding, and porch railing
Condition:			
Excellent	Good	Poor	
Additional Alterati	ons		
Structu	ire Usage	Exterior Wall Surface	
Current: NA		Wood siding	
Historic: NA			
Roof Material	Roof Features	Roof Type	
Asphalt shingle	None	Gable	
Ornamental Archit	tectural Details		Windows
Stickwork above por			Double-hung, fixed-pane, glass block
Outbuildings (Num	ber and Description)		
None			

Local Landmark	Y <u>N</u>	
National Register Historic Places	Y <u>N</u>	
National Register Historic District	Y <u>N</u>	Name:
Individually Eligible? No	A B C	Significance:

Additional Comments:			



Historical Resource Recordation Form

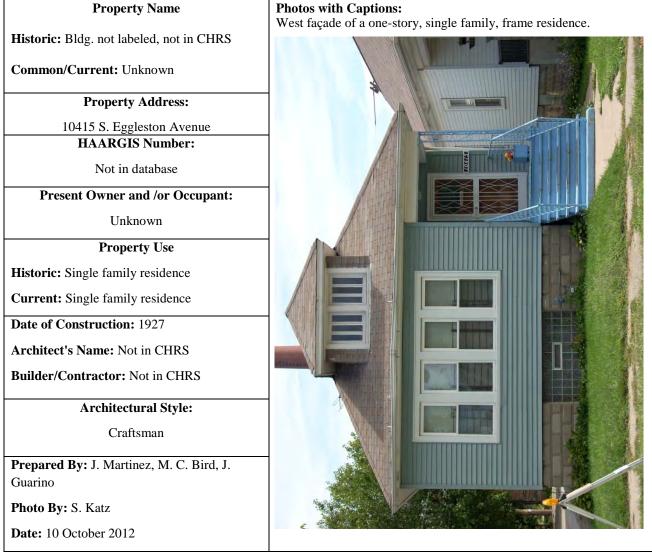

Property Description:

Stories: 1

This one-story frame bungalow in the Roseland community is situated on a raised concrete block basement with glass block windows. It is clad with synthetic siding and has a hip roof covered with asphalt shingles and a hip dormer with two windows that appear to be casements. The front elevation has a strip of four non-original one-over-one aluminum-sash windows and a recessed corner porch with a metal storm door, wood steps, metal railings, and an open metal corner post. This house does not have sufficient integrity or distinguishing architectural features to qualify as individually eligible for listing on the National Register.




Integrity:			Additional Notes/Descriptions
Unaltered	Slight Modification	Major Alteration	Replacement windows and cladding
Condition:			
Excellent	Good	Poor	
Additional Alteration	ons		
Structu	re Usage	Exterior Wall Surface	
Current: NA		Synthetic siding	
Historic: NA			
Roof Material	Roof Features	Roof Type	
Asphalt shingle	Dormer	Hip	
Ornamental Archit	ectural Details		Windows
None			Double-hung, casement, glass block
Outbuildings (Num	ber and Description)		
None			

Local Landmark	Y	<u>N</u>	
National Register Historic Places	Y	<u>N</u>	
National Register Historic District	Y	<u>N</u>	Name:
Individually Eligible? No	A	B C	Significance:

Additional Comments:			



Historical Resource Recordation Form

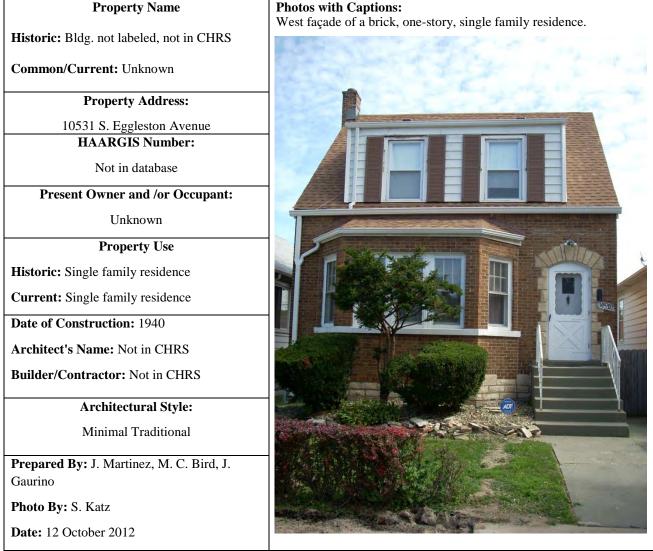

Property Description:

Stories: 1

This one-story, brick-clad cottage in the Roseland community is situated on a raised brick basement and has a side gable roof covered with asphalt shingles. It has and a non-original flat-roofed aluminum-clad dormer with two non-original one-over-one aluminum-sash windows. The front elevation has an off-center entrance with a metal storm door, concrete steps with metal railings, and a hip-roof living room bay with six-over-one wood-sash windows. Detailing includes decorative stone at the basement level and surrounding the front door. This building does not have sufficient distinguishing architectural features to qualify as individually eligible for listing on the National Register.



Integrity:			Additional Notes/Descriptions
Unaltered	Slight Modification	on Major Alteration	Some replacement windows
Condition:			
Excellent	Good	Poor	
Additional Alteration	ons		
Dormer added			
Structu	re Usage	Exterior Wall Surface	
Current: NA		Brick	
Historic: NA			
Roof Material	Roof Features	Roof Type	
Asphalt shingle	Dormer	Side gable	
Ornamental Archit	ectural Details	Windows	
Stone accents at base	ement level and around e	Double-hung	
Outbuildings (Num	ber and Description)		
None			

Local Landmark	Y <u>N</u>	
National Register Historic Places	Y <u>N</u>	
National Register Historic District	Y <u>N</u>	Name:
Individually Eligible? No	A B C	Significance:

Additional Comments:			



Historical Resource Recordation Form

Property Name	Photos with Captions:
	East faced of a one-story, single family, frame residence.
Historic: Bldg. not labeled, not in CHRS	
Common/Current: Unknown	
Property Address:	
10558 S. Eggleston Avenue	
HAARGIS Number:	
Not in database	
Present Owner and /or Occupant:	
Unknown	
Property Use	
Historic: Single family residence	
Current: Single family residence	
Date of Construction: 1924	
Architect's Name: Not in CHRS	
Builder/Contractor: Not in CHRS	
Architectural Style:	
Craftsman	
Prepared By: J. Martinez, M. C. Bird, J.	
Guarino	
Photo By: S. Katz	
Date: 12 October 2012	

Property Description:

Stories: 1

This one-story Craftsman bungalow at the northwest corner of Eggleston Avenue and 106th Street in the Roseland community is situated on a raised concrete block basement with glass block windows and is clad with synthetic siding. The building has a hip roof covered with asphalt shingles, overhanging eaves, decorative rafters, and a hip dormer. The residence has a recessed corner porch with a wood door, wood steps and railings, and a corner support consisting of a faux stone pedestal topped by a Doric column. The front (Eggleston) elevation has a picture window flanked by one-over-one aluminum-sash windows (non-original). The hip dormer has sliding windows, one of which is partially enclosed by plywood. The 106th Street elevation has a gabled pavilion, non-original one-over-one aluminum-sash windows, and a single casement window. This building does not have sufficient distinguishing architectural features or integrity to qualify as individually eligible for listing on the National Register.



Integrity:			Additional Notes/Descriptions
Unaltered	Slight Modification	Major Alteration	Replacement door, windows, and cladding
Condition:			
Excellent	Good	Poor	
Additional Alteration	ons		
Structu	re Usage	Exterior Wall Surface	
Current: NA		Synthetic siding	
Historic: NA			
Roof Material	Roof Features	Roof Type	
Asphalt shingle	Dormer	Hip	
Ornamental Archit	ectural Details		Windows
Exposed rafters, Dor	ic column		Double-hung, sliding, fixed-pane, glass block
Outbuildings (Num	ber and Description)		
None			

Local Landmark	Y <u>N</u>	
National Register Historic Places	Y <u>N</u>	
National Register Historic District	Y <u>N</u>	Name:
Individually Eligible? No	A B C	Significance:

Additional Comments:			



Historical Resource Recordation Form

Property Name	Photos with Captions: West façade of a one-story, brick, single family residence.
Historic: Bldg. not labeled, not in CHRS	west façade of a one story, offek, single failing festeence.
Common/Current: Unknown	
Property Address:	
10601 S. Eggleston Avenue	
HAARGIS Number:	
Not in database	
Present Owner and /or Occupant:	
Unknown	
Property Use	
Historic: Single family residence	
Current: Single family residence	
Date of Construction: 1929	
Architect's Name: Not in CHRS	
Builder/Contractor: Not in CHRS	
Architectural Style:	
Chicago Style Bungalow	
Prepared By: J. Martinez, M. C. Bird, J.	
Guarino	
Photo By: S. Katz	
Date: 12 October 2012	

Property Description:

Stories: 1

This one-story bungalow in the Roseland community is situated on a raised basement with glass block windows. The building is clad in brown brick, has a hip roof covered with asphalt shingles, and has overhanging eaves. The front and both side elevations feature large gable dormers and the rear elevation has a shed dormer, all of which are clad with aluminum siding. The house features a recessed corner porch with a metal storm door, concrete steps, low brick sidewalls, a brick corner pier, and arched front and side openings. The front elevation's three-sided living room bay has six windows and the front gable dormer has three windows, all of which are non-original one-over-one aluminum-sash. Detailing includes brick soldier courses above and below the living room bay windows, decorative stone insert blocks, and concrete sills. This house does not feature distinguishing architectural features and is not individually eligible for listing on the National Register.



Structural Survey

Integrity:			Additional Notes/Descriptions
Unaltered	Slight Modificatio	n Major Alteration	Replacement windows, cladding in dormers
Condition:			
Excellent	Good	Poor	
Additional Alterati	ons		
Dormers may have b	been a later addition.		
Structure Usage Exterior Wall Surface			
Current: NA Historic: NA		Brick (main), Aluminum siding (dormers)	
Roof Material	Roof Features	Roof Type	
Asphalt shingles	Dormer	Hip	
Ornamental Archit	tectural Details		Windows
Concrete sills and insert blocks, brick soldier courses			Double-hung, fixed-pane, stained glass
Outbuildings (Num	ber and Description)		

Detached two-car garage with pyramidal roof behind residence.

Local Landmark	Y <u>N</u>	
National Register Historic Places	Y <u>N</u>	
National Register Historic District	Y <u>N</u>	Name:
Individually Eligible? No	A B C	Significance:

Additional Comments:



Historical Resource Recordation Form

Property Name	Photos with Captions: East façade of a one-story, single family, brick residence.
Historic: Bldg. not labeled, not in CHRS	
Common/Current: Unknown	
Property Address:	
10612 S. Eggleston Avenue	
HAARGIS Number:	
Not in database	
Present Owner and /or Occupant:	
Unknown	
Property Use	
Historic: Single family residence	
Current: Single family residence	
Date of Construction: 1947	
Architect's Name: Not in CHRS	
Builder/Contractor: Not in CHRS	
Architectural Style:	
Vernacular	
Prepared By: J. Martinez, M. C. Bird, J.	
Guarino	
Photo By: S. Katz	
Date: 30 October 2012	
Property Description:	Stories: 1

Property Description:

Stories: 1

This one-story house in the Roseland community area is clad with tan face brick on its front elevation and common brick on its side elevations. The building has a steeply-pitched side-gable roof covered with asphalt shingles and two synthetic-clad gable dormers with one-over-one windows. Its front elevation has a centrally located, gabled, brick-clad entrance vestibule, a metal storm door with an unadorned wood surround, concrete steps with metal railings, and two nine-over-nine windows. It lacks distinguishing architectural features and is not individually eligible for listing on the National Register.



Integrity:			Additional Notes/Descriptions
Unaltered	Slight Modificatio	n Major Alteration	
Condition:			
Excellent	Good	Poor	
Additional Alterati	ons		
Structu	re Usage	Exterior Wall Surface	
Current: NA		Brick (main);	
Historic: NA		Synthetic siding (dormers)	
Roof Material	Roof Features	Roof Type	
Asphalt shingle	Dormers	Gable	
Ornamental Archit	ectural Details		Windows
None			Double-hung
Outbuildings (Num	ber and Description)		•
None			

Local Landmark	Y <u>N</u>	
National Register Historic Places	Y <u>N</u>	
National Register Historic District	Y <u>N</u>	Name:
Individually Eligible? No	A B C	Significance:

Additional Comments:			



Historical Resource Recordation Form

Property Name	Photos with Captions: East façade of a one-story, single family, frame residence.
Historic: Bldg. not labeled, not in CHRS	Last raçade of a one-story, single faining, frame residence.
Common/Current: Unknown	
Property Address:	
10720 S. Eggleston Avenue	
HAARGIS Number:	
Not in database	
Present Owner and /or Occupant:	
Vacant	
Property Use	
Historic: Single family residence	
Current: Single family residence	
Date of Construction: 1924	NANDAR AND
Architect's Name: Not in CHRS	
Builder/Contractor: Not in CHRS	
Architectural Style:	
Vernacular	
Prepared By: J. Martinez, M. C. Bird, J.	
Guarino	
Photo By: S. Katz	
Date: 12 October 2012	
Property Description:	Stories 1

Property Description:

Stories: 1

This one-story house in the Roseland community is clad with synthetic siding and has a cross-gable roof covered with asphalt shingles. The front elevation has a partial-width porch with gable roof, aluminumclad sidewalls, and wood posts, steps, and railings. Its front door and flanking windows are covered with plywood. This house lacks integrity and distinguishing architectural features and is not individually eligible for listing on the National Register.



Integrity:			Additional Notes/Descriptions
Unaltered	Slight Modification	Major Alteration	Replacement cladding
Condition:			
Excellent	Good	Poor	
Additional Alterati	ons		
Structu	ıre Usage	Exterior Wall Surface	
Current: NA		Synthetic siding	
Historic: NA			
Roof Material	Roof Features	Roof Type	
Asphalt shingle	None	Cross gable	
Ornamental Archit	ectural Details		Windows
One tapered wood column			Covered
Outbuildings (Num	ber and Description)		
None			

Local Landmark	Y <u>N</u>	
National Register Historic Places	Y <u>N</u>	
National Register Historic District	Y <u>N</u>	Name:
Individually Eligible? No	A B C	Significance:

Additional Comments:			



Historical Resource Recordation Form

Property Name	Photos with Captions: West façade of a one-story, single family, frame residence.
Historic: Bldg. not labeled, not in CHRS	west façade of a one story, single family, frame residence.
Common/Current: Unknown	
Property Address:	
10757 S. Eggleston Avenue	
HAARGIS Number:	
Not in database	
Present Owner and /or Occupant:	
Vacant	
Property Use	
Historic: Single family residence	Commences and the second
Current: Single family residence	
Date of Construction: 1923	
Architect's Name: Not in CHRS	
Builder/Contractor: Not in CHRS	
Architectural Style:	
Vernacular	
Prepared By: J. Martinez, M. C. Bird, J.	
Guarino	
Photo By: S. Katz	
Date: 12 October 2012	
Property Description:	Stories: 1

This one-story house at the northwest corner of Eggleston Avenue and 108th Street in the Roseland community is situated on a raised basement, is clad with synthetic siding, and has a hip roof covered with asphalt shingles. Its front elevation is partially clad with faux stone siding and has a partial-width porch with gable roof, wood deck, and post supports. The porch steps and railings have been removed; the front door and all window openings are covered with plywood. This house lacks integrity and distinguishing architectural features and is not individually eligible for listing on the National Register.



Integrity:			Additional Notes/Descriptions
Unaltered	Slight Modification	Major Alteration	Replacement siding, steps removed
Condition:			
Excellent	Good	Poor	
Additional Alteration	ons		
Structu	re Usage	Exterior Wall Surface	
Current: NA		Synthetic siding (main),	
Historic: NA		Faux stone (entrance)	
Roof Material	Roof Features	Roof Type	
Asphalt shingle	None	Hip	
Ornamental Architectural Details			Windows
None			Covered
Outbuildings (Num	ber and Description)		•
None			

Local Landmark	Y <u>N</u>	
National Register Historic Places	Y <u>N</u>	
National Register Historic District	Y <u>N</u>	Name:
Individually Eligible? No	A B C	Significance:

Additional Comments:	



Historical Resource Recordation Form

Property Name	Photos with Captions: East façade of a one-story, single family, frame residence.
Historic: Bldg. not labeled, not in CHRS	Last raçade or a one-story, single ranniy, frame residence.
Common/Current: Unknown	
Property Address:	
10904 S. Eggleston Avenue	
HAARGIS Number:	
Not in database	
Present Owner and /or Occupant:	
Unknown	
Property Use	
Historic: Single family residence	
Current: Single family residence	
Date of Construction: 1927	
Architect's Name: Not in CHRS	
Builder/Contractor: Not in CHRS	
Architectural Style:	
Vernacular	
Prepared By: J. Martinez, M. C. Bird, J.	The second secon
Guarino	
Photo By: S. Katz	
Date: 12 October 2012	
Property Description:	Stories: 1

This one-story house in the Roseland community is situated on a raised concrete block basement and clad with synthetic siding. The building has a hip-on-gable roof covered with asphalt shingles and overhanging eaves with wood brackets. The front elevation has a recessed corner porch with concrete steps, metal railings, a single wood corner post, and an entrance with a metal storm door. Windows are non-original and include a small casement window adjacent to the front door, a strip of three one-over-one windows on the first floor, and a pair of one-over-one aluminum-sash windows in the attic. This house lacks integrity and distinguishing architectural features and is not individually eligible for listing on the National Register.



Integrity:			Additional Notes/Descriptions
Unaltered	Slight Modification	n Major Alteration	Replacement windows and cladding
Condition:			
<u>Excellent</u>	Good	Poor	
Additional Alterati	ons		
Structu	re Usage	Exterior Wall Surface	
Current: NA		Synthetic siding	
Historic: NA			
Roof Material	Roof Features	Roof Type	
Asphalt shingles	None	Hip on Gable	
Ornamental Archit	ectural Details		Windows
None			Double-hung, casement
Outbuildings (Num	ber and Description)		
None			

Local Landmark	Y <u>N</u>	
National Register Historic Places	Y <u>N</u>	
National Register Historic District	Y <u>N</u>	Name:
Individually Eligible? No	A B C	Significance:

Additional Comments:	



Property Name Photos with Captions: Historic: Not labeled, not in CHRS West façade one-story, brick, single-family residence. Common/Current: Unknown Image: Common/Current: Unknown Property address: Image: Common/Current: Unknown

Historical Resource Recordation Form

10953 S. Eggleston Avenue

HAARGIS Number: Not in database

Present Owner and /or Occupant:

Unknown

Property Use

Historic: Single family residence

Current: Single family residence

Date of Construction: 1960

Architect's Name: Not in CHRS Builder/Contractor: Not in CHRS

Architectural Style:

Vernacular

Prepared By: C. Tolmie, M. C. Bird, J. Guarino

Photo By: S. Katz

Date: 16 September 2012

Property Description:

Stories: 1

THU

This one-story house in the Roseland community with a raised basement is clad with buff brick on its front elevation and common brick on its side and rear elevations. The building has a front gable roof covered with asphalt shingles and has overhanging eaves. Its front elevation has a projecting three-sided living room bay with a picture window flanked by one-over-one aluminum-sash windows that are sheltered by a metal awning. The residence has an off-center entrance with a metal storm door, concrete steps with metal railings, and an wood-clad gable laid in diagonal patterns. Detailing includes two decorative glass blocks adjacent to the front door and scalloped trim around the gable. It does not feature distinctive architectural elements and is not individually eligible for listing on the National Register.




Integrity:			Additional Notes/Descriptions
<u>Unaltered</u>	Slight Modification	n Major Alteration	
Condition:			
Excellent	Good	Poor	
Additional Alterati	ons		
Structu	re Usage	Exterior Wall Surface	
Current: NA		Brick (main),	
		Wood (gable end)	
Historic: NA			
Roof Material	Roof Features	Roof Type	
Asphalt shingle	None	Gable	
Ornamental Archit	ectural Details	Windows	
Glass block detail near entrance, diagonal pattern for gable clapboards			Double-hung
Outbuildings (Num	ber and Description)		
Detached, one-car, f	rame garage		

Local Landmark	Y <u>N</u>	
National Register Historic Places	Y <u>N</u>	
National Register Historic District	Y <u>N</u>	Name:
Individually Eligible? No	A B C	Significance:

Additional Comments:			



Historical Resource Recordation Form

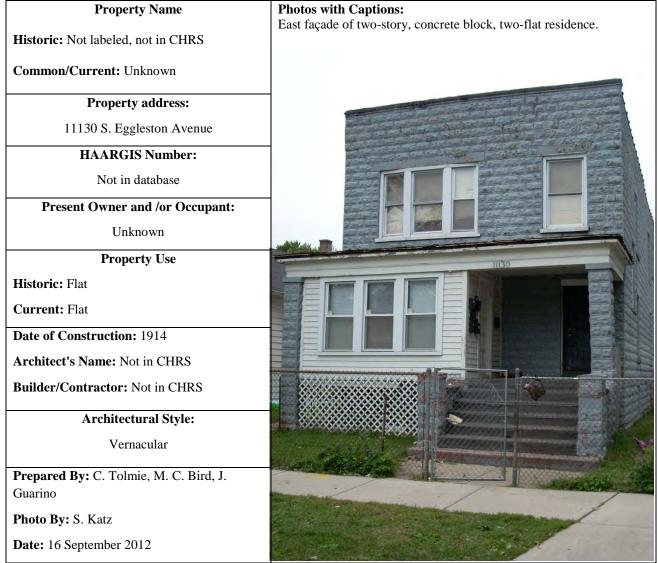

Property Description:

Stories: 2

This two-flat residential building in the Roseland community is situated on a raised basement and made of rusticated concrete block. The building has a flat roof and parapet. It features a flat-roofed full-width porch, half of which is enclosed and covered with aluminum siding. The enclosed porch has a strip of three non-original one-over-one aluminum-sash windows on its front elevation. The open half of the porch has an entrance with metal storm door, a faux stone corner support, and wood steps flanked by concrete block half-walls. The second floor of the front elevation has a strip of three windows and a single window, which are non-original one-over-one aluminum-sash and have stone sills and lintels. This house lacks integrity and distinctive architectural features and is not individually eligible for listing on the National Register.



Integrity:			Additional Notes/Descriptions
Unaltered	Slight Modification	n Major Alteration	Replacement windows
Condition:			
Excellent	Good	Poor	
Additional Alterati	ons		
Porch partially enclo	osed after 1938 (Sanborn).		
Structure Usage Exterior Wall Surface			
Current: NA		Concrete block	
Historic: NA			
Roof Material	Roof Features	Roof Type	
Unknown	Parapet	Flat	
Ornamental Architectural Details			Windows
Stone sills and lintels			Double-hung
Outbuildings (Num	ber and Description)		<u> </u>
None			

Local Landmark	Y	<u>N</u>	
National Register Historic Places	Y	<u>N</u>	
National Register Historic District	Y	<u>N</u>	Name:
Individually Eligible? No	А	B C	Significance:

Additional Comments:			



Historical Resource Recordation Form

Property Name	Photos with Captions: West façade of 1.5-story, single-family, frame residence.
Historic: Not labeled, not in CHRS	west laçade of 1.5-story, shigte-failing, frame festuciee.
Common/Current: Unknown	
Property address:	
11133 S. Eggleston Avenue	
HAARGIS Number:	
Not in database	
Present Owner and /or Occupant:	
Unknown	
Property Use	
Historic: Single family residence	
Current: Single family residence	
Date of Construction: 1888	
Architect's Name: Not in CHRS	
Builder/Contractor: Not in CHRS	
Architectural Style:	
Vernacular	
Prepared By: C. Tolmie	
Photo By: S. Katz	
Date: 16 September 2012	

Property Description:

Stories: 1.5

This 1.5-story frame house in the Roseland community is situated on a raised basement and is covered with synthetic siding. The building has an original, full-width, hip-roofed wrap-around wood porch with turned posts and straight railings. It has a cross-gable-on-hip roof covered with asphalt shingles. Its front elevation has an off-center door with transom and two one-over-one windows. The second floor of the front elevation has two pairs of double-hung windows, one of which features nine-over-nine sashes. Windows are modern replacements. This house lacks integrity and distinctive architectural features and is not individually eligible for listing on the National Register.



Structural Survey


Integrity:			Additional Notes/Descriptions
Unaltered	Slight Modification	Major Alteration	Replacement windows and cladding
Condition:			
Excellent	Good	Poor	
Additional Alteration	ons		
Structure Usage Exterior Wall Surface			
Current: NA		Synthetic siding	
Historic: NA			
Roof Material	Roof Features	Roof Type	
Asphalt shingle	None	Gable	
Ornamental Archit	ectural Details	Windows	
Turned columns on porch			Double-hung
Outbuildings (Num			
None			

Local Landmark	Y	<u>N</u>	
National Register Historic Places	Y	<u>N</u>	
National Register Historic District	Y	<u>N</u>	Name:
Individually Eligible? No	Α	B C	Significance:

Additional Comments:



Historical Resource Recordation Form

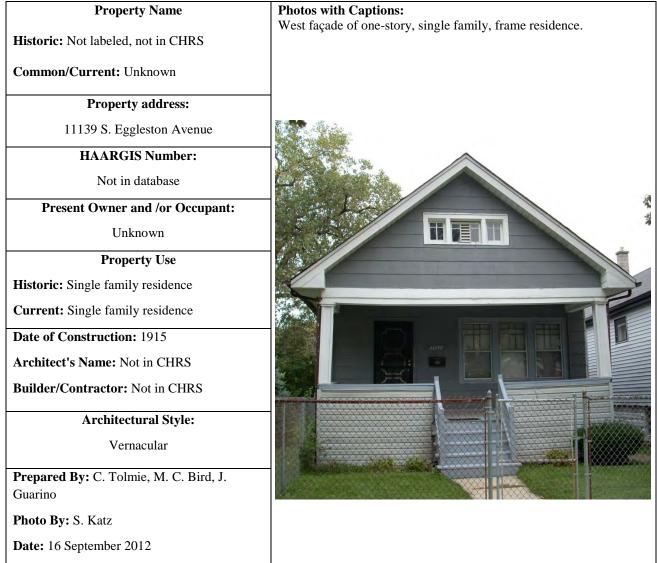

Property Description:

Stories: 1

This one-story frame house in the Roseland community is situated on a raised brick basement with glass block windows and is covered with synthetic siding. The building has a front gable roof covered with asphalt shingles. The front elevation has a full-width porch with low, aluminum-covered sidewalls and squat squared wood column supports. The entrance is off-center and has a metal storm door. There is a strip of three non-original double-hung windows on the first floor and a strip of three original wood casement windows in the gable. This house lacks integrity and distinctive architectural features and is not individually eligible for listing on the National Register.



Integrity:			Additional Notes/Descriptions
Unaltered	Slight Modification	Major Alteration	Replacement cladding and first floor windows
Condition:			
Excellent	Good	Poor	
Additional Alteration	ons		
Structure Usage Exterior Wall Surface			
Current: NA		Synthetic siding	
Historic: NA			
Roof Material	Roof Features	Roof Type	
Asphalt shingle	None	Gable	
Ornamental Archit	ectural Details		Windows
Squat, square colum	ns		Double-hung, casement, glass block
Outbuildings (Num	ber and Description)		
None			

Local Landmark	Y <u>N</u>	
National Register Historic Places	Y <u>N</u>	
National Register Historic District	Y <u>N</u>	Name:
Individually Eligible? No	A B C	Significance:

Additional Comments:			



Historical Resource Recordation Form

Property Name	Photos with Captions: West façade of a one-story, single family, frame residence.
Historic: Bldg. not labeled, not in CHRS	west façade of a one story, single family, france residence.
Common/Current: Unknown	
Property Address:	
11211 S. Eggleston Avenue	
HAARGIS Number:	
Not in database	
Present Owner and /or Occupant:	and the second
Vacant	
Property Use	
Historic: Single family residence	
Current: Single family residence	
Date of Construction: 1922	
Architect's Name: Not in CHRS	
Builder/Contractor: Not in CHRS	
Architectural Style:	
Craftsman	
Prepared By: J. Martinez, M. C. Bird, J.	
Guarino	
Photo By: S. Katz	
Date: 30 October 2012	

Property Description:

Stories: 1

This one-story Craftsman style bungalow in the Roseland community is situated on a raised brick basement and is clad with wood clapboards with wood shingles in the gabled ends. The building has a front gable roof covered with asphalt shingles and overhanging eaves with exposed rafters and decorative knee braces. The front elevation features a partial-width, front-gable, wood porch with squat, squared Doric columns and a boxed cornice. The porch door and adjacent window opening are covered with plywood. There is a group of four one-over-one windows on the first floor and a pair of original wood casement windows in the attic. This is an example of a Craftsman bungalow, an exceedingly common style during the 1910s and 1920s but lacks distinctive architectural features and is not individually eligible for listing on the National Register.



Integrity:			Additional Notes/Descriptions	
Unaltered	Slight Modification	Major Alteration	Replacement windows (first floor)	
Condition:				
Excellent	Good	Poor		
Additional Alterati	ons			
Structu	re Usage	Exterior Wall Surface		
Current: NA		Wood siding and shingles		
Historic: NA				
Roof Material	Roof Features	Roof Type		
Asphalt shingle	None	Gable		
Ornamental Archit	ectural Details	Windows		
Knee braces, exposed rafters, squared columns			Double-hung, casement	
Outbuildings (Number and Description)				
None				

Local Landmark	Y <u>N</u>	
National Register Historic Places	Y <u>N</u>	
National Register Historic District	Y <u>N</u>	Name:
Individually Eligible? No	A B C	Significance:

Additional Comments:			



Historical Resource Recordation Form

Property Name	Photos with Captions:
	West and south façades of a one-story, single family, frame
Historic: Bldg. not labeled, not in CHRS	residence.
Common/Current: Unknown	
Property Address:	
11257 S. Eggleston Avenue	
HAARGIS Number:	
Not in database	
Present Owner and /or Occupant:	
Unknown	
Property Use	
Historic: Single family residence	
Current: Single family residence	
Date of Construction: 1908	
Architect's Name: Not in CHRS	
Builder/Contractor: Not in CHRS	
Architectural Style:	
Vernacular	
Prepared By: J. Martinez, M. C. Bird, J.	
Guarino	
Photo By: S. Katz	
Date: 22 October 2012	

Property Description:

Stories: 1

This one-story house in the Roseland community is situated on a raised concrete block basement with glass block windows and is covered with synthetic siding. The building has a hip roof covered with asphalt shingles, and a hip dormer with two casement windows. The front elevation features a full-width, gable-roof, synthetic-clad sun porch surrounded by non-original one-over-one aluminum-sash windows and a centrally located door with sidelights. There is also an open shed-roof porch with concrete steps, metal railings, and open metal posts. This house lacks integrity and distinctive architectural features and is not individually eligible for listing on the National Register.



Integrity:			Additional Notes/Descriptions
Unaltered	Slight Modification	Major Alteration	Replacement windows and cladding
Condition:			
<u>Excellent</u>	Good	Poor	
Additional Alteration	ons		
Structu	re Usage	Exterior Wall Surface	
Current: NA		Synthetic siding	
Historic: NA			
Roof Material	Roof Features	Roof Type	
Asphalt shingle	Dormer	Hip	
Ornamental Archit	ectural Details		Windows
None			Double-hung, glass block,
			casement
Outbuildings (Num			
None			

Local Landmark	Y	<u>N</u>	
National Register Historic Places	Y	<u>N</u>	
National Register Historic District	Y	<u>N</u>	Name:
Individually Eligible? No	Α	BC	Significance:

Additional Comments:			



Historical Resource Recordation Form

Property Name	Photos with Captions: East façade of 1.5-story, single family, frame residence.		
Historic: Not labeled, not in CHRS	s		
Common/Current: Unknown			
Property address:			
9818 S. Emerald Avenue			
HAARGIS Number:			
Not in database			
Present Owner and /or Occupant:			
Unknown			
Property Use			
Historic: Single family residence			
Current: Single family residence			
Date of Construction: 1899			
Architect's Name: Not in CHRS			
Builder/Contractor: Not in CHRS			
Architectural Style:			
Vernacular			
Prepared By: C. Tolmie, M. C. Bird, J. Guarino			
Photo By: S. Katz			
Date: September 2012			

Property Description:

Stories: 1.5

This one-and-a-half-story frame house in the Washington Heights community sits on a raised basement and is clad with synthetic siding. The building has a front gable roof covered with asphalt shingles and an upper story shed-roofed addition along its south elevation. Its front elevation has a pent roof, an off-center hollow core metal door, concrete steps with metal railings, a picture window flanked by one-over-one aluminum-sash windows on the first floor, and a single one-over-one aluminum-sash window in the gable. The door, windows, cladding, and stair rails are non-original. This house lacks integrity and distinctive architectural features and is not individually eligible for listing on the National Register.



Structural Survey

Integrity:			Additional Notes/Descriptions
Unaltered	Slight Modification	Major Alteration	Replacement windows, doors, and cladding
Condition:			
<u>Excellent</u>	Good	Poor	
Additional Alteration	ons		
Shed-roofed addition	under construction.		
Structu	re Usage	Exterior Wall Surface	
Current: NA		Synthetic siding	
Historic: NA			
Roof Material	Roof Features	Roof Type	
Asphalt shingle	None	Gable	
Ornamental Archit	ectural Details		Windows
None			Double-hung, fixed-pane
Outbuildings (Num	ber and Description)		
Garage			

Local Landmark	Y <u>N</u>	
National Register Historic Places	Y <u>N</u>	
National Register Historic District	Y <u>N</u>	Name:
Individually Eligible? No	A B C	Significance:

Additional Comments:



Historical Resource Recordation Form

Property Name	Photos with Captions:
Historic: Not labeled, not in CHRS	West façade of one-story, single family, brick residence.
Common/Current: Unknown	
Property address:	
9823 S. Emerald Avenue	
HAARGIS Number:	
Not in database	
Present Owner and /or Occupant:	
Unknown	
Property Use	
Historic: Single family residence	
Current: Single family residence	
Date of Construction: 1944	
Architect's Name: Not in CHRS	
Builder/Contractor: Not in CHRS	
Architectural Style:	
Vernacular	
Prepared By: C. Tolmie, M. C. Bird, J.	
Guarino	
Photo By: S. Katz	
Date: September 2012	

Property Description:

Stories: 1

This one-story house in the Washington Heights community is clad with light brown face brick and has a side-gable roof covered with asphalt shingles. Its front elevation has a partial-width gable pavilion with a synthetic-sided gable, a synthetic-clad gable dormer, a central hollow core metal door surrounded by stone, and concrete steps with metal railings. There is a picture window on the first floor and three non-original double-hung aluminum sash windows: one on the first floor and one each in the gable pavilion and gable dormer. All front elevation windows have metal awnings. This house lacks distinctive architectural features and is not individually eligible for listing on the National Register.




Integrity:			Additional Notes/Descriptions
Unaltered	Slight Modification	Major Alteration	Replacement door and windows.
Condition:			
Excellent	Good	Poor	
Additional Alterati	ons		
Structu	ire Usage	Exterior Wall Surface	
Current: NA		Brick	
Historic: NA			
Roof Material	Roof Features	Roof Type	
Asphalt shingle	Dormer	Gable	
Ornamental Archit	tectural Details		Windows
Stone surrounding th	ne entrance	Double-hung	
Outbuildings (Num	ber and Description)		•
Garage			

Local Landmark	Y <u>N</u>	
National Register Historic Places	Y <u>N</u>	
National Register Historic District	Y <u>N</u>	Name:
Individually Eligible? No	A B C	Significance:

Additional Comments:			



Historical Resource Recordation Form

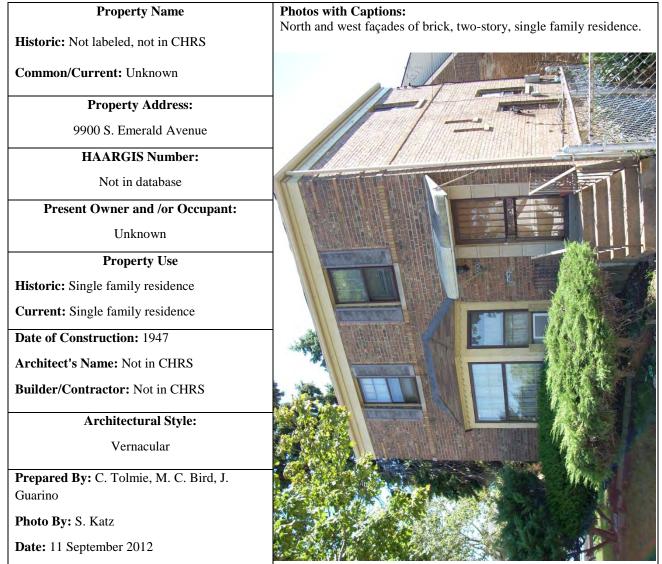

Property Description:

Stories: 2

This two-story brick-clad house in the Washington Heights community has a hip roof covered with asphalt shingles. Its front façade has an off-center door with concrete steps and metal railings, a three-sided bay window with hip roof on the first floor, and two six-over-one windows on the second floor. Details include concrete sills, a concrete door surround, brick stringcourses, and a scalloped wood panel above the windows in the bay. This is a standard post-World War II era and does not feature distinguishing architectural elements. Therefore, it is not individually eligible for listing on the National Register.




Integrity:			Additional Notes/Descriptions
<u>Unaltered</u>	Slight Modification	n Major Alteration	
Condition:			
Excellent	Good	Poor	
Additional Alterati	ons		
Structu	ıre Usage	Exterior Wall Surface	
Current: NA		Brick	
Historic: NA			
Roof Material	Roof Features	Roof Type	
Asphalt shingle	None	Pyramid	
Ornamental Archit	tectural Details		Windows
Brick stringcourses,	concrete sills and door s	Double-hung	
panel above windo			
Outbuildings (Num	ber and Description)		
	• /		
Storage shed			

Local Landmark	Y	<u>N</u>	
National Register Historic Places	Y	<u>N</u>	
National Register Historic District	Y	<u>N</u>	Name:
Individually Eligible? No	Α	B C	Significance:

Additional Comments:			



Historical Resource Recordation Form

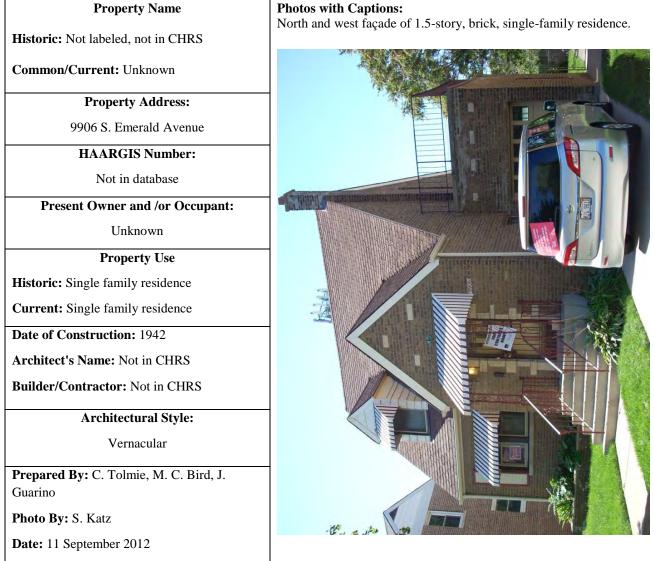

Property Description:

Stories: 1.5

This one-and-a-half-story brick-clad house in the Washington Heights community has a side gable roof covered with asphalt shingles, gable dormer, and an attached flat-roofed one-car garage with a rooftop balcony. Its front façade has a gable wall dormer and a porch with concrete steps, metal railings, and open metal posts supporting a metal canopy roof. The front elevation also features an off-center door surrounded by decorative stones and a pair of one-over-one windows. Stones also decorate the wall dormer and the garage cornice line. This post-World War II era home does not feature distinguishing architectural elements and is not individually eligible for listing on the National Register.



Integrity:			Additional Notes/Descriptions
Unaltered	Slight Modification	on Major Alteration	Replacement windows
Condition:			
Excellent	Good	Poor	
Additional Alterati	ons		
Structu	ire Usage	Exterior Wall Surface	
Current: NA		Brick	
Historic: NA			
Roof Material	Roof Features	Roof Type	
Asphalt shingle	Dormer	Gable	
Ornamental Archit	tectural Details		Windows
Stone around door, s	stone inserts on garage an	Double-hung	
Outbuildings (Num	ber and Description)		

Local Landmark	Y <u>N</u>	
National Register Historic Places	Y <u>N</u>	
National Register Historic District	Y <u>N</u>	Name:
Individually Eligible? No	A B C	Significance:

Additional Comments:			



Historical Resource Recordation Form

Property Name	Photos with Captions: East façade of two-story, brick, single-family residence.
Historic: Not labeled, not in CHRS	Last raçade of two-story, offek, single-ranning residence.
Common/Current: Unknown	
Property address:	
9909 S. Emerald Avenue	
HAARGIS Number:	
Not in database	
Present Owner and /or Occupant:	
Unknown	
Property Use	
Historic: Single family residence	
Current: Single family residence	
Date of Construction: 1944	
Architect's Name: Not in CHRS	
Builder/Contractor: Not in CHRS	
Architectural Style:	
Vernacular	
Prepared By: C. Tolmie, M. C. Bird, J. Guarino	
Photo By: S. Katz	and the second s
Date: September 2012	Total All

Property Description:

Stories: 2

This two-story house in the Washington Heights community is situated on a raised basement and is clad with light orange face brick on its front elevation and in common brick along its side and rear elevations. The building has a hip roof covered with asphalt shingles. Its front elevation has a partial-width, gable-roof, enclosed porch with a hollow core metal door, concrete steps, and metal railings. There is a picture window on the first floor and two one-over-one aluminum-sash windows on the second floor. The front door and windows are non-original. Detailing includes a decorative brick and stone door surround and concrete sills. It does not display distinguishing architectural features and is not individually eligible for listing on the National Register.




Integrity:	-		Additional Notes/Descriptions
Unaltered	Slight Modification	Major Alteration	Replacement windows and doors
Condition:			
Excellent	Good	Poor	
Additional Alterati	ons		
Structu	ire Usage	Exterior Wall Surface	
Current: NA		Brick	
Historic: NA			
Roof Material	Roof Features	Roof Type	
Asphalt shingle	None	Hip	
Ornamental Architectural Details			Windows
Decorative door surround, concrete sills			Double-hung, fixed-pane
Outbuildings (Num	ber and Description)		·
Garage			

Local Landmark	Y <u>N</u>	
National Register Historic Places	Y <u>N</u>	
National Register Historic District	Y <u>N</u>	Name:
Individually Eligible? No	A B C	Significance:

Additional Comments:			



Historical Resource Recordation Form

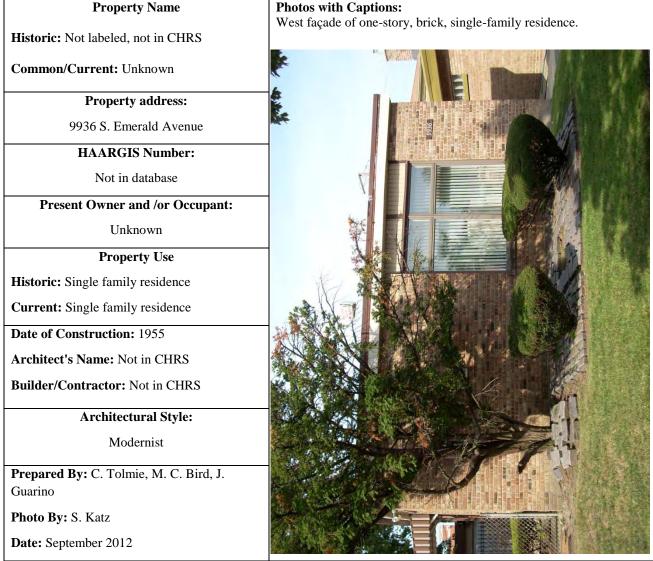

Property Description:

Stories: 1

This one-story, brick-clad, Modernist style house in the Washington Heights community has a flat roof and a pair of single-pane windows with transoms on the front elevation. The south elevation features a centrally located door and a small porch with concrete steps, metal railings, and two open metal posts supporting a metal awning roof. There are three groups of windows, including a strip of three casements. This house lacks distinctive architectural features and is not individually eligible for listing on the National Register.




Integrity:			Additional Notes/Descriptions
Unaltered	Slight Modification	Major Alteration	
Condition:			
Excellent	Good	Poor	
Additional Alterati	ons		
Structu	ire Usage	Exterior Wall Surface	
Current: NA		Brick	
Historic: NA			
Roof Material	Roof Features	Roof Type	
Unknown	None	Flat	
Ornamental Archit	ectural Details		Windows
None			Casement, fixed-pane
Outbuildings (Num	ber and Description)		·
Garage			

Local Landmark	Y <u>N</u>	
National Register Historic Places	Y <u>N</u>	
National Register Historic District	Y <u>N</u>	Name:
Individually Eligible? No	A B C	Significance:

Additional Comments:			



Historical Resource Recordation Form

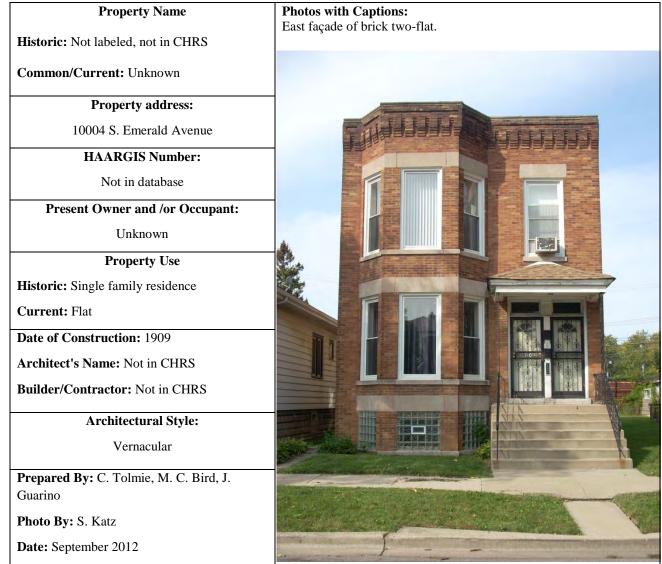

Property Description:

Stories: 2

This two-flat residential building in the Washington Heights community is situated on a raised basement with glass block windows and is clad with brown/orange face brick on its front elevation and with common brick along its side and rear elevations. The building has a full-height, three-sided window bay pavilion, a flat roof, and parapet. Its front elevation features a pair of off-center non-original hollow core metal doors and a hip-roof porch with concrete steps, metal railings, and open metal supports. The pavilion's central windows are single-pane, while the remaining windows in the pavilion and the single window above the entrance are one-over-one aluminum-sash. Windows are modern replacements. Detailing includes concrete sills, lintels, and brick corbelling at the parapet level. This two-flat lacks distinctive architectural features and is not individually eligible for listing on the National Register.



Integrity:			Additional Notes/Descriptions
Unaltered	Slight Modification	Major Alteration	Replacement windows, doors, and porch rails
Condition:			
<u>Excellent</u>	Good	Poor	
Additional Alteration	ons		
Structu	re Usage	Exterior Wall Surface	
Current: NA		Brick	
Historic: NA			
Roof Material	Roof Features	Roof Type	
Unknown	Parapet	Flat	
Ornamental Archit	ectural Details		Windows
Corbelling, concrete	sills and lintels		Double-hung, fixed-pane, glass block
Outbuildings (Num	ber and Description)		
Garage			

Local Landmark	Y <u>N</u>	
National Register Historic Places	Y <u>N</u>	
National Register Historic District	Y <u>N</u>	Name:
Individually Eligible? No	A B C	Significance:

Additional Comments:			



Historical Resource Recordation Form

Property Name	Photos with Captions: West and north façades of one-story, brick, single-family residence.
Historic: Not labeled, not in CHRS	west and north raçades of one-story, offek, single-ranning residence.
Common/Current: Unknown	
Property address:	
10100 S. Emerald Avenue	
HAARGIS Number:	
Not in database	
Present Owner and /or Occupant:	
Unknown	
Property Use	
Historic: Single family residence	
Current: Single family residence	
Date of Construction: 1940	
Architect's Name: Not in CHRS	
Builder/Contractor: Not in CHRS	
Architectural Style:	
Neo-Tudor	
Prepared By: C. Tolmie, M. C. Bird, J.	
Guarino	
Photo By: S. Katz	
Date: September 2012	

Property Description:

Stories: 1

This one-story, brick-clad, Neo-Tudor style house at the southwest corner of Emerald Avenue and 101st Street in the Washington Heights community is situated on a raised basement and has a steeply pitched cross-gable roof covered with asphalt shingles. The front elevation has a round-arched door, concrete steps with metal railings, and a non-original one-over-one aluminum-sash window. Detailing includes rusticated stone surrounding the door and at the corners of the house, concrete sills, and a stone insert in the gable end. This house lacks distinctive architectural features and is not individually eligible for listing on the National Register.



Integrity:			Additional Notes/Descriptions
Unaltered	Slight Modification	n Major Alteration	Replacement door and windows
Condition:			
Excellent	Good	Poor	
Additional Alteration	ons		
Structu	re Usage	Exterior Wall Surface	
Current: NA		Brick	
Historic: NA			
Roof Material	Roof Features	Roof Type	
Asphalt shingle	None	Cross-gable	
Ornamental Archit	ectural Details		Windows
Rusticated stone at entrance and corners of house, concrete sills and inserts			Double-hung
Outbuildings (Num	ber and Description)		·
Garage			

Local Landmark	Y <u>N</u>	
National Register Historic Places	Y <u>N</u>	
National Register Historic District	Y <u>N</u>	Name:
Individually Eligible? No	A B C	Significance:

Additional Comments:			



Historical Resource Recordation Form

Property Name	Photos with Captions:
Historic: Not labeled, not in CHRS	West façade of one-story, brick, single-family residence.
HISTORIC: Not labeled, not in CHKS	
Common/Current: Unknown	
Property address:	
10134 S. Emerald Avenue	
HAARGIS Number:	
Not in database	
Present Owner and /or Occupant:	
Unknown	
Property Use	
Historic: Single family residence	
Current: Single family residence	
Date of Construction: 1939	
Architect's Name: Not in CHRS	
Builder/Contractor: Not in CHRS	
Architectural Style:	
Minimal Traditional	
Prepared By: C. Tolmie, M. C. Bird, J.	
Guarino	
Photo By: S. Katz	
Date: September 2012	
Property Description:	Stories: 1

Property Description:

Stories: 1

This one-story brick-clad cottage in the Washington Heights community has a side-gable roof covered with asphalt shingles. Its front elevation has a partial-width gable pavilion with stone cladding, a round arch window in the gable, and a central metal storm door topped by a metal canopy. The door is flanked by two additional small, round-arch fixed-pane windows. There are concrete steps with metal railings and two non-original one-over-one aluminum sash windows with concrete sills. This house lacks integrity and distinctive architectural features and is not individually eligible for listing on the National Register.



Integrity:			Additional Notes/Descriptions
Unaltered	Slight modification	ns Major Alteration	Replacement windows
Condition:			
<u>Excellent</u>	Good	Poor	
Additional Alterati	ons		
Structu	ire Usage	Exterior Wall Surface	
Current: NA		Brick (main),	
Historic: NA		Stone (pavilion)	
Roof Material	Roof Features	Roof Type	
Asphalt shingle	None	Gable	
Ornamental Archit	tectural Details		Windows
Stone pavilion, roun	d arch windows, concrete	sills	Double-hung, fixed-pane
Outbuildings (Num	ber and Description)		
None			

Local Landmark	Y <u>N</u>	
National Register Historic Places	Y <u>N</u>	
National Register Historic District	Y <u>N</u>	Name:
Individually Eligible? No	A B C	Significance:

Additional Comments:			



Historical Resource Recordation Form

Property Name	Photos with Captions:
Common/Current: Unknown	West façade of one-story, brick, single-family residence.
Property address:	
10216 S. Emerald Avenue	
HAARGIS Number:	
Not in database	
Present Owner and /or Occupant:	
Unknown	
Property Use	
Historic: Single family residence	
Current: Single family residence	North façade of the residence showing the addition.
Date of Construction: 1956	
Architect's Name: Not in CHRS	
Builder/Contractor: Not in CHRS	
Architectural Style:	
Vernacular	
Prepared By: C. Tolmie, M. C. Bird, J.	
Guarino	
Photo By: S. Katz	
Date: September 2012	
Property Description:	Stories: 1
	ashington Heights community has a side gable roof covered with

This one-story brick-clad house in the Washington Heights community has a side gable roof covered with asphalt shingles. The front door is tucked into the side of the projecting gable-roof living room bay with synthetic-clad pediment. A shed-roofed addition to the rear portion of the residence rises above the living room. The front elevation has two groups of single pane windows flanked by casements on each corner and a small glass block window. The porch includes a concrete stoop and open metal post. A stone-clad exterior chimney fronts Emerald. The rear addition has two small, single-pane, casement windows along its front elevation. Detailing includes decorative stonework at the corners of the house and concrete sills. This house lacks integrity and distinctive architectural features and is not individually eligible for listing on the National Register.



Integrity:			Additional Notes/Descriptions
Unaltered	Slight Modificatio	ons <u>Major Alteration</u>	Replacement cladding
Condition:			
<u>Excellent</u>	Good	Poor	
Additional Alterati	ons		
Addition to rear root	fline		
Structure Usage Exterior Wall Surface			
Current: NA		Brick (main), synthetic siding	
Historic: NA		(gable ends and addition)	
Roof Material	Roof Features	Roof Type	
Asphalt shingle	None	Gable (main), shed (addition)	
Ornamental Archit	tectural Details		Windows
Decorative stonework, concrete sills			Casement, fixed-pane, glass block
Outbuildings (Number and Description)			
Garage			

Local Landmark	Y <u>N</u>	
National Register Historic Places	Y <u>N</u>	
National Register Historic District	Y <u>N</u>	Name:
Individually Eligible? No	A B C	Significance:

Additional comments		



Historical Resource Recordation Form

Property Name	Photos with Captions: East façade of a one-story, single family, frame residence.
Historic: Bldg. not labeled, not in CHRS	Last laçade of a one-story, single family, france residence.
Common/Current: Unknown	
Property Address:	
10316 S. Emerald Avenue	
HAARGIS Number:	
Not in database	
Present Owner and /or Occupant:	
Unknown	
Property Use	
Historic: Single family residence	
Current: Single family residence	
Date of Construction: 1919	
Architect's Name: Not in CHRS	
Builder/Contractor: Not in CHRS	
Architectural Style:	
Craftsman	
Prepared By: J. Martinez, M. C. Bird, J.	
Guarino	
Photo By: S. Katz	
Date: 23 October 2012	
Property Description:	Stories: 1

Property Description:

Stories: 1

This one-story Craftsman bungalow in the Roseland community has aluminum-covered side elevations, a faux stone-clad front elevation, a hip roof covered with asphalt shingles, and a hip dormer with a pair of single-pane sliding windows. The front elevation has a recessed corner porch with a squat, squared wood column support at the corner, a metal storm door, concrete steps with metal railings, and a living room bay featuring a strip of non-original one-over-one aluminum-sash windows that are partially obscured by a metal awning. This house lacks integrity and distinctive architectural features and is not individually eligible for listing on the National Register.



Integrity:			Additional Notes/Descriptions
Unaltered	<u>Slight Modificati</u>	on Major Alteration	Replacement windows and cladding
Condition:			
<u>Excellent</u>	Good	Poor	
Additional Alterati	ons		
Structure Usage Exterior Wall Surface			
Current: NA		Faux stone (façade),	
Historic: NA		Synthetic siding (sides and rear)	
Roof Material	Roof Features	Roof Type	
Asphalt shingle	Dormer	Hip	
Ornamental Architectural Details			Windows
Squat column on porch			Double-hung, sliding
Outbuildings (Num	ber and Description)		
None			

Local Landmark	Y <u>N</u>	
National Register Historic Places	Y <u>N</u>	
National Register Historic District	Y <u>N</u>	Name:
Individually Eligible? No	A B C	Significance:

Additional Comments:	



Historical Resource Recordation Form

Property Name	Photos with Captions: East façade of a one-story, single family, brick residence.
Historic: Bldg. not labeled, not in CHRS	Last raçade of a one-story, single family, onek residence.
Common/Current: Unknown	
Property Address:	
10428 S. Emerald Avenue	
HAARGIS Number:	
Not in database	
Present Owner and /or Occupant:	
Unknown	
Property Use	
Historic: Single family residence	
Current: Single family residence	
Date of Construction: 1941	
Architect's Name: Not in CHRS	
Builder/Contractor: Not in CHRS	
Architectural Style:	
Vernacular	
Prepared By: J. Martinez, M. C. Bird, J.	
Guarino	
Photo By: S. Katz	
Date: 23 October 2012	
Property Description:	Stories: 1

Property Description:

Stories: 1

This one-story brick-clad house in the Roseland community has a side-gabled roof covered with asphalt shingles and has two gable dormers with non-original aluminum siding, each with a six-over-one window. The front elevation has a centrally located, gabled, brick-clad projecting vestibule with a metal storm door, concrete steps, and metal railings. It is flanked by a window group on either side, both of which are obscured by metal shades. It does not feature distinguishing architectural elements and is not individually eligible for listing on the National Register.



Integrity:			Additional Notes/Descriptions
Unaltered	Slight Modification	Major Alteration	Replacement windows and cladding
Condition:			
<u>Excellent</u>	Good	Poor	
Additional Alterati	ons		
Structu	ire Usage	Exterior Wall Surface	
Current: NA		Brick	
Historic: NA			
Roof Material	Roof Features	Roof Type	
Asphalt shingle	Dormers	Gable	
Ornamental Architectural Details		Windows	
None			Double-hung, covered
Outbuildings (Num	ber and Description)		
None			

Local Landmark	Y <u>N</u>	
National Register Historic Places	Y <u>N</u>	
National Register Historic District	Y <u>N</u>	Name:
Individually Eligible? No	A B C	Significance:

Additional Comments:	



Historical Resource Recordation Form

Property Name	Photos with Captions: East façade of a one-story, single family, brick residence.
Historic: Bldg. not labeled, not in CHRS	
Common/Current: Unknown	
Property Address:	
10554 S. Emerald Avenue	
HAARGIS Number:	
Not in database	
Present Owner and /or Occupant:	
Unknown	
Property Use	
Historic: Single family residence	
Current: Single family residence	
Date of Construction: 1962	
Architect's Name: Not in CHRS	
Builder/Contractor: Not in CHRS	
Architectural Style:	
Vernacular	
Prepared By: J. Martinez, M. C. Bird, J.	
Guarino	
Photo By: S. Katz	the sec
Date: 23 October 2012	

Property Description:

Stories: 1

This one-story house in the Roseland community is situated on a raised basement with glass block windows. The building has a hip roof covered with asphalt shingles and overhanging eaves. The front elevation is clad with buff brick and in faux stone below the sill line. The south half of the front elevation is recessed and has a metal storm door, concrete steps with metal railings, and an open metal corner support. The living room bay has a picture window flanked by one-over-one aluminum-sash windows. Detailing includes two decorative glass blocks adjacent to the front door. It does not feature distinguishing architectural elements and is not individually eligible for listing on the National Register.



Integrity:			Additional Notes/Descriptions
<u>Unaltered</u>	Slight Modification	Major Alteration	Aluminum sashes may be original
Condition:			
Excellent	Good	Poor	
Additional Alteration	ons		
Structu	re Usage	Exterior Wall Surface	
Current: NA		Brick (main),	
Historic: NA		Faux stone (below sill)	
Roof Material	Roof Features	Roof Type	
Asphalt shingle	None	Hip	
Ornamental Archit	ectural Details		Windows
Decorative glass bloc	cks		Double-hung, fixed-pane, glass
			block
Outbuildings (Num	ber and Description)		
None			

Local Landmark	Y <u>N</u>	
National Register Historic Places	Y <u>N</u>	
National Register Historic District	Y <u>N</u>	Name:
Individually Eligible? No	A B C	Significance:

Additional Comments:			



Historical Resource Recordation Form

Property Name	Photos with Captions:
Historic: Bldg. not labeled, not in CHRS	East façade of a brick, two-story, single family residence.
Common/Current: Unknown	
Property Address:	
10614 S. Emerald Avenue	
HAARGIS Number:	
Not in database	
Present Owner and /or Occupant:	
Unknown	
Property Use	
Historic: Single family residence	
Current: Single family residence	
Date of Construction: 1948	
Architect's Name: Not in CHRS	
Builder/Contractor: Not in CHRS	
Architectural Style:	
Minimal Traditional	
Prepared By: J. Martinez, M. C. Bird, J.	
Guarino	
Photo By: S. Katz	
Date: 23 October 2012	
Property Description:	Stories: 2

This two-story house in the Roseland community has a hip roof covered with asphalt shingles. Its front elevation is clad in orange-brown face brick. It has an off-center metal storm door with fluted pilasters, concrete steps with metal railings, a three-sided window bay obscured by tall bushes and a low metal awning, and two non-original one-over-one aluminum-sash windows with metal awnings and wood shutters on the second floor. Detailing includes a vertical strip of three glass blocks adjacent to the door, concrete sills, and a brick stringcourse. It does not feature distinguishing architectural elements and is not individually eligible for listing on the National Register.



Integrity:			Additional Notes/Descriptions		
Unaltered	<u>Slight Modificatio</u>	n Major Alteration	Replacement windows; windows in bay obscured		
Condition:					
Excellent	Good	Poor			
Additional Alteration	ons				
Structu	ire Usage	Exterior Wall Surface			
Current: NA		Brick			
Historic: NA					
Roof Material	Roof Features	Roof Type			
Asphalt shingle	None	Hip			
Ornamental Archit	ectural Details	Windows			
Fluted pilasters, deco	orative glass blocks, conc	Double-hung, fixed-pane, glass block			
Outbuildings (Number and Description)					
None					

Local Landmark	Y <u>N</u>	[
National Register Historic Places	Y <u>N</u>	[
National Register Historic District	Y <u>N</u>	[Name:
Individually Eligible? No	A B	С	Significance:

Additional Comments:			



Historical Resource Recordation Form

Property Name	Photos with Captions: East façade of a one-story, single family, brick residence.
Historic: Bldg. not labeled, not in CHRS	Last fuçude of a one story, single family, offek festdenee.
Common/Current: Unknown	
Property Address:	
10750 S. Emerald Avenue	
HAARGIS Number:	
Not in database	
Present Owner and /or Occupant:	
Unknown	
Property Use	
Historic: Single family residence	
Current: Single family residence	
Date of Construction: 1956	
Architect's Name: Not in CHRS	
Builder/Contractor: Not in CHRS	
Architectural Style:	
Vernacular	
Prepared By: J. Martinez, M. C. Bird, J.	
Guarino	
Photo By: S. Katz	
Date: 23 October 2012	

Property Description:

Stories: 1

This one-story brick-clad house in the Roseland community has a gable roof covered with asphalt shingles, a metal storm door, concrete steps with metal railings, a five-paned bow window with casements, and a double-hung window in its recessed corner. Detailing includes decorative faux stone flanking the entrance and three adjacent glass blocks. It does not display distinguishing architectural features and is not individually eligible for listing on the National Register.



Integrity:			Additional Notes/Descriptions
<u>Unaltered</u>	Slight Modificatio	on Major Alteration	
<u>e narcerea</u>	Singlit Modifiedatio		
Condition:			
Excellent	Good	Poor	
Additional Alteration	ons		
Structu	re Usage	Exterior Wall Surface	
Current: NA		Brick, Synthetic siding (gable)	
Historic: NA			
Roof Material	Roof Features	Roof Type	
Asphalt shingle	None	Gable	
Ornamental Archit	ectural Details		Windows
Stone around entrand	ce, decorative glass block	Double-hung, casement, glass block	
Outbuildings (<i>Num</i>	ber and Description)		
	······································		
None			

Local Landmark	Y	<u>N</u>	
National Register Historic Places	Y	<u>N</u>	
National Register Historic District	Y	<u>N</u>	Name:
Individually Eligible? No	Α	B C	Significance:

Γ	Additional Comments:



Historical Resource Recordation Form

Property Name	Photos with Captions: East façade of a one-story, single family, brick residence.
Historic: Bldg. not labeled, not in CHRS	East fuçude of a one story, single family, offek festdence.
Common/Current: Unknown	
Property Address:	
10824 S. Emerald Avenue	
HAARGIS Number:	
Not in database	
Present Owner and /or Occupant:	
Unknown	
Property Use	
Historic: Single family residence	
Current: Single family residence	
Date of Construction: 1955	
Architect's Name: Not in CHRS	
Builder/Contractor: Not in CHRS	
Architectural Style:	
Vernacular	
Prepared By: J. Martinez, M. C. Bird, J.	
Guarino	Autor And
Photo By: S. Katz	
Date: 23 October 2012	

Property Description:

Stories: 1

This one-story house in the Roseland community has a side gable roof, is clad with orange brick, and features synthetic cladding in the gabled ends and above the sill line of the front elevation. The front elevation has an off-center hollow core metal door, a strip of three windows largely obscured by tall bushes and a low, metal awning, a glass block window, and a pair of rectangular sliding glass windows. It does not feature distinguishing architectural features and is not individually eligible for listing on the National Register.



Integrity:			Additional Notes/Descriptions
Unaltered	Slight Modificatio	n Major Alteration	Replacement cladding
Condition:			
Excellent	Good	Poor	
Additional Alteration	ons		
Structu	re Usage	Exterior Wall Surface	
Current: NA		Brick (main), synthetic siding	
Historic: NA		(gable ends and above sill)	
Roof Material	Roof Features	Roof Type	
Asphalt shingle	None	Gable	
Ornamental Archit	ectural Details		Windows
None			Sliding, glass block
Outbuildings (Num	ber and Description)	·	
None			

Local Landmark	Y <u>N</u>	
National Register Historic Places	Y <u>N</u>	
National Register Historic District	Y <u>N</u>	Name:
Individually Eligible? No	A B C	Significance:

Additional Comments:			



Historical Resource Recordation Form

Property Name	Photos with Captions: East façade of a split-level, single family, brick residence.
Historic: Bldg. not labeled, not in CHRS	
Common/Current: Unknown	
Property Address:	
10952 S. Emerald Avenue	
HAARGIS Number:	
Not in database	
Present Owner and /or Occupant:	
Unknown	
Property Use	
Historic: Single family residence	
Current: Single family residence	
Date of Construction: 1962	
Architect's Name: Not in CHRS	
Builder/Contractor: Not in CHRS	
Architectural Style:	
Vernacular	
Prepared By: J. Martinez, M. C. Bird, J.	
Guarino	
Photo By: S. Katz	
Date: 23 October 2012	
Property Description:	Stories: Split level

Property Description:

Stories: Split-level

This back-split house in the Roseland community is clad with buff brick; the front elevation of the back portion of the split is covered with synthetic siding. Both portions of the house have hip roofs covered with asphalt shingles and have wide, overhanging eaves. The front elevation has five large single-pane windows, three of which have matching single pane windows below the sill line, creating floor-to-ceiling glazing. The front door is situated along the south elevation, which has an exterior buff brick chimney and one-over-one aluminum-sash windows. It does not display distinguishing architectural features and is not individually eligible for listing on the National Register.



Integrity:			Additional Notes/Descriptions
integrity.			runnonar rotes Descriptions
<u>Unaltered</u>	Slight Modificat	ion Major Alteration	
Condition:			
<u>Excellent</u>	Good	Poor	
Additional Alteration	ons		
Structu	re Usage	Exterior Wall Surface	
Current: NA		Brick (front section façade),	
Historic: NA		synthetic siding (rear section)	
Roof Material	Roof Features	Roof Type	
Asphalt shingle	None	Hip	
Ornamental Archit	ectural Details		Windows
Sill line			Double-hung, fixed-pane
Outbuildings (Num	ber and Description)		
None			

Local Landmark	Y <u>N</u>	
National Register Historic Places	Y <u>N</u>	
National Register Historic District	Y <u>N</u>	Name:
Individually Eligible? No	A B C	Significance:

Additional Comments:			



Historical Resource Recordation Form

Property Name	Photos with Captions:
Historic: Bldg. not labeled, not in CHRS	East façade of a two-story, single family, brick residence.
Common/Current: Unknown	BX SAME
Property Address:	
11034 S. Emerald Avenue	
HAARGIS Number:	
Not in database	
Present Owner and /or Occupant:	
Unknown	
Property Use	
Historic: Single family residence	
Current: Single family residence	
Date of Construction: 1924	
Architect's Name: Not in CHRS	
Builder/Contractor: Not in CHRS	
Architectural Style:	
Vernacular	
Prepared By: J. Martinez, M. C. Bird, J. Guarino	
Photo By: S. Katz	
Date: 23 October 2012	

Property Description:

Stories: 2

This two-story brick-clad bungalow in the Roseland community is situated on a raised basement. The building has a hip roof covered with asphalt shingles, overhanging eaves, an aluminum-clad gable dormer with a strip of single-pane sliding windows partially covered by a metal awning. A two-story aluminum-clad gable-roof second story addition is visible. The three-sided front elevation encompasses the living room bay and features a central strip of three windows and flanking single windows, all of which are non-original one-over-one aluminum sash. The front door is situated along the south elevation and has a metal awning. Detailing includes concrete sills, sill courses, and decorative insert blocks flanking the central strip of windows. This is an example of a Chicago bungalow, a building type that the City of Chicago has recognized through its Historic Chicago Bungalow Initiative. However, this house has been modified with the second story addition, lacks distinctive architectural features, and is not individually eligible for listing on the National Register.



Structural Survey

Integrity:			Additional Notes/Descriptions
Unaltered	<u>Slight Modificati</u>	ion Major Alteration	Replacement windows and dormer cladding
Condition:			
Excellent	Good	Poor	
Additional Alteration	ons		
Second story added.			
Structure Usage Exterior Wall Surface			
Current: NA		Brick (original section), synthetic	
Historic: NA		siding (dormer and addition)	
Roof Material	Roof Features	Roof Type	
Asphalt shingle	Dormer	Hip, gable	
Ornamental Archit	tectural Details		Windows
Concrete sills and si	ll courses, decorative ins	Double-hung, sliding	
Outbuildings (Num	ber and Description)		
None			

Local Landmark	Y	<u>N</u>	
National Register Historic Places	Y	<u>N</u>	
National Register Historic District	Y	<u>N</u>	Name:
Individually Eligible? No	A B	8 C	Significance:

Additional Comments:



Historical Resource Recordation Form

Property Name	Photos with Captions:
Historic: Bldg. not labeled, not in CHRS	East façade of a one-story, single family, brick residence.
Common/Current: Unknown	
Property Address:	
11104 S. Emerald Avenue	
HAARGIS Number:	
Not in database	
Present Owner and /or Occupant:	
Unknown	
Property Use	
Historic: Single family residence	
Current: Single family residence	
Date of Construction: 1951	
Architect's Name: Not in CHRS	
Builder/Contractor: Not in CHRS	
Architectural Style:	
Vernacular	
Prepared By: J. Martinez, M. C. Bird, J.	
Guarino	
Photo By: S. Katz	
Date: 24 October 2012	

Property Description:

Stories: 1

This one-story brick-clad house in the Roseland community has a side-gabled roof covered with asphalt shingles and a front-facing projecting gabled pavilion with non-original aluminum siding in the gable. It sits atop a raised basement. The front elevation has a metal storm door with a bracketed gable hood and concrete steps with metal railings. There are two windows, both non-original: a picture window and a one-over-one aluminum-sash window both with concrete sills. It does not feature distinguishing architectural characteristics and is not individually eligible for listing on the National Register.




Integrity:			Additional Notes/Descriptions	
Unaltered	Slight Modification	on Major Alteration	Replacement windows and gable cladding	
Condition:				
<u>Excellent</u>	Good	Poor		
Additional Alterati	ons			
Structu	ire Usage	Exterior Wall Surface		
Current: NA		Brick (main), synthetic siding		
Historic: NA		(gable end)		
Roof Material	Roof Features	Roof Type		
Asphalt shingle	None	Gable		
Ornamental Archit	tectural Details		Windows	
Bracketed gable hoc	od, concrete sills	Double-hung, fixedpane		
Outbuildings (Number and Description)				
None				

Local Landmark	Y <u>N</u>	
National Register Historic Places	Y <u>N</u>	
National Register Historic District	Y <u>N</u>	Name:
Individually Eligible? No	A B C	Significance:

Additional Comments:			



Historical Resource Recordation Form

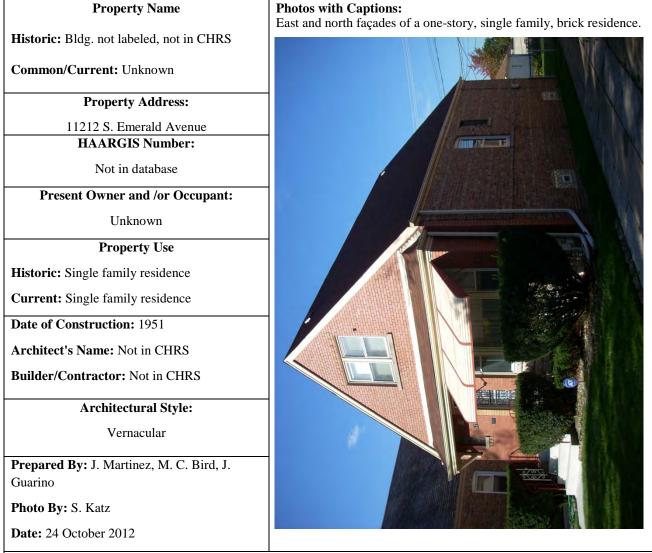

Property Description:

Stories: 1

This one-story cottage in the Roseland community is situated on a raised basement with glass block windows and is clad with orange brick on the front elevation and common brick on the side and rear elevations. The building has a steeply pitched front gable roof covered with asphalt shingles. The front elevation has a pent roof, an off-center metal storm door surrounded by yellow brick, concrete steps with metal railings, and an adjacent glass block window. The projecting living room bay features a non-original picture window flanked by one-over-one aluminum-sash windows that are partially obscured by a low metal awning. This bay is clad in faux stone below the sill line. A pair of non-original one-over-one aluminum-sash windows have concrete sills. This house lacks distinguishing architectural features and is not individually eligible for listing on the National Register.



Integrity:			Additional Notes/Descriptions
Unaltered	Slight Modification	on Major Alteration	Replacement windows
Condition:			
Excellent	Good	Poor	
Additional Alteration	ons		
Structu	re Usage	Exterior Wall Surface	
Current: NA		Brick (main),	
Historic: NA		Faux stone (below sill line)	
Roof Material	Roof Features	Roof Type	
Asphalt shingle	None	Gable	
Ornamental Archit	ectural Details		Windows
Concrete sills, contra	asting brick around entra	nce	Double-hung, fixed-pane, glass block
Outbuildings (Num	ber and Description)		
None			

Local Landmark	Y <u>N</u>	
National Register Historic Places	Y <u>N</u>	
National Register Historic District	Y <u>N</u>	Name:
Individually Eligible? No	A B C	Significance:

Additional Comments:			



Historical Resource Recordation Form

Property Name	Photos with Captions: North and east façades of a brick, two-story single family residence.
Historic: Bldg. not labeled, not in CHRS	Norm and east raçades of a breek, two story single rammy residence.
Common/Current: CAR-LA HSE	
Property Address:	
11310 S. Emerald Avenue	
HAARGIS Number:	
140613	
Present Owner and /or Occupant:	
Unknown	
Property Use	
Historic: Single family residence	
Current: Single family residence	
Date of Construction: 1928	
Architect's Name: Not in CHRS	
Builder/Contractor: Not in CHRS	
Architectural Style:	
French Eclectic	
Prepared By: J. Martinez, M. C. Bird, J.	
Guarino	
Photo By: S. Katz	
Date: 24 October 2012	
Property Description:	Stories ?

Property Description:

Stories: 2

This two-story asymmetrical French Eclectic style house in the Roseland community was built for Stuart Colman. It is clad with brownish-orange face brick. The building has a steeply pitched roof covered with slate, a pair of gabled pavilions along its north elevation, and an L-shaped footprint with a one-story side-gabled wing that features two flat-roofed dormers. The front elevation of the main block has two windows on the first floor that are obscured by metal grates and two through-the-cornice wall dormers with paired casement windows. The recessed front door has a smooth stone surround and a stone-clad upper story oriel is situated at the juncture between the front wing and its adjacent gabled pavilion. Attic windows in the paired gable pavilions are surrounded by stone quoins. Fenestration appears to be mainly casement windows. This is an unusual example of a French Eclectic style home in Roseland and stands as a visual landmark among the predominant building stock of cottages and bungalows. Although windows appear to be replacements, overall it has very good integrity and is recommended as individually eligible for National Register listing.



Structural Survey

Integrity:			Additional Notes/Descriptions	
Unaltered	Slight Modification	Major Alteration	Replacement windows	
Condition:				
<u>Excellent</u>	Good	Poor		
Additional Alterati	ons			
Structu	ire Usage	Exterior Wall Surface		
Current: NA		Brick		
Historic: NA				
Roof Material	Roof Features	Roof Type		
Slate	Dormers	Gable		
Ornamental Archit	ectural Details		Windows	
Stone oriel, stone qu	ioins, surround	Casement		
Outbuildings (Number and Description)				
None				


Local Landmark	Y	N	
National Register Historic Places	Y	<u>N</u>	
National Register Historic District	Y	<u>N</u>	Name:
Individually Eligible? Yes	A	в <u>с</u>	Significance: Unusual example of a French Eclectic house and visual landmark among the cottage and bungalow housing stock in Roseland.

Additional Comments:

CHRS coded orange: property possesses some architectural feature or historical association that made it potentially significant in the context of the surrounding community.



Historical Resource Recordation Form

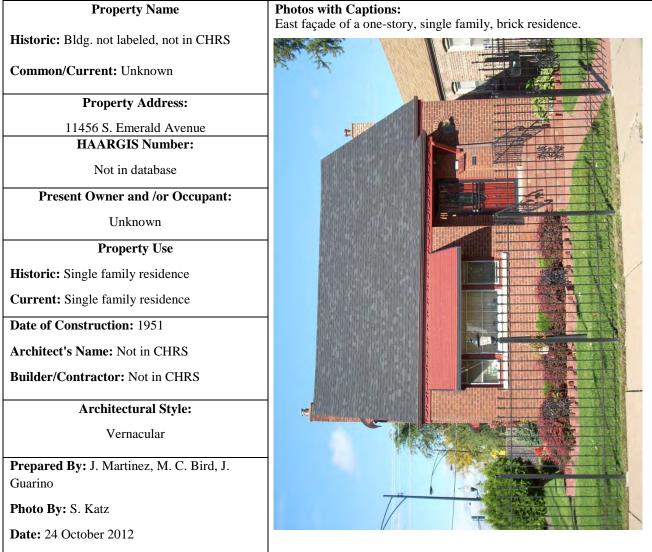

Property Description:

Stories: 1

This one-story brick-clad cottage at the northwest corner of Emerald Avenue and 115th Street in the Roseland community has a side gable roof covered with asphalt shingles and a rear gabled wing. The front elevation has a projecting living room bay with a multi-light window flanked by adjacent non-original one-over-one aluminum sash windows, an off-center hollow core metal door, ceramic tile steps with metal railings, and a bulls-eye window. A pent roof spans the living room bay and front door. This house does not feature distinguishing architectural elements and is not individually eligible for listing on the National Register.




Integrity:			Additional Notes/Descriptions
Unaltered	Slight Modification	Major Alteration	Replacement door and windows
Condition:			
Excellent	Good	Poor	
Additional Alteration	ons		
Structu	re Usage	Exterior Wall Surface	
Current: NA		Brick	
Historic: NA			
Roof Material	Roof Features	Roof Type	
Asphalt shingle	None	Gable	
Ornamental Archit	ectural Details	Windows	
Bulls-eye window			Double-hung, fixed-pane
Outbuildings (Num	ber and Description)		
None			

Local Landmark	Y <u>N</u>	
National Register Historic Places	Y <u>N</u>	
National Register Historic District	Y <u>N</u>	Name:
Individually Eligible? No	A B C	Significance:

Additional Comments:			



Historical Resource Recordation Form

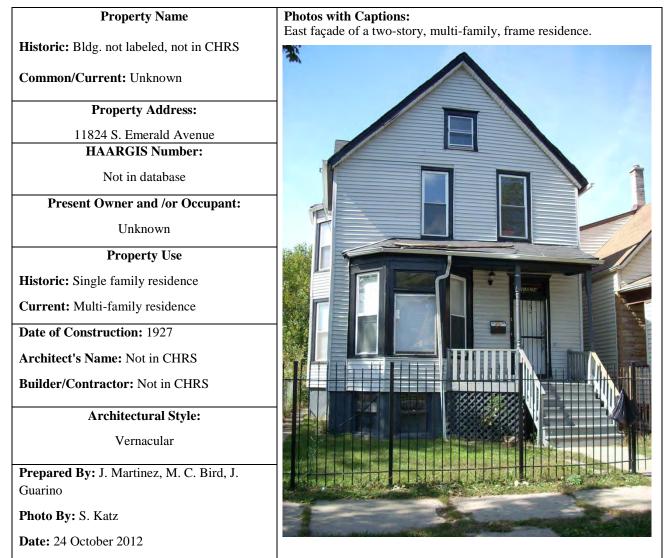

Property Description:

Stories: 2

This two-story frame house in the West Pullman neighborhood is situated on a raised brick basement that has been covered with concrete. Above, the house is covered with synthetic siding. The building has a cross-gable roof covered with asphalt shingles. Its front elevation has a partial-width wood porch; its hipped-roof of which spans the full façade to also shelter the adjacent three-sided window bay, which has a central non-original fixed-pane window with transom flanked by non-original one-over-one aluminum-sash windows. The porch has an off-center non-original hollow core metal door with a transom, wood posts, steps and straight railings. There are two windows on the second floor of the front elevation and one in the gable, all of which are non-original one-over-one aluminum-sash. The south elevation has a two-story three-sided window bay. This house lacks integrity and distinguishing architectural features and is not individually eligible for listing on the National Register.



Integrity:			Additional Notes/Descriptions
Unaltered	Slight Modification	n Major Alteration	Replacement door, windows, and cladding
Condition:			
<u>Excellent</u>	Good	Poor	
Additional Alterati	ons		
Structu	re Usage	Exterior Wall Surface	
Current: NA		Synthetic siding	
Historic: NA			
Roof Material	Roof Features	Roof Type	
Asphalt	None	Gable	
Ornamental Archit	ectural Details	Windows	
None			Double-hung, fixed-pane
Outbuildings (Num	ber and Description)		
None			

Local Landmark	Y <u>N</u>	
National Register Historic Places	Y <u>N</u>	
National Register Historic District	Y <u>N</u>	Name:
Individually Eligible? No	A B C	Significance:

Additional Comments:			



Historical Resource Recordation Form

Property Name	Photos with Captions: East façade of a two-story, brick, multi-family residence.
Historic: Bldg. not labeled, not in CHRS	East façade of a two-story, offek, multi-family fesidence.
Common/Current: Unknown	
Property Address:	
12012 S. Emerald Avenue	
HAARGIS Number:	
Not in database	
Present Owner and /or Occupant:	
Unknown	
Property Use	
Historic: Single family residence	
Current: Multi-family residence	
Date of Construction: 1904	
Architect's Name: Not in CHRS	
Builder/Contractor: Not in CHRS	
Architectural Style:	
Vernacular	
Prepared By: J. Martinez, M. C. Bird, J. Guarino	
Photo By: S. Katz	
Date: 24 October 2012	

Property Description:

Stories: 2

This two-story, brick-clad residential building in the West Pullman community has a flat roof and parapet. Its front elevation has an off-center pair of non-original hollow core metal doors, each with a transom. Windows are non-original and include a pair of one-over-one aluminum-sash windows on the first floor, a three-sided aluminum-clad window bay on the second floor with a central fixed-pane window and two oneover-one aluminum-sash windows, and a single fixed-pane window on the second floor. Detailing includes concrete sill courses, soldier course arched lintels, and decorative brickwork along the cornice. This building lacks integrity and distinctive architectural features and is not individually eligible for listing on the National Register.



Integrity:			Additional Notes/Descriptions
Unaltered	Slight Modificati	on Major Alteration	Replacement doors and windows
Condition:			
<u>Excellent</u>	Good	Poor	
Additional Alteration	ons		
Second story bay add	ded after 1938 (Sanborn		
Structure Usage Exterior Wall Surface			
Current: NA		Brick (main),	
Historic: NA		Synthetic siding (window bay)	
Roof Material	Roof Features	Roof Type	
Unknown	Parapet	Flat	
Ornamental Archit	ectural Details	Windows	
Decorative brickwor	k including lintels and c	Double-hung, fixed-pane	
Outbuildings (Num	ber and Description)		
None			

Local Landmark	Y <u>N</u>	
National Register Historic Places	Y <u>N</u>	
National Register Historic District	Y <u>N</u>	Name:
Individually Eligible? No	A B C	Significance:

Additional Comments:			



Historical Resource Recordation Form

Property Name	Photos with Captions:
	East facade of a one-story, brick, single family residence.
Historic: Bldg. not labeled, not in CHRS	
Common/Current: Unknown	
Property Address:	
12110 S. Emerald Avenue	
HAARGIS Number:	
Not in database	
Present Owner and /or Occupant:	A
Unknown	
Property Use	
Historic: Single family residence	
Current: Single family residence	
Date of Construction: 1949	
Architect's Name: Not in CHRS	
Builder/Contractor: Not in CHRS	
Architectural Style:	
Vernacular	
Prepared By: J. Martinez, M. C. Bird, J.	
Guarino	and the second state of th
Photo By: S. Katz	me that we want to have the
Date: 24 October 2012	

Property Description:

Stories: 1

This one-story house in the West Pullman community is clad with orange-brown face brick on its front elevation and common brick on its side and rear elevations. The building has a side-gable roof covered with asphalt shingles and a gabled one-story rear wing. The front elevation has an off-center, brick-clad, gabled vestibule with a hollow core metal door with a smooth surround, a bracketed metal awning, concrete steps with metal railings, a small glass block window, and a strip of three one-over-one windows. Detailing includes inserts at the gabled roof of the vestibule, a soldier course lintel, and concrete sills. It does not display distinguishing architectural features and is not individually eligible for listing on the National Register.



Integrity:			Additional Notes/Descriptions
Unaltered	Slight Modificati	Major Alteration	Replacement door
Onancied	<u>Siight Modificati</u>	Major Atteration	
Condition:			
Excellent	Good	Poor	
Additional Alterati	ons		
	. 1 1		
The rear wing appea	rs to be original.		
Structure Usage Exterior Wall Surface			
Current: NA		Brick	
Historic: NA			
Roof Material	Roof Features	Roof Type	
Asphalt shingle	None	Gable	
Ornamental Archit	tectural Details		Windows
Inserts under the gat	ble end of the vestibule,	Double-hung, glass block	
sills, surround			0,0
Outbuildings (Num	ber and Description)		
None			

Local Landmark	Y <u>N</u>	
National Register Historic Places	Y <u>N</u>	
National Register Historic District	Y <u>N</u>	Name:
Individually Eligible? No	A B C	Significance:

Additional Comments:			



Historical Resource Recordation Form

Property Name	Photos with Captions:
	East façade of a 1.5-story, single family, frame residence.
Historic: Bldg. not labeled, not in CHRS	
Common/Current: Unknown	
Property Address:	
12206 S. Emerald Avenue	
HAARGIS Number:	
Not in database	
Present Owner and /or Occupant:	
Vacant	
Property Use	
Historic: Single family residence	R -televe
Current: Single family residence	
Date of Construction: 1923	
Architect's Name: Not in CHRS	
Builder/Contractor: Not in CHRS	
Architectural Style:	
Craftsman	
Prepared By: J. Martinez, M. C. Bird, J.	
Guarino	
Photo By: S. Katz	
Date: 29 October 2012	

Property Description:

Stories: 1.5

This one-and-a-half-story Craftsman bungalow in the West Pullman community is situated on a raised concrete block basement with glass block windows and is covered with synthetic siding. The building has a hip-on-gable roof covered with asphalt shingles and overhanging eaves with knee braces. The front elevation has a full-width, gable-roofed wood porch with straight railings and faux stone piers supports topped by squat wood columns. The porch shelters an off-center door, a large window group and a small window opening on the first floor that are covered with plywood. There is a pair of double-hung wood-sash windows in the gable. Side elevation window openings are covered with plywood. This house lacks integrity and distinctive architectural features and is not individually eligible for listing on the National Register.




Integrity:			Additional Notes/Descriptions
Unaltered	Slight Modification	on Major Alteration	· ·
	C		
Condition:			
Excellent	Good	Poor	
Additional Alterati	ons		
Structu	ire Usage	Exterior Wall Surface	
Current: NA		Synthetic (asphalt shingles)	
Historic: NA			
Roof Material	Roof Features	Roof Type	
Asphalt shingle	None	Hip-on-gable	
Ornamental Archit	ectural Details		Windows
Knee braces			Double-hung, glass block, covered
Outbuildings (Num	ber and Description)		·
None			

Local Landmark	Y <u>N</u>	
National Register Historic Places	Y <u>N</u>	
National Register Historic District	Y <u>N</u>	Name:
Individually Eligible? No	A B C	Significance:

Additional Comments:			



Historical Resource Recordation Form

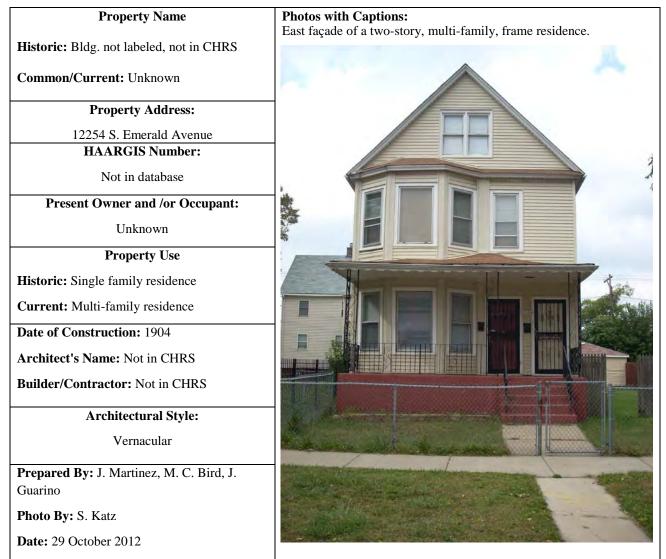

Property Description:

Stories: 2

This two-story multi-family residential building in the West Pullman community is situated on a raised concrete block basement with glass block windows and is covered with synthetic siding. The building has a front gable roof covered with asphalt shingles. The front elevation has a full-width, hip-roof porch with a concrete deck and steps, metal railings, and open metal posts. It also contains a pair of off-center doors and a two-story hip-roof window bay pavilion. There are three windows in the first floor bay, four windows on the second floor, including three in the window bay, and a pair of windows in the gable. Windows throughout the house are non-original one-over-one aluminum sash with the exception of the two central windows in the two-story window bay, which are fixed-pane, and the glass block in the basement. This building lacks integrity and distinctive architectural features and is not individually eligible for listing on the National Register.



Integrity:			Additional Notes/Descriptions
Unaltered	Slight Modification	on Major Alteration	Replacement door, windows, cladding, and porch rails
			chadding, and porch fails
Condition:			
Excellent	Good	Poor	
Additional Alteration	ons		
Structu	ire Usage	Exterior Wall Surface	
Current: NA		Synthetic siding	
Historic: NA			
Roof Material	Roof Features	Roof Type	
Asphalt shingle	None	Gable	
Ornamental Archit	ectural Details		Windows
None			Double-hung, fixed-pane, glass
			block
Outbuildings (Num	ber and Description)		
Detached two-car fra	ame car with hip roof.		

Local Landmark	Y <u>N</u>	
National Register Historic Places	Y <u>N</u>	
National Register Historic District	Y <u>N</u>	Name:
Individually Eligible? No	A B C	Significance:

Additional Comments:			



Historical Resource Recordation Form

Property Name	Photos with Captions:
	North and east facades of a brick, two-story, mixed-use building.
Historic: Bldg. not labeled, not in CHRS	
Common/Current: Unknown	
Property Address:	
12300 S. Emerald Avenue	
HAARGIS Number:	
Not in database	
Present Owner and /or Occupant:	
Cards, Gifts & Things, The Crowning Glory	
Barber & Beauty Salon	
Duran anta Ura	
Property Use	
Historic: Commercial	
Current: Mixed Use	
Date of Construction: 1915	
Architect's Name: Not in CHRS	d have a second s
Builder/Contractor: Not in CHRS	
Architectural Style:	
Vernacular	
Prepared By: J. Martinez, M. C. Bird, J.	
Guarino	
Photo By: S. Katz	
Date: 29 October 2012	
Property Description:	Stories: 2

Property Description:

Stories: 2

This two-story mixed-use building at the southwest corner of Emerald Avenue and 123rd Street in the West Pullman community is clad with brown face brick along its two street elevations. The building has a flat roof and a parapet that is rounded at the center of the Emerald Avenue elevation. The building has a non-original corner storefront with synthetic siding, a strip of three fixed-pane windows, and a mirrored glass corner door in the recessed corner entrance vestibule. The Emerald Avenue elevation has an off-center doorway with a non-original door that provides access to the second floor. An additional entrance with a non-original hollow core metal door is situated along the 123rd Street elevation. The first floor of the 123rd Street elevation and the building's second floor features one-over-one wood-sash windows arranged by themselves, in pairs, and in groups of three. One of these openings on the first floor has been in-filled with glass block. Detailing includes concrete sills, decorative square insert blocks at the parapet level, and brick stringcourses. This building lacks integrity and distinctive architectural features and is not individually eligible for listing on the National Register.



Integrity:			Additional Notes/Descriptions
Unaltered	Slight Modification	on Major Alteration	Replacement doors, windows, and storefronts
Condition:			
Excellent	Good	Poor	
Additional Alterati	ons		
Structu	ire Usage	Exterior Wall Surface	
Current: NA		Brick (main), synthetic siding	
Historic: NA		(corner storefront)	
Roof Material	Roof Features	Roof Type	
Unknown	Parapet	Flat	
Ornamental Archit	ectural Details		Windows
Concrete sill and insert blocks, brick stringcourses			Double-hung, fixed-pane, glass block
Outbuildings (Num	ber and Description)		
None			

Local Landmark	Y	<u>N</u>	
National Register Historic Places	Y	<u>N</u>	
National Register Historic District	Y	<u>N</u>	Name:
Individually Eligible? No	Α	B C	Significance:



Historical Resource Recordation Form

Property Name	Photos with Captions: East façade of a one-story, single family, frame residence.
Historic: Bldg. not labeled, not in CHRS	East laçade of a one-story, single family, frame residence.
Common/Current: Unknown	
Property Address:	
12350 S. Emerald Avenue	
HAARGIS Number:	
Not in database	
Present Owner and /or Occupant:	
Unknown	
Property Use	
Historic: Single family residence	
Current: Single family residence	
Date of Construction: 1931	
Architect's Name: Not in CHRS	
Builder/Contractor: Not in CHRS	
Architectural Style:	
Craftsman	
Prepared By: J. Martinez, M. C. Bird, J.	
Guarino	
Photo By: S. Katz	
Date: 29 October 2012	
Property Description.	Storiog 1

Property Description:

Stories: 1

This one-story Craftsman bungalow in the West Pullman community is situated on a raised concrete block basement with casement windows and is covered with synthetic siding. The building has a hip roof covered with asphalt shingles, overhanging eaves, and a hip dormer with a strip of three wood casement windows. The front elevation has a recessed corner porch with a corner support consisting of a faux stone pier topped by a squat wood column. The porch has wood steps with metal railings, an off-center metal storm door, and a strip of three non-original double-hung windows. This house lacks integrity and distinctive architectural features and is not individually eligible for listing on the National Register.



Integrity:			Additional Notes/Descriptions		
Unaltered	Slight Modification	Major Alteration	Some windows replaced		
Condition:					
Excellent	Good	Poor			
Additional Alteration	ons				
Structu	re Usage	Exterior Wall Surface			
Current: NA		Synthetic siding			
Historic: NA					
Roof Material	Roof Features	Roof Type			
Asphalt shingles	Dormer	Hip			
Ornamental Archit	ectural Details	Windows			
Squat column			Double-hung, casement		
Outbuildings (Num	Outbuildings (Number and Description)				
Two-car, detached, frame garage with hip roof					

Local Landmark	Y <u>N</u>	
National Register Historic Places	Y <u>N</u>	
National Register Historic District	Y <u>N</u>	Name:
Individually Eligible? No	A B C	Significance:

Additional Comments:			



Historical Resource Recordation Form

Property Name	Photos with Captions:
Historic: Bldg. not labeled, not in CHRS	East façade of a one-story, single family, frame residence.
Common/Current: Unknown	
Property Address:	
12400 S. Emerald Avenue	
HAARGIS Number:	
Not in database	
Present Owner and /or Occupant:	
Unknown	
Property Use	
Historic: Single family residence	
Current: Single family residence	
Date of Construction: 1924	
Architect's Name: Not in CHRS	
Builder/Contractor: Not in CHRS	
Architectural Style:	
Craftsman	
Prepared By: J. Martinez, M. C. Bird, J.	
Guarino	
Photo By: S. Katz	
Date: 29 October 2012	
Property Description:	Stories: 1

Property Description:

Stories: 1

This one-story Craftsman bungalow in the West Pullman community is situated on a raised concrete block basement and is covered with synthetic siding. The building has a hip roof covered with asphalt shingles, overhanging eaves, and a hip dormer with a strip of three single-pane sliding windows. The front elevation has a recessed corner porch with corner support consisting of a faux stone pier topped by a squat wood column, wood steps with straight wood railings, and an off-center hollow core metal door. There is also a strip of three double-hung wood-sash windows. This house lacks integrity and distinctive architectural features and is not individually eligible for listing on the National Register.



Integrity:			Additional Notes/Descriptions		
Unaltered	Slight Modification	Major Alteration	Replacement cladding		
Condition:					
Excellent	Good	Poor			
Additional Alterati	ons				
Structu	ire Usage	Exterior Wall Surface			
Current: NA		Synthetic siding			
Historic: NA					
Roof Material	Roof Features	Roof Type			
Asphalt shingles	Dormer	Hip			
Ornamental Archit	ectural Details		Windows		
Square column on po	orch		Double-hung, sliding		
Outbuildings (Num	Outbuildings (Number and Description)				
None					

Local Landmark	Y <u>N</u>	
National Register Historic Places	Y <u>N</u>	
National Register Historic District	Y <u>N</u>	Name:
Individually Eligible? No	A B C	Significance:

Additional Comments:		



Historical Resource Recordation Form

Property Name	Photos with Captions: East and south façades of a 1.5- story, single family, brick residence.
Historic: Bldg. not labeled, not in CHRS	East and south façades of a 1.5- story, single failing, offek festdenee.
Common/Current: Unknown	
Property Address:	
12446 S. Emerald Avenue	P-1
HAARGIS Number:	
Not in database	
Present Owner and /or Occupant:	
Unknown	
Property Use	
Historic: Single family residence	
Current: Single family residence	
Date of Construction: 1950	
Architect's Name: Not in CHRS	
Builder/Contractor: Not in CHRS	
Architectural Style:	
Vernacular	
Prepared By: J. Martinez, M. C. Bird, J.	
Guarino	
Photo By: S. Katz	
Date: 29 October 2012	

Property Description:

Stories: 1.5

This one-and-a-half-story in the West Pullman community is situated on a raised basement and is clad with face brick on its front elevation and common brick on its side and rear elevations. The building has a front gable roof covered with asphalt shingles and a wide, shed-roofed, synthetic-clad dormer addition along the south slope of the roof. The front elevation has a slightly projecting gabled entrance vestibule with a non-original hollow core metal door and a Classical wood surround consisting of fluted pilasters and cornice. The building also includes concrete steps with metal railings, a strip of three double-hung windows with metal awning and a lintel on the first floor, and a pair of three-over-one wood-sash windows in the gable. Windows feature concrete sills. This house lacks distinctive architectural features and is not individually eligible for listing on the National Register.



Integrity:			Additional Notes/Descriptions		
Unaltered	Slight Modificatio	n Major Alteration	Replacement door, addition		
Condition:					
Excellent	Good	Poor			
Additional Alteration	ons				
Dormer addition on	south side of roof				
Structu	re Usage	Exterior Wall Surface			
Current: NA		Brick (main),			
Historic: NA		Synthetic siding (addition)			
Roof Material	Roof Features	Roof Type			
Asphalt shingles	None	Gable			
Ornamental Archit	ectural Details		Windows		
Fluted pilasters and	Double-hung, glass block				
Outbuildings (Num	Outbuildings (Number and Description)				
None					

Local Landmark	Y <u>N</u>	
National Register Historic Places	Y <u>N</u>	
National Register Historic District	Y <u>N</u>	Name:
Individually Eligible? No	A B C	Significance:

Additional Comments:			



Historical Resource Recordation Form

Property Name	Photos with Captions: East façade of a one-story, single family, frame residence.
Historic: Bldg. not labeled, not in CHRS	Lust fuçude of a one story, single failing, france festionee.
Common/Current: Unknown	JUNE MARKEN
Property Address:	
12552 S. Emerald Avenue	
HAARGIS Number:	
Not in database	
Present Owner and /or Occupant:	
Unknown	
Property Use	
Historic: Single family residence	
Current: Single family residence	
Date of Construction: 1942	
Architect's Name: Not in CHRS	
Builder/Contractor: Not in CHRS	
Architectural Style:	
Vernacular	
Prepared By: J. Martinez, M. C. Bird, J.	
Guarino	
Photo By: S. Katz	
Date: 29 October 2012	

Property Description:

Stories: 1

This one-story home in the West Pullman community is clad with a stone veneer on the front elevation with asbestos or wood shingles on the other elevations. The building has a side-gabled roof covered with asphalt shingles and two gable dormers, each of which has a non-original one-over-one aluminum-sash window. The front elevation has a centrally located gabled vestibule with a metal storm door, concrete steps with metal railings, and paired windows on either side. One pair features original six-over-one wood-sash windows and the other has non-original one-over-one aluminum sash. It does not feature distinguishing architectural features and is not individually eligible for listing on the National Register.



Integrity:			Additional Notes/Descriptions	
Unaltered	Slight Modificati	ion Major Alteration	Some replacement windows; possible non-original cladding	
Condition:				
<u>Excellent</u>	Good	Poor		
Additional Alteration	ons			
Structu	re Usage	Exterior Wall Surface		
Current: NA		Faux stone (façade), wood or		
Historic: NA		asbestos shingles (sides and rear)		
Roof Material	Roof Features	Roof Type		
Asphalt shingles	Dormers	Gable		
Ornamental Archit	ectural Details	Windows		
None			Double-hung	
Outbuildings (Number and Description)				
None				

Local Landmark	Y <u>N</u>	
National Register Historic Places	Y <u>N</u>	
National Register Historic District	Y <u>N</u>	Name:
Individually Eligible? No	A B C	Significance:

Additional Comments:			



Historical Resource Recordation Form

Property Name	Photos with Captions:
Historic Dide actichated actic CUDS	East façade of a 1.5-story, single family, frame residence.
Historic: Bldg. not labeled, not in CHRS	AND HE REAL PROPERTY AND A REAL PROPERTY A REAL PROPERTY AND A REA
Common/Current: Unknown	
Property Address:	
12608 S. Emerald Avenue	
HAARGIS Number:	
Not in database	
Present Owner and /or Occupant:	7,000 77
Unknown	
Property Use	
Historic: Single family residence	
Current: Single family residence	
Date of Construction: 1925	
Architect's Name: Not in CHRS	
Builder/Contractor: Not in CHRS	
Architectural Style:	
Vernacular	
Prepared By: J. Martinez, M. C. Bird, J.	
Guarino	
Photo By: S. Katz	
Date: 29 October 2012	

Property Description:

Stories: 1.5

This one-and-a-half-story frame cottage in the West Pullman community is situated on a raised concrete block basement and is covered with synthetic siding. The building has a front gable roof covered with asphalt shingles. The front elevation has an off-center hollow core metal door with a wood bracketed boxed gable hood, and concrete steps with metal railings. There is a group of three windows on the first floor (fixed-pane flanked by double-hung sashes) and a single pane window in the gable. This house lacks integrity and distinctive architectural features and is not individually eligible for listing on the National Register.



Integrity:			Additional Notes/Descriptions
Unaltered	Slight Modification	n Major Alteration	Replacement door, windows, and brackets on hooded entrance
Condition:			
<u>Excellent</u>	Good	Poor	
Additional Alterati	ons		
Structu	ire Usage	Exterior Wall Surface	
Current: NA		Synthetic siding	
Historic: NA			
Roof Material	Roof Features	Roof Type	
Asphalt shingle	None	Gable	
Ornamental Archit	tectural Details	Windows	
Brackets on hood			Double-hung, fixed-pane
Outbuildings (Num	ber and Description)		
None			

Local Landmark	Y <u>N</u>	
National Register Historic Places	Y <u>N</u>	
National Register Historic District	Y <u>N</u>	Name:
Individually Eligible? No	A B C	Significance:

Additional Comments:			



Historical Resource Recordation Form

Property Name	Photos with Captions: East façade of a brick, two-story, single family residence.
Historic: Bldg. not labeled, not in CHRS	
Common/Current: Unknown	
Property Address:	
12650 S. Emerald Avenue	
HAARGIS Number:	
Not in database	
Present Owner and /or Occupant:	
Unknown	
Property Use	
Historic: Single family residence	
Current: Single family residence	
Date of Construction: 1943	
Architect's Name: Not in CHRS	
Builder/Contractor: Not in CHRS	
Architectural Style:	
Vernacular	
Prepared By: J. Martinez, M. C. Bird, J.	
Guarino	
Photo By: S. Katz	
Date: 29 October 2012	

Property Description:

Stories: 2

This two-story house in the West Pullman community is situated on a raised basement and is clad with face brick on its front elevation and common brick on its side and rear elevations. The building has a hip roof covered with asphalt shingles. The front elevation has an off-center metal storm door, concrete steps with metal railings, a picture window on the first floor, and two one-over-one windows on the second floor. Detailing includes a concrete door surround, a vertical strip of three glass blocks adjacent to the door, brick lintels, a brick stringcourse, and concrete sills. This house lacks distinctive architectural features and is not individually eligible for listing on the National Register.



Integrity:			Additional Notes/Descriptions
<u>Unaltered</u>	Slight Modificatio	n Major Alteration	
Condition:			
Excellent	Good	Poor	
Additional Alterati	ons		
Structu	ire Usage	Exterior Wall Surface	
Current: NA		Brick	
Historic: NA			
Roof Material	Roof Features	Roof Type	
Asphalt shingles	None	Hip	
Ornamental Archit	ectural Details		Windows
Decorative glass blo	cks, brick stringcourses, c	Double-hung, fixed-pane, glass block	
Outbuildings (Num	ber and Description)		
None			

Local Landmark	Y <u>N</u>	
National Register Historic Places	Y <u>N</u>	
National Register Historic District	Y <u>N</u>	Name:
Individually Eligible? No	A B C	Significance:

Additional Comments:			



Historical Resource Recordation Form

Property Name	Photos with Captions: East façade of a one-story, single family, brick residence.
Historic: Bldg. not labeled, not in CHRS	Last façade of a one-story, single failing, onek fesidence.
Common/Current: Unknown	
Property Address:	
12706 S. Emerald Avenue	
HAARGIS Number:	
Not in database	
Present Owner and /or Occupant:	
Unknown	
Property Use	
Historic: Single family residence	
Current: Single family residence	
Date of Construction: 1957	
Architect's Name: Not in CHRS	
Builder/Contractor: Not in CHRS	
Architectural Style:	
Vernacular	
Prepared By: J. Martinez, M. C. Bird, J.	
Guarino	The second se
Photo By: S. Katz	
Date: 29 October 2012	
Property Description:	Stories: 1

Property Description:

Stories: 1

This one-story house in the West Pullman community is situated on a raised basement and is clad with buff brick on its front elevation and common brick on its side and rear elevations. The building has a front gable roof covered with asphalt shingles and a wood-clad gabled end. The front elevation has a recessed corner porch with a door tucked into the side of the living room bay, a corner window, concrete steps with metal railings, and a non-original picture window flanked by one-over-one aluminum-sash windows. Detailing includes three decorative glass blocks on the living room bay and concrete sills. It does not feature distinguishing architectural elements and is not individually eligible for listing on the National Register.



Integrity:			Additional Notes/Descriptions
Unaltered	Slight Modification	Major Alteration	Replacement windows
Condition:			
<u>Excellent</u>	Good	Poor	
Additional Alteration	ons		
Structu	re Usage	Exterior Wall Surface	
Current: NA		Brick (main),	
Historic: NA		Wood (gable end)	
Roof Material	Roof Features	Roof Type	
Asphalt shingle	None	Gable	
Ornamental Archit	ectural Details		Windows
Decorative glass block, concrete sills			Double-hung, fixed-pane, glass block
Outbuildings (Num	ber and Description)		
None			

Local Landmark	Y <u>N</u>	
National Register Historic Places	Y <u>N</u>	
National Register Historic District	Y <u>N</u>	Name:
Individually Eligible? No	A B C	Significance:

Additional Comments:			



Historical Resource Recordation Form

Property Name	Photos with Captions: East façade of a one-story, single family, brick residence.
Historic: Bldg. not labeled, not in CHRS	Last façade of a one-story, single failing, onek tesidence.
Common/Current: Unknown	
Property Address:	
12814 S. Emerald Avenue	
HAARGIS Number:	
Not in database	
Present Owner and /or Occupant:	
Unknown	
Property Use	
Historic: Single family residence	
Current: Single family residence	
Date of Construction: 1952	
Architect's Name: Not in CHRS	
Builder/Contractor: Not in CHRS	
Architectural Style:	
Vernacular	
Prepared By: J. Martinez, M. C. Bird, J.	
Guarino	
Photo By: S. Katz	
Date: 29 October 2012	

Property Description:

Stories: 1

This one-story house in the West Pullman community is situated on a raised basement and is clad with face brick on its front elevation and common brick on its side and rear elevations. The building has a hip roof covered with asphalt shingles. The front elevation has a centrally-located metal storm door, concrete steps with metal railings, a large picture window in one corner, and a pair of one-over-one aluminum-sash windows in the other corner. All windows have concrete sills. The house does not feature distinguishing architectural features and is not individually eligible for listing on the National Register.



Integrity:			Additional Notes/Descriptions
<u>Unaltered</u>	Slight Modification	Major Alteration	
Condition:			
Excellent	Good	Poor	
Additional Alterati	ons		
Structu	ire Usage	Exterior Wall Surface	
Current: NA		Brick	
Historic: NA			
Roof Material	Roof Features	Roof Type	
Asphalt shingles	None	Hip	
Ornamental Archit	ectural Details	Windows	
Concrete sills			Double-hung, fixed pane
Outbuildings (Num	ber and Description)		·
None			

Local Landmark	Y <u>N</u>	
National Register Historic Places	Y <u>N</u>	
National Register Historic District	Y <u>N</u>	Name:
Individually Eligible? No	A B C	Significance:

Additional Comments:		



Historical Resource Recordation Form

Property Name	Photos with Captions:
Historic: Bldg. not labeled, not in CHRS	East façade of a one-story, brick, single family residence.
Common/Current: Unknown	
Property Address:	
12842 S. Emerald Avenue	The second
HAARGIS Number:	
Not in database	
Present Owner and /or Occupant:	
Unknown	
Property Use	
Historic: Single family residence	
Current: Single family residence	
Date of Construction: 1954	
Architect's Name: Not in CHRS	
Builder/Contractor: Not in CHRS	
Architectural Style:	
Vernacular	
Prepared By: J. Martinez, M. C. Bird, J.	
Guarino	
Photo By: S. Katz	
Date: 29 October 2012	
Deres ander Deres der deres	

Property Description:

Stories: 1

This one-story house in the West Pullman community is situated on a raised basement and is clad with orange face brick on its front elevation and common brick on its side and rear elevations. The building has a front gable roof covered with asphalt shingles. The front elevation has an off-center hollow core metal door with a concrete surround, concrete steps with metal railings, and a non-original picture window flanked by one-over-one aluminum-sash windows over a concrete sill. It does not feature distinguishing architectural features and is not individually eligible for listing on the National Register.



Integrity:			Additional Notes/Descriptions
Unaltered	Slight Modification	Major Alteration	Replacement door and windows
Condition:			
Excellent	Good	Poor	
Additional Alterati	ons		
Structu	ire Usage	Exterior Wall Surface	
Current: NA		Brick	
Historic: NA			
Roof Material	Roof Features	Roof Type	
Asphalt shingle	None	Gable	
Ornamental Archit	tectural Details	Windows	
Concrete door surround, concrete sills			Double-hung, fixed-pane
Outbuildings (Num	ber and Description)		
None			

Local Landmark	Y <u>N</u>	
National Register Historic Places	Y <u>N</u>	
National Register Historic District	Y <u>N</u>	Name:
Individually Eligible? No	A B C	Significance:

Additional Comments:		



Historical Resource Recordation Form

Property Name	Photos with Captions: East façade of a one-story, brick, single family residence.
Historic: Bldg. not labeled, not in CHRS	
Common/Current: Unknown	
Property Address:	
12904 S. Emerald Avenue	
HAARGIS Number:	
Not in database	
Present Owner and /or Occupant:	
Unknown	
Property Use	
Historic: Single family residence	A SECOND STREET, STREE
Current: Single family residence	
Date of Construction: 1955	
Architect's Name: Not in CHRS	
Builder/Contractor: Not in CHRS	
Architectural Style:	
Vernacular	
Prepared By: J. Martinez, M. C. Bird, J.	
Guarino	
Photo By: S. Katz	
Date: 29 October 2012	
Denormality Denormality is an	Stard 1

Property Description:

Stories: 1

This one-story house in the West Pullman community is situated on a raised basement with glass block windows and is clad with face brick on its front elevation and common brick on its side and rear elevations. The building has a hip roof covered with asphalt shingles and has a projecting gabled living room bay. One-half of the front elevation is recessed beneath the overhanging eaves and has a hollow core metal door with concrete surround, concrete steps with metal railings, and a small adjacent glass block window. The gabled living room bay has a non-original picture window flanked by one-over-one aluminum-sash windows and is clad with a stone veneer beneath the sill line of this window group. The residence has a ventilating louver in the gable. It does not feature distinguishing architectural elements and is not individually eligible for listing on the National Register.



Integrity:			Additional Notes/Descriptions
Unaltered	Slight Modification	n Major Alteration	Replacement windows
Condition:			
Excellent	Good	Poor	
Additional Alteration	ons		
Structu	re Usage	Exterior Wall Surface	
Current: NA		Brick (main), stone veneer	
Historic: NA		(façade below sill)	
Roof Material	Roof Features	Roof Type	
Asphalt shingles	None	Hip	
Ornamental Archit	ectural Details		Windows
Concrete door surround, sill line			Double-hung, fixed-pane, glass block
Outbuildings (Num	ber and Description)		
None			

Local Landmark	Y <u>N</u>	
National Register Historic Places	Y <u>N</u>	
National Register Historic District	Y <u>N</u>	Name:
Individually Eligible? No	A B C	Significance:

Additional Comments:			



Historical Resource Recordation Form

Property Name	Photos with Captions: Looking south at light industrial complex.
Historic: Bldg. not labeled, not in CHRS	Looking south at rent industrial complex.
Common/Current: Unknown	
Property Address:	
11730-11736 S. Front Avenue	
HAARGIS Number:	A DEAL ON A DEAL
Not in database	4.5
Present Owner and /or Occupant:	
Unknown	
Property Use	
Historic: Industrial	
Current: Industrial	
Date of Construction: 1952-1962	
Architect's Name: Not in CHRS	
Builder/Contractor: Not in CHRS	
Architectural Style:	
Vernacular	
Prepared By: J. Martinez, M. C. Bird, J.	
Guarino	
Photo By: S. Katz	
Date: 2 October 2012	

Property Description:

Stories: 1

This concrete block, Quonset utility outbuilding in the West Pullman community is set back from the public right-of-way and has a front elevation with a centrally located garage door opening flanked by a one-overone window on either side. The 1962 aerial photograph shows two buildings on the property, the extant Quonset and a larger building. The larger building was razed between 2007 and 2012. A one-story building and a trailer standing on the remaining concrete slab from the larger, razed building are also part of this complex but too far from the road for evaluation. Windows appear to be fixed-pane on all buildings within the complex. This building complex does not have distinguishing architectural features and is not individually eligible for listing on the National Register.



Integrity:			Additional Notes/Descriptions
Unaltered	Slight Modification	Major Alteration	Extant buildings that are visible from the public ROW remain unchanged
Condition:			
Excellent	Good	Poor	
Additional Alterati	ons		
Structu	ire Usage	Exterior Wall Surface	
Current: NA		Concrete block	
Historic: NA			
Roof Material	Roof Features	Roof Type	
Asphalt	None	Barrel	
Ornamental Archit	tectural Details		Windows
None			Fixed-pane
Outbuildings (Num	ber and Description)		
None			

Local Landmark	Y <u>N</u>	
National Register Historic Places	Y <u>N</u>	
National Register Historic District	Y <u>N</u>	Name:
Individually Eligible? No	A B C	Significance:

Additional Comments:			



Historical Resource Recordation Form

Property Name	Photos with Captions:
	West façade of brick, one-story, single-family residence.
Historic: Not labeled, not in CHRS	
Common/Current: Unknown	
Property address:	
9909 S. Green Avenue	
HAARGIS Number:	
Not in database	
Present Owner and /or Occupant:	
Unknown	
Property Use	
Historic: Single family residence	
Current: Single family residence	
Date of Construction: 1929	
Architect's Name: Not in CHRS	
Builder/Contractor: Not in CHRS	
Architectural Style:	
Chicago Style Bungalow	
Prepared By: C. Tolmie, M. C. Bird, J.	
Guarino	
Photo By: S. Katz	
Date: September 2012	
Property Description.	Stories: 1

Property Description:

Stories: 1

This one-story brick-clad bungalow in the Washington Heights community sits on a raised basement. The building has a hip roof covered with asphalt shingles, overhanging eaves, and a gable dormer with a pair of single-pane windows. The door is tucked into one side of the three-sided living room bay, which has a non-original central picture window flanked by one-over-one aluminum-sash windows. Its front elevation also has a recessed corner porch with two round-arch openings, concrete steps with low brick sidewalls, and a casement window. Details include an archway on the porch, decorative brickwork, and stone inserts above and below the window bay.

This is an example of a brick "Chicago Style Bungalow," a building type that the City of Chicago has recognized through its Historic Chicago Bungalow Initiative. However, this house lacks distinctive architecture features and is not individually eligible for listing on the National Register.




Integrity:			Additional Notes/Descriptions
Unaltered	Slight Modifications	Major Alteration	Replacement windows
Condition:			
Excellent	Good	Poor	
Additional Alteration	ons		
Structu	re Usage	Exterior Wall Surface	
Current: NA		Brick	
Historic: NA			
Roof Material	Roof Features	Roof Type	
Asphalt shingle	Dormer	Hip	
Ornamental Archit	ectural Details		Windows
Soldier brick archwa	y, stone inserts		Fixed pane, double-hung,
			casement
Outbuildings (Num	ber and Description)		
Garage			

Local Landmark	Y <u>N</u>	
National Register Historic Places	Y <u>N</u>	
National Register Historic District	Y <u>N</u>	Name:
Individually Eligible? No	A B C	Significance:

Additional Comments:			



Historical Resource Recordation Form

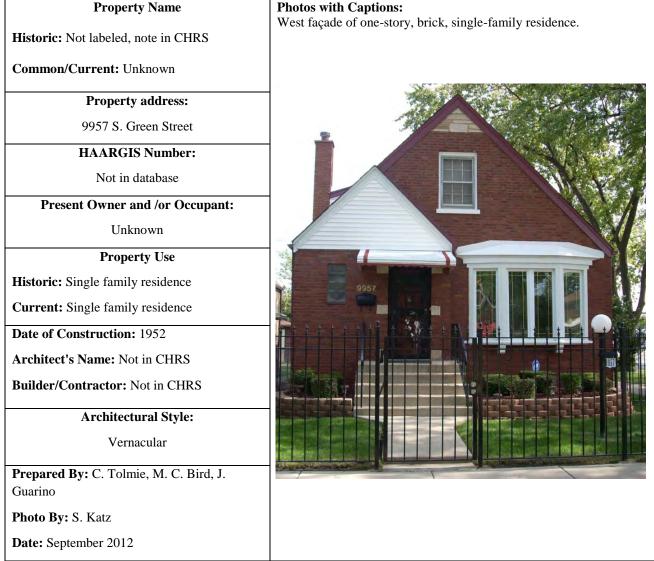

Property Description:

Stories: 1

This one-story brick-clad cottage at the northeast corner of Green and 100th streets in the Washington Heights community is situated on a raised basement and has a front gable roof covered with asphalt shingles. Its front elevation has a brick-clad gable entrance vestibule with a metal storm door topped by a metal awning and concrete steps with metal railings. Windows include a small glass block window by the door, a bow window with four casements on the first floor, and a single six-over-six window in the gable. Detailing includes decorative stones flanking the door and at the apex of the gable. The side (100th Street) elevation includes a flat-roof wall dormer with a small glass block window, a side door with a metal storm door, a concrete stoop with metal railings, and a metal awning. This house lacks distinctive architectural features and is not individually eligible for listing on the National Register.



Integrity:			Additional Notes/Descriptions
<u>Unaltered</u>	Slight modificatio	ns Major Alteration	
Condition:			
Excellent	Good	Poor	
Additional Alteration	ons		
Structu	re Usage	Exterior Wall Surface	
Current: NA		Brick, Synthetic siding (gable)	
Historic: NA			
Roof Material	Roof Features	Roof Type	
Asphalt shingle	Dormer	Gable	
Ornamental Archit	ectural Details		Windows
Stones at entrance and at gable			Casement, double-hung, glass block
Outbuildings (Num	ber and Description)		
Garage			

Local Landmark	Y <u>N</u>	
National Register Historic Places	Y <u>N</u>	
National Register Historic District	Y <u>N</u>	Name:
Individually Eligible? No	A B C	Significance:

Additional Comments:			



Historical Resource Recordation Form

Property Name	Photos with Captions:
Historic: Not labeled, not in CHRS	West façade of one-story, masonry, single family residence.
Common/Current: Unknown	
Property address:	
100051 S. Green Street	
HAARGIS Number:	
Not in database	
Present Owner and /or Occupant:	
Unknown	
Property Use	
Historic: Single family residence	
Current: Single family residence	
Date of Construction: 1928	
Architect's Name: Not in CHRS	
Builder/Contractor: Not in CHRS	
Architectural Style:	
Craftsman	
Prepared By: C. Tolmie, M. C. Bird, J.	
Guarino	
Photo By: S. Katz	
Date: September 2012	
Property Decemintion.	Stavian 1

Property Description:

Stories: 1

This single story Craftsman bungalow in the Washington Heights community is situated on a raised basement and is clad in faux stone, brick, stucco, and synthetic siding. The building has a side-gable roof with asphalt shingles, overhanging eaves with the brackets removed, and a front-gable dormer with a strip of non-original one-over-one aluminum-sash windows. The front elevation is clad with faux stone and stucco. The roof extends forward to shelter a full-width porch that has faux stone corner piers, low sidewalls, and concrete steps. The centrally located front door is flanked by a strip of three double-hung non-original windows on either side. The side elevations are clad in brown brick and have stucco-covered gables. The south elevation has an original hip-roof living room bay, behind which is a synthetic-clad, two-story addition. This house lacks integrity and distinctive architectural features and is not individually eligible for listing on the National Register.



Integrity:			Additional Notes/Descriptions
Unaltered	<u>Slight Modificati</u>	Major Alteration	Replacement windows, door, and cladding on the two-story bay extension
Condition:			
Excellent	Good	Poor	
Additional Alterati	ons		
Structu	re Usage	Exterior Wall Surface	
Current: NA		Stucco (upper façade), faux stone	
Historic: NA		(lower façade), brick (sides), synthetic siding (2-story bay)	
Roof Material	Roof Features	Roof Type	
Asphalt shingle	Dormer	Gable	
Ornamental Archit	ectural Details	Windows	
Brackets removed from under eaves of dormer.			Double-hung
Outbuildings (Num	ber and Description)		
None			

Local Landmark	Y <u>N</u>	
National Register Historic Places	Y <u>N</u>	
National Register Historic District	Y <u>N</u>	Name:
Individually Eligible? No	A B C	Significance:

Additional Comments:			



Historical Resource Recordation Form

Property Name	Photos with Captions:
Historic: Not labeled, not in CHRS	West facade of brick, one-story, single-family residence.
Common/Current: Unknown	
Property address:	
10157 S. Green Street	
HAARGIS Number:	
Not in database	
Present Owner and /or Occupant:	
Unknown	
Property Use	тинининин собо
Historic: Single family residence	
Current: Single family residence	
Date of Construction: 1957	
Architect's Name: Not in CHRS	
Builder/Contractor: Not in CHRS	
Architectural Style:	
Vernacular	
Prepared By: C. Tolmie, M. C. Bird, J.	
Guarino	
Photo By: S. Katz	
Date: September 2012	

Property Description:

Stories: 1

This one-story house at the northeast corner of Green and 102nd streets in the Washington Heights community is situated on a raised basement with glass block windows and is clad in yellow brick on its two street elevations. The building has a front gable clad in diagonally installed synthetic siding and framed by scalloped verge boards; asphalt shingles cover the roof. Its front elevation has a projecting living room bay with a bow window comprising four casements. It has a metal storm door with a stone surround, a small glass block window, and a partial-width porch with concrete steps, metal railings and open metal supports. It does not feature distinguishing architectural elements and is not individually eligible for listing on the National Register.



Integrity:			Additional Notes/Descriptions
integrity.			Additional Notes/Descriptions
Unaltered	Slight Modification	ons Major Alteration	Replacement windows
	<u> </u>		-
Condition:			
Excellent	Good	Poor	
Additional Alterati	ons		
Structu	ire Usage	Exterior Wall Surface	
Current: NA		Brick (main),	
Current. IVA		Synthetic cladding (gable end)	
Historic: NA		Synthetic clauding (gable chu)	
Roof Material	Roof Features	Roof Type	
Nooi material			
Asphalt shingle	None	Gable	
Ornamental Archit	tectural Details		Windows
~ .		_	~
Stone surround at entrance, scalloped verge boards			Casement, glass block
Outbuildings (Num	ber and Description)		
Garage			

Local Landmark	Y <u>N</u>	
National Register Historic Places	Y <u>N</u>	
National Register Historic District	Y <u>N</u>	Name:
Individually Eligible? No	A B C	Significance:

Additional comments			



Property Name Photos with Captions: West facade of one-story, brick, single-family residence. Historic: Not labeled, not in CHRS. Common/Current: Unknown **Property address:** 10201 S. Green Street **HAARGIS Number:** Not in database **Present Owner and /or Occupant:** Unknown **Property Use** Historic: Single family residence **Current:** Single family residence Date of Construction: 1926 Architect's Name: Not in CHRS Builder/Contractor: Not in CHRS **Architectural Style:** Chicago Style Bungalow Prepared By: C. Tolmie, M. C. Bird, J. Guarino Photo By: S .Katz Date: September 2012

Historical Resource Recordation Form

Property Description:

Stories: 1

This one-story brick-clad bungalow at the southeast corner of Green and 102nd streets in the Washington Heights community is situated on a raised basement with glass block windows. The building has a hip roof with asphalt shingles, overhanging eaves, and hip dormers with paired non-original single-pane sliding windows along its front and north elevations. The front elevation has a flat roof projecting living room bay surrounded by non-original double-hung windows, the central grouping of which is partially covered by a metal awning. It also has a decorative off-center metal storm door with a metal awning, concrete steps with low brick sidewalls, and metal railings. Detailing includes brick panels along the base of the living room bay, soldier brick lintels, and square concrete insert blocks used as decorative accents. This is an example of a Chicago Style Bungalow, a building type that the City of Chicago has recognized through its Historic Chicago Bungalow Initiative. However, this house lacks distinctive architectural features and is not individually eligible for listing on the National Register.



Integrity:			Additional Notes/Descriptions
integrity.			Additional Notes/Descriptions
Unaltered	Slight Modification	Major Alteration	Replacement windows
Chartered	<u></u>		*
Condition:			
Excellent	Good	Poor	
<u>Excellent</u>	0000	FOOI	
Additional Alterati	ons		
Structu	ire Usage	Exterior Wall Surface	
Current: NA		Brick	
Current. NA		Ditex	
Historic: NA			
Roof Material	Roof Features	Roof Type	
A sphalt shingle	Dormers	Hip	
Asphalt shingle	Donners	mp	
Ornamental Archit	tectural Details		Windows
Concrete sills and in	serts, brick panels and sold	lier course lintel	Double-hung, sliding, glass block
Coherete shis and hi	serts, ottek patiels and sold		Double hung, shung, glass block
Outbuildings (Num	ber and Description)		
Garage			

Local Landmark	Y <u>N</u>	
National Register Historic Places	Y <u>N</u>	
National Register Historic District	Y <u>N</u>	Name:
Individually Eligible? No	A B C	Significance:

Additional Comments:			



Property Name Photos with Captions: West façade of one-story, brick, single-family residence. Historic: Not labeled, not in CHRS Common/Current: Unknown **Property address:** 10237 S. Green Street **HAARGIS Number:** Not in database **Present Owner and /or Occupant:** Unknown **Property Use** Historic: Single family residence **Current:** Single family residence Date of Construction: 1926 Architect's Name: Not in CHRS Builder/Contractor: Not in CHRS **Architectural Style:** Chicago Style Bungalow Prepared By: C. Tolmie, M. C. Bird, J. Guarino Photo By: S. Katz Date: September 2012

Historical Resource Recordation Form

Property Description:

Stories: 1

This one-story brick-clad bungalow in the Washington Heights community is situated on a raised basement with glass block windows. The building has a hip roof with asphalt shingles, overhanging eaves, and hip dormers with infilled openings along its front and rear elevations. The three-sided front elevation is surrounded by non-original double-hung windows that are partially covered by metal awnings. The front door is located along the south elevation. Detailing includes brick panels along the base of the living room bay, a soldier brick course, and square concrete insert blocks used as decorative accents. This is an example of a Chicago Style Bungalow, a building type that the City of Chicago has recognized through its Historic Chicago Bungalow Initiative. However, this house lacks distinctive architectural features and is not individually eligible for listing on the National Register.



Structural Survey

Integrity:			Additional Notes/Descriptions
meginy.			Additional Notes/Descriptions
Unaltered	Slight Modification	ns Major Alteration	Replacement windows, dormer
			window in-filled
Condition:			
Excellent	Good	Poor	
Excenent	<u>000u</u>	1 001	
Additional Alteration	ons		
Structu	re Usage	Exterior Wall Surface	
Current: NA		Brick	
Historic: NA			
Roof Material	Roof Features	Roof Type	
Asphalt shingle	Dormers	Hip	
Ornamental Archit	ectural Details		Windows
Brick panels, soldier	brick course, concrete ins	sert blocks	Double-hung, glass block
-			0.0
Outbuildings (Num	ber and Description)		
None			

Local Landmark	Y <u>N</u>	
National Register Historic Places	Y <u>N</u>	
National Register Historic District	Y <u>N</u>	Name:
Individually Eligible? No	A B C	Significance:

Additional Comments:



Historical Resource Recordation Form

Property Name	Photos with Captions:
Historic: Bldg. not labeled, not in CHRS	West façade of a 1.5-story, single family, frame residence.
Common/Current: Unknown	
Property Address:	
10345 S. Green Street	
Alternate: 10345 S. Alpine Drive	
HAARGIS Number:	
Not in database	
Present Owner and /or Occupant:	
Unknown	
Property Use	
Historic: Single family residence	
Current: Single family residence	
Date of Construction: 1919	
Architect's Name: Not in CHRS	
Builder/Contractor: Not in CHRS	
Architectural Style:	
Vernacular	
Prepared By: J. Martinez, M. C. Bird, J.	
Guarino	and a second and a s
Photo By: S. Katz	
Date: 24 October 2012	

Property Description:

Stories: 1.5

This one-and-a-half-story frame house in the Washington Heights community is situated on a raised brick basement and is covered with synthetic siding. The building has a hip-on-gable roof with a dormer. The front elevation has a full-width, flat-roofed porch, half of which is enclosed as a sunroom with a door tucked into its side. The open half of the porch has a metal corner support, metal railings and a clay tile deck with two steps. Fenestration on the front elevation includes a pair of non-original one-over-one aluminum-sash windows and a non-original picture window flanked by one-over-one aluminum-sash windows. A low, light brown colored brick planter stretches across the width of the sun porch. This house lacks integrity and distinctive architectural features and is not individually eligible for listing on the National Register.



Structural Survey

Integrity:			Additional Notes/Descriptions
Unaltered	Slight Modificati	ion Major Alteration	Replacement windows and porch rails
Condition:			
Excellent	Good	Poor	
Additional Alteration	ons		
Porch partially enclo	osed after 1938 (Sanborr	-	
Structure Usage Exterior Wall Surf			
Current: NA		Synthetic siding	
Historic: NA			
Roof Material	Roof Features	Roof Type	
Asphalt shingle	Dormer	Hip on gable	
Ornamental Archit	ectural Details	Windows	
Brick planter			Double-hung, fixed-pane
Outbuildings (Num	ber and Description)		
None			

Local Landmark	Y <u>N</u>	
National Register Historic Places	Y <u>N</u>	
National Register Historic District	Y <u>N</u>	Name:
Individually Eligible? No	A B C	Significance:

Additional Comments:



Historical Resource Recordation Form

Property Name	Photos with Captions: West façade of a one-story, single family, brick residence.
Historic: Bldg. not labeled, not in CHRS	west façade of a one-story, single family, onek fesidence.
Common/Current: Unknown	L S
Property Address:	
10401 S. Green Street	
HAARGIS Number:	ANY ANY
Not in database	
Present Owner and /or Occupant:	
Unknown	
Property Use	
Historic: Single family residence	
Current: Single family residence	
Date of Construction: 1949	
Architect's Name: Not in CHRS	
Builder/Contractor: Not in CHRS	
Architectural Style:	
Minimal Traditional	
Prepared By: J. Martinez, M. C. Bird, J.	and the second
Guarino	
Photo By: S. Katz	
Date: 23 October 2012	
Property Description:	Storios: 1

Property Description:

Stories: 1

This one-story brick-clad house at the southeast corner of Green and 104th streets in the Washington Heights community is situated on a raised basement with glass block windows. The building has a steeply pitched front gable roof with asphalt shingles and a shed dormer along its south elevation. Its front elevation has a slightly projecting off-center entrance vestibule topped by a pediment. The vestibule has a metal storm door, concrete steps and railings, and bracketed metal awning. The first floor has a three-sided window bay with a central picture window flanked by non-original one-over-one aluminum-sash windows and a smooth stone base. A pair of non-original one-over-one aluminum-sash windows is situated in the gable. Detailing includes decorative brickwork at the corners and concrete sills. This house lacks distinctive architectural features and is not individually eligible for listing on the National Register.



Integrity:			Additional Notes/Descriptions
Unaltered	Slight Modificatio	n Major Alteration	Replacement door and windows
Condition:			
<u>Excellent</u>	Good	Poor	
Additional Alterati	ons		
Shed dormer may be	e a later addition		
Structu	ire Usage	Exterior Wall Surface	
Current: NA		Brick	
Historic: NA			
Roof Material	Roof Features	Roof Type	
Asphalt	Dormer	Gable	
Ornamental Archit	tectural Details		Windows
Entrance with pediment and bracketed awning, concrete sills, stone base under bay, decorative brickwork			Double-hung, fixed-pane, glass block
Outbuildings (Num	ber and Description)		
None			

Local Landmark	Y <u>N</u>	
National Register Historic Places	Y <u>N</u>	
National Register Historic District	Y <u>N</u>	Name:
Individually Eligible? No	A B C	Significance:

Additional Comments:			



Historical Resource Recordation Form

Property Name	Photos with Captions: West façade of a one-story, single family, brick residence.
Historic: Bldg. not labeled, not in CHRS	
Common/Current: Unknown	
Property Address:	
10457 S. Green Street	
HAARGIS Number:	
Not in database	
Present Owner and /or Occupant:	
Unknown	
Property Use	
Historic: Single family residence	
Current: Single family residence	
Date of Construction: 1956	
Architect's Name: Not in CHRS	
Builder/Contractor: Not in CHRS	
Architectural Style:	
Vernacular	
Prepared By: J. Martinez, M. C. Bird, J.	
Guarino	-
Photo By: S. Katz	
Date: 23 October 2012	

Property Description:

Stories: 1

This one-story brick-clad house at the northeast corner of Green and 105th streets in the Washington Heights community is situated on a raised basement. The building has a front gable roof covered with asphalt shingles. The north half of the front elevation is recessed and has a metal storm door, concrete steps with metal railings, and a small glass block window. The living room bay has a non-original picture window flanked by one-over-one aluminum-sash windows that are partially obscured by a metal awning. Detailing includes concrete sills below both windows and stone inserts at the basement corner. The front elevation's gable is clad with synthetic siding. This standard home does not display distinguishing architectural features and is not individually eligible for listing on the National Register.




Integrity:			Additional Notes/Descriptions
Unaltered	Slight Modification Major Alteration		Replacement windows and cladding
Condition:			
<u>Excellent</u>	Good	Poor	
Additional Alteration	ons		
Structu	re Usage	Exterior Wall Surface	
Current: NA		Brick, synthetic (gable end)	
Historic: NA			
Roof Material	Roof Features	Roof Type	
Asphalt shingle	None	Gable	
Ornamental Archit	ectural Details		Windows
concrete sills, stone	inserts at corner		Double-hung, fixed-pane, glass block
Outbuildings (Num	ber and Description)		
None			

Local Landmark	Y <u>N</u>	
National Register Historic Places	Y <u>N</u>	
National Register Historic District	Y <u>N</u>	Name:
Individually Eligible? No	A B C	Significance:

Additional Comments:			



Historical Resource Recordation Form

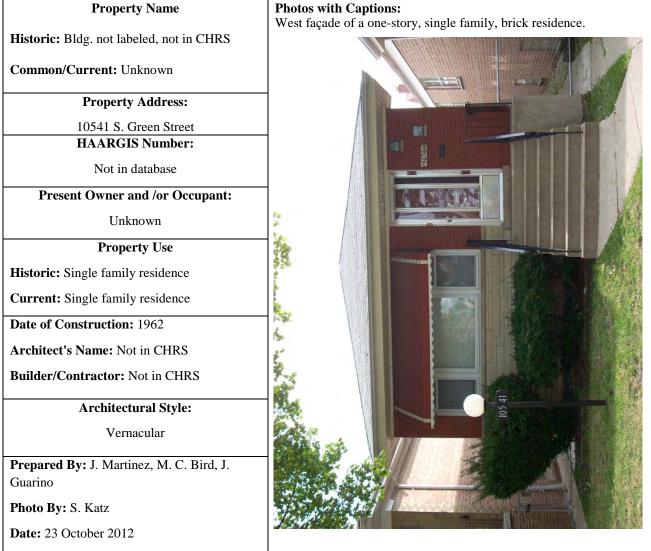

Property Description:

Stories: 1

This one-story brick-clad house in the Washington Heights community sits on a raised basement with glass block window. The building has a hip roof covered with asphalt shingles and overhanging eaves. The front elevation is clad in orange face brick and in faux stone below the sill line. It has an off-center metal storm door, concrete steps with metal railings, and a picture window flanked by one-over-one aluminum-sash windows that are partially obscured by a metal awning. Detailing includes two decorative glass blocks adjacent to the front door. It does not display distinguishing architectural features and is not individually eligible for listing on the National Register.



Integrity:			Additional Notes/Descriptions
<u>Unaltered</u>	Slight Modification	Major Alteration	Aluminum sashes may be original
Condition:			
Excellent	Good	Poor	
Additional Alteration	ons		
Structu	re Usage	Exterior Wall Surface	
Current: NA		Brick,	
Historic: NA		Faux stone (below sill)	
Roof Material	Roof Features	Roof Type	
Asphalt shingle	None	Hip	
Ornamental Archit	ectural Details		Windows
Decorative glass bloc	cks		Double-hung, fixed-pane, glass block
Outbuildings (Num	ber and Description)		
None			

Local Landmark	Y <u>N</u>	
National Register Historic Places	Y <u>N</u>	
National Register Historic District	Y <u>N</u>	Name:
Individually Eligible? No	A B C	Significance:

Additional Comments:			



Historical Resource Recordation Form

Property Name	Photos with Captions: West façade of a one-story, single family, brick residence.
Historic: Bldg. not labeled, not in CHRS	west façade of a one-story, single failing, offek festdence.
Common/Current: Unknown	
Property Address:	
10601 S. Green Street	
HAARGIS Number:	
Not in database	
Present Owner and /or Occupant:	
Unknown	
Property Use	
Historic: Single family residence	
Current: Single family residence	
Date of Construction: 1954	
Architect's Name: Not in CHRS	
Builder/Contractor: Not in CHRS	
Architectural Style:	
Vernacular	
Prepared By: J. Martinez, M. C. Bird, J.	
Guarino	The second s
Photo By: S. Katz	
Date: 23 October 2012	
Den en ter Den en in til en e	Stard and 1

Property Description:

Stories: 1

This one-story house in the Washington Heights community is situated on a raised basement with glass block windows and is clad with tan-brown brick. The building has a front gable roof covered with asphalt shingles. The front elevation has a projecting living room bay with a non-original picture window flanked by one-over-one aluminum-sash windows that are partially obscured by a low, metal awning. The residence includes an off-center metal storm door flanked by fluted concrete molding, concrete steps with metal railings, and a single four-over-four corner window. A pent roof spans the living room bay and front door. It does not display distinguishing architectural features and is not individually eligible for listing on the National Register.



Integrity:			Additional Notes/Descriptions
<u>Unaltered</u>	Slight Modification	Major Alteration	
Condition:			
Excellent	Good	Poor	
Additional Alteration	ons		
Structu	re Usage	Exterior Wall Surface	
Current: NA		Brick	
Historic: NA			
Roof Material	Roof Features	Roof Type	
Asphalt shingle	None	Gable	
Ornamental Architectural Details			Windows
Fluted concrete molding around door			Double-hung, fixed-pane, glass block
Outbuildings (Number and Description)			
None			

Local Landmark	Y <u>N</u>	
National Register Historic Places	Y <u>N</u>	
National Register Historic District	Y <u>N</u>	Name:
Individually Eligible? No	A B C	Significance:

Additional Comments:			



Historical Resource Recordation Form

Property Name	Photos with Captions: West façade of a one-story, single family, brick residence.
Historic: Bldg. not labeled, not in CHRS	west fuque of a one sory, single failing, brek residence.
Common/Current: Unknown	
Property Address:	
10701 S. Green Street	
HAARGIS Number:	
Not in database	
Present Owner and /or Occupant:	
Unknown	
Property Use	
Historic: Single family residence	
Current: Single family residence	
Date of Construction: 1950	
Architect's Name: Not in CHRS	
Builder/Contractor: Not in CHRS	
Architectural Style:	
Vernacular	
Prepared By: J. Martinez, M. C. Bird, J.	
Guarino	
Photo By: S. Katz	
Date: 23 October 2012	

Property Description:

Stories: 1

This one-story brick-clad cottage in the Morgan Park community is situated on a raised basement with glass block windows and has a steeply pitched side-gable roof. Its front elevation has a slightly projecting brickclad gabled entrance vestibule with a metal storm door and a small adjacent glass block window. The porch has concrete steps, metal railings, open metal supports and metal awning roof. This elevation has a picture window flanked by double-hung windows that are partially obscured by a low, metal awning. Detailing includes decorative stone flanking the door and used as accents on the entrance vestibule. It does not display distinguishing architectural features and is not individually eligible for listing on the National Register.



Integrity:			Additional Notes/Descriptions
<u>Unaltered</u>	Slight Modification	Major Alteration	
Condition:			
Excellent	Good	Poor	
Additional Alteration	ons		
Structu	re Usage	Exterior Wall Surface	
Current: NA		Brick	
Historic: NA			
Roof Material	Roof Features	Roof Type	
Asphalt shingle	None	Gable	
Ornamental Archit	ectural Details		Windows
Stone at entrance and	d as accents	Double-hung, fixed-pane, glass block	
Outbuildings (Num	ber and Description)		•
None			

Local Landmark	Y <u>N</u>	
National Register Historic Places	Y <u>N</u>	
National Register Historic District	Y <u>N</u>	Name:
Individually Eligible? No	A B C	Significance:

Additional Comments:			



Historical Resource Recordation Form

Property Name	Photos with Captions: West façade of a one-story, single family, brick residence.
Historic: Bldg. not labeled, not in CHRS	west façade of a one-story, single family, offek festdence.
Common/Current: Unknown	
Property Address:	
10757 S. Green Street	
HAARGIS Number:	
Not in database	
Present Owner and /or Occupant:	
Unknown	
Property Use	
Historic: Single family residence	
Current: Single family residence	
Date of Construction: 1947	
Architect's Name: Not in CHRS	
Builder/Contractor: Not in CHRS	
Architectural Style:	
Vernacular	
Prepared By: J. Martinez, M. C. Bird, J.	
Guarino	
Photo By: S. Katz	
Date: 23 October 2012	
Property Description:	Stories: 1

This one-story brick-clad cottage in the Morgan Park community has a cross-gable roof covered with asphalt shingles. The front elevation has metal storm door with sunburst motif and bracketed metal awning, concrete steps with metal railings, a picture window flanked by one-over-one windows, and a single one-over-one window. An additional one-over-one window is situated in the gable. All windows are non-original and have metal awnings. It does not feature distinguishing architectural elements and is not individually eligible for listing on the National Register.




Integrity:			Additional Notes/Descriptions
Unaltered	Slight Modification	Major Alteration	Replacement windows
		3	
Condition:			
Excellent	Good	Poor	
Additional Alteration	ons		
Structu	re Usage	Exterior Wall Surface	
Current: NA		Brick	
Historic: NA			
Roof Material	Roof Features	Roof Type	
Asphalt shingle	None	Cross-gable	
Ornamental Archit	ectural Details		Windows
None			Double-hung, fixed-pane
Outbuildings (Num	ber and Description)		
None			

Local Landmark	Y <u>N</u>	
National Register Historic Places Y		
National Register Historic District	Y <u>N</u>	Name:
Individually Eligible? No	A B C	Significance:

Additional Comments:			



Historical Resource Recordation Form

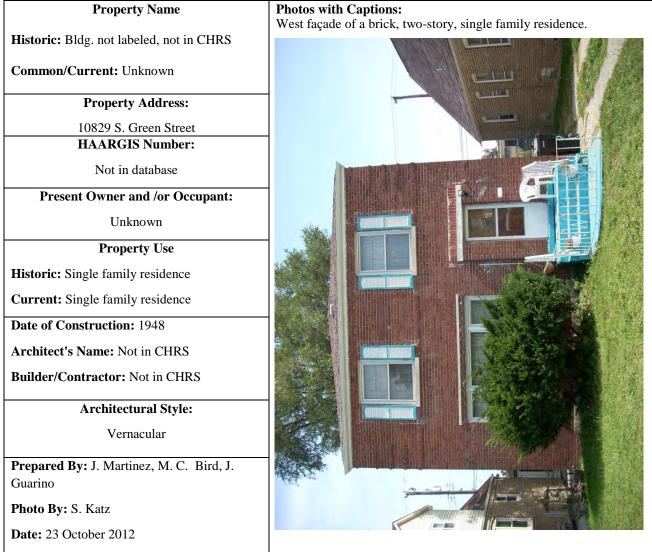

Property Description:

Stories: 2

This two-story house is situated on a raised basement in the Morgan Park community and is clad with faced brick on its front elevation and common brick on its side and rear elevations. The building has a hip roof covered with asphalt shingles. Its front elevation has a slightly projecting off-center entrance with a metal storm door, concrete steps, and metal railings. Windows on the front elevation are non-original and include a picture window flanked by one-over-one aluminum-sash windows on the first floor and two one-over-one aluminum-sash windows on the second floor. Detailing includes brick stringcourses with soldier course lintels and concrete sills. It does not display distinguishing architectural features and is not individually eligible for listing on the National Register.




Integrity:			Additional Notes/Descriptions
Unaltered	Slight Modificati	on Major Alteration	Replacement windows
Condition:			
Excellent	Good	Poor	
Additional Alterati	ons		
Tack strips, that onc	e secured awnings, rema	in above the windows.	
Structu	ire Usage	Exterior Wall Surface	
Current: NA		Brick	
Historic: NA			
Roof Material	Roof Features	Roof Type	
Asphalt shingle	None	Hip	
Ornamental Archit	tectural Details		Windows
Brick stringcourses,	soldier course lintels, co	Double-hung, fixed-pane	
Outbuildings (Num	ber and Description)		
None			

Local Landmark	Y	N	
National Register Historic Places	V	N	
	•		
National Register Historic District	v	Ν	Name:
National Register Historic District	T	1	i vanic.
			C! !@
			Significance:
Individually Eligible? No	Α	B C	

Additional Comments:		



Historical Resource Recordation Form

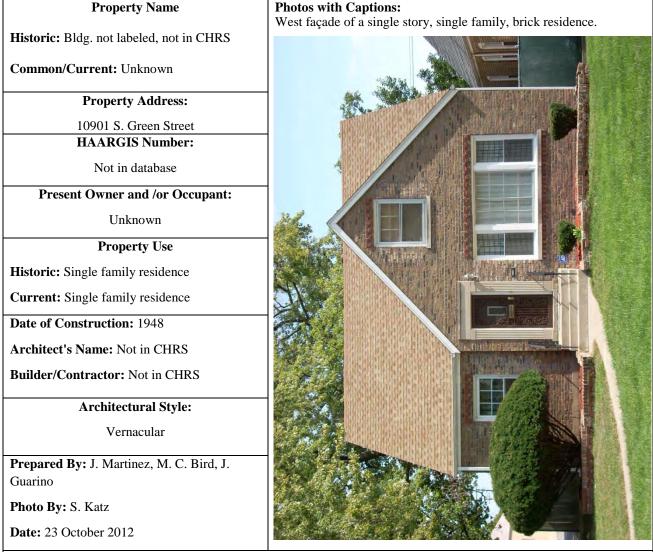

Property Description:

Stories: 1

This one-story brick-clad cottage in the Morgan Park community is situated on a raised basement and has a cross-gable roof covered with asphalt shingles. The front elevation has a metal storm door with a concrete surround consisting of fluted pilasters and a smooth lintel, concrete steps with metal railings, a sixteen-light window flanked by one-over-one aluminum-sash windows, and two six-over-one aluminum-sash windows: one on the first floor and one in the gable. Windows are modern replacements. Detailing includes decorative brickwork above the windows, concrete sills, and faux stone at the water table. It does not feature distinguishing architectural characteristics and is not individually eligible for listing on the National Register.



Integrity:			Additional Notes/Descriptions
Unaltered	Slight Modification	Major Alteration	Replacement windows
Condition:			
Excellent	Good	Poor	
Additional Alteration	ons		
Structu	re Usage	Exterior Wall Surface	
Current: NA		Brick	
Historic: NA			
Roof Material	Roof Features	Roof Type	
Asphalt shingle	None	Cross-gable	
Ornamental Archit	ectural Details		Windows
Stone lintel at entran	ce, fluted pilasters, decora	Double-hung, fixed-pane	
concrete sills, faux s	-		
Outbuildings (Num	ber and Description)		
None			

Local Landmark	Y <u>N</u>	
National Register Historic Places Y N		
National Register Historic District	Y <u>N</u>	Name:
Individually Eligible? No	A B C	Significance:

Additional Comments:			



Historical Resource Recordation Form

Property Name	Photos with Captions: West façade of a one-story single family, brick residence.
Historic: Bldg. not labeled, not in CHRS	west façade of a one-story single failing, offek festdence.
Common/Current: Unknown	
Property Address:	
11001 S. Green Street	
HAARGIS Number:	
Not in database	
Present Owner and /or Occupant:	
Unknown	
Property Use	
Historic: Single family residence	
Current: Single family residence	a commission where the second se
Date of Construction: 1942	
Architect's Name: Not in CHRS	
Builder/Contractor: Not in CHRS	
Architectural Style:	
Neo-Tudor	
Prepared By: J. Martinez, M. C. Bird, J.	
Guarino	
Photo By: S. Katz	
Date: 23 October 2012	

Property Description:

Stories: 1

This one-story, brick clad house in the Morgan Park community is situated on a raised basement with glass block windows. The building has a hip-on-gable roof with a gable garage facing the street. The house's front entrance is located within a vestibule that is topped by a shed-roof, is brick-clad, and is located in the ell created by the main section of the house and the gable garage. It has a hollow core metal door, concrete steps, and metal railings. The front elevation has a non-original aluminum-clad first floor bay window and two additional pairs of non-original aluminum-sash windows: one on the first floor and one in the gable. The north elevation has an overhead garage door and a one-over-one aluminum-sash window. Detailing includes decorative stonework at the corners of the house, vertical half-timbering in the north gable (much of which has been removed), and concrete sills. This house does not feature sufficient distinguishing architectural features to qualify as individually eligible for listing on the National Register.



Midwest Archaeological Research Services, Inc. 505 North State Street Marengo, Illinois 60152 Phone (815) 568- 0680

Integrity:			Additional Notes/Descriptions
Unaltered	Slight Modification	n Major Alteration	Replacement windows
Condition:			
Excellent	Good	Poor	
Additional Alterati	ions		
Ghost lines on the g have been removed.		v shutters and other trim may	
Structu	ıre Usage	Exterior Wall Surface	
Current: NA		Brick	
Historic: NA			
Roof Material	Roof Features	Roof Type	
Asphalt shingle	None	Gable	
Ornamental Architectural Details			Windows
Decorative brickwork, stonework, half-timbering, concrete sills		Double-hung	
Outbuildings (Num	iber and Description)		
None			

Local Landmark	Y <u>N</u>	
National Register Historic Places	Y <u>N</u>	
National Register Historic District	Y <u>N</u>	Name:
Individually Eligible? No	A B C	Significance:

Additional Comments:		



Historical Resource Recordation Form

Property Name	Photos with Captions:
	West and south façades of two-story, brick and frame, single-family
Historic: Not labeled, not in CHRS	residence.
Common/Current: Unknown	
Property Address:	
11039 S. Green Street	
HAARGIS Number:	
Not in database	
Present Owner and /or Occupant:	
Unknown	
Property Use	
Historic: Single family residence	
Current: Single family residence	
Date of Construction: 1942	
Architect's Name: Not in CHRS	
Builder/Contractor: Not in CHRS	
Architectural Style:	
Vernacular	
Prepared By: C. Tolmie, M. C. Bird, J.	
Guarino	
Photo By: S. Katz	
Date: 13 September 2012	

Property Description:

Stories: 2

This two-story house in the Morgan Park community has a brick-clad first floor, a synthetic-clad second floor, and a gable roof covered with asphalt shingles. The front elevation has a hip-roofed enclosed front porch with a side entrance door, concrete steps, and metal railing. There are three one-over-one aluminum-sash windows and one glass block window on the first floor front façade and a single one-over-one on the second. Detailing includes a stone sill course and buff brick stringcourses. The second floor on this house is a later addition. This home does not feature sufficient integrity or distinguishing features to qualify as eligible for individual listing on the National Register.



Integrity:			Additional Notes/Descriptions
Unaltered_	Slight Modification	Major Alteration	Replacement windows, roof raised
Condition:			
Excellent	Good	Poor	
Additional Alterati	ons		
Structu	ire Usage	Exterior Wall Surface	
Current: NA		Brick (lower),	
Historic: NA		Synthetic siding (upper)	
Roof Material	Roof Features	Roof Type	
Asphalt shingle	None	Gable	
Ornamental Archit	tectural Details		Windows
Stone sill course, brick stringcourses			Double hung
Outbuildings (Number and Description)			
Garage			

Local Landmark	Y <u>N</u>	
National Register Historic Places	Y <u>N</u>	
National Register Historic District	Y <u>N</u>	Name:
Individually Eligible? No	A B C	Significance:

Additional Comments:			



Historical Resource Recordation Form

Property Name	Photos with Captions: West façade of a two-story, brick, multi-family residence.
Historic: Bldg. not labeled, not in CHRS	West higher of a two story, offek, makin failing residence.
Common/Current: Unknown	
Property Address:	
11121 S. Green Street	
HAARGIS Number:	
Not in database	
Present Owner and /or Occupant:	
Unknown	
Property Use	
Historic: Multi-family residence	
Current: Multi-family residence	
Date of Construction: 1959	
Architect's Name: Not in CHRS	
Builder/Contractor: Not in CHRS	
Architectural Style:	
Vernacular	
Prepared By: J. Martinez, M. C. Bird, J.	
Guarino	
Photo By: S. Katz	
Date: 23 October 2012	

Property Description:

Stories: 2

This two-story residential building in the Morgan Park community is situated on a raised basement with glass block windows and is clad with buff brick along the front elevation and with common brick along the side and rear elevations. The building has a flat roof and parapet. The north half of the front elevation has a full-height rectangular pavilion, both floors of which feature a window group comprised of a picture window flanked by one-over-one aluminum-sash windows with metal awnings. The south half of the front elevation has an off-center hollow core metal door, a flat-roofed canopy with two open metal supports, and a concrete stoop. Detailing includes decorative glass blocks adjacent to the door and three horizontal strips of glass blocks on the second floor, above the entrance. This building lacks distinguishing architectural features and is not individually eligible for listing on the National Register.



Integrity:			Additional Notes/Descriptions
Unaltered	Slight Modificati	on Major Alteration	Replacement door; windows may be original
Condition:			
Excellent	Good	Poor	
Additional Alterati	ons		
Structu	ire Usage	Exterior Wall Surface	
Current: NA		Brick	
Historic: NA			
Roof Material	Roof Features	Roof Type	
Unknown	Parapet	Flat	
Ornamental Archit	ectural Details		Windows
Decorative glass blo	cks		Double-hung, fixed-pane, glass block
Outbuildings (Num	ber and Description)		
None			

Local Landmark	Y	<u>N</u>	
National Register Historic Places	Y	<u>N</u>	
National Register Historic District	Y	<u>N</u>	Name:
Individually Eligible? No	A	BC	Significance:

Additional Comments:			



Historical Resource Recordation Form

Property Name	Photos with Captions:
Historic: Bldg. not labeled, not in CHRS	West façade of a one-story, single family, brick residence.
Common/Current: Unknown	
Property Address:	A.
11247 S. Green Street	And the second
HAARGIS Number:	
Not in database	
Present Owner and /or Occupant:	
Unknown	
Property Use	
Historic: Single family residence	
Current: Single family residence	
Date of Construction: 1950	
Architect's Name: Not in CHRS	
Builder/Contractor: Not in CHRS	
Architectural Style:	
Vernacular	
Prepared By: J. Martinez, M. C. Bird, J.	
Guarino	
Photo By: S. Katz	
Date: 24 October 2012	

Property Description:

Stories: 1

This one-story brick-clad cottage in the Morgan Park community has a side gable roof covered with asphalt shingles and a rear gabled wing. The residence is on a raised basement. The front elevation has a slightly projecting gabled brick-clad vestibule with a metal storm door surrounded by stone quoins, a metal awning, a small adjacent glass block window, and concrete steps with metal railings. The living room bay has a picture window flanked by one-over-one aluminum sash windows that are partially obscured by a metal awning. Detailing included decorative brick above and below the windows. This house lacks distinguishing architectural features and is not individually eligible for listing on the National Register.



Structural Survey

Integrity:			Additional Notes/Descriptions	
<u>Unaltered</u>	Slight Modification	n Major Alteration		
	-	-		
Condition:				
<u>Excellent</u>	Good	Poor		
Additional Alteration	ons			
Structu	re Usage	Exterior Wall Surface		
Current: NA		Brick		
Historic: NA				
Roof Material	Roof Features	Roof Type		
Asphalt shingle	None	Gable		
Ornamental Archit	ectural Details		Windows	
Stone surrounding the entrance, decorative brick around windows			Double-hung, fixed-pane, glass block	
Outbuildings (Num	Outbuildings (Number and Description)			
None				

Local Landmark	Y <u>N</u>	
National Register Historic Places	Y <u>N</u>	
National Register Historic District	Y <u>N</u>	Name:
Individually Eligible? No	A B C	Significance:



Historical Resource Recordation Form

Property Name	Photos with Captions:
	West façade of a brick, one-story, single family residence.
Historic: Bldg. not labeled, not in CHRS	
Common/Current: Unknown	
Property Address:	
11359 S. Green Street	
HAARGIS Number:	
Not in database	
Present Owner and /or Occupant:	
Unknown	
Property Use	
Historic: Single family residence	
Current: Single family residence	
Date of Construction: 1951	
Architect's Name: Not in CHRS	
Builder/Contractor: Not in CHRS	
Architectural Style:	
Vernacular	
Prepared By: J. Martinez, M. C. Bird, J.	
Guarino	
Photo By: S. Katz	
Date: 24 October 2012	

Property Description:

Stories: 1

This one-story brick-clad house in the Morgan Park community has a front gable roof covered with asphalt shingles. Its front elevation features an off-center metal storm door with a concrete surround and a porch with concrete steps, metal railings, two open metal supports, and a metal awning roof. It has a small glass block window and a picture window flanked by non-original one-over-one aluminum-sash windows. A small bulls-eye window is situated in the attic gable. Detailing includes contrasting brick around the bulls-eye window and both above and below the other window group. It does not display distinguishing architectural features and is not individually eligible for listing on the National Register.



Integrity:			Additional Notes/Descriptions	
Unaltered	Slight Modification	on Major Alteration	Replacement windows	
Condition:				
<u>Excellent</u>	Good	Poor		
Additional Alterati	ons			
Structu	ire Usage	Exterior Wall Surface		
Current: NA		Brick		
Historic: NA				
Roof Material	Roof Features	Roof Type		
Asphalt shingle	None	Gable		
Ornamental Archit	tectural Details		Windows	
Contrasting brick are	ound the windows, bulls-	eve window	Double-hung, fixed-pane, glass	
block				
Outbuildings (Num	Outbuildings (Number and Description)			
None				
INOILE				

Local Landmark	Y <u>N</u>	
National Register Historic Places	Y <u>N</u>	
National Register Historic District	Y <u>N</u>	Name:
Individually Eligible? No	A B C	Significance:

Additional Comments:			



Historical Resource Recordation Form

Property Name	Photos with Captions: West façade of a two-story, two-flat, frame residence.
Historic: Bldg. not labeled, not in CHRS	
Common/Current: Unknown	
Property Address:	
12143 S. Green Street	
HAARGIS Number:	
Not in database	
Present Owner and /or Occupant:	
Unknown	
Property Use	
Historic: Flat	
Current: Flat	
Date of Construction: 1909	
Architect's Name: Not in CHRS	
Builder/Contractor: Not in CHRS	
Architectural Style:	
Vernacular	Contraction of the second
Prepared By: J. Martinez, M. C. Bird, J.	
Guarino	
Photo By: S. Katz	
Date: 26 October 2012	

Property Description:

Stories: 2

This two-flat residential building in the West Pullman community sits on a raised concrete block basement with glass block windows and is covered with synthetic siding. The building has a flat roof with parapet. The front elevation has a partial-width, flat-roofed, wood porch with an off-center door, straight railings and posts, and a full-height three-sided window bay pavilion with six non-original one-over-one aluminum-sash windows: three on the first floor and three on the second floor. The second floor also has a single non-original one-over-one aluminum-sash window above the porch. This building lacks integrity and distinctive architectural features and is not individually eligible for listing on the National Register.



Integrity:			Additional Notes/Descriptions	
Unaltered	Slight Modification	n Major Alteration	Replacement door, windows, and cladding	
Condition:				
<u>Excellent</u>	Good	Poor		
Additional Alterati	ons			
Structu	ire Usage	Exterior Wall Surface		
Current: NA		Synthetic siding		
Historic: NA				
Roof Material	Roof Features	Roof Type		
Unknown	Parapet	Flat		
Ornamental Archit	tectural Details		Windows	
None			Double-hung, glass block	
Outbuildings (Num	Outbuildings (Number and Description)			
None				

Local Landmark	Y <u>N</u>	
National Register Historic Places	Y <u>N</u>	
National Register Historic District	Y <u>N</u>	Name:
Individually Eligible? No	A B C	Significance:

Additional Comments:	



Historical Resource Recordation Form

Property Name	Photos with Captions: West façade of a 1.5-story, single family, frame residence.
Historic: Bldg. not labeled, not in CHRS	west laçade of a 1.5-story, single family, frame residence.
Common/Current: Unknown	
Property Address:	
12257 S. Green Street	
HAARGIS Number:	
Not in database	
Present Owner and /or Occupant:	
Unknown	
Property Use	
Historic: Single family residence	
Current: Single family residence	
Date of Construction: 1911	
Architect's Name: Not in CHRS	
Builder/Contractor: Not in CHRS	
Architectural Style:	
Vernacular	
Prepared By: J. Martinez, M. C. Bird, J.	- Contraction of the second se
Guarino	
Photo By: S. Katz	
Date: 26 October 2012	

Property Description:

Stories: 1.5

This one-and-a-half-story frame cottage in the West Pullman community is situated on a raised concrete block basement with glass block windows and is covered with synthetic siding. The building has a front gable roof covered with asphalt shingles. The front elevation has a non-original, full-width, gable-roofed, enclosed porch covered with synthetic siding. The porch has an off-center hollow core metal door, concrete steps with metal railings, and a strip of three non-original one-over-one aluminum-sash windows. A pair of double-hung windows is situated in the gable. This house lacks integrity and distinctive architectural features and is not individually eligible for listing on the National Register.



Structural Survey

Integrity:			Additional Notes/Descriptions
Unaltered	Slight Modification	Major Alteration	Replacement door, windows, and cladding
Condition:			
Excellent	Good	Poor	
Additional Alteration	ons		
Porch enclosed			
Structu	re Usage	Exterior Wall Surface	
Current: NA		Synthetic siding	
Historic: NA			
Roof Material	Roof Features	Roof Type	
Asphalt shingle	None	Gable	
Ornamental Archit	ectural Details		Windows
None			Double-hung, glass block
Outbuildings (Num	ber and Description)		
None			

Local Landmark	Y <u>N</u>	
National Register Historic Places	Y <u>N</u>	
National Register Historic District	Y <u>N</u>	Name:
Individually Eligible? No	A B C	Significance:

Additional Comments:



Historical Resource Recordation Form

Property Name	Photos with Captions:West façade of a one-story, single family, frame residence.
Historic: Bldg. not labeled, not in CHRS	west façade of a one-story, single family, frame fesidence.
Common/Current: Unknown	
Property Address:	
12317 S. Green Street	
HAARGIS Number:	
Not in database	
Present Owner and /or Occupant:	
Unknown	
Property Use	
Historic: Single family residence	
Current: Single family residence	
Date of Construction: 1907	
Architect's Name: Not in CHRS	A A A A A A A A A A A A A A A A A A A
Builder/Contractor: Not in CHRS	
Architectural Style:	
Vernacular	
Prepared By: J. Martinez, M. C. Bird, J.	and the second s
Guarino	
Photo By: S. Katz	
Date: 26 October 2012	
Property Description:	Stories: 1

This one-story frame cottage in Calumet Park is situated on a raised concrete block basement with glass block windows and is covered with synthetic siding. The building has a front gable roof with asphalt shingles. The front elevation has a full-width, hip-roof wood porch with metal railings and open metal supports, an off-center metal storm door, a picture window flanked by one-over-one aluminum-sash windows, and a single one-over-one aluminum-sash window in the gable. Windows are modern replacements. This house lacks integrity and distinctive architectural features; therefore, it is not individually eligible for listing on the National Register.



Integrity:			Additional Notes/Descriptions
Unaltered	Slight Modification	Major Alteration	Replacement door, windows, cladding, and porch rails
Condition:			
<u>Excellent</u>	Good	Poor	
Additional Alteration	ons		
Structu	re Usage	Exterior Wall Surface	
Current: NA		Synthetic siding	
Historic: NA			
Roof Material	Roof Features	Roof Type	
Asphalt shingles	None	Gable	
Ornamental Archit	ectural Details		Windows
None			Double-hung, fixed-pane, glass block
Outbuildings (Num	ber and Description)		
None			

Local Landmark	Y	<u>N</u>	
National Register Historic Places	Y	<u>N</u>	
National Register Historic District	Y	<u>N</u>	Name:
Individually Eligible? No	A	BC	Significance:

Additional Comments:			



Historical Resource Recordation Form

Property Name	Photos with Captions:
	West and south façades of a one-story, single family residence
Historic: Bldg. not labeled, not in CHRS	
Common/Current: Unknown	
Property Address:	
12359 S. Green Street	
HAARGIS Number:	
Not in database	
Present Owner and /or Occupant:	
Unknown	
Property Use	
Historic: Single family residence	
Current: Single family residence	
Date of Construction: 1949	
Architect's Name: Not in CHRS	
Builder/Contractor: Not in CHRS	
Architectural Style:	
Vernacular	
Prepared By: J. Martinez, M. C. Bird, J.	
Guarino	
Photo By: S. Katz	
Date: 26 October 2012	
Property Description:	Stories: 1

Property Description:

Stories: 1

This one-story frame bungalow at the northeast corner of Green and 124th streets in Calumet Park is situated on a raised concrete block basement and is covered with synthetic siding. The building has a hip roof covered with asphalt shingles. Its front (Green Street) elevation has an off-center door with a bracketed gabled hood, concrete steps with metal railings, and a small casement window adjacent to the door. The elevation also has a gabled projecting living room bay with a bracketed, hip-roofed, three-sided bay window with multi-light glazing that is partially obscured by a low metal awning. There is a small window with a metal awning in the gable. The side elevation (124th Street) also has a bracketed, hip-roofed, three-sided bay window with multi-light glazing that is partially obscured by a low metal awning and a side entrance door with bracketed gabled hood. This house lacks distinctive architectural features and is not individually eligible for listing on the National Register.



Integrity:			Additional Notes/Descriptions
integrity:			Additional Notes/Descriptions
Unaltered	Slight Modification	n Major Alteration	Replacement cladding
	·····@·······················	<u> </u>	
Con l'élana			
Condition:			
Excellent	Good	Poor	
Additional Alterati	ons		
<u> </u>			
Structu	ire Usage	Exterior Wall Surface	
Current: NA		Synthetic siding	
Historic: NA			
Roof Material	Roof Features	Roof Type	
A anhalt shinala	None	Hip	
Asphalt shingle	None	т	
Ornamental Architectural Details			Windows
Bracketed gable hoods, brackets under the bays			Casement, fixed-pane
Outbuildings (Num	ber and Description)		
Detached, two-car, f	rame garage		

Local Landmark	Y <u>N</u>	
National Register Historic Places	Y <u>N</u>	
National Register Historic District	Y <u>N</u>	Name:
Individually Eligible? No	A B C	Significance:

Additional Comments:			



Historical Resource Recordation Form

Property Name	Photos with Captions: West and north façades of a two-story, single family residence.
Historic: Bldg. not labeled, not in CHRS	west and north façades of a two-story, single failing residence.
Common/Current: Unknown	
Property Address:	
12409 S. Green Street	
HAARGIS Number:	
Not in database	
Present Owner and /or Occupant:	
Unknown	
Property Use	
Historic: Single family residence	
Current: Single family residence	
Date of Construction: 1925	
Architect's Name: Not in CHRS	
Builder/Contractor: Not in CHRS	
Architectural Style:	
Vernacular	
Prepared By: J. Martinez, M. C. Bird, J.	
Guarino	
Photo By: S. Katz	
Date: 26 October 2012	
Buonontry Descriptions	Starian 2

Property Description:

Stories: 2

This two-story frame house in Calumet Park is covered with synthetic siding and has a front gable roof covered with asphalt shingles. Its front elevation has an off-center non-original hollow core metal door with a concrete stoop and a picture window flanked by one-over-one aluminum-sash windows on the first floor. There is a three-sided bay window and a single window on the second floor and a pair of windows in the gable; these windows are all non-original one-over-one aluminum-sash. This house lacks integrity and distinctive architectural features and is not individually eligible for listing on the National Register.



Integrity:			Additional Notes/Descriptions
Unaltered	Slight Modification	n Major Alteration	Replacement door, windows, and cladding
Condition:			
<u>Excellent</u>	Good	Poor	
Additional Alterati	ons		
Structu	ire Usage	Exterior Wall Surface	
Current: NA		Synthetic siding	
Historic: NA			
Roof Material	Roof Features	Roof Type	
Asphalt shingle	None	Gable	
Ornamental Archit	tectural Details		Windows
None			Double-hung, fixed-pane
Outbuildings (Num	ber and Description)		
None			

Local Landmark	Y <u>N</u>	
National Register Historic Places	Y <u>N</u>	
National Register Historic District	Y <u>N</u>	Name:
Individually Eligible? No	A B C	Significance:

Additional Comments:			



Historical Resource Recordation Form

Property Name	Photos with Captions:		
Historic: Bldg. not labeled, not in CHRS	West façade of a one-story, brick, single family residence.		
Common/Current: Unknown			
Property Address:			
12713 S. Green Street			
HAARGIS Number:	Long and the second		
Not in database			
Present Owner and /or Occupant:			
Unknown			
Property Use			
Historic: Single family residence			
Current: Single family residence			
Date of Construction: 1953			
Architect's Name: Not in CHRS			
Builder/Contractor: Not in CHRS			
Architectural Style:			
Vernacular			
Prepared By: J. Martinez, M. C. Bird, J.			
Guarino	A State of the second stat		
Photo By: S. Katz			
Date: 29 October 2012			

Property Description:

Stories: 1

This one-story cottage in the West Pullman community is situated on a raised basement with glass block windows and is clad with face brick on the front elevation and common brick on the side and rear elevations. The building has a front gable roof covered with asphalt shingles. The front elevation has a hollow core metal door, concrete steps with metal railings, a small glass block window, and a projecting living room bay surrounded on three sides by multi-paned windows, the central group of which is partially obscured by a low metal awning. A pair of one-over-one windows with metal awning is situated in the gable. All windows have concrete sills. A bracketed pent roof spans the door and living room bay. It does not feature any distinguishing architectural features and is not individually eligible for listing on the National Register.



Integrity:			Additional Notes/Descriptions
Unaltered	Slight Modification	Major Alteration	Replacement door
Condition:			
<u>Excellent</u>	Good	Poor	
Additional Alteration	ons		
Structu	re Usage	Exterior Wall Surface	
Current: NA		Brick	
Historic: NA			
Roof Material	Roof Features	Roof Type	
Asphalt shingles	None	Gable	
Ornamental Archit	ectural Details		Windows
Bracketed pent roof,	concrete sills		Double-hung, fixed-pane, glass block
Outbuildings (Num	ber and Description)		
None			

Y <u>N</u>	
Y <u>N</u>	
Y <u>N</u>	Name:
A B C	Significance:
	Y <u>N</u> Y <u>N</u>

Additional Comments:			



Historical Resource Recordation Form

Property Name	Photos with Captions:
	East façade of two-story brick and frame single-family residence.
Historic: Not labeled, not in CHRS	
Common/Current: Unknown	
Property Address:	
12817 S. Green Street	
HAARGIS Number:	
Not in database	
Present Owner and /or Occupant:	
Unknown	
Property Use	
Historic: Single family residence	
Current: Single family residence	
Date of Construction: 1952	
Architect's Name: Not in CHRS	
Builder/Contractor: Not in CHRS	
Architectural Style:	
Vernacular	
Prepared By: C. Tolmie, M. C. Bird, J.	
Guarino	
Photo By: S. Katz	
Date: 13 September 2012	

Property Description:

Stories: 2

This two-story house in the West Pullman community is clad with brick on the first floor and synthetic siding on the second floor. It has a hip roof covered with asphalt shingles. Its front façade has a centrally located front door, concrete steps with metal railings, two pairs of one-over one windows on the first floor, and two one-over-one-windows on the second floor. This house does not feature distinguishing features and is not eligible for individual listing on the National Register.



Integrity:			Additional Notes/Descriptions
Unaltered	Slight Modification	Major Alteration	Replacement siding
Condition:			
Excellent	Good	Poor	
Additional Alterati	ons		
Structu	ire Usage	Exterior Wall Surface	
Current: NA		Brick (lower),	
Historic: NA		Synthetic siding (upper)	
Roof Material	Roof Features	Roof Type	
Asphalt shingle	None	Hipped	
Ornamental Archit	ectural Details		Windows
None			Double-hung
Outbuildings (Num	ber and Description)		·
None			

Local Landmark	Y <u>N</u>	
National Register Historic Places	Y <u>N</u>	
National Register Historic District	Y <u>N</u>	Name:
Individually Eligible? No	A B C	Significance:

Additional Comments:			



Historical Resource Recordation Form

Property Name	Photos with Captions: West façade of a brick, one-story, single family residence.
Historic: Bldg. not labeled, not in CHRS	west façade of a offek, one-story, single family residence.
Common/Current: Unknown	
Property Address:	
12819 S. Green Street	
HAARGIS Number:	
Not in database	
Present Owner and /or Occupant:	
Unknown	
Property Use	
Historic: Single family residence	
Current: Single family residence	
Date of Construction: 1952	
Architect's Name: Not in CHRS	
Builder/Contractor: Not in CHRS	
Architectural Style:	
Vernacular	
Prepared By: J. Martinez, M. C. Bird, J. Guarino	
Photo By: S. Katz	
Date: 3 October 2012	
Property Description:	Stories: 1

Property Description:

Stories: 1

This one-story brick-clad house in the West Pullman community has a front gable roof covered with asphalt shingles. Its front façade is clad with face brick; it has a gabled projecting living room, a hollow metal paneled door, a pair of non-original windows, and a picture window. It does not feature distinguishing architectural features and is not individually eligible for listing on the National Register.



Integrity:			Additional Notes/Descriptions
Unaltered	Slight Modificatio	n Major Alteration	Replacement door and windows
Condition:			
Excellent	Good	Poor	
Additional Alteration	ons		
Structu	ire Usage	Exterior Wall Surface	
Current: NA		Brick (lower),	
Historic: NA		Synthetic siding (gable end)	
Roof Material	Roof Features	Roof Type	
Asphalt shingle	None	Gable	
Ornamental Archit	ectural Details	Windows	
None			Sliding or casement
Outbuildings (Number and Description)			
None			

Local Landmark	Y <u>N</u>	
National Register Historic Places	Y <u>N</u>	
National Register Historic District	Y <u>N</u>	Name:
Individually Eligible? No	A B C	Significance:



Historical Resource Recordation Form

Property Name	Photos with Captions:
	East and south façades of one-story, brick, single-family residence.
Historic: Not labeled, not in CHRS	
Common/Current: Unknown	
Property Address:	
12823 S. Green Street	
HAARGIS Number:	
Not in database	
Present Owner and /or Occupant:	
Unknown	
Property Use	
Historic: Single family residence	
Current: Single family residence	
Date of Construction: 1952	
Architect's Name: Not in CHRS	
Builder/Contractor: Not in CHRS	
Architectural Style:	
Vernacular	
Prepared By: C. Tolmie, M. C. Bird, J.	
Guarino	
Photo By: S. Katz	
Date: 13 September 2012	

Property Description:

Stories: 1

This one-story brick-clad house in the West Pullman community has a front gable roof covered with asphalt shingles. Its front façade is clad with face brick and has a hollow metal door on one side of a flat-roofed projection of the living room. It also has a picture window and a pair of one-over-one windows on the first floor, and a pair of sliding glass windows in the gable, all of which are non-original. It does not feature distinguishing architectural features and is not individually eligible for listing on the National Register.



Integrity:			Additional Notes/Descriptions
Unaltered	Slight Modification	Major Alteration	Replacement windows and door
Condition:			
Excellent	Good	Poor	
Additional Alterati	ons		
Structu	ire Usage	Exterior Wall Surface	
Current: NA		Brick	
Historic: NA			
Roof Material	Roof Features	Roof Type	
Asphalt shingle	None	Gable	
Ornamental Architectural Details			Windows
None			Fixed-pane, double-hung, sliding
Outbuildings (Number and Description)			
Garage			

Local Landmark	Y <u>N</u>	
National Register Historic Places	Y <u>N</u>	
National Register Historic District	Y <u>N</u>	Name:
Individually Eligible? No	A B C	Significance:

Additional Comments:			



Historical Resource Recordation Form

Property Name	Photos with Captions:
	East and south façades of 1.5-story, brick, single family residence.
Historic: Not labeled, not in CHRS	
Common/Current: Unknown	
Property Address:	
12825 S. Green Street	
HAARGIS Number:	
Not in database	
Present Owner and /or Occupant:	
Unknown	
Property Use	
Historic: Single family residence	
Current: Single family residence	
Date of Construction: 1952	
Architect's Name: Not in CHRS	
Builder/Contractor: Not in CHRS	
Architectural Style:	
Vernacular	
Prepared By: C. Tolmie, M. C. Bird, J.	
Guarino	
Photo By: S. Katz	
Date: 13 September 2012	

Property Description:

Stories: 1.5

This one-and-a-half-story brick-clad house in the West Pullman community has a front gable roof covered with asphalt shingles. Its front façade is clad with face brick. It has a hollow metal door on one side of a shed-roofed projection of the living room, two pairs of one-over-one windows on the first floor, and a pair of sliding glass windows in the gable (all non-original). It does not feature distinguishing architectural features and is not individually eligible for listing on the National Register.



Integrity:			Additional Notes/Descriptions
Unaltered	Slight Modification	Major Alteration	Replacement windows
Chartered	<u>Slight Mounication</u>	Major Atteration	
Condition:			
<u>Excellent</u>	Good	Poor	
Additional Alterati	ons		
Structu	re Usage	Exterior Wall Surface	
Current: NA		Brick	
Historic: NA			
Roof Material	Roof Features	Roof Type	
Asphalt shingle	None	Gable	
Ornamental Archit	ectural Details		Windows
None			Double-hung, sliding
Outbuildings (Num	ber and Description)		
Garage			

Local Landmark	Y <u>N</u>	
National Register Historic Places	Y <u>N</u>	
National Register Historic District	Y <u>N</u>	Name:
Individually Eligible? No	A B C	Significance:

Additional Comments:			



Historical Resource Recordation Form

Property Name	Photos with Captions:
Historic: Not labeled, not in CHRS	East and south façades of 1.5 story, brick single-family residence.
Common/Current: Unknown	
Property Address:	E CALLER AND A CAL
12829 S. Green Street	
HAARGIS Number:	
Not in database	
Present Owner and /or Occupant:	
Unknown	
Property Use	
Historic: Single family residence	
Current: Single family residence	
Date of Construction: 1952	
Architect's Name: Not in CHRS	
Builder/Contractor: Not in CHRS	
Architectural Style:	
Vernacular	
Prepared By: C. Tolmie, M. C. Bird, J. Guarino	
Photo By: S. Katz	
Date: 13 September 2012	

Property Description:

Stories: 1.5

This 1.5 story, brick clad house in the West Pullman community has a front gable roof covered with asphalt shingles. Its front façade is clad with face brick, has a hollow metal door on one side of a flat-roofed projection of the living room. It has two sets of windows on the first floor—a fixed-pane flanked by double-hung windows and a pair of sliding glass windows. An additional pair of sliding glass windows is situated in the gable. It does not feature distinguishing architectural elements and is not individually eligible for listing on the National Register.



Integrity:			Additional Notes/Descriptions
<u>Unaltered</u>	Slight Modification	Major Alteration	
Condition:			
<u>Excellent</u>	Good	Poor	
Additional Alterati	ons		
Structu	ire Usage	Exterior Wall Surface	
Current: NA		Brick	
Historic: NA			
Roof Material	Roof Features	Roof Type	
Asphalt shingle	None	Gable	
Ornamental Archit	ectural Details		Windows
None			Fixed-pane, double-hung, sliding
Outbuildings (Num	ber and Description)		·
Garage			

Local Landmark	Y <u>N</u>	
National Register Historic Places	Y <u>N</u>	
National Register Historic District	Y <u>N</u>	Name:
Individually Eligible? No	A B C	Significance:

Additional Comments:			



Historical Resource Recordation Form

Property Name	Photos with Captions:
Historic: Not labeled, not in CHRS	East and south façades of 1.5-story, brick, single-family residence.
Common/Current: Unknown	
Property Address:	
12831 S. Green Street	
HAARGIS Number:	
Not in database	
Present Owner and /or Occupant:	
Unknown	
Property Use	
Historic: Single family residence	
Current: Single family residence	
Date of Construction: 1952	
Architect's Name: Not in CHRS	
Builder/Contractor: Not in CHRS	
Architectural Style:	The server to a server and the
Vernacular	
Prepared By: C. Tolmie, M. C. Bird, J.	
Guarino	
Photo By: S. Katz	
Date: 13 September 2012	

Property Description:

Stories: 1.5

This 1.5-story brick-clad house in the West Pullman community has a front gable roof covered with asphalt shingles. Its front elevation is clad with brown face brick and has two strips of windows on the first floor, one of which is situated within a shed-roofed window bay, plus a single window in the gable. The windows are located below low metal awnings but appear to be casement. The door is situated along the north side of the house. It does not feature distinguishing architectural features and is not individually eligible for listing on the National Register.



Integrity:			Additional Notes/Descriptions
Unaltered	Slight Modification	Major Alteration	Windows may be replacements
Condition:			
Excellent	Good	Poor	
Additional Alteration	ons		
Structu	re Usage	Exterior Wall Surface	
Current: NA		Brick	
Historic: NA			
Roof Material	Roof Features	Roof Type	
Asphalt shingle	None	Gable	
Ornamental Archit	ectural Details	Windows	
None			Casement
Outbuildings (Num	ber and Description)		
Garage			

Local Landmark	Y <u>N</u>	
National Register Historic Places	Y <u>N</u>	
National Register Historic District	Y <u>N</u>	Name:
Individually Eligible? No	A B C	Significance:

Additional Comments:			



Historical Resource Recordation Form

Property Name	Photos with Captions:
	East and south façades of 1.5-story, brick, single family residence.
Historic: Not labeled, not in CHRS	
Common/Current: Unknown	
Property Address:	
12835 S. Green Street	
HAARGIS Number:	
Not in database	
Present Owner and /or Occupant:	
Unknown	
Property Use	
Historic: Single family residence	
Current: Single family residence	
Date of Construction: 1952	
Architect's Name: Not in CHRS	
Builder/Contractor: Not in CHRS	
Architectural Style:	
Vernacular	
Prepared By: C. Tolmie, M. C. Bird, J.	
Guarino	
Photo By: S. Katz	
Date: 13 September 2012	

Property Description:

Stories: 1.5

This one-and-a-half-story brick-clad house in the West Pullman community has a gable roof covered with asphalt shingles. Its front façade is clad with face brick and has a hollow metal door on one side of a shed-roofed projection of the living room. A fixed-pane window and two one-over-one windows occupy the first floor and there is a pair of one-over-one windows in the gable. Detailing includes the use of contrasting-colored brick around the windows. It does not contain distinguishing architectural features and is not individually eligible for listing on the National Register.



Integrity:			Additional Notes/Descriptions		
<u>Unaltered</u>	Slight Modification	Major Alteration			
Condition:					
Excellent	Good	Poor			
Additional Alterati	ons				
Structu	ire Usage	Exterior Wall Surface			
Current: NA		Brick			
Historic: NA					
Roof Material	Roof Features	Roof Type			
Asphalt shingle	None	Gable			
Ornamental Archit	ectural Details	Windows			
Buff-colored brick f	rame windows	Fixed-pane, double-hung			
Outbuildings (Number and Description)					
Garage					

Local Landmark	Y <u>N</u>	
National Register Historic Places	Y <u>N</u>	
National Register Historic District	Y <u>N</u>	Name:
Individually Eligible? No	A B C	Significance:

Additional Comments:			



Historical Resource Recordation Form

Property Name	Photos with Captions: North and east façades of one-story, brick single family residence
Historic: Not labeled, not in CHRS	(top and bottom, respectively).
Common/Current: Unknown	
Property Address:	
12837 S. Green Street	the second se
HAARGIS Number:	
Not in database	
Present Owner and /or Occupant:	
Unknown	
Property Use	A Particuetoustinande
Historic: Single family residence	
Current: Single family residence	
Date of Construction: 1952	
Architect's Name: Not in CHRS	
Builder/Contractor: Not in CHRS	
Architectural Style:	
Vernacular	
Prepared By: C. Tolmie, M. C. Bird, J.	
Guarino	
Photo By: S. Katz and CCA	
Date: 13 September 2012	

Property Description:

Stories: 1

This one-story brick-clad house in the West Pullman community has a side gable roof covered with asphalt shingles. The front façade has a centrally located door and an asymmetrical array of windows—a sliding window on one side with a picture window flanked by one-over-one sashes on the other side. Fenestration on the side elevation is comprised of a one-over-one window, a single-pane window, and sliding windows in the gable. This standard post-WWII home does not feature any distinguishing architectural features and is not individually eligible for listing on the National Register.



Integrity:			Additional Notes/Descriptions			
<u>Unaltered</u>	Slight Modification	Major Alteration				
C						
Condition:						
Excellent	Good	Poor				
Additional Alterati	ons					
Structu	re Usage	Exterior Wall Surface				
Current: NA		Brick				
Historic: NA						
Roof Material	Roof Features	Roof Type				
Asphalt shingle	None	Gable				
Ornamental Archit	ectural Details		Windows			
None			Fixed-pane, double-hung			
Outbuildings (Num	Outbuildings (Number and Description)					
Garage						

Local Landmark	Y <u>N</u>	
National Register Historic Places	Y <u>N</u>	
National Register Historic District	Y <u>N</u>	Name:
Individually Eligible? No	A B C	Significance:



Historical Resource Recordation Form

Property Name	Photos with Captions: West façade of a one-story, single family, brick residence.
Historic: Bldg. not labeled, not in CHRS	
Common/Current: Unknown	
Property Address:	
12851 S. Green Street	
HAARGIS Number:	
Not in database	
Present Owner and /or Occupant:	
Unknown	
Property Use	
Historic: Single family residence	
Current: Single family residence	
Date of Construction: 1951	
Architect's Name: Not in CHRS	
Builder/Contractor: Not in CHRS	
Architectural Style:	
Vernacular	
Prepared By: J. Martinez, M. C. Bird, J.	
Guarino	
Photo By: S. Katz	
Date: 29 October 2012	
Property Decorintion.	Staniae 1

Property Description:

Stories: 1

This one-story brick-clad house at the southeast corner of Green Street and 128th Place in the West Pullman community has a hip roof with overhanging eaves and asphalt shingles. The front (128th Place) elevation has a centrally-located metal storm door, concrete steps with metal railings, a pair of windows that appear to be casements, and a non-original picture window flanked by one-over-one aluminum-sash windows. The Green Street elevation has a projecting brick bay and two pairs of casement windows. All windows have concrete sills. It does not feature distinguishing architectural elements and is not individually eligible for listing on the National Register.



Integrity:			Additional Notes/Descriptions
Unaltered	Slight Modification	Major Alteration	Replacement windows
Condition:			
Excellent	Good	Poor	
Additional Alteration	ons		
Structu	re Usage	Exterior Wall Surface	
Current: NA		Brick	
Historic: NA			
Roof Material	Roof Features	Roof Type	
Asphalt shingle	None	Hip	
Ornamental Archit	ectural Details		Windows
Concrete sills			Casement, fixed-pane, double-
			hung
Outbuildings (Num	ber and Description)		
None			

Local Landmark	Y	<u>N</u>	
National Register Historic Places	Y	<u>N</u>	
National Register Historic District	Y	<u>N</u>	Name:
Individually Eligible? No	Α	B C	Significance:

Additional Comments:			



Historical Resource Recordation Form

Property Name	Photos with Captions: West façade of a one-story, single family, brick residence.
Historic: Bldg. not labeled, not in CHRS	west façade of a one-story, single failing, onek residence.
Common/Current: Unknown	
Property Address:	
12877 S. Green Street	
HAARGIS Number:	
Not in database	
Present Owner and /or Occupant:	
Unknown	
Property Use	
Historic: Single family residence	
Current: Single family residence	
Date of Construction: 1952	
Architect's Name: Not in CHRS	
Builder/Contractor: Not in CHRS	
Architectural Style:	
Vernacular	
Prepared By: J. Martinez, M. C. Bird, J.	
Guarino	
Photo By: S. Katz	
Date: 29 October 2012	
Property Description:	Stories: 1

Property Description:

Stories: 1

This one-story house in the West Pullman community sits on a raised basement; it is clad with face brick on its front elevation and common brick on its side and rear elevations. The hip roofed building has a front-facing gabled pavilion with synthetic-clad gable and scalloped verge boards. The front elevation has a centrally located metal storm door, concrete steps with metal railings, and two non-original one-over-one aluminum-sash windows with concrete sills. It does not feature distinguishing architectural characteristics and is not individually eligible for listing on the National Register.



Integrity:			Additional Notes/Descriptions
Unaltered	Slight Modificatio	on Major Alteration	Replacement windows and cladding
Condition:			
Excellent	Good	Poor	
Additional Alteration	ons		
Structure Usage Exterior Wall Surface			
Current: NA		Brick (main),	
Historic: NA		Synthetic siding (gable end)	
Roof Material	Roof Features	Roof Type	
Asphalt shingle	None	Hip	
Ornamental Archit	ectural Details	Windows	
Scalloped verge boards, concrete sills			Double-hung
Outbuildings (Num	ber and Description)		
None			

Local Landmark	Y <u>N</u>	
National Register Historic Places	Y <u>N</u>	
National Register Historic District	Y <u>N</u>	Name:
Individually Eligible? No	A B C	Significance:

Additional Comments:			



Photos with Captions: Property Name West and north façades of one-story, commercial property. Historic: Not labeled, not in CHRS Common/Current: Bell Bros. Cleaners **Property address:** 10004 S. Halsted Street **HAARGIS Number:** Not in database **Present Owner and /or Occupant:** Bell Bros. Cleaning **Property Use** Historic: Commercial Current: Commercial Date of Construction: 1957 Architect's Name: Not in CHRS Builder/Contractor: Not in CHRS **Architectural Style:** Vernacular Prepared By: C. Tolmie, M. C. Bird, J. Guarino Photo By: S. Katz Date: September 2012

Historical Resource Recordation Form

Property Description:

Stories: 1

This one-story, flat-roofed, metal-clad, concrete block commercial building at the corner of Halsted and 100th streets in the Washington Heights community has a plate glass door and large display windows. There are also metal double doors and glass block windows. This building lacks distinctive architectural features and is not individually eligible for listing on the National Register.



Integrity:			Additional Notes/Descriptions
<u>Unaltered</u>	Slight Modification	Major Alteration	
Condition:			
Excellent	Good	Poor	
Additional Alterati	ons		
Structu	re Usage	Exterior Wall Surface	
Current: NA		Metal-clad concrete block	
Historic: NA			
Roof Material	Roof Features	Roof Type	
Unknown	None	Flat	
Ornamental Archit	ectural Details		Windows
None			Fixed-pane, glass block
Outbuildings (Num	ber and Description)		•
None			

Local Landmark	Y <u>N</u>	
National Register Historic Places	Y <u>N</u>	
National Register Historic District	Y <u>N</u>	Name:
Individually Eligible? No	A B C	Significance:

Additional Comments:			



Historical Resource Recordation Form

Property Name	Photos with Captions:
	East and north façades of one-story, multi-family, frame residence.
Historic: Not labeled, not in CHRS	
Common/Current: Unknown	
Property address:	
10114 S. Halsted Street	
HAARGIS Number:	
None	
Present Owner and /or Occupant:	
Unknown	
Property Use	
Historic: Single family residence	
Current: Multi-family residence	
Date of Construction: 1903	
Architect's Name: Not in CHRS	
Builder/Contractor: Not in CHRS	
Architectural Style:	
Vernacular	
Prepared By: C. Tolmie, M. C. Bird, J. Guarino	
Photo By: S. Katz	
Date: September 2012	

Property Description:

Stories: 1

This one-story frame house in the Washington Heights community is situated on a raised basement and is covered with synthetic siding. The building has a front gable roof covered with asphalt shingles. The front elevation has a pent roof, an off-center metal storm door, and concrete side-facing steps with metal railings. There is a picture window flanked by one-over-one aluminum-sash windows on the first floor and a single one-over-one aluminum-sash window in the gable, all of which are non-original. The north elevation has a wide aluminum-clad shed dormer with windows. Windows on the side elevations are non-original one-over-one sash of varying sizes. This house lacks integrity and distinctive architectural features and is not individually eligible for listing on the National Register.



Integrity:			Additional Notes/Descriptions
Unaltered	Slight Modification	ns Major Alteration	Replacement windows and cladding
Condition:			
<u>Excellent</u>	Good	Poor	
Additional Alterati	ons		
Conversion from sin	gle family residence after	1938 (Sanborn)	
Structure Usage		Exterior Wall Surface	
Current: NA		Synthetic siding	
Historic: NA			
Roof Material	Roof Features	Roof Type	
Asphalt shingle	Dormer	Gable	
Ornamental Archit	ectural Details		Windows
None			Double-hung
Outbuildings (Num	ber and Description)		
None			

Local Landmark	Y <u>N</u>	
National Register Historic Places	Y <u>N</u>	
National Register Historic District	Y <u>N</u>	Name:
Individually Eligible? No	A B C	Significance:

Additional Comments:			



Historical Resource Recordation Form

Property Name	Photos with Captions: East façade of one-story, brick multi-family residence
Historic: Not labeled, not in CHRS	Last laçade of one-story, onek multi-lanning lesidence
Common/Current: Unknown	
Property address:	
10116 S. Halsted Street	
HAARGIS Number:	
None	
Present Owner and /or Occupant:	
Unknown	
Property Use	
Historic: Mixed use	
Current: Multi-family residence	
Date of Construction: 1937	
Architect's Name: Not in CHRS	
Builder/Contractor: Not in CHRS	
Architectural Style:	
Vernacular	
Prepared By: C. Tolmie, M. C. Bird, J.	
Guarino	
Photo By: S. Katz	
Date: September 2012	

Property Description:

Stories: 1

This one-story brick-clad building in the Washington Heights community has been converted from a commercial structure to a multi-family residence. It has a concrete water table, flat roof, and parapet with concrete coping and inserts. Brick stringcourses traverse the cornice. Its front elevation has a centrally located recessed metal door with an in-filled transom, a strip of storefront display windows to the south, and a strip of non-original one-over-one aluminum-sash windows to the north. This building lacks integrity and distinctive architectural features and is not individually eligible for listing on the National Register.




Integrity:			Additional Notes/Descriptions
Unaltered	Slight Modification	ns Major Alteration	Replacement windows
Condition:			
Excellent	Good	Poor	
Additional Alteration	ons		
Converted to multi-f	amily residence		
Structure Usage Exterior Wall Surface			
Current: NA		Brick	
Historic: NA			
Roof Material	Roof Features	Roof Type	
Unknown	Parapet	Flat	
Ornamental Archit	ectural Details	Windows	
Patterned brickwork, brick stringcourses, concrete coping and inserts			Double-hung, fixed-pane
Outbuildings (Num	ber and Description)		
None			

Local Landmark	Y	<u>N</u>	
National Register Historic Places	Y	<u>N</u>	
National Register Historic District	Y	<u>N</u>	Name:
Individually Eligible? No	Α	B C	Significance:

Additional comments			



Historical Resource Recordation Form

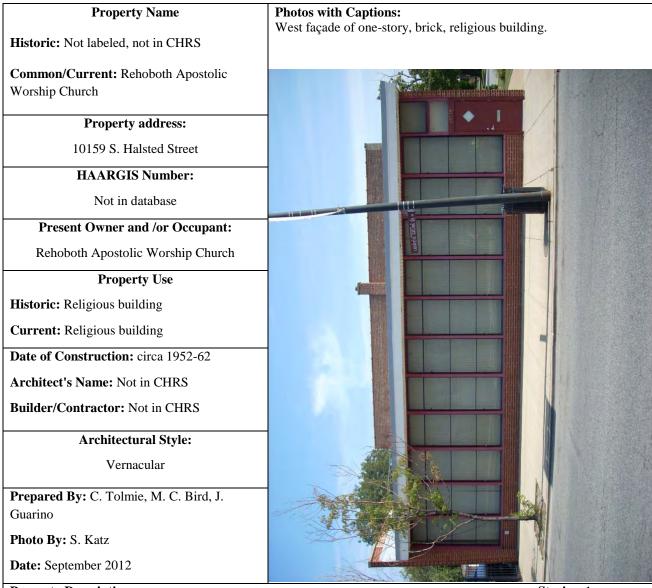

Property Description:

Stories: 1

This one-story brick-clad church building at the northeast corner of Halsted and 102nd streets in the Washington Heights community has a flat roof and a tall, protruding brick sidewall that rises above the roofline. The front (Halsted) elevation is glazed with a continuous series of tall windows and has an off-center hollow core metal door. Detailing is limited to an insert block. This building lacks distinctive architectural features and is not individually eligible for listing on the National Register.




Integrity:			Additional Notes/Descriptions
<u>Unaltered</u>	Slight Modifications	Major Alteration	Replacement door
Condition:			
Excellent	Good	Poor	
Additional Alterati	ons		
Structu	re Usage	Exterior Wall Surface	
Current: NA		Brick	
Historic: NA			
Roof Material	Roof Features	Roof Type	
Tar	None	Flat	
Ornamental Archit	ectural Details		Windows
Insert block			Fixed-pane
Outbuildings (Num	ber and Description)		•
None			

Local Landmark	Y <u>N</u>	
National Register Historic Places	Y <u>N</u>	
National Register Historic District	Y <u>N</u>	Name:
Individually Eligible? No	A B C	Significance:

Additional comments			



Historical Resource Recordation Form

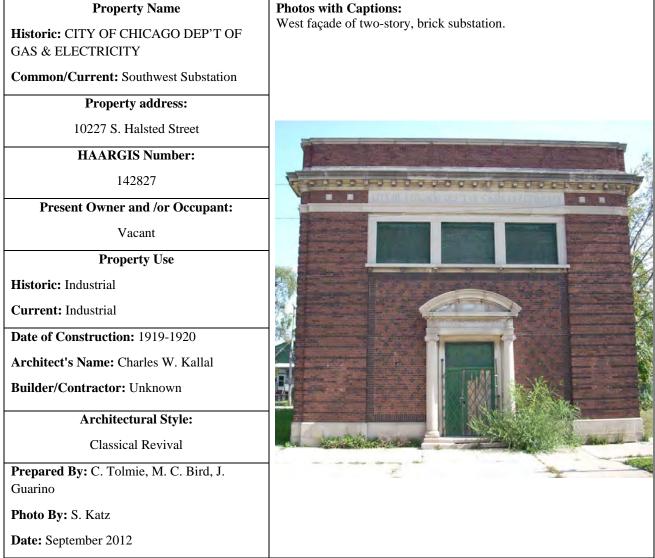

Property Description:

Stories: 2

This vacant, two-story, Classical Revival style substation building in the Washington Heights community has a stone water table and a flat roof with parapet. The front façade is clad with dark brown-colored brick that accents the façade with stringcourses, soldier courses, and cruciform patterns against the reddish brown-colored brick. The sides and rear feature common brick. The front elevation features a centrally located entrance with a Classical surround that includes Ionic columns and an entablature with a segmental pediment and frieze band with incised lettering that reads, "Southwest Substation." The original door, sidelight and transom have been removed and their openings covered with plywood. Directly above the entrance is a strip of three plywood-covered window openings with stone casing. Decorative detailing includes full-height brick corner pilasters, a stone belt course above the windows, and a stone cornice with widely spaced dentils. Directly beneath the cornice is a stone panel with incised lettering that reads, "City of Chicago Dep't of Gas & Electricity." Nearly all of the side elevation window openings are covered with plywood. This is a rare extant example of a Classical Revival substation building in the Washington Heights community. It has retained its decorative detailing, and it is possible that original windows may be extant behind the



wood covering. Assuming that the interior has retained interior fabric, this building is recommended as individually eligible for listing on the National Register under Criterion C for architecture.

Structural Survey

Integrity:			Additional Notes/Descriptions
<u>Unaltered</u>	Slight modification	s Major Alteration	Visible elements are unaltered
Condition:			
Excellent	Good	Poor	
Additional Alterati	ons		
Openings covered w	ith plywood.		
Structu	re Usage	Exterior Wall Surface	
Current: NA		Brick	
Historic: NA			
Roof Material	Roof Features	Roof Type	
Unknown	Parapet	Flat	
Ornamental Archit	ectural Details		Windows
Classical surround at entrance, stone casings, corner pilasters, stone belt			covered
course, stone cornice	e with dentils, inscribed sto	one panel, decorative brickwork	
utilizing contrasting	colored bricks		
Outbuildings (Num None	ber and Description)		1

Local Landmark	Y	<u>N</u>	
National Register Historic Places	Y	<u>N</u>	
National Register Historic District	Y	<u>N</u>	Name:
Individually Eligible? Yes	<u>A</u>	в <u>с</u>	Significance: Rare example of an intact Classical Revival substation in the community

Additional comments

CHRS coded orange: property possesses some architectural feature or historical association that made it potentially significant in the context of the surrounding community.



Property Name Photos with Captions: East façade of two-story, mixed-use, brick building. Historic: Not labeled, not in CHRS Common/Current: Unknown **Property Address:** 10238-10240 S. Halsted Street **HAARGIS Number:** Not in database **Present Owner and /or Occupant:** Trinity African Hair Braiding **Property Use** TRINITY AFRICAN HAIR BRAIDING OPEN 7 DAYS Historic: Commercial **Current:** Mixed-Use Date of Construction: 1938 Architect's Name: Not in CHRS Builder/Contractor: Not in CHRS Architectural Style: Vernacular Prepared By: C. Tolmie, M. C. Bird, J. Guarino Photo By: S. Katz Date: 13 September 2012

Historical Resource Recordation Form

Property Description:

Stories: 2

This two-story, flat-roofed, mixed-use building in the Washington Heights community has a front façade clad with limestone on the first floor and light brown and orange-colored face brick above. The first floor has two non-original large central display windows and doors on either end. The second floor has two strips of three non-original one-over-one windows with stone casing. Art Deco detailing includes limestone banding with chevron and zigzag patterns on the first and second floors and fluted pilasters that terminate in scrolls flanking the two doors. This building does not feature sufficient distinguishing features to qualify eligible for individual listing on the National Register.



Integrity:			Additional Notes/Descriptions
Unaltered	Slight Modification	n Major Alteration	Replacement windows
Condition:			
Excellent	Good	Poor	
Additional Alterati	ons		
Structu	ire Usage	Exterior Wall Surface	
Current: NA		Brick	
Historic: NA			
Roof Material	Roof Features	Roof Type	
Unknown	Parapet	Flat	
Ornamental Archit	ectural Details		Windows
Limestone banding, fluted pilasters with scrolls, brick stringcourse along			Double-hung, fixed-pane
cornice			
Outbuildings (Num	ber and Description)		•
None			

Local Landmark	Y <u>N</u>	
National Register Historic Places	Y <u>N</u>	
National Register Historic District	Y <u>N</u>	Name:
Individually Eligible? No	A B C	Significance:



Historical Resource Recordation Form

Property Name	Photos with Captions: West and south façades of 1.5-story, single-family, frame residence.
Historic: Not labeled, not in CHRS	west and south façades of 1.5-story, single-failing, frame festdence.
Common/Current: Unknown	
Property address:	
10241 S. Halsted Street	
HAARGIS Number:	
Not in database	
Present Owner and /or Occupant:	
Unknown	
Property Use	
Historic: Single family residence	
Current: Single family residence	
Date of Construction: 1894	
Architect's Name: Not in CHRS	
Builder/Contractor: Not in CHRS	
Architectural Style:	
Vernacular	
Prepared By: C. Tolmie, M. C. Bird, J.	
Guarino	The second secon
Photo By: S. Katz	
Date: September 2012	

Property Description:

Stories: 1.5

This one-and-a-half-story frame house in the Washington Heights community is covered with synthetic siding and has a front gable roof covered with asphalt shingles. The front elevation has an off-center non-original hollow core metal door with a non-original horizontal window strip above; there are tall, paired, non-original one-over-one windows, each with a cornice, on the first floor and in the gable. New wood steps and metal rails provide access to the residence. The north elevation has a hip-roof three-sided window bay with double-hung, non-original aluminum sashes. This house lacks integrity and distinctive architectural features and is not individually eligible for listing on the National Register.



Structural Survey

Integrity:			Additional Notes/Descriptions
Unaltered	Slight modifications	s Major Alteration	Replacement door, windows, cladding, and porch rails
Condition:			
<u>Excellent</u>	Good	Poor	
Additional Alteration	ons		
One-story segment a	t rear is original according	to the Sanborn maps.	
Structu	re Usage	Exterior Wall Surface	
Current: NA		Synthetic siding	
Historic: NA			
Roof Material	Roof Features	Roof Type	
Asphalt shingle	None	Gable	
Ornamental Archit	ectural Details		Windows
Cornice above windows			Double-hung
Outbuildings (Num	ber and Description)		
None			

Local Landmark	Y	<u>N</u>	
National Register Historic Places	Y	<u>N</u>	
National Register Historic District	Y	<u>N</u>	Name:
Individually Eligible? No	Α	B C	Significance:

Additional Comments:



Historical Resource Recordation Form

Property Name	Photos with Captions: East façade of a brick, two-story, mixed-use building.
Historic: Bldg. not labeled, not in CHRS	Last raçade of a oriek, two-story, mixed-use building.
Common/Current: Unknown	
Property Address:	
10326 S. Halsted Street (10328 S. Halsted CCA)	
HAARGIS Number:	
Not in database	
Present Owner and /or Occupant:	
House of Derrion	
Property Use	
Historic: Mixed-Use	
Current: Mixed Use	
Date of Construction: circa 1940s or 1950s	
Architect's Name: Not in CHRS	
Builder/Contractor: Not in CHRS	
Architectural Style:	
Vernacular	
Prepared By: J. Martinez, M. C. Bird, J. Guarino	
Photo By: S. Katz	
Date: 23 October 2012	

Property Description:

Stories: 2

This two-story commercial building in the Washington Heights community has a flat roof and parapet with concrete coping. Its front elevation is covered with a stone veneer on the first floor and in patterned buff brick above. It has two storefronts with angled display windows flanked by plate glass doors with glass transoms. A third hollow core metal door with glass transom provides access to the second floor space. The second floor has two window groups: a pair of non-original one-over-one aluminum-sash windows and a non-original picture window flanked by one-over-one aluminum-sash windows, both of which are partially obscured by metal awnings. This building lacks distinctive architectural features and is not individually eligible for listing on the National Register.



Integrity:			Additional Notes/Descriptions
Unaltered	Slight Modification	n Major Alteration	Replacement commercial doors and second floor windows
Condition:			
Excellent	Good	Poor	
Additional Alterati	ons		
Structu	re Usage	Exterior Wall Surface	
Current: NA		Brick (upper)	
Historic: NA		Faux stone (lower)	
Roof Material	Roof Features	Roof Type	
Unknown	Parapet	Flat	
Ornamental Archit	ectural Details		Windows
Patterned brickwork			Double-hung, fixed-pane
Outbuildings (Num	ber and Description)		
None			

Local Landmark	Y <u>N</u>	
National Register Historic Places	Y <u>N</u>	
National Register Historic District	Y <u>N</u>	Name:
Individually Eligible? No	A B C	Significance:

Additional Comments:	



Historical Resource Recordation Form

Property Name	Photos with Captions: West façade of a brick, one-story, religious building.
Historic: Bldg. not labeled, not in CHRS	
Common/Current: Unknown	
Property Address:	
10401-10419 S. Halsted Street	
HAARGIS Number:	
Not in database	300
Present Owner and /or Occupant:	
The Way Of Holiness Mission Ministries	
Property Use	
Historic: Commercial	
Current: Religious	OF HOLINESS MISSION MINISTRIES
Date of Construction: 1957	
Architect's Name: Not in CHRS	to the second
Builder/Contractor: Not in CHRS	
Architectural Style:	
Mid-Century Modern	
Prepared By: J. Martinez, M. C. Bird, J.	All and a second s
Guarino	
Photo By: S. Katz	
Date: 23 October 2012	

Property Description:

Stories: 1

This one-story flat-roofed building in the Roseland community has a front elevation that is clad with buff brick and has a projecting corner bay and an angled corner pier that are covered with a stone veneer. It has a wide door opening and four windows, all of which are covered with metal shades. This Mid-Century modern building lacks distinctive architectural features and is not individually eligible for listing on the National Register.




Integrity:			Additional Notes/Descriptions
Unaltered	Slight Modificati	on Major Alteration	•
Condition:			
Excellent	Good	Poor	
Additional Alteration	ons		
Structu	re Usage	Exterior Wall Surface	
Current: NA		Brick (façade), faux stone (corner	
Historic: NA		pier and bay)	
Roof Material	Roof Features	Roof Type	
Unknown	None	Flat	
Ornamental Archit	ectural Details		Windows
None			Covered
Outbuildings (Num	ber and Description)		
None			

Local Landmark	Y <u>N</u>	
National Register Historic Places	Y <u>N</u>	
National Register Historic District	Y <u>N</u>	Name:
Individually Eligible? No	A B C	Significance:

Additional Comments:			



Historical Resource Recordation Form

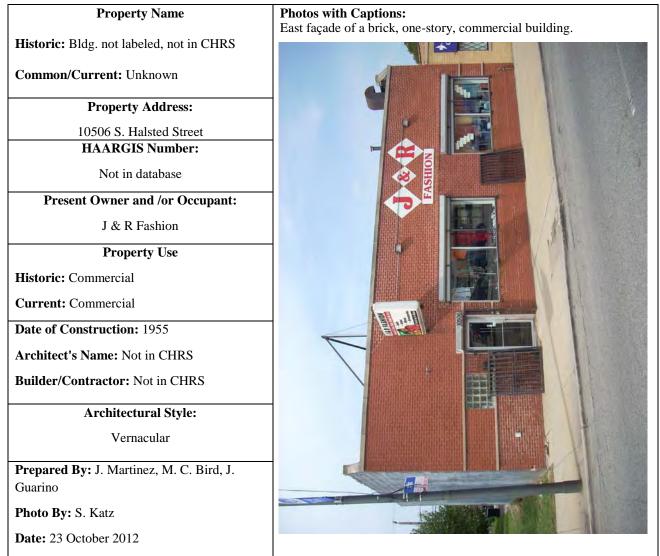

Property Description:

Stories: 1

This one-story concrete-block commercial building in the Washington Heights community has a flat roof and parapet. Its front elevation is clad with orange brick, has an off-center plate glass door, an adjacent glass block window, and two strips of display windows. Endwalls extend above the roofline. Detailing includes concrete banding and coping. This building lacks distinctive architectural features and is not individually eligible for listing on the National Register.



Integrity:			Additional Notes/Descriptions
<u>Unaltered</u>	Slight Modification	Major Alteration	
Condition:			
Excellent	Good	Poor	
Additional Alterati	ons		
Structu	ire Usage	Exterior Wall Surface	
Current: NA		Brick	
Historic: NA			
Roof Material	Roof Features	Roof Type	
Unknown	Parapet	Flat	
Ornamental Archit	tectural Details		Windows
Concrete banding ar	nd coping		Fixed-pane, glass block
Outbuildings (Num	ber and Description)		
None			

Local Landmark	Y <u>N</u>	
National Register Historic Places	Y <u>N</u>	
National Register Historic District	Y <u>N</u>	Name:
Individually Eligible? No	A B C	Significance:

Additional Comments:			



Historical Resource Recordation Form

Property Name	Photos with Captions:	
Historic: Bldg. not labeled, not in CHRS	West façade of a one-story, brick, commercial building.	
Common/Current: Unknown		
Property Address:		
10615 S. Halsted Street		
HAARGIS Number:		
Not in database		
Present Owner and /or Occupant:		
D&P Jones Insurance Agency Inc., Safeco		
Property Use		
Historic: Commercial		
Current: Commercial		
Date of Construction: 1954		
Architect's Name: Not in CHRS		
Builder/Contractor: Not in CHRS		
Architectural Style:		
Vernacular		
Prepared By: J. Martinez, M. C. Bird, J.		
Guarino		
Photo By: S. Katz		
Date: 23 October 2012		
	<u> </u>	

Property Description:

Stories: 1

This one-story commercial building in the Roseland community has a flat roof and parapet. Its front elevation is clad with red brick and has faux stone corner piers, an off-center plate glass door, a horizontal strip of four single-pane windows, and concrete coping. The side and rear elevations are clad with common brick. This building does not feature distinguishing architectural elements and is not individually eligible for listing on the National Register.



Integrity:			Additional Notes/Descriptions
<u>Unaltered</u>	Slight Modification	Major Alteration	
Condition:			
<u>Excellent</u>	Good	Poor	
Additional Alterati	ons		
Structure Usage		Exterior Wall Surface	
Current: NA		Brick	
Historic: NA			
Roof Material	Roof Features	Roof Type	
Unknown	Parapet	Flat	
Ornamental Architectural Details			Windows
Faux stone corner piers, concrete coping			Fixed-pane
Outbuildings (Number and Description)			
None			

Local Landmark	Y <u>N</u>	
National Register Historic Places	Y <u>N</u>	
National Register Historic District	Y <u>N</u>	Name:
Individually Eligible? No	A B C	Significance:

Additional Comments:			



Historical Resource Recordation Form

Property Name	Photos with Captions: South and east façades of a one-story, commercial building.
Historic: Bldg. not labeled, not in CHRS	bount and case ingrades of a one story, commercial building.
Common/Current: Hot Spot	
Property Address:	
10861 S. Halsted St.	
HAARGIS Number:	
Not in database	
Present Owner and /or Occupant:	
Hot Spot	
Property Use	
Historic: Commercial	Doos Doos Doos Doos Doos Doos Doos Doos
Current: Commercial	
Date of Construction: 1954	
Architect's Name: Not in CHRS	
Builder/Contractor: Not in CHRS	
Architectural Style:	
Vernacular	
Prepared By: J. Martinez, M. C. Bird, J.	
Guarino	
Photo By: S. Katz	
Date: 23 October 2012	

Property Description:

Stories: 1

This one-story concrete block fast food restaurant in the Roseland community has a flat roof with a flared metal boxed parapet, hollow core metal doors, and single-pane windows. The roof extends to the north to serve as a flat-roofed canopy for the drive-through that is supported by two boxed piers. This building does not feature distinguishing architectural features and is not individually eligible for listing on the National Register.



Integrity:			Additional Notes/Descriptions
<u>Unaltered</u>	Slight Modification	Major Alteration	
Condition:			
Excellent	Good	Poor	
Additional Alterati	ons		
Structu	ire Usage	Exterior Wall Surface	
Current: NA		Concrete block	
Historic: NA			
Roof Material	Roof Features	Roof Type	
Unknown	Parapet	Flat	
Ornamental Archit	ectural Details		Windows
None			Fixed-pane
Outbuildings (Num	ber and Description)	·	
None			

Local Landmark	Y <u>N</u>	
National Register Historic Places	Y <u>N</u>	
National Register Historic District	Y <u>N</u>	Name:
Individually Eligible? No	A B C	Significance:

Additional Comments:			



Photos with Captions: Property Name West façade of one-story, concrete block, commercial property. Historic: Not labeled, not in CHRS Common/Current: Unknown **Property Address:** 11011 S. Halsted Street **HAARGIS Number:** Not in database **Present Owner and /or Occupant:** Vacant **Property Use** Historic: Commercial Current: Commercial Date of Construction: 1961 Architect's Name: Not in CHRS Builder/Contractor: Not in CHRS Architectural Style: Vernacular Prepared By: C. Tolmie, M. C. Bird, J. Guarino Photo By: S. Katz Date: 13 September 2012

Historical Resource Recordation Form

Property Description:

Stories: 1

This one-story gable-roofed commercial building in the Roseland community has a front elevation that is clad in buff brick, a centrally located recessed glass door, and flanking display windows that are largely covered with plywood. The gable includes a large wood signboard. The two non-gable elevations are painted concrete block and extend above the roofline. The lower portions of the roofline have been built up along the non-gable sides. A rear addition is present. This building does not feature sufficient integrity or distinguishing features to qualify as eligible for individual listing on the National Register.



Integrity:			Additional Notes/Descriptions
Unaltered	Slight Modification	Major Alteration	Boarded-up, conditions unknown
Condition:			
Excellent	Good	Poor	Brick cladding falling off
Additional Alterati	ons		
Structu	ire Usage	Exterior Wall Surface	
Current: NA		Brick	
Historic: NA			
Roof Material	Roof Features	Roof Type	
Asphalt shingles	None	Gable	
Ornamental Archit	tectural Details		Windows
None			Fixed-pane
Outbuildings (Num	ber and Description)		·
None			

Local Landmark	Y <u>N</u>	
National Register Historic Places	Y <u>N</u>	
National Register Historic District	Y <u>N</u>	Name:
Individually Eligible? No	A B C	Significance:

Additional Comments:			



Historical Resource Recordation Form

Property Name	Photos with Captions: West façade of 1.5-story, frame, multi-family residence.
Historic: Bldg. not labeled, not in CHRS	west taçade of 1.5-story, france, multi-frankry residence.
Common/Current: Unknown	
Property Address:	
11013 S. Halsted Street	
HAARGIS Number:	
Not in database	
Present Owner and /or Occupant:	
Unknown	
Property Use	
Historic: Single family residence	
Current: Multi-family residence	
Date of Construction: 1879	
Architect's Name: Not in CHRS	
Builder/Contractor: Not in CHRS	
Architectural Style:	
Vernacular	•
Prepared By: J. Martinez, M. C. Bird, J.	
Guarino	Concerte and Aller
Photo By: S. Katz	
Date: 23 October 2012	

Property Description:

Stories: 1.5

This one-and-a-half-story house in the Roseland community is situated on a raised concrete block basement with casement windows and is clad with wood boards laid vertically on the first floor and synthetic siding on the second floor. The building has a front gable roof covered with asphalt shingles. Its front elevation has an off-center non-original hollow core metal door beneath a gabled wooden hood, wood steps with railings, a raised wood deck (non-original), and two window openings on the first floor, both of which are covered with plywood. There is a strip of non-original one-over-one windows in the gable and a wide, shed-roofed wall dormer on the north elevation. This house lacks integrity and distinguishing architectural features and is not individually eligible for listing on the National Register.



Integrity:			Additional Notes/Descriptions
Unaltered	Slight Modification	Major Alteration	Replacement doors, windows, and cladding
Condition:			
Excellent	Good	Poor	
Additional Alterati	ons		
Structu	ire Usage	Exterior Wall Surface	
Current: NA		Wood, synthetic siding	
Historic: NA			
Roof Material	Roof Features	Roof Type	
Asphalt shingle	Dormer	Gable	
Ornamental Archit	tectural Details		Windows
None			Double-hung, casement, covered
Outbuildings (Num	ber and Description)		
None			

Local Landmark	Y <u>N</u>	
National Register Historic Places	Y <u>N</u>	
National Register Historic District	Y <u>N</u>	Name:
Individually Eligible? No	A B C	Significance:

Additional Comments:	



Historical Resource Recordation Form

Property Name	Photos with Captions:		
Historic: Professional Dental Building	West façade of a brick, one-story, commercial building.		
Common/Current: Professional Dental			
Building			
Property Address:			
11139 S. Halsted Street			
HAARGIS Number:			
Not in database			
Present Owner and /or Occupant:			
Professional Dental Building			
Property Use			
Historic: Commercial			
Current: Commercial			
Date of Construction: 1957			
Architect's Name: Not in CHRS			
Builder/Contractor: Not in CHRS			
Architectural Style:			
Modernistic			
Prepared By: J. Martinez, M. C. Bird, J.			
Guarino			
Photo By: S. Katz			
Date: 24 October 2012			

Property Description:

Stories: 1

This one-story, Mid-Century Modern office building at the Roseland community is clad with light orange face brick and has an L-shaped footprint with a shed-roofed front wing and a flat-roofed rear wing. The Halsted elevation of the rear wing has three rectangular glass block windows while the south elevation of the front wing has an off-center door and floor-to-ceiling windows covered with large metal shades. This building lacks distinguishing architectural features and is not individually eligible for listing on the National Register.



Integrity:			Additional Notes/Descriptions
Unaltered	Slight Modification	Major Alteration	-
<u>e narcerea</u>	Singlit Woullication	Trajor 7 normanon	
Condition:			
Excellent	Good	Poor	
Additional Alterati	ons		
Structu	re Usage	Exterior Wall Surface	
Current: NA		Brick	
Historic: NA			
Roof Material	Roof Features	Roof Type	
Unknown	None	Flat	
Ornamental Archit	ectural Details		Windows
None			Glass-block
Outbuildings (Num	ber and Description)		•
None			

Local Landmark	Y <u>N</u>	
National Register Historic Places	Y <u>N</u>	
National Register Historic District	Y <u>N</u>	Name:
Individually Eligible? No	A B C	Significance:

Additional Comments:			



Historical Resource Recordation Form

Property Name	Photos with Captions:
Historic: Bldg. not labeled, not in CHRS	North and east façades of a brick, one-story, commercial building.
Historic: Didg. not hobidu, not in critici	
Common/Current: Unknown	
Property Address:	
11200 S. Halsted Street	
HAARGIS Number:	
Not in database	
Present Owner and /or Occupant:	
Morgan Park Auto Service	
Property Use	
Historic: Commercial	I DOGO
Current: Commercial	
Date of Construction: 1925	
Architect's Name: Not in CHRS	
Builder/Contractor: Not in CHRS	
Architectural Style:	
Vernacular	
Prepared By: J. Martinez, M. C. Bird, J.	
Guarino	
Photo By: S. Katz	
Date: 24 October 2012	THE REAL PROPERTY AND A DECIMAL OF A DECIMAL
Property Description:	Stories: 1

Property Description:

Stories: 1

This one-story commercial building at the southwest corner of Halsted and 112th streets in the Morgan Park community is clad with yellow brick along its two street elevations. The building has a granite water table, a flat roof, and a crenellated parapet with terra cotta coping. The central section of the Halsted elevation is covered with wood boards laid vertically and spanned by a horizontal strip of rectangular single-pane windows. This elevation has doors on either end that are surrounded by cream-colored terra cotta and topped by ogee arches. The 112th Street elevation has three garage door openings and glass block windows. The storefronts have been completely altered and in-filled. Detailing includes terra cotta finals, decorative panels, and banding at the parapet level. This building lacks integrity and is not individually eligible for listing on the National Register.



Integrity:			Additional Notes/Descriptions
Unaltered	Slight Modificatio	n Major Alteration	Remodeled storefronts, openings in-filled
Condition:			
Excellent	Good	Poor	
Additional Alteration	ons		
Structu	re Usage	Exterior Wall Surface	
Current: NA		Brick (main), granite (water	
Historic: NA		table), terra cotta (accents)	
Roof Material	Roof Features	Roof Type	
Unknown	Parapet	Flat	
Ornamental Archit	ectural Details		Windows
Crenellated parapet,	terra cotta coping, finials	, ogee arches, banding, and	Fixed-pane, glass block
panels			
Outbuildings (Num	ber and Description)		
None			

Local Landmark	Y	<u>N</u>	
National Register Historic Places	Y	<u>N</u>	
National Register Historic District	Y	<u>N</u>	Name:
Individually Eligible? No	Α	BC	Significance:

Additional Comments:			



Historical Resource Recordation Form

Property Name	Photos with Captions: East façade of a brick, two-story, mixed-use building.
Historic: Bldg. not labeled, not in CHRS	Last façade of a blick, two-story, inixed-use building.
Common/Current: Unknown	
Property Address:	
11320-11322 S. Halsted Street	
HAARGIS Number:	
Not in database	
Present Owner and /or Occupant:	
Unknown	
Property Use	
Historic: Mixed-Use	
Current: Mixed-Use	
Date of Construction: 1962	
Architect's Name: Not in CHRS	
Builder/Contractor: Not in CHRS	
Architectural Style:	
Modernistic	
Prepared By: J. Martinez, M. C. Bird, J.	
Guarino	
Photo By: S. Katz	
Date: 24 October 2012	
Property Description:	Stories: 2

Property Description:

Stories: 2

This two-story commercial building in the Morgan Park community has a flat roof, parapet, concrete banding, and projecting corner piers covered with faux stone on the first floor and yellow brick above. Its front elevation is clad with yellow face brick and has a central hollow core metal door flanked by two storefronts, each with central doors and angled display windows. The recessed second floor has a central door and four groups of windows, each of which is comprised of a picture window and flanking one-overone aluminum-sash windows. Although an example of a Mid-Century Modern commercial building, it does not feature sufficient distinguishing architectural features to qualify as individually eligible for listing on the National Register.



Integrity:			Additional Notes/Descriptions
<u>Unaltered</u>	Slight Modification	on Major Alteration	
Condition:			
Excellent	Good	Poor	
Additional Alterati	ons		
Structu	ire Usage	Exterior Wall Surface	
Current: NA		Brick (main), faux stone (piers)	
Historic: NA			
Roof Material	Roof Features	Roof Type	
Unknown	Parapet	Flat	
Ornamental Archit	tectural Details		Windows
Concrete banding, projecting piers			Double-hung, fixed pane
Outbuildings (Num	ber and Description)	•	
None			

Local Landmark	Y <u>N</u>	
National Register Historic Places	Y <u>N</u>	
National Register Historic District	Y <u>N</u>	Name:
Individually Eligible? No	A B C	Significance:

Additional Comments:			



Historical Resource Recordation Form

Property Name	Photos with Captions: North and east façades of a brick, one-story, commercial building
Historic: Bldg. not labeled, not in CHRS	North and east raçades of a breek, one-story, commercial bunding
Common/Current: Unknown	
Property Address:	
11600 S. Halsted Street	e e e e e e e e e e e e e e e e e e e
HAARGIS Number:	
Not in database	
Present Owner and /or Occupant:	
Karastan Rugs & Carpets	
Property Use	
Historic: Commercial	
Current: Commercial	
Date of Construction: 1962	
Architect's Name: Not in CHRS	
Builder/Contractor: Not in CHRS	
Architectural Style:	
Vernacular	
Prepared By: J. Martinez, M. C. Bird, J.	
Guarino	
Photo By: S. Katz	
Date: 24 October 2012	
Property Description:	Stories: 1-2

Property Description:

Stories: 1-2

This one-story retail commercial building at the corner of Halsted and 116th streets in the West Pullman community has a flat roof and parapet; it is clad with light brown face brick. The two street elevations feature a series of tall plate glass display windows that span nearly the entire length of the Halsted Street elevation. A two-story flat-roofed wing situated at the south end of its Halsted Street elevation is clad with the same light brown face brick and has four single-pane windows on the first floor. This building lacks distinguishing architectural features and is not individually eligible for listing on the National Register.



Integrity:			Additional Notes/Descriptions
<u>Unaltered</u>	Slight Modificati	on Major Alteration	
Condition:			
Excellent	Good	Poor	
Additional Alterati	ons		
Structu	ire Usage	Exterior Wall Surface	
Current: NA		Brick	
Historic: NA			
Roof Material	Roof Features	Roof Type	
Unknown	Parapet	Flat	
Ornamental Archit	ectural Details		Windows
None			Fixed pane
Outbuildings (Num	ber and Description)		•
None			

Local Landmark	Y <u>N</u>	
National Register Historic Places	Y <u>N</u>	
National Register Historic District	Y <u>N</u>	Name:
Individually Eligible? No	A B C	Significance:

Additional Comments:			



Historical Resource Recordation Form

Property Name	Photos with Captions:
	East façade of a brick, one-story, single family residence.
Historic: Bldg. not labeled, not in CHRS	
Common/Current: Unknown	
Property Address:	
11642 S. Halsted Street	
HAARGIS Number:	
Not in database	
Present Owner and /or Occupant:	
Unknown	
Property Use	
Historic: Single family residence	
Current: Single family residence	
Date of Construction: 1925	
Architect's Name: Not in CHRS	
Builder/Contractor: Not in CHRS	
Architectural Style:	
Chicago Bungalow	
Prepared By: J. Martinez, M. C. Bird, J.	
Guarino	
Photo By: S. Katz	
Date: 24 October 2012	
Duananty Descriptions	Stariage 1

Property Description:

Stories: 1

This one-story brick-clad bungalow in the West Pullman community is situated on a raised basement and has a hip roof covered with asphalt shingles, a hip dormer, and overhanging eaves. The front elevation has a recessed corner porch with a metal storm door, low brick sidewalls, a corner brick pier support, and concrete steps with metal railings. Windows on the front elevation include a non-original picture window flanked by one-over-one aluminum-sash windows in the living room bay, and a strip of three window openings in the dormer. The house has a synthetic-clad addition at the rear. Detailing includes square insert blocks used as decorative accents and concrete sills. This is an example of a Chicago bungalow, a building type that the City of Chicago has recognized through its Historic Chicago Bungalow Initiative. However, this house lacks distinctive architectural features and is not individually eligible for listing on the National Register.



Integrity:			Additional Notes/Descriptions
Unaltered	Slight Modification	Major Alteration	Replacement windows
Condition:			
Excellent	Good	Poor	
Additional Alteration	ons		
Addition at rear			
Structu	re Usage	Exterior Wall Surface	
Current: NA		Brick	
Current: NA		Direk	
Historic: NA			
Roof Material	Roof Features	Roof Type	
Asphalt shingle	Dormer	Hip	
Ornamental Archit	ectural Details		Windows
Insert blocks, concre	ete sills		Double-hung, sliding or casement
Outbuildings (Num	ber and Description)		·
None			

Local Landmark	Y <u>N</u>	
National Register Historic Places	Y <u>N</u>	
National Register Historic District	Y <u>N</u>	Name:
Individually Eligible? No	A B C	Significance:

Additional Comments:			



Historical Resource Recordation Form

Property Name	Photos with Captions: West façade of a one-story, single family, brick residence.
Historic: Bldg. not labeled, not in CHRS	west façade of a one-story, single faining, offek fesidence.
Common/Current: Unknown	
Property Address:	
11753 S. Halsted Street	
HAARGIS Number:	
Not in database	
Present Owner and /or Occupant:	
Unknown	
Property Use	
Historic: Single family residence	
Current: Single family residence	
Date of Construction: 1914	
Architect's Name: Not in CHRS	
Builder/Contractor: Not in CHRS	
Architectural Style:	
Craftsman	
Prepared By: J. Martinez, M. C. Bird, J.	
Guarino	
Photo By: S. Katz	
Date: 24 October 2012	

Property Description:

Stories: 1

This vacant one-story brick-clad house in the West Pullman community is situated on a raised basement. The building has a hip roof covered with asphalt shingles, a hip dormer with a pair of window openings that only retain their upper sashes, and overhanging eaves. The front elevation has a full-width gabled wood porch with brick pier supports, an off-center hollow core metal door, a small casement window, and a strip of three non-original windows that include two with single panes and one that is double-hung. This house lacks integrity and distinctive architectural features and is not individually eligible for listing on the National Register.



Integrity:			Additional Notes/Descriptions
Unaltered	Slight Modification	Major Alteration	Replacement door and windows
Condition:			
Excellent	Good	Poor	
Additional Alterati	ons		
Structu	ire Usage	Exterior Wall Surface	
Current: NA		Brick	
Historic: NA			
Roof Material	Roof Features	Roof Type	
Asphalt shingle	Dormer	Hip	
Ornamental Archit	ectural Details		Windows
None			Double-hung, casement
Outbuildings (Num	ber and Description)		•
None			

Local Landmark	Y <u>N</u>	
National Register Historic Places	Y <u>N</u>	
National Register Historic District	Y <u>N</u>	Name:
Individually Eligible? No	A B C	Significance:

Additional Comments:			



Historical Resource Recordation Form

Property Name	Photos with Captions: South façade of a masonry, two-story, industrial building.
Historic: Bldg. not labeled, not in CHRS	South façade of a masonity, two-story, industrial building.
Common/Current: Flagstone Veneer Stone	
Galloy &Van Etten Inc. Cut Stone Contractors	
Property Address:	
11756 S. Halsted Street	
HAARGIS Number:	
Not in database	
Present Owner and /or Occupant:	
Flagstone Veneer Stone Galloy &Van Etten	
Inc. Cut Stone Contractors	
Property Use	
Historic: Industrial	
Current: Industrial	
Date of Construction: 1931	
Architect's Name: Not in CHRS	
Builder/Contractor: Not in CHRS	
Architectural Style:	
Vernacular	
Prepared By: J. Martinez, M. C. Bird, J.	
Guarino	
Photo By: Steve Katz	
Date: 24 October 2012	
Property Description: This two-story concrete block light industrial bu	Stories: 2 ilding in the West Pullman community has a one-story wing at its

This two-story concrete block light industrial building in the West Pullman community has a one-story wing at its south end; both the main building and wing have flat roofs. A line of buttresses divide the building's long Halsted Street elevation into a series of thirteen bays; large windows have all been in-filled with synthetic materials. One of these bays features an overhead garage door. The front (south) elevation of the one-story office wing has a hollow core metal door with an in-filled transom, three non-original one-over-one aluminum-sash windows, and two large window openings in-filled with concrete block. An additional flat-roofed one-and-a-half-story wing is situated along the rear of the main building block. Its west elevation features a series of windows and overhead doors. Detailing includes concrete stringcourses and applied letters.

This industrial building is recommended for National Register listing under Criterion A for Industry. Dutch immigrant



Abram Van Etten and his partner George Galloy established the stone fabricating company in 1899. Located in a community that experienced a collapse of its industrial base in the 1970s and considerable disinvestment since that time, the building serves as an important, and rare, example of an early twentieth-century industrial building in West Pullman that retains its original use and ownership. It retains the majority of its original materials with the exception of fenestration along Halsted Street, where it appears that the windows have either been covered or removed.

Structural Survey

Integrity:			Additional Notes/Descriptions
Unaltered	Slight Modification	n Major Alteration	Replacement windows, some openings in-filled
Condition:			
<u>Excellent</u>	Good	Poor	
Additional Alterati	ons		
Structu	ire Usage	Exterior Wall Surface	
Current: NA		Concrete block	
Historic: NA			
Roof Material	Roof Features	Roof Type	
Unknown	Parapet	Flat	
Ornamental Archit	tectural Details		Windows
Buttresses, stringcou	urses, lettering		Double-hung
Outbuildings (Num	ber and Description)		
None			

Local Landmark	Y	<u>N</u>	
National Register Historic Places	Y	<u>N</u>	
National Register Historic District	Y	<u>N</u>	Name:
Individually Eligible? Yes	<u>A</u>	BC	Significance: An important and rare example of an early twentieth century industrial building in West Pullman that retains its original use and ownership.

Additional Comments:



Historical Resource Recordation Form

Property Name	Photos with Captions: West façade of a one-story, multi-family residence.
Historic: Bldg. not labeled, not in CHRS	west laçade of a one story, main failing residence.
Common/Current: Unknown	
Property Address:	
11763 S. Halsted Street	
HAARGIS Number:	
Not in database	
Present Owner and /or Occupant:	
Unknown	
Property Use	
Historic: Single family residence	
Current: Multi-family residence	
Date of Construction: 1904	
Architect's Name: Not in CHRS	
Builder/Contractor: Not in CHRS	
Architectural Style:	
Vernacular	
Prepared By: J. Martinez, M. C. Bird, J.	
Guarino	
Photo By: S. Katz	
Date: 24 October 2012	

Property Description:

Stories: 1

This one-story frame house in the West Pullman community has a raised brick basement and is covered with synthetic siding. The building has a front gable roof covered with asphalt shingles. Its front elevation has a full-width hip-roof wood porch that contains a gable accent above the door. The porch roof is supported with straight posts and railings, and an off-center door and two one-over-one windows on both the raised basement and the first floor levels. The first floor door has a transom: both the door and first floor windows retain their original wood casings with pilasters and cornices. An octagonal ventilating louver is situated in the gable. This house lacks integrity and distinguishing architectural features and is not individually eligible for listing on the National Register.



Integrity:			Additional Notes/Descriptions
Unaltered	<u>Slight Modificatio</u>	n Major Alteration	Replacement cladding and porch rails
Condition:			
Excellent	Good	Poor	
Additional Alteration	ons		
Structu	re Usage	Exterior Wall Surface	
Current: NA		Synthetic siding	
Historic: NA			
Roof Material	Roof Features	Roof Type	
Asphalt shingle	None	Gable	
Ornamental Archit	ectural Details	Windows	
Gable accent on porch roof, window pilasters and cornices			Double-hung
Outbuildings (Num			
None			

Local Landmark	Y <u>N</u>	
National Register Historic Places	Y <u>N</u>	
National Register Historic District	Y <u>N</u>	Name:
Individually Eligible? No	A B C	Significance:

Additional Comments:			



Historical Resource Recordation Form

Property Name	Photos with Captions:
Historic: Not labeled, not in CHRS	South and east façades of one-story, brick, commercial building.
Common/Current: Unknown	
Property Address:	
11800 S. Halsted St.	
HAARGIS Number:	
Not in database	p. III.
Present Owner and /or Occupant:	
Unknown	
Property Use	Thermond All Physical Processing Annual States
Historic: Commercial (Oils & Misc. Storage at Coal Yard, 1939)	
Current: Commercial	
Date of Construction: 1922	
Architect's Name: Not in CHRS database	
Builder/Contractor: Not in CHRS database	
Architectural Style:	
Vernacular	
Prepared By: C. Tolmie, M. C. Bird, J.	
Guarino	
Photo By: S. Katz	
Date: 13 September 2012	
Property Description:	Stories: 1

This one-story brick-clad flat-roofed commercial building at the southwest corner of Halsted and 118th streets in the West Pullman community has a metal door, a glass block window, and a pair of windows along its front (Halsted) elevation, and five window openings along its 118th Street elevation. Fenestration is comprised of one-over-one-windows, three of which are covered with plywood. Both street elevations feature brick corbelling. This building does not feature sufficient integrity or distinguishing features to qualify as eligible for individual listing on the National Register.



Structural Survey

Integrity:			Additional Notes/Descriptions
Unaltered	Slight Modification	Major Alteration	
Condition:			
Excellent	Good	Poor	
Additional Alterati	ons		
Structu	ire Usage	Exterior Wall Surface	
Current: NA		Brick	
Historic: NA			
Roof Material	Roof Features	Roof Type	
Unknown	None	Flat	
Ornamental Archit	ectural Details		Windows
Corbelling			Double-hung, some boarded up
Outbuildings (Num	ber and Description)		
None			


Local Landmark	Y <u>N</u>	
National Register Historic Places	Y <u>N</u>	
National Register Historic District	Y <u>N</u>	Name:
Individually Eligible? No	A B C	Significance:

Additional Comments:

Converted from commercial to residential according to the Sanborn map and CCA records



Historical Resource Recordation Form

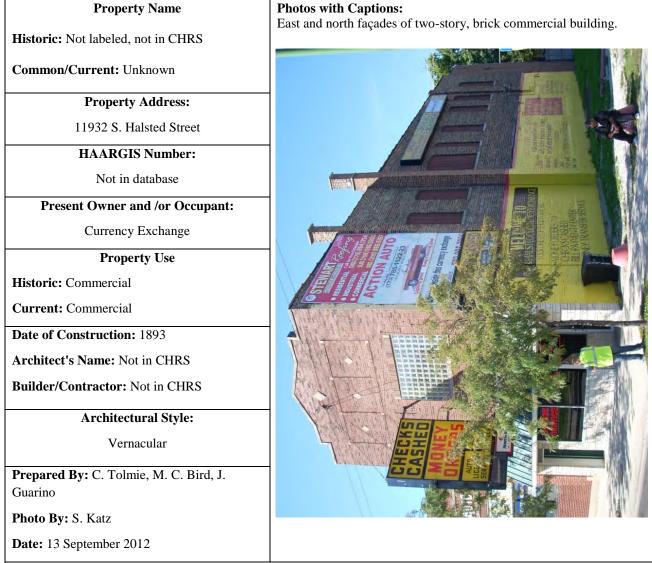

Property Description:

Stories: 2

This two-story commercial building in the West Pullman community has a flat roof and shaped parapet. The first floor of its front elevation is clad in faux stone and has two centrally located display windows and two non-original doors, one at either end: one is glass and the other is metal. The storefront level is topped by a full-width wood signboard and the upper level is clad in brown face brick and has two windows, one of which is in-filled with glass blocks. Detailing includes concrete sills, flat arches, and diamond-shaped stone inserts at the parapet level. All side elevation windows are covered with wood. This building does not feature sufficient integrity or distinguishing features to qualify as eligible for individual listing on the National Register.



Integrity:			Additional Notes/Descriptions
Unaltered	Slight Modificatio	n Major Alteration	Replacement storefront, replacement or bricked windows
Condition:			
<u>Excellent</u>	Good	Poor	
Additional Alterati	ons		
Structu	ire Usage	Exterior Wall Surface	
Current: NA		Brick	
Historic: NA			
Roof Material	Roof Features	Roof Type	
Unknown	Parapet	Flat	
Ornamental Archit	tectural Details	Windows	
Stepped parapet, concrete sills, flat arches, stone inserts			Fixed-pane, glass block
Outbuildings (Num	ber and Description)		
None			

Local Landmark	Y <u>N</u>	
National Register Historic Places	Y <u>N</u>	
National Register Historic District	Y <u>N</u>	Name:
Individually Eligible? No	A B C	Significance:

Additional Comments:			



Historical Resource Recordation Form

Property Name	Photos with Captions: East façade of one-story, brick commercial building.
Historic: Garage (Sanborn, 1939)	East laçade of one-story, onek commercial bundling.
Common/Current: Action Auto Collision Center	
Property Address:	
11934-11938 S. Halsted Street	
HAARGIS Number:	
Not in database	
Present Owner and /or Occupant:	
Action Auto Collision Center	
Property Use	
Historic: Commercial	
Current: Commercial	
Date of Construction: 1926	
Architect's Name: Not in CHRS	
Builder/Contractor: Not in CHRS	
Architectural Style:	
Vernacular	
Prepared By: C. Tolmie, M. C. Bird, J.	
Guarino	
Photo By: S. Katz	
Date: 13 September 2012	
Property Description:	Storios: 1

Property Description:

Stories: 1

This one-story auto repair shop in the West Pullman community has a flat roof and a shaped parapet that is rounded in the center. Its three-bay façade is clad with brown face brick and has an overhead metal garage door in the center and strips of fixed-pane windows on its flanking bays. The south bay also has a metal door with transom. All three bays feature metal signboards. Detailing includes concrete banding, coping, and inserts. This building does not feature sufficient integrity or distinguishing features to qualify as eligible for individual listing on the National Register.



Integrity:			Additional Notes/Descriptions
Unaltered	Slight Modification	on Major Alteration	Replacement windows and garage doors
Condition:			
Excellent	Good	Poor	
Additional Alteration	ons		
Structu	re Usage	Exterior Wall Surface	
Current: NA		Brick	
Historic: NA			
Roof Material	Roof Features	Roof Type	
Unknown	Parapet	Flat	
Ornamental Archit	ectural Details		Windows
Shaped parapet, con-	crete banding, coping, an	Fixed-pane	
Outbuildings (Num	ber and Description)		
None			

Local Landmark	Y <u>N</u>	
National Register Historic Places	Y <u>N</u>	
National Register Historic District	Y <u>N</u>	Name:
Individually Eligible? No	A B C	Significance:

Additional Comments:			



Historical Resource Recordation Form

Property Name	Photos with Captions:
Historic: Not labeled, not in CHRS	East façade of mixed-use, two-story, brick building.
Common/Current: Unknown	
Property Address:	
11944 S. Halsted Street	
HAARGIS Number:	
Not in database	
Present Owner and /or Occupant:	
Unknown	
Property Use	
Historic: Commercial	
Current: Mixed-Use	
Date of Construction: 1926	
Architect's Name: Not in CHRS	
Builder/Contractor: Not in CHRS	
Architectural Style:	
Vernacular	
Prepared By: C. Tolmie, M. C. Bird, J. Guarino	
Photo By: S. Katz	
Date: 13 September 2012	

Property Description:

Stories: 2

This two-story mixed-use building in the West Pullman community has a flat roof and parapet. Its front elevation is clad in red face brick and has an off-center metal door with transom. The storefront has maintained its original design with recessed door and flanking display windows. The second floor has five non-original one-over-one aluminum-sash windows. Detailing includes stone coping with foliate motifs atop first floor brick piers, two spandrel panels with decorative brickwork, stone banding on one-half of the second floor, and a parapet with decorative square terra cotta panels and corner brick panels with corbelling. One-half of the brickwork on the second floor of the front elevation is non-original. This building does not feature sufficient integrity to qualify as eligible for individual listing on the National Register.




Integrity:			Additional Notes/Descriptions
Unaltered	Slight Modification	on Major Alteration	Modifications to half of the second story brickwork
Condition:			
Excellent	Good	Poor	
Additional Alterati	ions		
Structu	ıre Usage	Exterior Wall Surface	
Current: NA		Brick	
Historic: NA			
Roof Material	Roof Features	Roof Type	
Unknown	Parapet	Flat	
Ornamental Archit	tectural Details		Windows
Stone coping, brick	piers, terra cotta panels, c	corbelling	Fixed-pane, double-hung
Outbuildings (Num	iber and Description)		·
None			

Local Landmark	Y <u>N</u>	
National Register Historic Places	Y <u>N</u>	
National Register Historic District	Y <u>N</u>	Name:
Individually Eligible? No	A B C	Significance:

Additional Comments:			



Historical Resource Recordation Form

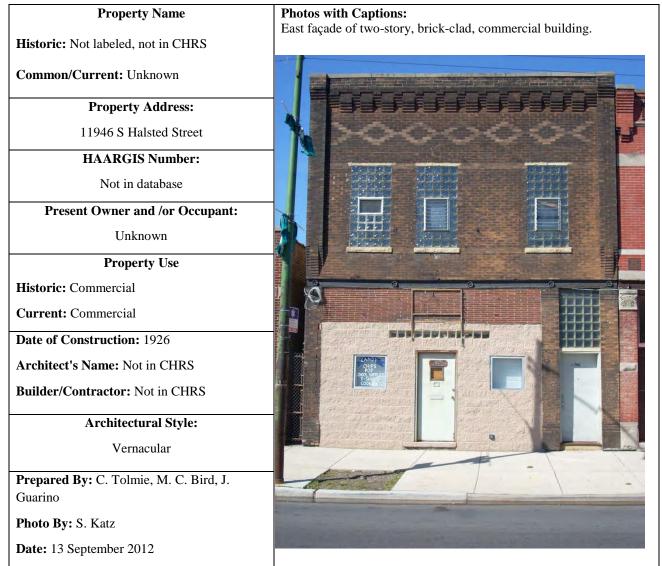

Property Description:

Stories: 2

This two-story commercial building in the West Pullman community has a flat roof and parapet, and is clad with brown face brick. The building's former storefront has been in-filled with concrete block and brick and has a hollow metal door and two non-original square single-pane windows. An off-center entrance that provides access to the second floor has a non-original hollow metal door and its transom has been in-filled with glass blocks. The three window openings on the second floor have been in-filled with glass blocks and ventilating louvers and feature stone sills. Detailing includes corner pilasters with corbelling on the second floor level, buff brickwork arranged in a diamond pattern above the second floor windows, and brick corbelling at the parapet level. This building has experienced a loss of integrity and does not feature sufficient distinctive architectural features to qualify as eligible for individual listing on the National Register.




Integrity:			Additional Notes/Descriptions
Unaltered	Slight Modification	on <u>Major Alteration</u>	Original storefront in-filled with; new doors; window openings in- filled
Condition:			
Excellent	Good	Poor	
Additional Alteration	ons		
Structu	re Usage	Exterior Wall Surface	
Current: NA		Brick	
Historic: NA			
Roof Material	Roof Features	Roof Type	
Unknown	Parapet	Flat	
Ornamental Archit	ectural Details		Windows
Corner pilasters with corbelling, buff brickwork, corbelling			Fixed-pane, glass-block
Outbuildings (Num	ber and Description)		•
None			

Local Landmark	Y	<u>N</u>	
National Register Historic Places	Y	<u>N</u>	
National Register Historic District	Y	<u>N</u>	Name:
Individually Eligible? No	Α	BC	Significance:

Additional Comments:			



Historical Resource Recordation Form

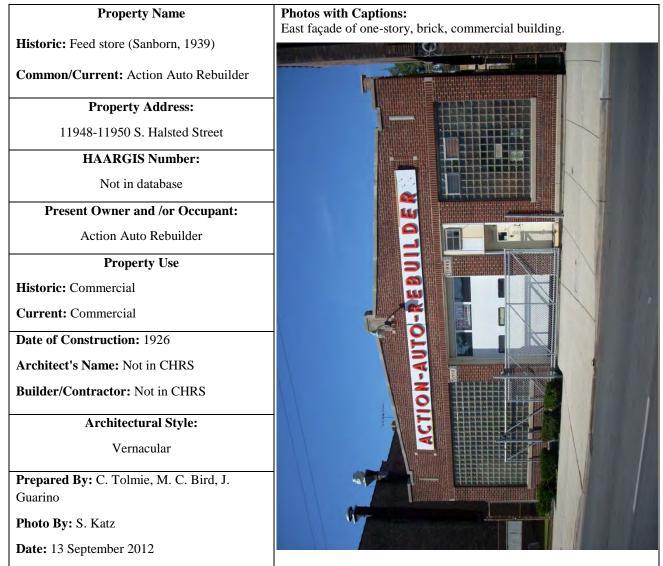

Property Description:

Stories: 1

This one-story auto-repair shop in the West Pullman community has a flat roof and triangular shaped parapet with concrete coping. Its front elevation is clad in brown brick and has a centrally located metal overhead garage door, an adjacent metal door with transom, and large flanking window openings that have been in-filled with glass blocks. Detailing includes concrete sills, coping, insert blocks, brick banding, and a panel displaying the business name. This building does not feature sufficient integrity or distinguishing features to qualify as eligible for individual listing on the National Register.



Structural Survey

Integrity:			Additional Notes/Descriptions
Unaltered	Slight Modification	n Major Alteration	Replacement doors, windows
Condition:			
Excellent	Good	Poor	
Additional Alterati	ons		
Structu	re Usage	Exterior Wall Surface	
Current: NA		Brick	
Historic: NA			
Roof Material	Roof Features	Roof Type	
Unknown	Parapet	Flat	
Ornamental Archit	ectural Details		Windows
Shaped parapet with	concrete coping, concrete	Fixed-pane, glass block	
parapet, brick band	ling, panel displaying th	ne business name	
Outbuildings (Num	ber and Description)		
None			

Local Landmark	Y <u>N</u>	
National Register Historic Places	Y <u>N</u>	
National Register Historic District	Y <u>N</u>	Name:
Individually Eligible? No	A B C	Significance:

Additional Comments:			



Property Name Photos with Captions: East façade of two-story, brick mixed-use building. Historic: Not labeled, not in CHRS Common/Current: Unknown **Property Address:** 11958 S. Halsted Street **HAARGIS Number:** Not in database **Present Owner and /or Occupant:** Unknown **Property Use** Historic: Commercial

Historical Resource Recordation Form

Current: Mixed-use

Date of Construction: 1894

Architect's Name: Not in CHRS Builder/Contractor: Not in CHRS

Architectural Style:

Vernacular

Prepared By: C. Tolmie, M. C. Bird, J. Guarino

Photo By: S. Katz

Date: 13 September 2012

Stories: 2

Cafe

Property Description: This two-story mixed-use building at the northwest corner of Halsted and 120th streets in the West Pullman community has a flat roof and shaped parapet with stone inserts and brick stringcourses. The building fabric at the street corner of the first floor has been removed so that the non-original corner door, which is covered in metal, is deeply recessed. A secondary entrance at the opposite end of the front elevation features a hollow core metal door and transom in-filled with wood and is flanked by original brown brick cladding. The remainder of the first floor along both street elevations features non-original brick cladding. The second floor of the front elevation features a large fixed-pane window flanked by casements and a separate pair of casements, all of which are non-original. Windows and door openings along the 120th Street elevation have been altered and the second floor of this elevation features a series of one-over-one windows. One of these windows is in-filled with glass block. This building does not feature sufficient integrity or distinguishing features to qualify as eligible for individual listing on the National Register.



Integrity:			Additional Notes/Descriptions
Unaltered	Slight Modification	n Major Alteration	Replacement windows and doors, altered first floor
Condition:			
Excellent	Good	Poor	
Additional Alteration	ons		
Structure Usage		Exterior Wall Surface	
Current: NA		Brick	
Historic: NA			
Roof Material	Roof Features	Roof Type	
Unknown	Parapet	Flat	
Ornamental Architectural Details			Windows
Shaped parapet, stone inserts, and brick stringcourses			Double-hung, casement
Outbuildings (Number and Description)			
None			

Local Landmark	Y <u>N</u>	
National Register Historic Places	Y <u>N</u>	
National Register Historic District	Y <u>N</u>	Name:
Individually Eligible? No	A B C	Significance:

Additional Comments:			



Historical Resource Recordation Form

Property Name	Photos with Captions: East façade of one-story, masonry religious building.
Historic: Not labeled, not in CHRS	L'ast laçade of one-story, masonry l'englous bunding.
Common/Current: Unknown	
Property Address:	
12000 S. Halsted Street	ETHEFTER
HAARGIS Number:	
Not in database	
Present Owner and /or Occupant:	
Sure-Way Missionary Baptist Church	
Property Use	
Historic: Commercial	
Current: Religious	
Date of Construction: 1939	
Architect's Name: Not in CHRS	
Builder/Contractor: Not in CHRS	
Architectural Style:	
Art Deco	
Prepared By: C. Tolmie, M. C. Bird, J.	
Guarino	
Photo By: S. Katz	
Date: 13 September 2012	
Duananty Deconintions	Stariog 1

Property Description:

Stories: 1

This Art Deco style one-story church at the southwest corner of Halsted and 120th streets in the West Pullman community has a flat roof and parapet. Its front elevation is clad in smooth limestone and has a centrally located recessed entrance with glass double-doors, a transom, and fluted side walls. The entrance is flanked by two large glass block windows. Detailing includes two flattened stone reliefs featuring eagle motifs, dentils, and banding at the parapet level. A mid-century modern, one-story, flat-roofed wing clad in faux stone and buff brick is situated along the south side of the original building (bottom of photo). It features three large picture windows along its front elevation and wide roof overhangs.

This is a nice example of a stripped down Art Deco façade and a mid-century modern wing. However, the alternation of the two large window openings with glass block infill compromises the integrity of this small building, which no longer serves it original use. As a result, this building does not qualify as eligible for individual listing on the National Register.




Integrity:			Additional Notes/Descriptions
Unaltered	Slight Modification	on Major Alteration	Replacement windows
Condition:			
<u>Excellent</u>	Good	Poor	
Additional Alterati	ions		
Post WWII addition	on south side		
Structu	ıre Usage	Exterior Wall Surface	
Current: NA Historic: NA		Stone (façade), Brick (sides and rear)	
Roof Material	Roof Features	Roof Type	
Unknown	Parapet	Flat	
Ornamental Archit	tectural Details	Windows	
Eagles in relief, fluted side walls and parapet with dentils and banding			Glass block
Outbuildings (Num	iber and Description)		
None			

Local Landmark	Y <u>N</u>	
National Register Historic Places	Y <u>N</u>	
National Register Historic District	Y <u>N</u>	Name:
Individually Eligible? No	A B C	Significance:

Additional Comments:			



Historical Resource Recordation Form

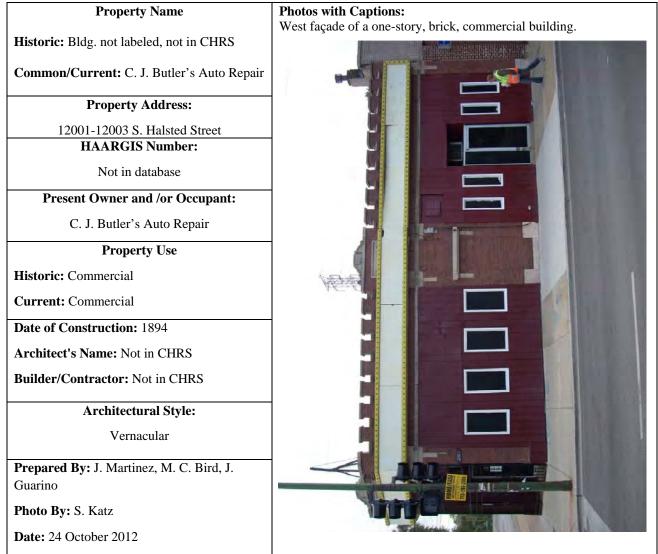

Property Description:

Stories: 1

This one-story commercial building in the West Pullman community is clad with orange-brown face brick on its 120th Street elevation and synthetic siding on its Halsted elevation. The building has a flat roof and a crenellated parapet with concrete coping. The parapet is obscured by a continuous metal sign plate. The recessed corner entrance has a non-original plate glass door with an in-filled transom. The Halsted Street elevation has been altered with installation of a series of fixed-pane windows and an off-center glass door. However, this elevation retains four original brick piers with stone coping and geometric motifs as well as a portion of original brick cladding in the center, which includes a stone lintel above the outline of a former door opening now in-filled with brick. The 120th Street elevation includes two non-original doors, three double-hung wood-sash windows, and brick corbelling at the roofline. This building lacks integrity and distinctive architectural features and is not individually eligible for listing on the National Register.



Integrity:			Additional Notes/Descriptions
Unaltered	Slight Modificatio	n Major Alteration	Replacement doors, cladding & windows; openings in-filled
Condition:			
<u>Excellent</u>	Good	Poor	
Additional Alterati	ons		
Structu	ire Usage	Exterior Wall Surface	
Current: NA		Brick, synthetic siding	
Historic: NA			
Roof Material	Roof Features	Roof Type	
Unknown	Parapet	Flat	
Ornamental Archit	ectural Details		Windows
Crenellated parapet,	concrete coping, brick pie	Fixed pane, double-hung	
geometric motifs, sto	one lintel, brick corbelling		
Outbuildings (Num	ber and Description)		
None			

Local Landmark	Y	<u>N</u>	
National Register Historic Places	Y	<u>N</u>	
National Register Historic District	Y	<u>N</u>	Name:
Individually Eligible? No	Α	BC	Significance:

Additional Comments:			



Historical Resource Recordation Form

Property Name	Photos with Captions:
	East façade of two-story, mixed-use, brick building.
Historic: Not labeled, not in CHRS	
Common/Current: Unknown	
Property Address:	
12018 S. Halsted Street	
HAARGIS Number:	
Not in database	
Present Owner and /or Occupant:	
Unknown	
Property Use	
Historic: Commercial	
Current: Mixed-Use	
Date of Construction: 1916	
Architect's Name: Not in CHRS	
Builder/Contractor: Not in CHRS	
Architectural Style:	
Vernacular	
Prepared By: C. Tolmie, M. C. Bird, J. Guarino	
Photo By: S. Katz	
Date: 13 September 2012	

Property Description:

Stories: 2

This two-story mixed-use building in the West Pullman community has a flat roof and shaped parapet. Its front elevation is clad in brown and buff-colored face brick and has a storefront with recessed glass door flanked by display windows with transoms that are in-filled. A secondary entrance has a non-original hollow metal door and provides access to the upper level apartment. The second floor of the front elevation has five non-original one-over-one aluminum-sash windows. Detailing includes flat arches, stick-like molding in stone at the parapet level and a stone panel with decorative shield and swags motif. This building does not feature sufficient integrity or distinguishing features to qualify as eligible for individual listing on the National Register.



Integrity:			Additional Notes/Descriptions
Unaltered	Slight Modification	Major Alteration	Replacement window and doors
Condition:			
Excellent	Good	Poor	
Additional Alterati	ons		
Structu	ire Usage	Exterior Wall Surface	
Current: NA		Brick	
Historic: NA			
Roof Material	Roof Features	Roof Type	
Unknown	Parapet	Flat	
Ornamental Archit	ectural Details		Windows
Shaped parapet, flat	arches, stone molding, stor	Fixed-pane, double-hung	
stone inserts			
Outbuildings (Num	ber and Description)		
None			

Local Landmark	Y <u>N</u>	
National Register Historic Places	Y <u>N</u>	
National Register Historic District	Y <u>N</u>	Name:
Individually Eligible? No	A B C	Significance:

Additional Comments:			



Historical Resource Recordation Form

Property Name	Photos with Captions:
Historic: Not labeled, not in CHRS	East façade of two-story, brick, mixed-use building.
Common/Current: Unknown	
Property Address:	
12022 S. Halsted Street	
HAARGIS Number:	
Not in database	
Present Owner and /or Occupant:	
Pick-a-Tool Rentals	
Property Use	and the second s
Historic: Commercial	
Current: Mixed-Use	
Date of Construction: 1898	
Architect's Name: Not in CHRS	
Builder/Contractor: Not in CHRS	
Architectural Style:	
Vernacular	
Prepared By: C. Tolmie, M. C. Bird, J. Guarino	
Photo By: S. Katz	the second se
Date: 13 September 2012	

Property Description:

Stories: 2

This two-story mixed-use building in the West Pullman community has a flat roof and shaped parapet. Its front elevation is clad in brown and orange-colored brick and has a storefront with a recessed glass door flanked by display windows and transoms covered with signage. A secondary entrance with wood door and transom provides access to the upper level apartment. This door's original glass has been replaced with wood. The second floor of the front elevation has five three-over-one wood-sash windows. Detailing includes rows of vertical bricks, stone sills, and concrete coping. This building does not feature sufficient distinguishing features to quality as eligible for individual listing on the National Register.



Integrity:			Additional Notes/Descriptions
Unaltered	Slight Modification	on Major Alteration	
Condition:			
Excellent	Good	Poor	
Additional Alterati	ons		
Structu	ire Usage	Exterior Wall Surface	
Current: NA		Brick	
Historic: NA			
Roof Material	Roof Features	Roof Type	
Unknown	Parapet	Flat	
Ornamental Archit	tectural Details	Windows	
Stone sills, inserts, coping, and brick stringcourses			Fixed-pane, double-hung
Outbuildings (Num	ber and Description)	·	
None			

Local Landmark	Y <u>N</u>	
National Register Historic Places	Y <u>N</u>	
National Register Historic District	Y <u>N</u>	Name:
Individually Eligible? No	A B C	Significance:

Additional Comments:		



Historical Resource Recordation Form

Property Name	Photos with Captions: West façade of a brick, two-story, multi-family residence.
Historic: Bldg. not labeled, not in CHRS	west façade of a blick, two-story, multi-family fesidence.
Common/Current: Unknown	
Property Address:	
12033 S. Halsted Street	
HAARGIS Number:	
Not in database	
Present Owner and /or Occupant:	
Unknown	
Property Use	
Historic: Flat	
Current: Multi-family residence	
Date of Construction: 1914	
Architect's Name: Not in CHRS	
Builder/Contractor: Not in CHRS	
Architectural Style:	
Vernacular	and burning human human human have
Prepared By: J. Martinez, M. C. Bird, J.	
Guarino	innin,
Photo By: S. Katz	
Date: 24 October 2012	

Property Description:

Stories: 2

This two-story residence in the West Pullman community is situated on a raised basement and is clad with brown face brick on the front elevation and common brick on the side and rear elevations. The building has a gambrel roof covered with asphalt shingles. The front elevation has a full-width hip-roofed wood porch, one-half of which has been enclosed with synthetic siding and has a picture window. The open half of the porch has an off-center doorway that has been in-filled with brick, wood steps, and a corner tapered wood column at the corner. The entrance into the home is through the enclosed porch. The second floor of the front elevation has a bay with a picture window flanked by one-over-one aluminum-sash windows and a pair of one-over-one aluminum-sash windows. The attic level has a pair of windows. The side elevations feature one-over-one aluminum-sash windows of varying sizes and a small dormer. All windows are modern replacements. This house lacks integrity and distinctive architectural features and is not individually eligible for listing on the National Register.



Integrity:			Additional Notes/Descriptions
Unaltered	Slight Modification	Major Alteration	Replacement windows and door
Condition:			
Excellent	Good	Poor	
Additional Alteration	ons		
Front porch enclosed	l		
Structu	re Usage	Exterior Wall Surface	
Current: NA		Brick (main)	
Historic: NA		Synthetic siding (porch)	
Roof Material	Roof Features	Roof Type	
Asphalt shingle	Dormer	Gambrel	
Ornamental Archite	ectural Details		Windows
None			Double-hung, fixed-pane
Outbuildings (Num	ber and Description)		
None			

Local Landmark	Y <u>N</u>	
National Register Historic Places	Y <u>N</u>	
National Register Historic District	Y <u>N</u>	Name:
Individually Eligible? No	A B C	Significance:

Additional Comments:			



Historical Resource Recordation Form

Property Name	Photos with Captions:
	East façade of a two-story, masonry, mixed-use building.
Historic: Bldg. not labeled, not in CHRS	
Common/Current: Unknown	
Property Address:	
12048 S. Halsted Street	
HAARGIS Number:	
Not in database	
Present Owner and /or Occupant:	
Unknown	
Property Use	
Historic: Commercial	
Current: Mixed-Use	
Date of Construction: 1901	
Architect's Name: Not in CHRS	Anather Anather Anather
Builder/Contractor: Not in CHRS	
Architectural Style:	
Vernacular	
Prepared By: J. Martinez, M. C. Bird, J. Guarino	
Photo By: S. Katz	
Date: 24 October 2012	

Property Description:

Stories: 2

This two-story mixed-use building in the West Pullman community has a flat roof and parapet. Its front elevation is clad with non-original brick below the display windows, rusticated limestone up to the parapet level, and orange brick above. The side and rear elevations are clad in orange brick. The front elevation has a pent roof, a strip of display windows, a non-original off-center door on the first floor, and four non-original one-over-one aluminum-sash windows, three of which are grouped together, on the second floor. Detailing includes a stone panel with foliate motif on the second floor. The south elevation has first floor windows that are in-filled with glass block and a series of one-over-one wood-sash windows on the second floor. This building lacks integrity and distinctive architectural features and is not individually eligible for listing on the National Register.



Integrity:			Additional Notes/Descriptions
Unaltered	Slight Modification	Major Alteration	Replacement door, windows, and cladding; some openings infilled
Condition:			
Excellent	Good	Poor	
Additional Alterati	ons		
Structu	ire Usage	Exterior Wall Surface	
Current: NA		Brick (main),	
Historic: NA		Stone (partial façade)	
Roof Material	Roof Features	Roof Type	
Unknown	Parapet	Flat	
Ornamental Archit	ectural Details		Windows
Stone panel with fol	iate motif		Double-hung, fixed-pane, glass block
Outbuildings (Num	ber and Description)		
None			

Local Landmark	Y	<u>N</u>	
National Register Historic Places	Y	<u>N</u>	
National Register Historic District	Y	<u>N</u>	Name:
Individually Eligible? No	Α	BC	Significance:

Additional Comments:			



Historical Resource Recordation Form

Property Name	Photos with Captions:
Historic Dida actichated actic CUDS	East façade of a one-story single family residence.
Historic: Bldg. not labeled, not in CHRS	
Common/Current: Unknown	
Property Address:	
12142 S. Halsted Street	
HAARGIS Number:	
Not in database	
Present Owner and /or Occupant:	
Unknown	
Property Use	
Historic: Single family residence	
Current: Single family residence	
Date of Construction: 1942	
Architect's Name: Not in CHRS	
Builder/Contractor: Not in CHRS	
Architectural Style:	
Vernacular	
Prepared By: J. Martinez, M. C. Bird, J.	
Guarino	
Photo By: S. Katz	
Date: 24 October 2012	
Property Description:	Stories: 1

This one-story home in the West Pullman community sits atop a raised basement and is clad with face brick on the front elevation and common brick on the side and rear elevations. The building has a side-gabled roof covered with asphalt shingles and two synthetic-clad gable dormers, each of which has a non-original one-over-one aluminum-sash window. Its front elevation has a gabled, brick-clad vestibule with a metal storm door and concrete steps with metal railings. The vestibule is flanked by paired non-original one-overone aluminum-sash windows on either side. Detailing includes soldier course lintels and a brick door surround. The residence does not display distinguishing architectural features and is not individually eligible for listing on the National Register



Integrity:			Additional Notes/Descriptions
Unaltered	Slight Modification	Major Alteration	Replacement windows and cladding (dormers)
Condition:			
<u>Excellent</u>	Good	Poor	
Additional Alteration	ons		
Structu	re Usage	Exterior Wall Surface	
Current: NA		Brick (main),	
Historic: NA		Synthetic siding (dormers)	
Roof Material	Roof Features	Roof Type	
Asphalt shingle	Dormers	Gable	
Ornamental Archit	ectural Details		Windows
Lintels, surround			Double-hung
Outbuildings (Num	ber and Description)		
None			

Local Landmark	Y <u>N</u>	
National Register Historic Places	Y <u>N</u>	
National Register Historic District	Y <u>N</u>	Name:
Individually Eligible? No	A B C	Significance:

Additional Comments:			



Historical Resource Recordation Form

Property Name	Photos with Captions: West façade of a two-story, multi-family, frame residence.
Historic: Bldg. not labeled, not in CHRS	west laçade of a two story, manie residence.
Common/Current: Unknown	
Property Address:	
12155 S. Halsted Street	
HAARGIS Number:	
Not in database	
Present Owner and /or Occupant:	
Unknown	
Property Use	
Historic: Single family residence	
Current: Multi-family residence	
Date of Construction: 1920	
Architect's Name: Not in CHRS	
Builder/Contractor: Not in CHRS	
Architectural Style:	
Vernacular	
Prepared By: J. Martinez, M. C. Bird, J.	
Guarino	descent and the second s
Photo By: S. Katz	The second second second second
Date: 24 October 2012	
Property Description:	Stories: 2

Property Description:

Stories: 2

This two-story frame house in the West Pullman community is situated on a raised concrete block basement with glass block windows and is covered with synthetic siding. The building has a front gable roof covered with asphalt shingles. Its front elevation has an off-center hollow core metal door, a partial-width flat-roofed porch with wood posts and railings, and concrete steps. The building also has a two-story, three-sided window bay pavilion and a single window on the second floor, and one window in the gable. The cladding, doors, railings, and windows non-original; above the basement, windows are one-over-one aluminum-sash. This building lacks integrity and distinctive architectural features and is not individually eligible for listing on the National Register.



Integrity:			Additional Notes/Descriptions
Unaltered	Slight Modification	n Major Alteration	Replacement door, windows, cladding, and porch rails
Condition:			
<u>Excellent</u>	Good	Poor	
Additional Alterati	ons		
Structu	ire Usage	Exterior Wall Surface	
Current: NA		Synthetic siding	
Historic: NA			
Roof Material	Roof Features	Roof Type	
Asphalt shingle	None	Gable	
Ornamental Archit	tectural Details		Windows
None			Double-hung, glass block
Outbuildings (Num	ber and Description)		·
None			

Local Landmark	Y <u>N</u>	
National Register Historic Places	Y <u>N</u>	
National Register Historic District	Y <u>N</u>	Name:
Individually Eligible? No	A B C	Significance:

Additional Comments:	



Historical Resource Recordation Form

Property Name	Photos with Captions: East faced of a one-story, brick, commercial building.
Historic: Bldg. not labeled, not in CHRS	
Common/Current: Unknown	
Property Address:	
12156 S. Halsted Street	
HAARGIS Number:	
Not in database	
Present Owner and /or Occupant:	
Battery Sales Inc.	
Property Use	
Historic: Commercial	
Current: Commercial	
Date of Construction: 1937	
Architect's Name: Not in CHRS	
Builder/Contractor: Not in CHRS	
Architectural Style:	
Vernacular	
Prepared By: J. Martinez, M. C. Bird, J.	
Guarino	
Photo By: S. Katz	
Date: 24 October 2012	

Property Description:

Stories: 1

This one-story flat-roofed commercial building in the West Pullman community has a three-bay front elevation with four brick piers and a clay tile parapet. The central bay is in-filled with concrete block and has a hollow core metal door. The flanking bay to the south has two single-pane windows. The bay to the north has a pair of wood doors. Other window openings along the side elevations have been in-filled with concrete block. This building lacks integrity and distinctive architectural features and is not individually eligible for listing on the National Register.



Integrity:			Additional Notes/Descriptions
Unaltered	Slight Modification	Major Alteration	In-filled window openings
Condition:			
Excellent	Good	Poor	
Additional Alterati	ons		
Structu	re Usage	Exterior Wall Surface	
Current: NA		Brick	
Historic: NA			
Roof Material	Roof Features	Roof Type	
Unknown	Parapet	Flat	
Ornamental Archit	ectural Details		Windows
None			Fixed-pane
Outbuildings (Num	ber and Description)		·
None			

Local Landmark	Y	<u>N</u>	
National Register Historic Places	Y	<u>N</u>	
National Register Historic District	Y	<u>N</u>	Name:
Individually Eligible? No	Α	B C	Significance:

Additional Comments:			



Historical Resource Recordation Form

Property Name	Photos with Captions:
Historic: Bldg. not labeled, not in CHRS	East and north façades of the one-story, brick, commercial buildings at 11212 (left) and 11216 (right).
Common/Current: Unknown	
Property Address:	
12212-12220 S. Halsted Street	
HAARGIS Number:	
Not in database	EUCG FABRICATING= KEDING ==
Present Owner and /or Occupant:	
FWC Fabricating and Welding Co.	
Property Use	
Historic: Commercial	East façade of the one-story, brick, commercial building at 11220.
Current: Commercial	
Date of Construction: 1955	
Architect's Name: Not in CHRS	
Builder/Contractor: Not in CHRS	
Architectural Style:	
Vernacular	
Prepared By: J. Martinez, M. C. Bird, J.	
Guarino	
Photo By: S. Katz	

Date: 24 October 2012

Property Description:

Stories: 1

This address consists of three commercial buildings in the West Pullman community that share common party walls. The 12212 building is a one-story, flat-roofed, concrete block building with brick laid in a running bond on its Halsted elevation; it features a pair of plate-glass double doors and the outlines of two former window openings and a door opening that have been in-filled with brick. The 12216 building is a one-story flat-roofed building with a brick front, an off-center door, a strip of three window openings (one in-filled and two fixed pane), and concrete banding above the windows and at the roofline. The 12220 building is a one-story flat-roofed building that is set back from the sidewalk; it has a south-facing front elevation with a pair of plate-glass double doors and a Mid-Century modern shed-roofed canopy supported by wood posts embedded in faux stone planters. The lower portion of 12220's east (Halsted) and south elevations are faced with wood boards that are vertically laid. These buildings lack distinctive architectural features and are not individually eligible for listing on the National Register.




Integrity:			Additional Notes/Descriptions
Unaltered	Slight Modification	Major Alteration	Some window openings in-filled with brick
Condition:			
Excellent	Good	Poor	
Additional Alterati	ons		
Structu	re Usage	Exterior Wall Surface	
Current: NA		Brick, Concrete block	
Historic: NA			
Roof Material	Roof Features	Roof Type	
Unknown	None	Flat	
Ornamental Archit	ectural Details		Windows
Concrete banding (12216), canopy (12220)			Fixed pane
Outbuildings (Num	ber and Description)		
None			

Local Landmark	Y <u>N</u>	
National Register Historic Places	Y <u>N</u>	
National Register Historic District	Y <u>N</u>	Name:
Individually Eligible? No	A B C	Significance:



Historical Resource Recordation Form

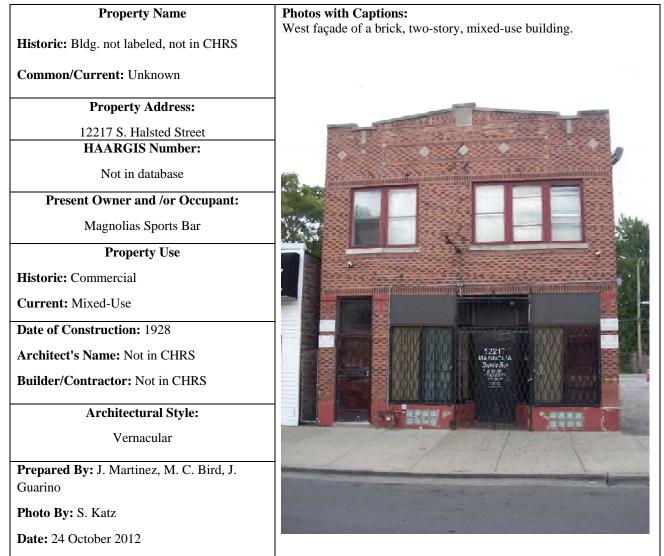

Property Description:

Stories: 2

This two-story mixed-use building in the West Pullman neighborhood is clad with multi-colored face brick (laid in a pattern) on the front elevation and common brick along the side and rear elevations. The building has a flat roof and shaped parapet. The front elevation has a concrete water table with decorative glass blocks, a storefront with recessed central entrance and flanking display windows, and an off-center door that provides access to the second floor. Transoms above storefront windows and the off-center entry have been in-filled. Second floor windows include five non-original one-over-one aluminum-sash windows arranged in a pair and in a group of three. Detailing includes insert blocks, a concrete panel with shield motif, coping, brick stringcourse, brick recessed panel, and concrete sills. Additional detailing includes concrete inserts along the storefront façade. This building lacks integrity and distinctive architectural features and is not individually eligible for listing on the National Register.



Integrity:			Additional Notes/Descriptions
Unaltered	Slight Modificat	ion Major Alteration	Replacement door and windows
Condition:			
Excellent	Good	Poor	
Additional Alteration	ons		
Structu	re Usage	Exterior Wall Surface	
Current: NA		Brick	
Historic: NA			
Roof Material	Roof Features	Roof Type	
Unknown	Parapet	Flat	
Ornamental Archit	ectural Details		Windows
Concrete insert block	ks, panel, coping, patter	ned bricks, panels, stringcourse,	Double-hung, fixed pane
concrete sills, glass b	plocks		
Outbuildings (Num	ber and Description)		
None			

Local Landmark	Y <u>N</u>	
National Register Historic Places	Y <u>N</u>	
National Register Historic District	Y <u>N</u>	Name:
Individually Eligible? No	A B C	Significance:

Additional Comments:			



Historical Resource Recordation Form

Property Name	Photos with Captions: East façade of a brick, two-story, industrial building.
Historic: Structural Steel Shop	Last façade of a brick, two-story, industrial bundling.
Common/Current: Fabricating & Welding	
Corp.	
Property Address:	
12246 S. Halsted Street	
HAARGIS Number:	
Not in database	
Present Owner and /or Occupant:	
Fabricating & Welding Corp.	
Property Use	
Historic: Industrial	
Current: Industrial	
Date of Construction: 1929	
Architect's Name: Not in CHRS	Bitter Store
Builder/Contractor: Not in CHRS	
Architectural Style:	
Vernacular	
Prepared By: J. Martinez, M. C. Bird, J.	I BERT
Guarino	
Photo By: S. Katz	
Date: 24 October 2012	
Proporty Description.	Staniage 2

Property Description:

Stories: 2

The industrial building in the West Pullman community is clad with face brick along the Halsted elevation. It features a shaped parapet, symmetrical façade, and central entrance with a concrete surround featuring scrolled brackets and a lintel with curvilinear motifs. The building includes two garage door openings with brick arches and stone keystones; one of the garage bays is in-filled with concrete block. Detailing includes four brick pilasters, a concrete belt course, concrete panels, a brick arch with keystone spanning the width of the garage door opening, and concrete coping and sills. Former window openings on the first floor are in-filled with decorative stone. Three of the five second-floor window openings are in-filled with glass block, two are double-hung aluminum sash. This building lacks integrity and is not individually eligible for listing on the National Register.



Structural Survey

Integrity:			Additional Notes/Descriptions
Unaltered	<u>Slight Modificati</u>	ion Major Alteration	Door and window openings infilled with concrete block and stone
Condition:			
Excellent	Good	Poor	
Additional Alterati	ons		
Structu	re Usage	Exterior Wall Surface	
Current: NA		Brick	
Historic: NA			
Roof Material	Roof Features	Roof Type	
Unknown	Parapet	Flat	
Ornamental Archit	ectural Details		Windows
Brick pilasters, conc	rete belt courses, brick a	arches, keystone, concrete coping,	Double-hung, glass block
sills, and panels, con	crete surround at entran	ce, lintels, brick panels	
Outbuildings (Num	ber and Description)		
None			

Local Landmark	Y <u>N</u>	
National Register Historic Places	Y <u>N</u>	
National Register Historic District	Y <u>N</u>	Name:
Individually Eligible? No	A B C	Significance:

Additional Comments:



Historical Resource Recordation Form

Property Name	Photos with Captions: East façade of a brick, one-story, commercial building.
Historic: Bldg. not labeled, not in CHRS	Last laçade of a brick, one story, commercial building.
Common/Current: Unknown	
Property Address:	
12308 S. Halsted Street	
HAARGIS Number:	
Not in database	
Present Owner and /or Occupant:	
Unknown	
Property Use	
Historic: Commercial	
Current: Commercial	
Date of Construction: 1950	
Architect's Name: Not in CHRS	
Builder/Contractor: Not in CHRS	
Architectural Style:	
Vernacular	
Prepared By: J. Martinez, M. C. Bird, J.	
Guarino	
Photo By: S. Katz	
Date: 24 October 2012	
December December 41 and	Stars 1

Property Description:

Stories: 1

This one-story, flat-roofed, commercial building in Calumet Park is clad with orange face brick along its Halsted Street elevation and with common brick along its side and rear elevations. Its front elevation has a central plate glass door flanked by strips of three single-pane windows on either side. Detailing is limited to concrete coping, sills, and inserts blocks. Brackets and shadows on the façade suggest that a sign plate has been removed. This building lacks distinctive architectural features and is not individually eligible for listing on the National Register.



Integrity:			Additional Notes/Descriptions
<u>Unaltered</u>	Slight Modification	Major Alteration	
Condition:			
Excellent	Good	Poor	
Additional Alteration	ons		
Sign plate may have	been present.		
Structu	ire Usage	Exterior Wall Surface	
Current: NA		Brick	
Historic: NA			
Roof Material	Roof Features	Roof Type	
Unknown	Parapet	Flat	
Ornamental Archit	ectural Details		Windows
Concrete coping, sill	ls, and insert blocks		Fixed-pane
Outbuildings (Num	ber and Description)		
None			

Local Landmark	Y <u>N</u>	
National Register Historic Places	Y <u>N</u>	
National Register Historic District	Y <u>N</u>	Name:
Individually Eligible? No	A B C	Significance:

Additional Comments:			



Historical Resource Recordation Form

Property Name	Photos with Captions: West façade of a brick, one-story, commercial building.
Historic: Bldg. not labeled, not in CHRS	West façade of a offen, one story, commercial bandary.
Common/Current: Unknown	
Property Address:	
12309 S. Halsted Street	
HAARGIS Number:	
Not in database	Similar Simi
Present Owner and /or Occupant:	
AAMCO Transmissions	
Property Use	
Historic: Commercial	
Current: Commercial	
Date of Construction: 1953	
Architect's Name: Not in CHRS	
Builder/Contractor: Not in CHRS	
Architectural Style:	
Vernacular	
Prepared By: J. Martinez, M. C. Bird, J.	A MARCA
Guarino	
Photo By: S. Katz	
Date: 29 October 2012	

Property Description:

Stories: 1

This one-story flat-roofed commercial building in the West Pullman community is clad with brown face brick on its front elevation and common brick along its side and rear elevations. The front elevation has a concrete water table and a recessed, centrally located hollow core metal door with an in-filled transom. There are four large window openings with concrete sills, two of which are in-filled and two of which are fixed-pane. It has a stepped parapet with concrete coping. This building lacks distinctive architectural features and is not individually eligible for listing on the National Register.




Integrity:			Additional Notes/Descriptions
Unaltered	Slight Modification	Major Alteration	Some windows in-filled
Condition:			
Excellent	Good	Poor	
Additional Alterati	ons		
Structu	ire Usage	Exterior Wall Surface	
Current: NA		Brick	
Historic: NA			
Roof Material	Roof Features	Roof Type	
Unknown	Parapet	Flat	
Ornamental Archit	tectural Details		Windows
Concrete coping, sills			Fixed-pane
Outbuildings (Number and Description)			
None			

Local Landmark	Y <u>N</u>	
National Register Historic Places	Y <u>N</u>	
National Register Historic District	Y <u>N</u>	Name:
Individually Eligible? No	A B C	Significance:

Additional Comments:			



Historical Resource Recordation Form

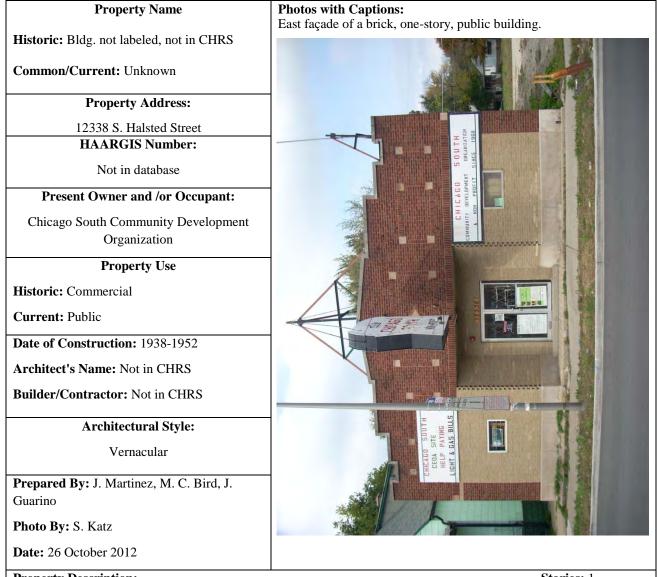

Property Description:

Stories: 1

This one-story brick building in Calumet Park has a concrete water table, flat roof, and stepped parapet with concrete coping. The storefront level has been altered with the installation of non-original buff brick cladding. The alteration has replaced original windows and doors; there are now plate glass double-doors in the centrally-located recessed entrance vestibule and two small single-pane windows. The parapet features decorative brickwork and square insert blocks. This building lacks distinctive architectural features and is not individually eligible for listing on the National Register.



Integrity:			Additional Notes/Descriptions
Unaltered	Slight Modification	n Major Alteration	Replacement storefront façade, windows, doors
Condition:			
Excellent	Good	Poor	
Additional Alterati	ons		
Structu	re Usage	Exterior Wall Surface	
Current: NA		Brick	
Historic: NA			
Roof Material	Roof Features	Roof Type	
Unknown	Parapet	Flat	
Ornamental Archit	ectural Details		Windows
Stepped parapet with concrete coping, decorative panels, insert blocks, soldier			Fixed pane
course, concrete wat	er table		
Outbuildings (Num	ber and Description)		
None			

Local Landmark	Y <u>N</u>	
National Register Historic Places	Y <u>N</u>	
National Register Historic District	Y <u>N</u>	Name:
Individually Eligible? No	A B C	Significance:

Additional Comments:			



Historical Resource Recordation Form

Property Name	Photos with Captions:
Historic: Bldg. not labeled, not in CHRS	West and south facades if a one-story, brick, commercial building.
Common/Current: The New Halsted Bowl	
Property Address:	
12345 S. Halsted Street	
HAARGIS Number:	
Not in database	
Present Owner and /or Occupant:	
The New Halsted Bowl	
Property Use	
Historic: Commercial	
Current: Commercial	
Date of Construction: 1959	
Architect's Name: Not in CHRS	
Builder/Contractor: Not in CHRS	
Architectural Style:	
Vernacular	
Prepared By: J. Martinez, M. C. Bird, J.	
Guarino	
Photo By: S. Katz	
Date: 29 October 2012	
Property Description:	Stories: 1

This one-story bowling alley at the northeast corner of Halsted and 124th streets in the West Pullman community has a flat roof with a shallow domed area on its north side. Both street elevations are clad with alternating bands of yellow and orange colored face brick and are largely unadorned, except for the south end of the Halsted Street elevation, which is clad with a stone veneer and has glass double-doors and three double-hung windows. The stone veneer turns the corner to cover a small portion of the 124th Street elevation, which is pierced by an in-filled window opening. This building lacks distinctive architectural features and is not individually eligible for listing on the National Register.



Integrity:			Additional Notes/Descriptions
Unaltered	Slight Modification	Major Alteration	One in-filled window opening
Condition:			
<u>Excellent</u>	Good	Poor	
Additional Alterati	ons		
Structu	re Usage	Exterior Wall Surface	
Current: NA		Brick (main),	
Historic: NA		Faux stone (entrance)	
Roof Material	Roof Features	Roof Type	
Unknown	None	Flat, domed	
Ornamental Archit	ectural Details		Windows
Banded brick colors			Double-hung
Outbuildings (Num	ber and Description)		·
None			

Local Landmark	Y <u>N</u>	
National Register Historic Places	Y <u>N</u>	
National Register Historic District	Y <u>N</u>	Name:
Individually Eligible? No	A B C	Significance:

Additional Comments:		



Historical Resource Recordation Form

Property Name	Photos with Captions: East façade of a 1.5-story, single family, frame residence.
Historic: Bldg. not labeled, not in CHRS	Last laçade of a 1.5 story, single taliniy, france festeblee.
Common/Current: Unknown	
Property Address:	
12352 S. Halsted Street	There are a second and the second sec
HAARGIS Number:	
Not in database	
Present Owner and /or Occupant:	
Unknown	
Property Use	
Historic: Single family residence	
Current: Single family residence	
Date of Construction: 1924	
Architect's Name: Not in CHRS	
Builder/Contractor: Not in CHRS	
Architectural Style:	
Vernacular	
Prepared By: J. Martinez, M. C. Bird, J.	
Guarino	
Photo By: S. Katz	
Date: 26 October 2012	
n . n	

Property Description:

Stories: 1.5

This one-and-a-half-story frame cottage in Calumet Park is situated on a raised concrete block basement with glass block windows and is covered with synthetic siding. The building has a front gable roof covered with asphalt shingles and shed dormers along its side elevations. The front elevation has a full-width, hiproof wood porch with supports made of faux stone piers topped by squat boxed columns. The porch shelters an off-center door and three non-original one-over-one aluminum-sash windows. There are two nonoriginal one-over-one aluminum-sash windows in the gable. This house lacks distinctive architectural features and is not individually eligible for listing on the National Register.



	Additional Notes/Descriptions	
	-	
tion Major Alteration	Replacement windows	
Poor		
Exterior Wall Surface		
Synthetic siding		
Roof Type		
Gable		
Ornamental Architectural Details		
	Double-hung, glass block	
	Exterior Wall Surface Synthetic siding Roof Type	

Local Landmark	Y <u>N</u>	
National Register Historic Places	Y <u>N</u>	
National Register Historic District	Y <u>N</u>	Name:
Individually Eligible? No	A B C	Significance:

Additional Comments:			



Historical Resource Recordation Form

Property Name	Photos with Captions: South façade of brick, one-story, religious building.
Historic: S.S. Peter and Paul Church	South have of offer, one story, fengious bunding.
Common/Current: S.S. Peter and Paul Church	
Property Address:	a surfact where the second second
12433-12439 S. Halsted Street	
HAARGIS Number:	
Not in database	A State of the second sec
Present Owner and/or Occupant:	
S.S. Peter & Paul Roman Catholic Church and	
Rectory	
Property Use	
Historic: Religious	
Current: Religious	
Date of Construction: 1958-1959	
Architect's Name: Fox & Fox	
Builder/Contractor: Not in CHRS	
Architectural Style:	
Modernistic	
Prepared By: J. Martinez, M. C. Bird, J.	
Guarino	
Photo By: S. Katz	
Date: 29 October 2012	
Burnetter Description	Charles 1

Property Description:

Stories: 1

This Mid-Century Modern church at the northeast corner of Halsted and 125th streets in the West Pullman community was built for the parish of Saints Peter and Paul. The church is clad with orange face brick and stone veneer, has a steeply pitched front gable roof, deep roof overhangs along the front elevation, and a square hip-roof corner tower with a vertical strip of leaded glass windows. The front elevation has a central pavilion flanked by projecting full-height brick piers, three sets of original double doors divided by concrete piers and topped with a concrete spandrel with incised lettering that reads "S.S. Peter and Paul," and features an expansive area above which is glazed with leaded glass. The side elevations feature a series of narrow windows that appear to be double-hung. This building is recommended as individually eligible for National Register listing under Criterion C for architecture as an excellent and rare example of a Mid-Century Modern church in West Pullman.




Integrity:			Additional Notes/Descriptions
<u>Unaltered</u>	Slight Modification	n Major Alteration	
Condition:			
Excellent	Good	Poor	
Additional Alterati	ons		
Structu	ire Usage	Exterior Wall Surface	
Current: NA		Brick (main),	
Historic: NA		Stone veneer (façade)	
Roof Material	Roof Features	Roof Type	
Asphalt	None	Gable	
Ornamental Archit	tectural Details		Windows
Tower, brick piers, concrete piers and spandrel, incised lettering			Fixed-pane, casement, double- hung
Outbuildings (Num	iber and Description)		
None			

Local Landmark	Y <u>N</u>	
National Register Historic Places	Y <u>N</u>	
National Register Historic District	Y <u>N</u>	Name:
Individually Eligible? Yes	A B <u>C</u>	Significance: An excellent and rare example of a Mid-Century Modern church in West Pullman.

Additional Comments:		



Historical Resource Recordation Form

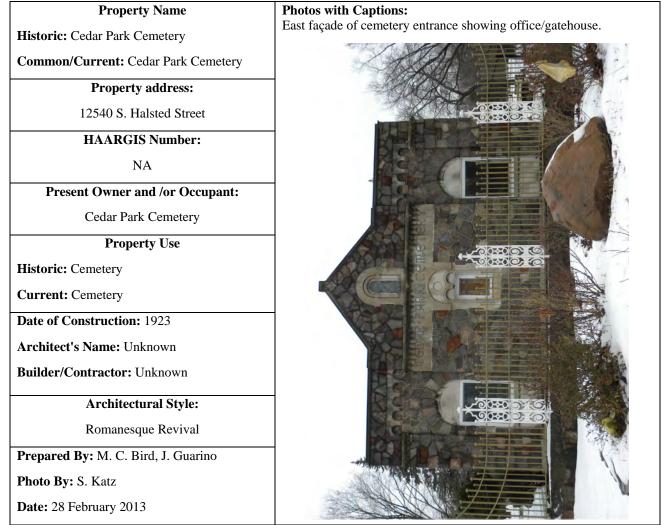

Property Description:

Stories: 1

Cedar Park Cemetery, founded in the early twentieth century, comprises a formal landscape on 94.5 acres at 12540 S. Halsted Street. Plantings include large deciduous shade trees as well as ornamental shrubs and mowed lawn. Grave markers are mounted flush with the lawn. The landscape is not exceptional nor does it contain any distinctive design features and does not warrant listing on the National Register of Historic Places.

Extant buildings and structures include the office/gatehouse with ornamental gate and fence, an obelisk, three mausoleums, and a cinder block building. Cedar Park Cemetery's one-story Romanesque Revival style gatehouse is located at its Halsted Street entrance. The entrance features two pairs of massive stone gateposts and metal entrance gates. Original metal fencing extends along the length of the cemetery's Halsted Street boundary, which also features several stone piers. The gatehouse, gateposts, and piers are built of grey, brown, and pink stones that are randomly laid. The building and piers have excellent integrity and were likely installed circa 1923, along with the metal entrance gates and fencing along Halsted Street, when the Cedar Park Cemetery Association purchased its original 53-acre site. The building, piers, and gates are locally eligible for National Register listing under Criterion C for architecture due to their high quality craftsmanship and unusual stonework.

The gatehouse has a flat roof, parapet, and stone cornice. All windows have stone sills and stone lintels with a type of



scallop shell motif. The Halsted Street elevation has four windows: a small stained glass window in its projecting bay, a single window with round-arched transoms on either side of the bay, and a small, round-arched window flanked by slender colonettes in the parapet gable. The Halsted elevation bay is topped with stone banding incised with the words "Cedar Park Cemetery." The north elevation has a centrally located pair of wood French doors and six wood-sash windows: three each on either side of the entrance. The south elevation has a centrally located multi-paned wood door with sidelights flanked by slender engaged columns. The south elevation's four windows include a single one-over-one window on one side of the door and a group of three windows—a single pane flanked by one-over-one windows—on the other. Doors on both the north and south elevations are topped by flat stone lintels and accessed via concrete steps flanked by stone piers. The rear elevation has five one-over-one windows: a single, centrally-located window with a pair of windows on either side.

The three granite-clad mausoleums (the location of one is obscured by trees) appear to date from the middle to late twentieth-century. One of them features a chapel, which hosts non-denominational funeral services. The cinder block building, accessed by a secondary entrance just north of 125th Street, is utilitarian in nature and may serve as a maintenance building and/or as a crematorium. Neither the mausoleums nor the cinder block building appear to be eligible for inclusion on the National Register of Historic Places.

Integrity:			Additional Notes/Descriptions		
<u>Unaltered</u>	Slight modification	ns Major Alteration			
Condition:					
Excellent	Good	Poor			
Additional Alterati	ions				
Structu	ıre Usage	Exterior Wall Surface			
Current: Metal gates	s, obelisk	Stone			
Historic: Metal gate	s, obelisk				
Roof Material	Roof Features	Roof Type			
Unknown	Parapet	Flat			
Ornamental Archi	tectural Details	Windows			
Stone sills and lintel	s with shell motif, arched	Art glass, double-hung, fixed-pane			
doors, incised stone	banding "Cedar Park Cem				
Outbuildings (Number and Description)					
Three mausoleums ((granite-clad) and cinder b	lock building			



Local Landmark	Y	<u>N</u>	
National Register Historic Places	Y	<u>N</u>	
National Register Historic District	Y	<u>N</u>	Name:
Individually Eligible? Yes	A	в <u>с</u>	Significance: The building, piers, and gates are eligible for architecture due to their high quality craftsmanship and unusual stonework.

Additional comments

Additional photographs:





Historical Resource Recordation Form

Property Name	Photos with Captions: West and north façades of a brick, two-story, mixed-use building.
Historic: Bldg. not labeled, not in CHRS	west and north rayades of a breek, two-story, mixed-use building.
Common/Current: Jack's Lounge	
Property Address:	
12717 S. Halsted Street	
HAARGIS Number:	
Not in database	
Present Owner and /or Occupant:	
Jack's Lounge	
Property Use	
Historic: Mixed-Use	
Current: Mixed-Use	
Date of Construction: 1952	
Architect's Name: Not in CHRS	
Builder/Contractor: Not in CHRS	
Architectural Style:	
Vernacular	
Prepared By: J. Martinez, M. C. Bird, J.	
Guarino	
Photo By: S. Katz	
Date: 29 October 2012	
	1

Property Description:

Stories: 2

This two-story building in the West Pullman community has a flat roof and parapet. The first floor of its front elevation is surrounded with a stone veneer and has two non-original doors with transoms. The two former display window areas have been in-filled with buff brick and small windows. The second floor is clad with face brick and has two window groups: a picture window flanked by one-over-one windows and a pair of one-over-one windows. The side and rear elevations are clad with common brick. Detailing includes a fluted concrete cornice, concrete sills, and a brick stringcourse. This building lacks integrity and distinguishing architectural features and is not individually eligible for listing on the National Register.



Structural Survey

Integrity:			Additional Notes/Descriptions
Unaltered	Slight Modificati	ion Major Alteration	storefront in-filled
	Silgin into di interne	<u></u>	
Condition:			
Excellent	Good	Poor	
Additional Alterati	ons		
Structu	ire Usage	Exterior Wall Surface	
Current: NA		Brick, faux stone	
Historic: NA			
Roof Material	Roof Features	Roof Type	
Unknown	Parapet	Flat	
Ornamental Archit	ectural Details		Windows
Fluted concrete cornice, concrete sills, brick stringcourse			Double-hung, fixed pane, glass
			block
Outbuildings (Num	ber and Description)		
_			
None			

Local Landmark	Y <u>N</u>	
National Register Historic Places	Y <u>N</u>	
National Register Historic District	Y <u>N</u>	Name:
Individually Eligible? No	A B C	Significance:


Additional Comments:

Although the building looks older than 1952, review of the aerial photographs supports the date.





Historical Resource Recordation Form

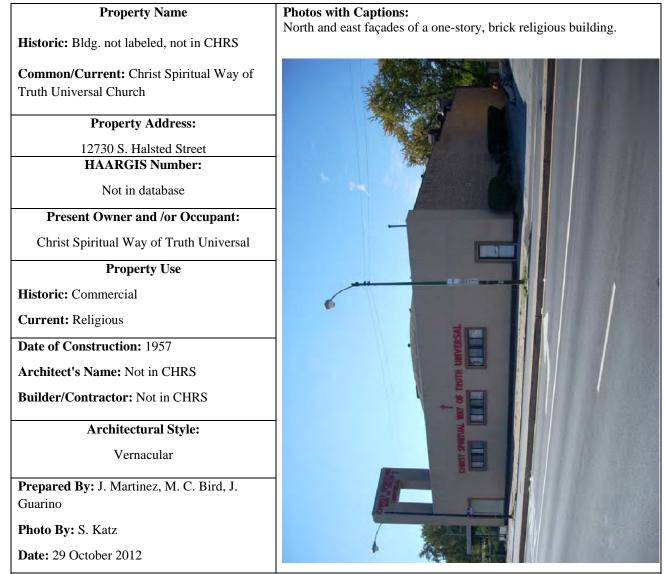

Property Description:

Stories: 1

This one-story brick-clad church building in the West Pullman community has a roof that is mainly flat with a shallow domed area and is covered with a smooth material that appears to be shotcrete along its east (Halsted) and south elevations. The Halsted elevation has three strips of four single-pane windows, a plate glass door at its north end, and a large single-pane window at its south end. The building's front entrance is along the south elevation, facing its parking lot, and has a pair of double doors at its east end that are sheltered by a flat-roofed metal canopy supported by two metal posts. A tall sign that signified the church's name is situated at the southeast corner of the building. This building does not feature distinguishing architectural elements and is not individually eligible for listing on the National Register.



Integrity:			Additional Notes/Descriptions
integrity.			Additional Notes/Descriptions
Unaltered	Slight Modification	on Major Alteration	
Condition:			
<u>Excellent</u>	Good	Poor	
Additional Alterati	ons		
Structu	ire Usage	Exterior Wall Surface	
Current: NA		Shotcrete (façade)	
		Brick (secondary elevations)	
Historic: NA		· · · ·	
Roof Material	Roof Features	Roof Type	
Unknown	None	Flat, Dome	
Ornamental Archit	ectural Details		Windows
None			Fixed-pane
Outbuildings (Num	ber and Description)		·
None			

Local Landmark	Y	<u>N</u>	
National Register Historic Places	Y	<u>N</u>	
National Register Historic District	Y	<u>N</u>	Name:
Individually Eligible? No	A I	B C	Significance:

Additional Comments:			



Historical Resource Recordation Form

Property Name	Photos with Captions:
Historic: Not labeled, not in CHRS	East façade of one-story, brick commercial building.
Common/Current: Unknown	
Property Address:	
12746-12804 S. Halsted Street	
HAARGIS Number:	
Not in database	
Present Owner and /or Occupant:	
King Food & Grocery, Lowe's Barbers,	
Olnia's Soul Food, World of Suds	
Property Use	
Historic: Commercial	
Current: Commercial	
Date of Construction: 1952	
Architect's Name: Not in CHRS	
Builder/Contractor: Not in CHRS	
Architectural Style:	
Vernacular	
Prepared By: C. Tolmie, M. C. Bird, J.	
Guarino	
Photo By: S. Katz	
Date: 13 September 2012	

Property Description:

Stories: 1

This one-story brick-clad strip mall in the West Pullman community has a flat-roof, parapet, and an L-shaped footprint. It is set back from the street, allowing for parking in front. Its Halsted Street elevation features a series of storefronts with glass doors and display windows, some of which are vacant and covered with plywood. This building does not feature any distinguishing features to qualify as eligible for individual listing on the National Register.




Integrity:			Additional Notes/Descriptions
Unaltered	Slight Modification	Major Alteration	Some storefronts covered with plywood
Condition:			
Excellent	Good	Poor	
Additional Alterati	ons		
Structu	re Usage		
Current: NA		Brick	
Historic: NA			
Roof Material	Roof Features	Roof Type	
Unknown	Parapet	Flat	
Ornamental Archit	ectural Details		Windows
None			Fixed-pane
Outbuildings (Num	ber and Description)		
None			

Local Landmark	Y <u>N</u>	
National Register Historic Places	Y <u>N</u>	
National Register Historic District	Y <u>N</u>	Name:
Individually Eligible? No	A B C	Significance:

Additional Comments:			



Historical Resource Recordation Form

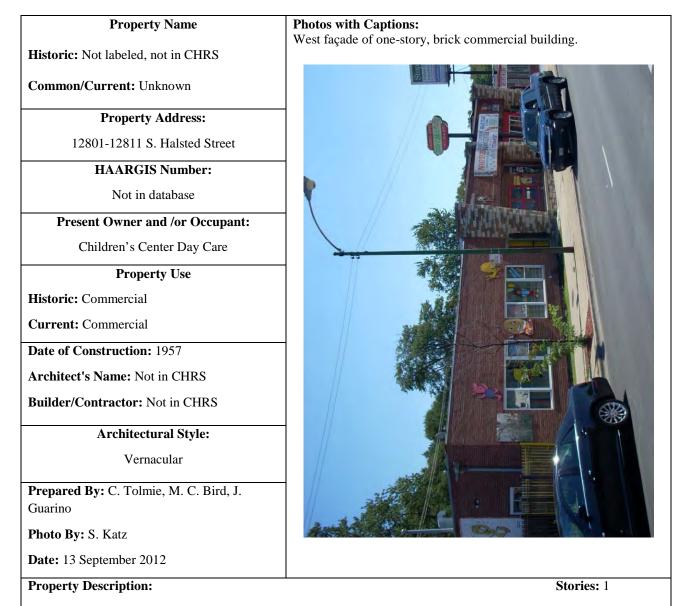

This one-story brick-clad building in the West Pullman community, which accommodates a day care center, has a flat roof and parapet. Its front elevation features faux stone piers, three of which are projecting and rise above the roofline, dividing the front (Halsted) elevation into five bays that feature glass doors and fenestration that includes picture windows and double-hung windows of varying shapes and sizes. This building does not feature distinguishing architectural elements to qualify as eligible for individual listing on the National Register.



Integrity:			Additional Notes/Descriptions
<u>Unaltered</u>	Slight Modification	Major Alteration	
Condition:			
Excellent	Good	Poor	
Additional Alterati	ons		
Structu	re Usage	Exterior Wall Surface	
Current: NA		Brick	
Historic: NA			
Roof Material	Roof Features	Roof Type	
Unknown	Parapet	Flat	
Ornamental Architectural Details			Windows
Faux stone piers			Fixed-pane, double-hung
Outbuildings (Num	ber and Description)		·
None			

Local Landmark	Y <u>N</u>	
National Register Historic Places	Y <u>N</u>	
National Register Historic District	Y <u>N</u>	Name:
Individually Eligible? No	A B C	Significance:



Photos with Captions: Property Name West façade of a one-story, brick, commercial building. Historic: Bldg. not labeled, not in CHRS Common/Current: Unknown **Property Address:** 12841 S. Halsted Street HAARGIS Number: Not in database Present Owner and /or Occupant: Unknown **Property Use** Historic: Commercial Current: Commercial Date of Construction: 1955 Architect's Name: Not in CHRS Builder/Contractor: Not in CHRS **Architectural Style:** Vernacular Prepared By: J. Martinez, M. C. Bird, J. Guarino Photo By: S. Katz Date: 29 October 2012

Historical Resource Recordation Form

Property Description:

Stories: 1

This one-story commercial building in the West Pullman community has a flat roof and parapet. The front elevation has a buff brick parapet, corner piers clad with a stone veneer, and two central doors with in-filled transoms. One of its former display windows has been in-filled with wood boards while the other has been in-filled with buff brick and a rectangular window. The side and rear elevations are clad with common brick. This building lacks integrity and distinctive architectural features and is not individually eligible for listing on the National Register.




Integrity:			Additional Notes/Descriptions
Unaltered	Slight Modification	Major Alteration	Replacement storefront
C			
Condition:			
Excellent	Good	Poor	
Additional Alterati	ons		
Structu	ire Usage	Exterior Wall Surface	
Current: NA		Brick	
Historic: NA			
Roof Material	Roof Features	Roof Type	
Unknown	Parapet	Flat	
Ornamental Architectural Details			Windows
Faux stone in piers			Fixed-pane
Outbuildings (Num	ber and Description)	•	
None			

Local Landmark	Y	<u>N</u>	
National Register Historic Places	Y	<u>N</u>	
National Register Historic District	Y	<u>N</u>	Name:
Individually Eligible? No	A	B C	Significance:

Additional Comments:			



Historical Resource Recordation Form

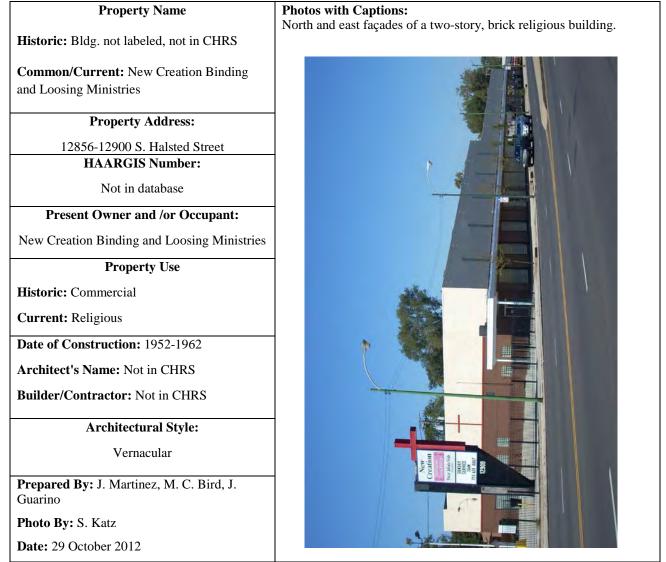

Property Description:

Stories: 2

This expansive two-story, flat-roofed, brick-clad building has a one-story wing to the north. The building appears to have been built as a chain store or supermarket, but now serves as a church. A flat-roofed canopy extends along the entire length of the building's front (Halsted) elevation and shelters a pair of plate glass double-doors with transom and a continuous series of nearly floor-to-ceiling window openings that are in-filled with glass blocks and separated by wood cladding that is vertically laid. The second floor of the front elevation's two-story block has a series of narrow glass block windows. The front elevation of the one-story north wing is clad with wood that is vertically laid and a pair of wood double-doors but no windows. The building's south elevation has a pair of plate-glass double-doors with transom at its eastern end and a series of glass block windows. It does not feature distinguishing architectural features and is not individually eligible for listing on the National Register.



Integrity:			Additional Notes/Descriptions
Unaltered	Slight Modification	<u>n</u> Major Alteration	Replacement windows
Condition:			
Excellent	Good	Poor	
Additional Alteration	ons		
Structu	re Usage	Exterior Wall Surface	
Current: NA		Brick (main), wood boards	
Historic: NA			
Roof Material	Roof Features	Roof Type	
Unknown	None	Flat	
Ornamental Archit	ectural Details		Windows
None			Glass block
Outbuildings (Num	ber and Description)	·	
None			

Local Landmark	Y <u>N</u>	
National Register Historic Places	Y <u>N</u>	
National Register Historic District	Y <u>N</u>	Name:
Individually Eligible? No	A B C	Significance:

Additional Comments:			



Historical Resource Recordation Form

Property Name	Photos with Captions: East façade of split-level, brick, single family residence.
Historic: Not labeled, not in CHRS	Last laçade of spin-level, offek, single failing residence.
Common/Current: Unknown	
Property Address:	
9820 S. Harvard Avenue	
HAARGIS Number:	
Not in database	
Present Owner and /or Occupant:	
Unknown	
Property Use	
Historic: Single family residence	
Current: Single family residence	
Date of Construction: 1959	
Architect's Name: Not in CHRS	
Builder/Contractor: Not in CHRS	
Architectural Style:	
Vernacular	
Prepared By: C. Tolmie, M. C. Bird, J.	
Guarino	
Photo By: S. Katz	
Date: 16 September 2012	

Property Description:

Stories: Split-level

This back-split home in the Roseland community has a hip roof on both levels that are covered with asphalt shingles. The front elevation is clad with orange face brick and has a centrally located hollow core metal door, two pairs of casement windows, and metal steps and railings. It does not feature distinguishing architectural elements and is not individually eligible for listing on the National Register.



Integrity:			Additional Notes/Descriptions	
Unaltered	Slight Modification	Major Alteration	Replacement door	
Condition:				
Excellent	Good	Poor		
Additional Alterati	ons			
Structu	re Usage	Exterior Wall Surface		
Current: NA		Brick		
Historic: NA				
Roof Material	Roof Features	Roof Type		
Asphalt shingles	None	Hip		
Ornamental Architectural Details			Windows	
None			Casement	
Outbuildings (Num				
Detached two-car garage				

Local Landmark	Y <u>N</u>	
National Register Historic Places	Y <u>N</u>	
National Register Historic District	Y <u>N</u>	Name:
Individually Eligible? No	A B C	Significance:

Additional Comments:			



Historical Resource Recordation Form

Property Name	Photos with Captions:
Historic: Not labeled, not in CHRS	East and north façades, of 1.5-story, single family, brick residence.
HISTOFIC: Not labeled, not in CHRS	
Common/Current: Unknown	
Property Address:	
9823 S. Harvard Avenue	
HAARGIS Number:	
Not in database	
Present Owner and /or Occupant:	
Unknown	
Property Use	
Historic: Single family residence	
Current: Single family residence	
Date of Construction: 1915	
Architect's Name: Not in CHRS	
Builder/Contractor: Not in CHRS	
Architectural Style:	
Vernacular	
Prepared By: C. Tolmie, M. C. Bird, J.	
Guarino	
Photo By: S. Katz	
Date: 16 September 2012	

Property Description:

Stories: 1.5

This 1.5-story home in the Roseland community is situated on a raised brick basement with glass block windows and has a front gable roof covered with asphalt shingles. Its front elevation is clad with brown face brick, as is its enclosed, full-width, hip roof porch that has concrete lintels and sills. The front elevation has an off-center door with sidelights, metal steps and railings, and two first-floor window groups that are covered with metal screens, as were the paired windows in the gable. Some windows on the side elevation are in-filled with brick and glass block. This home lacks integrity and does not feature sufficient distinguishing features to qualify as eligible for individual listing on the National Register.



Integrity:			Additional Notes/Descriptions
Unaltered	Slight Modification	Major Alteration	Replacement door, enclosed porch, metal storm shutters, window openings in-filled
Condition:			
Excellent	Good	Poor	
Additional Alterati	ons		
Structu	ire Usage	Exterior Wall Surface	
Current: NA		Brick	
Historic: NA			
Roof Material	Roof Features	Roof Type	
Asphalt shingles	None	Gable	
Ornamental Archit	tectural Details		Windows
Concrete lintels and sills			Glass block, covered
Outbuildings (Num	ber and Description)		
Garage			

Local Landmark	Y	<u>N</u>	
National Register Historic Places	Y	<u>N</u>	
National Register Historic District	Y	<u>N</u>	Name:
Individually Eligible? No	A	B C	Significance:

Additional Comments:			



Historical Resource Recordation Form

Property Name	Photos with Captions:
Historic: Not labeled, not in CHRS	East and north façades of one-story, single family, frame residence.
Common/Current: Unknown	
Property address:	
11314 S. Harvard Avenue	
HAARGIS Number:	
Not in database	
Present Owner and /or Occupant:	
Vacant	
Property Use	
Historic: Single family residence	
Current: Single family residence	
Date of Construction: 1926	
Architect's Name: Not in CHRS	
Builder/Contractor: Not in CHRS	
Architectural Style:	
Craftsman	
Prepared By: C. Tolmie, M. C. Bird, J. Guarino	
Photo By: S. Katz	
Date: 16 September 2012	

Property Description:

Stories: 1

This one-story frame bungalow in the Roseland community is situated on a raised concrete block basement with glass block windows and is clad with faux stone on the front elevation. The building has a hip roof covered with asphalt shingles and a hip dormer with three small non-original one-over-one aluminum-sash windows. The front elevation has a recessed corner porch with wood steps, railings, and a corner post. The front door and all first floor windows have been covered with plywood. This house lacks integrity and distinctive architectural features and is not individually eligible for listing on the National Register.



Structural Survey


Integrity:			Additional Notes/Descriptions
Unaltered	Slight Modification	Major Alteration	Replacement windows and cladding
Condition:			
Excellent	Good	Poor	
Additional Alteration	ons		
Structu	re Usage	Exterior Wall Surface	
Current: NA		Faux stone (front)	
Historic: NA		Synthetic siding (sides)	
Roof Material	Roof Features	Roof Type	
Asphalt shingle	Dormer	Hip	
Ornamental Archit	ectural Details		Windows
None			Double-hung, glass block
Outbuildings (Num	ber and Description)		
Garage			

Local Landmark	Y <u>N</u>	
National Register Historic Places	Y <u>N</u>	
National Register Historic District	Y <u>N</u>	Name:
Individually Eligible? No	A B C	Significance:

Additional Comments:



Historical Resource Recordation Form

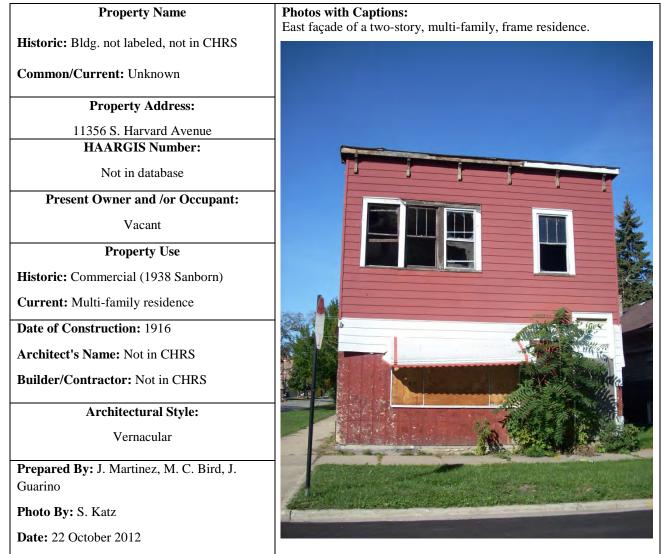

Property Description:

Stories: 2

This two-story building at the northwest corner of Harvard Avenue and 114th Street in the Roseland community is clad with wood board vertically laid on the first floor and with synthetic siding on the second floor. The building has a flat roof and parapet. The front (Harvard Avenue) elevation has an off-center door and a group of three first floor windows that have been covered with plywood and are sheltered by a metal awning. The second floor of the front elevation has four windows—a group of three and a single window—that were formerly three-over-one wood-sash, although most of the glass panes are now gone. The front elevation is topped by a bracketed unadorned wood cornice. The windows on the 114th Street elevation have been covered with plywood on the first floor and have missing glass panes on the second floor. This former commercial building lacks integrity and distinctive architectural features and is not individually eligible for listing on the National Register.




Integrity:			Additional Notes/Descriptions
Unaltered	Slight Modificati	on Major Alteration	Replacement cladding
Condition:			
Excellent	Good	Poor	
Additional Alteration	ons		
Converted from com	mercial to residential af		
Structu	re Usage	Exterior Wall Surface	
Current: NA		Synthetic siding (upper),	
Historic: NA		Wood (lower)	
Roof Material	Roof Features	Roof Type	
Unknown	Parapet	Flat	
Ornamental Archit	ectural Details	Windows	
Bracketed cornice			Double-hung
Outbuildings (Num	ber and Description)		
None			

Local Landmark	Y <u>N</u>	
National Register Historic Places	Y <u>N</u>	
National Register Historic District	Y <u>N</u>	Name:
Individually Eligible? No	A B C	Significance:

Additional Comments:			



Historical Resource Recordation Form

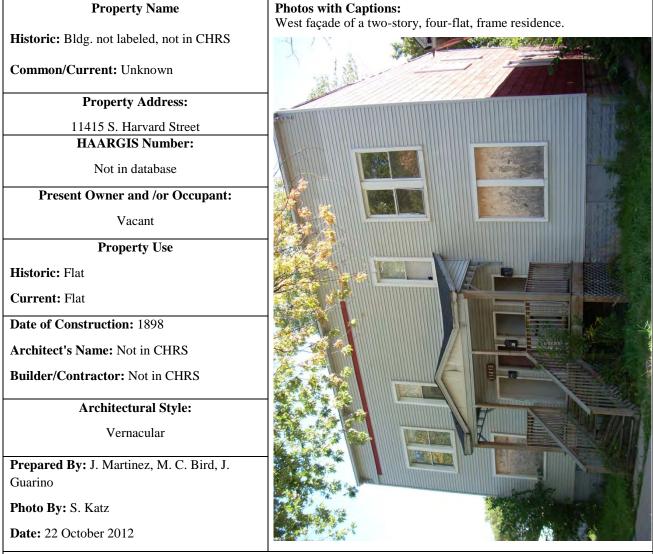

Property Description:

Stories: 2

This two-story four-flat building in the Roseland community is situated on a raised concrete block basement and is covered with synthetic siding. The building has a flat roof and parapet. Its front elevation has four centrally located doorways that lack doors, a partial-width wood porch with a gable-on-shed roof, nonoriginal straight posts and railings. There are two window groups on the first floor that are covered with plywood and six non-original one-over-one aluminum-sash windows on the second floor. The parapet level features a bracketed unadorned cornice. This building lacks integrity and distinctive architectural features and is not individually eligible for listing on the National Register.



Integrity:			Additional Notes/Descriptions
Unaltered	Slight Modification	n Major Alteration	Replacement windows, cladding, and porch rails
Condition:			
Excellent	Good	Poor	
Additional Alterati	ons		
Structu	re Usage	Exterior Wall Surface	
Current: NA		Synthetic siding	
Historic: NA			
Roof Material	Roof Features	Roof Type	
Unknown	Parapet	Flat	
Ornamental Archit	ectural Details		Windows
Bracketed cornice			Double-hung
Outbuildings (Num	ber and Description)		
None			

Local Landmark	Y <u>N</u>	
National Register Historic Places	Y <u>N</u>	
National Register Historic District	Y <u>N</u>	Name:
Individually Eligible? No	A B C	Significance:

Additional Comments:	



Historical Resource Recordation Form

Property Name	Photos with Captions:
	East façade of a single story, single family, frame residence.
Historic: Bldg. not labeled, not in CHRS	The second secon
Common/Current: Unknown	
Property Address:	
10204 S. Indiana Avenue	
HAARGIS Number:	
Not in database	
Present Owner and /or Occupant:	
Unknown	
Property Use	
Historic: Single family residence	
Current: Single family residence	
Date of Construction: 1903	
Architect's Name: Not in CHRS	
Builder/Contractor: Not in CHRS	
Architectural Style:	
Vernacular	
Prepared By: J. Martinez, M. C. Bird, J. Guarino	
Photo By: S. Katz	
Date: 30 October 2012	

Property Description:

Stories: 1

This one-story frame cottage in the Roseland neighborhood is situated on a raised concrete block basement with glass block windows and is covered with synthetic siding. The building has a front gable roof covered with asphalt shingles. The front elevation has a full-width, hip roof, synthetic-clad porch with an off-center door, wood steps with straight wood railings, and three non-original windows—two one-over-one aluminum-sash and one small single-pane. A pair of non-original one-over-one aluminum-sash windows is situated in the gable. The south elevation has a three-sided bay window topped by a through-the-cornice gabled wall dormer. The north elevation has a shed dormer. This house lacks integrity and distinguishing architectural features and is not individually eligible for listing on the National Register.



Structural Survey

Integrity:			Additional Notes/Descriptions
Unaltered	Slight Modification	Major Alteration	Replacement windows and cladding
Condition:			
Excellent	Good	Poor	
Additional Alteration	ons		
Enclosed porch			
Structu	re Usage	Exterior Wall Surface	
Current: NA		Synthetic siding	
Historic: NA			
Roof Material	Roof Features	Roof Type	
Asphalt shingle	Dormers	Gable	
Ornamental Archit	ectural Details		Windows
None			Double-hung, fixed pane, glass block
Outbuildings (Num	ber and Description)		
None			

Local Landmark	Y <u>N</u>	
National Register Historic Places	Y <u>N</u>	
National Register Historic District	Y <u>N</u>	Name:
Individually Eligible? No	A B C	Significance:

Additional Comments:

I



Historical Resource Recordation Form

Property Name	Photos with Captions: East façade of a two-story, multi-family, frame residence.
Historic: Bldg. not labeled, not in CHRS	Last laçade of a two-story, multi-failing, frame residence.
Common/Current: Unknown	
Property Address:	
10242 S. Indiana Avenue	
HAARGIS Number:	
Not in database	
Present Owner and /or Occupant:	
Unknown	
Property Use	
Historic: Single family residence	
Current: Multi-family residence	
Date of Construction: 1906	
Architect's Name: Not in CHRS	
Builder/Contractor: Not in CHRS	
Architectural Style:	
Vernacular	
Prepared By: J. Martinez, M. C. Bird, J.	
Guarino	
Photo By: S. Katz	
Date: 30 October 2012	

Property Description:

Stories: 2

This two-story frame house in the Roseland community is situated on a raised concrete block basement with glass block windows and is covered with synthetic siding. The building has a front gable roof covered with asphalt shingles. The front elevation has a two-story window bay pavilion and a partial-width, shed-roof porch. The porch has a non-original hollow core metal door with a transom, wood steps, metal railings, and two open metal supports. There are three windows in the first floor bay, four windows on the second floor, including three in the bay, and a pair of windows in the gable, all of which are non-original one-over-one aluminum-sash. This house lacks integrity and distinguishing architectural features and is not individually eligible for listing on the National Register.



Integrity:			Additional Notes/Descriptions
Unaltered	Slight Modification	on Major Alteration	Replacement door, windows, cladding, porch rails and supports
Condition:			
Excellent	Good	Poor	
Additional Alteration	ons		
Structu	re Usage	Exterior Wall Surface	
Current: NA		Synthetic siding, including faux	
Historic: NA		stone below with bay sill	
Roof Material	Roof Features	Roof Type	
Asphalt shingle	None	Gable	
Ornamental Archit	ectural Details		Windows
None			Double-hung, glass block
Outbuildings (Num	ber and Description)		•
None			

Local Landmark	Y <u>N</u>	
National Register Historic Places	Y <u>N</u>	
National Register Historic District	Y <u>N</u>	Name:
Individually Eligible? No	A B C	Significance:

Additional Comments:			



Property Name Photos with Captions: Historic: Bldg. not labeled, not in CHRS East façade of a two-story, multi-family, frame residence. Common/Current: Unknown Property Address:

Historical Resource Recordation Form

11708 S. Indiana Avenue HAARGIS Number:

Not in database

Present Owner and /or Occupant:

Unknown

Property Use

Historic: Single family residence

Current: Multi-family residence

Date of Construction: 1908

Architect's Name: Not in CHRS

Builder/Contractor: Not in CHRS

Architectural Style:

Vernacular

Prepared By: J. Martinez, M. C. Bird, J. Guarino

Photo By: S. Katz

Date: 22 October 2012

Property Description:

Stories: 2

This two-story frame house at the southwest corner of Indiana Avenue and 117th Street in the West Pullman community is situated on a raised concrete block basement with glass block windows and is covered with synthetic siding. The building has a front gable roof covered with asphalt shingles. Its front elevation has a full-width, flat-roof, enclosed sun porch with an off-center metal storm door, concrete steps with metal railings (non-original), and a strip of three windows on the first floor. The second floor of the front elevation has a strip of three windows and a single window, and the attic level has a pair of windows. Windows are non-original one-over-one aluminum-sash. This house lacks integrity and distinctive architectural features and is not individually eligible for listing on the National Register.



Integrity:			Additional Notes/Descriptions
Unaltered	Slight Modification	n Major Alteration	Replacement windows, cladding, and porch rails
Condition:			
Excellent	Good	Poor	
Additional Alterati	ons		
Structu	ire Usage	Exterior Wall Surface	
Current: NA		Synthetic siding	
Historic: NA			
Roof Material	Roof Features	Roof Type	
Asphalt shingle	None	Gable	
Ornamental Archit	tectural Details		Windows
None			Double-hung, glass block
Outbuildings (Num	ber and Description)		
None			

Local Landmark	Y <u>N</u>	
National Register Historic Places	Y <u>N</u>	
National Register Historic District	Y <u>N</u>	Name:
Individually Eligible? No	A B C	Significance:

Additional Comments:	



Historical Resource Recordation Form

Property Name	Photos with Captions:
Historic: Bldg. not labeled, not in CHRS	North and west façades of two story, single family residence (above), concrete block outbuilding (below)
Common/Current: Unknown	
Property Address:	
11709 S. Indiana Ave.	
HAARGIS Number:	
Not in database	
Present Owner and /or Occupant:	
Unknown	
Property Use	
Historic: Single family residence	
Current: Single family residence	
Date of Construction: 1908	
Architect's Name: Not in CHRS	
Builder/Contractor: Not in CHRS	
Architectural Style:	
Vernacular	T THE AND A SALE
Prepared By: J. Martinez, M. C. Bird, J.	
Guarino	and TITLE Parts and the second
Photo By: S. Katz	
Date: 2 October 2012	Marker - Marker - Salar
Property Description.	Stories: ?

Property Description:

Stories: 2

This two-story frame house in the West Pullman community is situated on a raised concrete block basement, is clad with synthetic siding, and has a gable roof with asphalt shingles. The front elevation features a two-story flat-roofed addition and a single story, shed-roofed, enclosed porch. Fenestration is comprised of non-original one-over-one aluminum-sash windows, many of which are covered with plywood. This house lacks integrity, does not have distinguishing architectural features, and is not individually eligible for listing on the National Register.



Structural Survey

Integrity:			Additional Notes/Descriptions
Unaltered	Slight Modification	Major Alteration	Replacement doors, cladding and windows
Condition:			
Excellent	Good	Poor	
Additional Alteration	ons		
Addition on front faç	cade, enclosed porch		
Structure Usage Exterior Wall Surface			
Current: NA		Synthetic siding	
Historic: NA			
Historic: NA Roof Material	Roof Features	Roof Type	
	Roof Features None	Roof Type Gable, Flat	
Roof Material	None		Windows
Roof Material Asphalt	None		Windows Double-hung

Two-car, gable-roofed, concrete block garage with glass block and louvered windows, and asphalt shingles

Local Landmark	Y <u>N</u>	
National Register Historic Places	Y <u>N</u>	
National Register Historic District	Y <u>N</u>	Name:
Individually Eligible? No	A B C	Significance:

Additional Comments:



Historical Resource Recordation Form

Property Name	Photos with Captions: West façade of a brick, two-story, multi-family residence.
Historic: Bldg. not labeled, not in CHRS	west laçade of a brief, two-story, mani-family residence.
Common/Current: Unknown	
Property Address:	
11715 S. Indiana Avenue	
HAARGIS Number:	
Not in database	
Present Owner and /or Occupant:	
Unknown	
Property Use	
Historic: Single family residence	
Current: Multi-family residence	
Date of Construction: 1908	
Architect's Name: Not in CHRS	
Builder/Contractor: Not in CHRS	
Architectural Style:	
Vernacular	
Prepared By: J. Martinez, M. C. Bird,	
J.Guarino	
Photo By: S. Katz	
Date: 30 October 2012	

Property Description:

Stories: 2

This two-flat, multi-family residential building in the West Pullman community is situated on a raised basement with glass block windows and is clad with face brick on the front elevation and common brick on the side and rear elevations. The building has a full-height window bay pavilion, a flat roof, and parapet. The front elevation has a partial-width porch with concrete steps and open metal posts supporting a metal shed-roof. A pair of off-center storm doors is located under the porch roof. There are seven non-original one-over-one windows: three on the first floor bay and four on the second floor, including three on its window bay. Detailing includes concrete sills, belt courses, brick cornice with corbelling, and brick dentils. This building lacks distinctive architectural features and is not individually eligible for listing on the National Register.



Integrity:			Additional Notes/Descriptions
Unaltered	Slight Modification	Major Alteration	Replacement windows
Condition:			
Excellent	Good	Poor	
Additional Alterati	ons		
Structu	ire Usage	Exterior Wall Surface	
Current: NA		Brick	
Historic: NA			
Roof Material	Roof Features	Roof Type	
Unknown	Parapet	Flat	
Ornamental Architectural Details			Windows
Concrete sills and belt courses; brick cornice with corbelling, brick			Double-hung, glass block
dentils			
Outbuildings (Number and Description)			
None			

Local Landmark	Y <u>N</u>	
National Register Historic Places	Y <u>N</u>	
National Register Historic District	Y <u>N</u>	Name:
Individually Eligible? No	A B C	Significance:



Historical Resource Recordation Form

Property Name	Photos with Captions:
Historic: Bldg. not labeled, not in CHRS	East façade of a two-story, single family, frame residence.
Historic. Didg. not naticed, not in Crites	
Common/Current: Unknown	AK BA
Property Address:	
11740 S. Indiana Ave	
HAARGIS Number:	
Not in database	
Present Owner and /or Occupant:	
Vacant	
Property Use	
Historic: Single family residence	
Current: Single family residence	
Date of Construction: 1888	
Architect's Name: Not in CHRS	
Builder/Contractor: Not in CHRS	
Architectural Style:	
Vernacular	
Prepared By: J. Martinez, M. C. Bird, J.	
Guarino	
Photo By: S. Katz	
Date: 30 October 2012	

Property Description:

Stories: 2

This two-story frame house in the West Pullman community is situated on a raised concrete block basement with glass block windows and is covered with synthetic siding. The building has a front gable roof covered with what appears to be roofing paper. The front elevation has a full-width, hip-roof, wood porch with a synthetic-clad base, straight wood railings and posts, and an off-center door. A group of three windows on the first floor are partially obscured by plywood. There are four windows on the second floor (three of which are grouped together) and a pair of windows in the gable. Above the basement, windows are non-original one-over-one aluminum-sash. This house lacks integrity and distinctive architectural features and is not individually eligible for listing on the National Register.




Integrity:			Additional Notes/Descriptions
Unaltered	Slight Modification	n Major Alteration	Replacement door, windows, cladding, and porch rails
Condition:			
Excellent	Good	Poor	
Additional Alterati	ons		
Structu	ire Usage	Exterior Wall Surface	
Current: NA		Synthetic siding	
Historic: NA			
Roof Material	Roof Features	Roof Type	
Roofing paper	None	Gable	
Ornamental Archit	tectural Details		Windows
None			Double-hung, glass block
Outbuildings (Num	ber and Description)		·
None			

Local Landmark	Y <u>N</u>	
National Register Historic Places	Y <u>N</u>	
National Register Historic District	Y <u>N</u>	Name:
Individually Eligible? No	A B C	Significance:

Additional Comments:			



Historical Resource Recordation Form

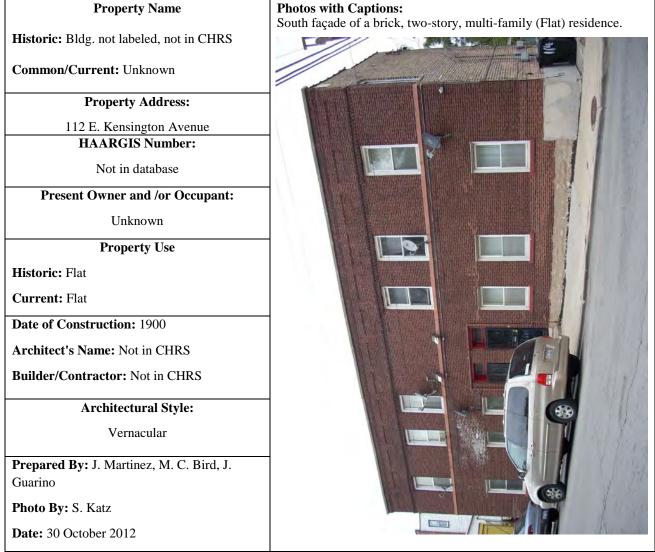

Property Description:

Stories: 2

This two-story brick-clad flat residential building in the West Pullman community has a flat roof and parapet. Its front elevation is clad with face brick, has two centrally-located plate glass doors with transoms, and twelve non-original one-over-one aluminum-sash windows: six on the first floor and six on the second. Detailing includes recessed brick panels with dentils at the parapet level, concrete sills, coping, and a concrete stringcourse. This building lacks integrity and distinctive architectural features and is not individually eligible for listing on the National Register.




Integrity:			Additional Notes/Descriptions
- · ·			Replacement windows
Unaltered	Slight Modificatio	on Major Alteration	Replacement whiclows
Condition:			
Excellent	Good	Poor	
Additional Alterati	ons		
Structu	ıre Usage	Exterior Wall Surface	
Current: NA		Brick	
Historic: NA			
Roof Material	Roof Features	Roof Type	
Unknown	Parapet	Flat	
Ornamental Archit	tectural Details		Windows
Recessed brick panels with dentils; concrete stringcourse, coping, and sills			Double-hung, fixed pane
Outbuildings (Num	ber and Description)		·
None			

Local Landmark	Y <u>N</u>	
National Register Historic Places	Y <u>N</u>	
National Register Historic District	Y <u>N</u>	Name:
Individually Eligible? No	A B C	Significance:

Additional Comments:			



Historical Resource Recordation Form

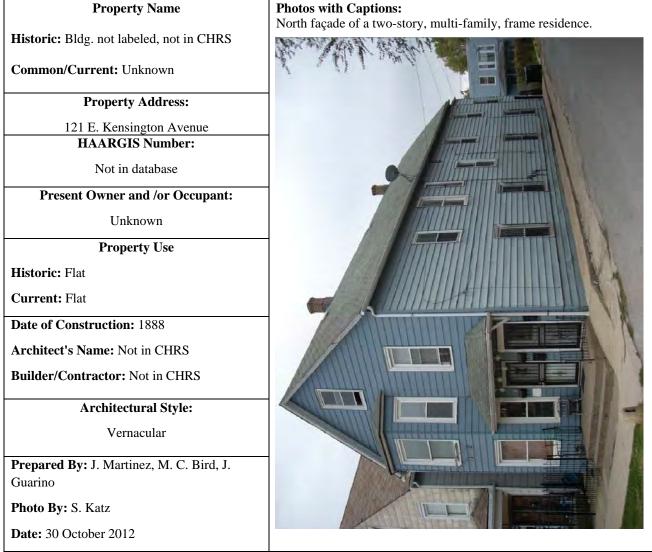

Property Description:

Stories: 2

This two-story, frame, two-flat residential building in the West Pullman community is covered with synthetic siding. The building has a two-story, three-sided window bay pavilion on its front elevation and a front gable roof covered with asphalt shingles. The front elevation has an off-center pair of hollow core metal doors topped by a bracketed pent roof. There are three windows on the first floor, four windows on the second floor, and a single window in the gable. All windows are non-original one-over-one aluminum-sash. This building lacks integrity and distinguishing architectural features and is not individually eligible for listing on the National Register.




Integrity:			Additional Notes/Descriptions
Unaltered	Slight Modification	Major Alteration	Replacement doors, windows, and cladding
Condition:			
Excellent	Good	Poor	
Additional Alteration	ons		
Structu	re Usage	Exterior Wall Surface	
Current: NA		Synthetic siding	
Historic: NA			
Roof Material	Roof Features	Roof Type	
Asphalt shingle	None	Gable	
Ornamental Archit	ectural Details		Windows
Bracketed pent roof			Double-hung
Outbuildings (Num	ber and Description)		
None			

Local Landmark	Y <u>N</u>	
National Register Historic Places	Y <u>N</u>	
National Register Historic District	Y <u>N</u>	Name:
Individually Eligible? No	A B C	Significance:

Additional Comments:			



Historical Resource Recordation Form

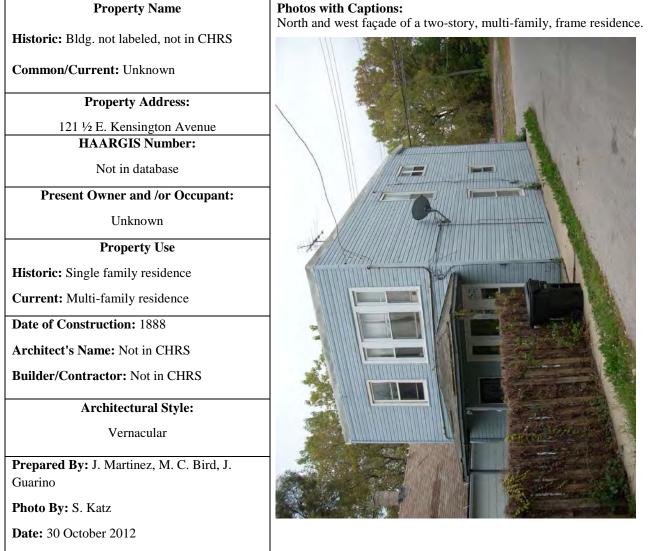

Property Description:

Stories: 2

This two-story residential building in the West Pullman community is clad with synthetic siding and has a flat roof and parapet. The first floor of its front elevation has an off-center storm door and a group of three windows sheltered by a full-width hip roof that is supported by three wood posts. The second floor of the front elevation has four windows, three of which are grouped together. Windows are non-original one-over-one aluminum sash. This house lacks integrity and distinctive architectural features and is not individually eligible for listing on the National Register.




Integrity:			Additional Notes/Descriptions
Unaltered	Slight Modification	n Major Alteration	Replacement windows and cladding
Condition:			
Excellent	Good	Poor	
Additional Alterati	ons		
Structu	re Usage	Exterior Wall Surface	
Current: NA		Synthetic siding	
Historic: NA			
Roof Material	Roof Features	Roof Type	
Unknown	Parapet	Flat	
Ornamental Archit	ectural Details		Windows
None			Double-hung
Outbuildings (Num	ber and Description)		
None			

Local Landmark	Y <u>N</u>	
National Register Historic Places	Y <u>N</u>	
National Register Historic District	Y <u>N</u>	Name:
Individually Eligible? No	A B C	Significance:

Additional Comments:			



Historical Resource Recordation Form

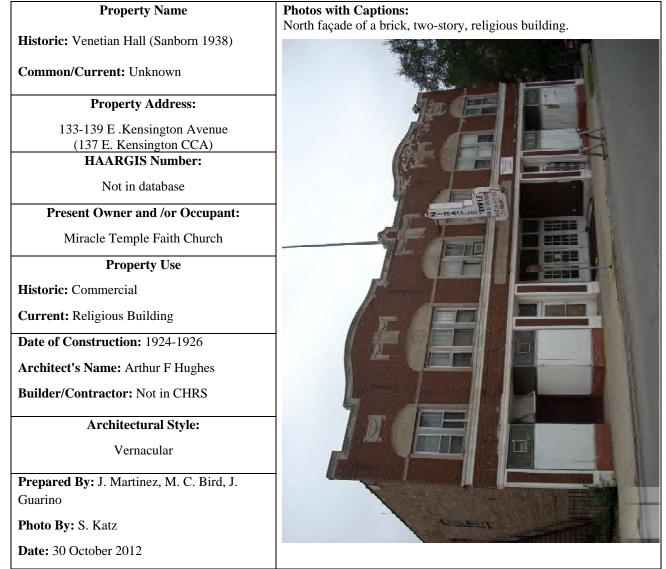

Property Description:

Stories: 2

This two-story building in the West Pullman community (formerly part of Kensington) was originally called "Venetian Hall." The performance hall was built for a cultural/recreational purpose, although it has long since been repurposed as a church. The 1938 Sanborn shows the hall with a stage, balcony, and place for storage of scenery. The street entrance was flanked by two storefronts in 1938, as it is now.

The building is clad with face brick on its front elevation and common brick on its side and rear elevations. The building has a flat roof and a shaped parapet with concrete coping. The first floor of the front elevation has a recessed centrally located bay with three pairs of multi-light wood doors and in-filled transoms. This central bay is flanked by two original storefronts with central recessed doors and flanking display windows that are covered with wood and topped by transoms that have been in-filled with glass block. Separating the central bay from the two flanking storefronts are two doors with transoms that provide access to the second floor. The spandrel area directly above the




central entrance bay has a concrete sign plate with incised lettering that reads: "Venetian Hall." Fenestration on the second floor features six-over-one and three-over-one wood-sash windows arranged in pairs and in groups of three, topped by round-arch stone lintels with rosette motifs. The parapet features a series of Classical shields and swags.

The exterior of this building has good overall integrity, although elements of the original storefronts materials are no longer extant. However, it does not display sufficient distinguishing architectural features to qualify as individually eligible for listing on the National Register for its architecture. Instead, is recommended for individual listing under Criterion A for its original use as a social venue for area residents in the early twentieth century. Local theater houses, such as the Venetian Hall, were jewels within the local communities. It's rare to see an early twentieth century neighborhood social hall that retains its original storefronts and is set within a residential area comprised of worker's housing, rather than along a commercial thoroughfare. The opening of Illinois Terra Cotta works in the first half of the twentieth century brought Italians to Kensington; the area gradually became a center of South Side Italian-American life with the establishment of Venetian Hall and the nearby San Antonio de Padua (patron saint of Venice) Roman Catholic Church.

Integrity:			Additional Notes/Descriptions
Unaltered	Slight Modification	on Major Alteration	Some original storefront materials no longer extant
Condition:			
Excellent	Good	Poor	
Additional Alterati	ons		
Converted to use as	a church.		
Structu	ire Usage	Exterior Wall Surface	
Current: NA		Brick	
Historic: NA			
Roof Material	Roof Features	Roof Type	
Unknown	Parapet	Flat	
Ornamental Archit	tectural Details	Windows	
Concrete coping, inc	cised name plate, stone li	Double-hung, glass block	
Outbuildings (Num	ber and Description)		
None			



Local Landmark	Y	<u>N</u>	
National Register Historic Places	Y	<u>N</u>	
National Register Historic District	Y	<u>N</u>	Name:
Individually Eligible? Yes	A	BC	Significance: Good overall integrity and important social gathering place for Italian-American residents of Kensington in the early twentieth century.

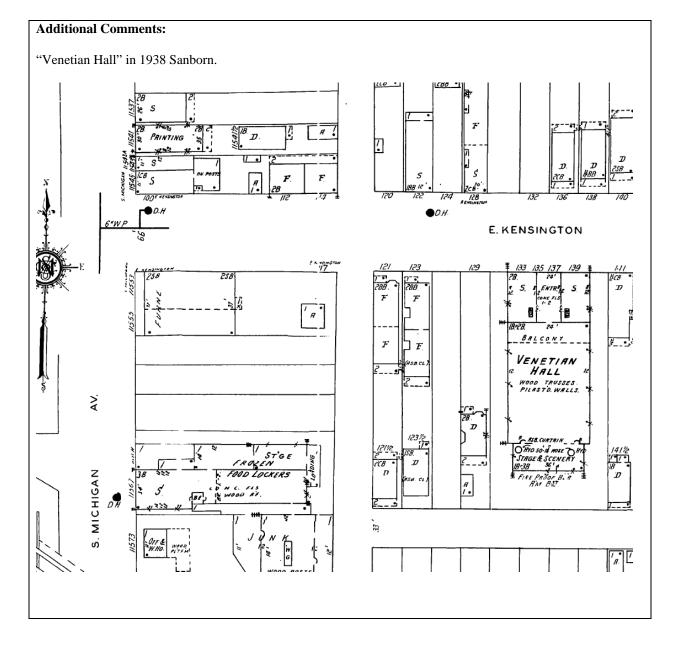



Historical Resource Recordation Form

Property Name	Photos with Captions: West façade of a brick, one-story, single family residence.		
Historic: Bldg. not labeled, not in CHRS	west laçade of a blick, one-story, single family residence.		
Common/Current: Unknown			
Property Address:			
9723 S. La Salle Street			
HAARGIS Number:			
Not in database			
Present Owner and /or Occupant:			
Unknown			
Property Use			
Historic: Single family residence			
Current: Single family residence			
Date of Construction: 1955			
Architect's Name: Not in CHRS			
Builder/Contractor: Not in CHRS			
Architectural Style:			
Vernacular			
Prepared By: J. Martinez, M. C. Bird, J.			
Guarino			
Photo By: S. Katz			
Date: 8 October 2012			

Property Description:

Stories: 1

This one-story home in the Roseland community is situated on a raised brick basement with casement windows and has a gable-on-hip roof clad with asphalt shingles. The front elevation has a pent roof, an off-center door, concrete steps with metal railings, a small glass block window, and a picture window flanked by casements. This window group is partially obscured by a low metal awning. Detailing includes a diamond-shaped tile insert in the gable end, stone quoins near the base of the residence, concrete sills, and scalloped boards above and below the pent roof. It does not feature distinguishing architectural elements and is not individually eligible for listing on the National Register.



Integrity:			Additional Notes/Descriptions
<u>Unaltered</u>	Slight Modification	on Major Alteration	
Condition:			
Excellent	Good	Poor	
Additional Alterati	ons		
Structu	ire Usage	Exterior Wall Surface	
Current: NA		Brick	
Historic: NA			
Roof Material	Roof Features	Roof Type	
Asphalt	None	Gable-on-hip	
Ornamental Archit	tectural Details		Windows
Diamond-shaped t	ile insert, stone quoins,	Fixed-pane, glass block, casement	
boards			
Outbuildings (Num	ber and Description)		
None			

Local Landmark	Y	<u>N</u>	
National Register Historic Places	Y	<u>N</u>	
National Register Historic District	Y	<u>N</u>	Name:
Individually Eligible? No	Α	B C	Significance:

		Comments:	Additional



Historical Resource Recordation Form

Property Name	Photos with Captions: East façade of a brick, two-story, single family residence.
Historic: Bldg. not labeled, not in CHRS	
Common/Current: Unknown	and the second sec
Property Address:	
9738 S. La Salle Street	
HAARGIS Number:	
Not in database	
Present Owner and /or Occupant:	
Unknown	
Property Use	
Historic: Single family residence	
Current: Single family residence	
Date of Construction: 1964	
Architect's Name: Not in CHRS	9738
Builder/Contractor: Not in CHRS	
Architectural Style:	
Vernacular	
Prepared By: J. Martinez, M. C. Bird, J.	
Guarino	
Photo By: S. Katz	
Date: 8 October 2012	

Property Description:

Stories: 2

This home in the Roseland community is clad with orange face brick and has a hip roof covered with asphalt shingles. The hip roof extends beyond the front elevation to serve as the roof of the second floor balcony, which is situated above the flat-roofed full-façade porch. Both levels feature open metal supports and railings. The porch has concrete steps. The front elevation features off-center doors trimmed with stone on both floors, a picture window flanked by double-hung windows on the first floor, and a pair of double-hung windows on the second floor. This building does not feature distinguishing architectural features and is not individually eligible for listing on the National Register.



Integrity:			Additional Notes/Descriptions
<u>Unaltered</u>	Slight Modification	Major Alteration	
Condition:			
Excellent	Good	Poor	
Additional Alterati	ons		
Structu	re Usage	Exterior Wall Surface	
Current: NA		Brick	
Historic: NA			
Roof Material	Roof Features	Roof Type	
Asphalt	None	Hip	
Ornamental Archit	ectural Details	Windows	
Stone at entrances.		Double-hung, fixed-pane	
Outbuildings (Num	ber and Description)		
None			

Local Landmark	Y <u>N</u>	
National Register Historic Places	Y <u>N</u>	
National Register Historic District	Y <u>N</u>	Name:
Individually Eligible? No	A B C	Significance:

Additional Comments:			



Historical Resource Recordation Form

Property Name	Photos with Captions: East façade of a one-story, frame, single family residence.
Historic: Bldg. not labeled, not in CHRS	
Common/Current: Unknown	
Property Address:	
9902 S. La Salle Street	
HAARGIS Number:	
Not in database	
Present Owner and /or Occupant:	
Unknown	
Property Use	
Historic: Single family residence	
Current: Single family residence	
Date of Construction: 1919	
Architect's Name: Not in CHRS	
Builder/Contractor: Not in CHRS	
Architectural Style:	
Vernacular	Mile Contraction
Prepared By: J. Martinez, M. C. Bird, J.	
Guarino	
Photo By: S. Katz	The second s
Date: 8 October 2012	

Property Description:

Stories: 1

This one-story cottage in the Roseland community is situated on a raised brick basement with glass block windows, is clad with aluminum siding, and has a front gable roof covered with asphalt shingles. A non-original, full-width, enclosed front porch covered with lattice obscures the original front elevation of the house. The porch has a horizontal strip of square, non-original windows and an off-center door. The side elevations have one-over-one windows. This home does not have sufficient integrity or distinguishing features to qualify as eligible for individual listing on the National Register.



Midwest Archaeological Research Services, Inc. 505 North State Street Marengo, Illinois 60152 Phone (815) 568- 0680

Integrity:			Additional Notes/Descriptions
Unaltered	Slight Modification	Major Alteration	Replacement windows, cladding
Condition:			
Excellent	Good	Poor	
Additional Alteration	ons		
Addition to front faç	ade		
Structu	re Usage	Exterior Wall Surface	
Current: NA		Synthetic siding	
Historic: NA			
Roof Material	Roof Features	Roof Type	
Asphalt	None	Gable	
Ornamental Archit	ectural Details		Windows
None			Double-hung, fixed-pane, glass
			block
Outbuildings (Num	ber and Description)		

Local Landmark	Y <u>N</u>	
National Register Historic Places	Y <u>N</u>	
National Register Historic District	Y <u>N</u>	Name:
Individually Eligible? No	A B C	Significance:

Additional Comments:	 		



Historical Resource Recordation Form

Property Name	Photos with Captions:
	East façade of a brick, one-story, single family residence.
Historic: Bldg. not labeled, not in CHRS	
Common/Current: Unknown	
Property Address:	
9706 S. Lafayette Avenue	
Alternate: 9708 S Perry Ave.	
HAARGIS Number:	
Not in database	
Present Owner and /or Occupant:	
Unknown	
Property Use	
Historic: Single family residence	
Current: Single family residence	
Date of Construction: 1957	
Architect's Name: Not in CHRS	
Builder/Contractor: Not in CHRS	
Architectural Style:	
Vernacular	
Prepared By: J. Martinez, M. C. Bird, J.	
Guarino	
Photo By: S. Katz	
Date: 8 October 2012	

Property Description:

Stories: 1

This one-story home in the Roseland community is situated on a raised brick basement and has a front gable roof covered with asphalt shingles. Its front elevation is clad with faux stone below the sill line, orange face brick above, and synthetic siding in the gable. It has a centrally-located door, concrete steps with metal railings, a single-pane window flanked by a casement, and what appears to be a pair of casement windows. Windows are partially obscured by low metal awnings. This standard 1950s era house does not display distinguishing architectural features and is not individually eligible for listing on the National Register.



Integrity:			Additional Notes/Descriptions
integrity.			
Unaltered	Slight Modification	on Major Alteration	Replacement windows
Condition:			
Excellent	Good	Poor	
Additional Alterati	ons		
Structu	ire Usage	Exterior Wall Surface	
Current: NA		Brick (main),	
		Synthetic siding (gable end)	
Historic: NA			
Roof Material	Roof Features	Roof Type	
Asphalt	None	Gable	
Ornamental Archit	ectural Details		Windows
None			Casement, fixed-pane, glass block
Outbuildings (Num	ber and Description)		
None			

Local Landmark	Y <u>N</u>	
National Register Historic Places	Y <u>N</u>	
National Register Historic District	Y <u>N</u>	Name:
Individually Eligible? No	A B C	Significance:

Additional Comments:			



Historical Resource Recordation Form

Property Name	Photos with Captions East and south façades of one-story, single family, frame residence.
Historic: Not labeled, not in CHRS	East and south façades of one-story, single family, frame residence.
Common/Current: Unknown	
Property Address:	
11528 S. Lafayette Avenue	
HAARGIS Number:	
Not in database	
Present Owner and /or Occupant:	
Unknown	
Property Use	
Historic: Single family residence	
Current: Single family residence	
Date of Construction: 1889	
Architect's Name: Not in CHRS	
Builder/Contractor: Not in CHRS	
Architectural Style:	
Vernacular	and an an and the second se
Prepared By: C. Tolmie, M. C. Bird, J. Guarino	
Photo By: S. Katz	
Date: 10 September 2012	

Property Description:

Stories: 1

This one-story house in the West Pullman community is situated on a raised brick basement, is clad with aluminum siding, and has a front gable roof covered with asphalt shingles. Its front elevation features a gable-roofed, full-width, enclosed porch with an off-center door, metal steps and railings, and two non-original one-over-one windows. This house lacks sufficient integrity and distinguishing architectural features to qualify as individually eligible for listing on the National Register.



Integrity:			Additional Notes/Descriptions
Unaltered	Slight Alterations	Major Alterations	Replacement windows, door, and cladding
Condition:			
<u>Excellent</u>	Good	Poor	
Additional Alterati	ons		
Structu	re Usage	Exterior Wall Surface	
Current: NA		Synthetic siding	
Historic: NA			
Roof Material	Roof Features	Roof Type	
Asphalt shingle	None	Gable	
Ornamental Archit	ectural Details		Windows
None			Double-hung
Outbuildings (Num	ber and Description)		
None			

Local Landmark	Y <u>N</u>	
National Register Historic Places	Y <u>N</u>	
National Register Historic District	Y <u>N</u>	Name:
Individually Eligible? No	A B C	Significance:

Additional Comments:		



Historical Resource Recordation Form

Property Name	Photos with Captions East façade of one-story, single-family, frame residence.
Historic: Not labeled, not in CHRS	Last façade of one story, single failing, france residence.
Common/Current: Unknown	
Property Address:	
11532 S. Lafayette Avenue	
HAARGIS Number:	
Not in database	
Present Owner and /or Occupant:	
Unknown	
Property Use	
Historic: Single family residence	
Current: Single family residence	
Date of Construction: 1888	
Architect's Name: Not in CHRS	
Builder/Contractor: Not in CHRS	
Architectural Style:	
Vernacular	
Prepared By: C. Tolmie, M. C. Bird, J.	
Guarino	and the second
Photo By: S. Katz	
Date: 10 September 2012	

Property Description:

Stories: 1

This one-story house in the West Pullman community is situated on a raised concrete block basement, is clad with synthetic siding, and has a gable roof covered with asphalt shingles. Its front elevation features a flat-roofed, full-width, wood porch with wood slats and posts. It also has an off-center hollow core metal door and a strip of three non-original one-over-one aluminum sash windows. This house lacks sufficient integrity and distinguishing architectural features to qualify as individually eligible for listing on the National Register.




Integrity:			Additional Notes/Descriptions
Unaltered	Slight Alterations	Major Alterations	Replacement door, windows,
			cladding, and porch
Condition:			
Excellent	Good	Poor	
Additional Alterati	ons		
Structu	ire Usage	Exterior Wall Surface	
Current: NA		Synthetic siding	
Historic: NA			
Roof Material	Roof Features	Roof Type	
Asphalt shingle	None	Gable	
Ornamental Archit	tectural Details		Windows
None			Double-hung
Outbuildings (Num	ber and Description)		
None			

Local Landmark	Y <u>N</u>	
National Register Historic Places	Y <u>N</u>	
National Register Historic District	Y <u>N</u>	Name:
Individually Eligible? No	A B C	Significance:

Additional Comments:			



Historical Resource Recordation Form

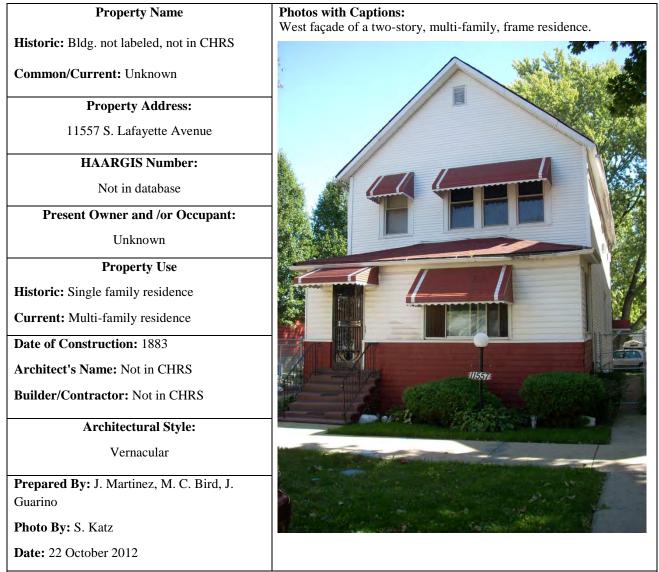

Property Description:

Stories: 2

This two-story house in the West Pullman community is situated on a raised concrete block basement with glass block windows and is covered with synthetic siding. The building has a front gable roof covered with asphalt shingles. Its front elevation has a full-width, hip-roof, enclosed porch with non-original synthetic siding, an off-center entrance with metal storm door and metal awning, and a first floor group of sliding windows that is partially obscured by a metal awning. The second floor of the front elevation has a strip of three windows and a single window, all of which are non-original one-over-one aluminum-sash with metal awnings. This house lacks integrity and distinctive architectural features and is not individually eligible for listing on the National Register.



Integrity:			Additional Notes/Descriptions
Unaltered	Slight Modification	Major Alteration	Replacement windows and cladding
Condition:			
<u>Excellent</u>	Good	Poor	
Additional Alterati	ons		
Structu	ire Usage	Exterior Wall Surface	
Current: NA		Synthetic siding	
Historic: NA			
Roof Material	Roof Features	Roof Type	
Asphalt shingle	None	Gable	
Ornamental Archit	ectural Details		Windows
None			Double-hung, glass block, sliding
Outbuildings (Num	ber and Description)		
None			

Local Landmark	Y <u>N</u>	
National Register Historic Places	Y <u>N</u>	
National Register Historic District	Y <u>N</u>	Name:
Individually Eligible? No	A B C	Significance:

Additional Comments:	



Historical Resource Recordation Form

Property Name	Photos with Captions: East façade of a 1.5-story, single family, brick residence.
Historic: Bldg. not labeled, not in CHRS	Last laçade of a 1.5-story, single failing, offek festdence.
Common/Current: Unknown	Cherry and the
Property Address:	
12018 S. Loomis Street	
HAARGIS Number:	
Not in database	
Present Owner and /or Occupant:	
Unknown	
Property Use	
Historic: Single family residence	
Current: Single family residence	
Date of Construction: 1904	
Architect's Name: Not in CHRS	
Builder/Contractor: Not in CHRS	
Architectural Style:	
Vernacular	
Prepared By: J. Martinez, M. C. Bird, J.	the second secon
Guarino	and an
Photo By: S. Katz	
Date: 30 October 2012	
Duon outer Descriptions	

Property Description:

Stories: 1.5

This one-and-a-half-story house in the West Pullman community is situated on a raised basement and is clad with red face brick and synthetic siding. The building has a steeply pitched front gable roof with front-facing synthetic-clad gable. Its front elevation has a full-width, hip roof, synthetic-clad, enclosed porch with a metal storm door, concrete steps with metal railings, and a picture window flanked by one-over-one windows. The second floor of the front elevation has a pair of one-over-one windows that extend through the cornice into the synthetic-clad gable. A single one-over-one window is situated at the apex of the gable. All windows are modern replacements with aluminum sashes. The south elevation has a through-the-cornice shed dormer. This house lacks integrity and distinguishing architectural features and is not individually eligible for listing on the National Register.



Structural Survey

Integrity:			Additional Notes/Descriptions
Unaltered	Slight Modification	on Major Alteration	Replacement windows and cladding
Condition:			
Excellent	Good	Poor	
Additional Alteration	ons		
Porch enclosed			
Structu	ıre Usage	Exterior Wall Surface	
Current: NA		Brick (main), Synthetic siding	
Historic: NA		(gable end and porch)	
Roof Material	Roof Features	Roof Type	
Asphalt shingles	Dormer	Gable	
Ornamental Archit	ectural Details		Windows
None			Double-hung, fixed-pane
Outbuildings (Num	ber and Description)		
Detached, two-car, f	rame garage		

Local Landmark	Y <u>N</u>	
National Register Historic Places	Y <u>N</u>	
National Register Historic District	Y <u>N</u>	Name:
Individually Eligible? No	A B C	Significance:

Additional Comments:



Historical Resource Recordation Form

Property Name	Photos with Captions:
	East façade of 1.5-story, single-family, frame residence.
Historic: Not labeled, not in CHRS	
Common/Current: Unknown	
Property address:	
9906 S. Lowe Avenue	
HAARGIS Number:	
Not in database	
Present Owner and /or Occupant:	
Unknown	
Property Use	
Historic: Single family residence	
Current: Single family residence	
Date of Construction: 1904	
Architect's Name: Not in CHRS	
Builder/Contractor: Not in CHRS	
Architectural Style:	
Vernacular	
Prepared By: C. Tolmie, M. C. Bird, J. Guarino	
Photo By: S. Katz	
Date: September 2012	

Property Description:

Stories: 1.5

This one-and-a-half-story frame house in the Washington Heights community is situated on a raised basement and is covered with synthetic siding. The building has a front gable roof covered with asphalt shingles. Its front elevation has a full-width, hip-roof, enclosed porch with an off-center door, four non-original one-over-one aluminum-sash windows, wood steps, and metal railings. A pair of non-original one-over-one aluminum-sash windows is situated in the gable. Detailing includes corner porch pilasters and an engaged Doric column flanking the door. This house lacks integrity and distinctive architectural features and is not individually eligible for listing on the National Register.



Integrity:			Additional Notes/Descriptions
Unaltered	Slight Modification	Major Alteration	Enclosed porch, replacement windows and cladding
Condition:			
Excellent	Good	Poor	
Additional Alterati	ons		
Structu	ire Usage	Exterior Wall Surface	
Current: N/A		Synthetic siding	
Historic: N/A			
Roof Material	Roof Features	Roof Type	
Asphalt shingle	None	Gable	
Ornamental Archit	ectural Details		Windows
Pilasters, Doric colu	mn		Double-hung
Outbuildings (Num	ber and Description)		
None			

Local Landmark	Y <u>N</u>	
National Register Historic Places	Y <u>N</u>	
National Register Historic District	Y <u>N</u>	Name:
Individually Eligible? No	A B C	Significance:

Additional Comments:		



Historical Resource Recordation Form

Property Name	Photos with Captions:
Historic: Not labeled, not in CHRS	West façade of one-story, single-family, frame residence.
HISTORIC: NOT labeled, not in CHKS	
Common/Current: Unknown	
Property address:	
9907 S. Lowe Avenue	
HAARGIS Number:	
Not in database	
Present Owner and /or Occupant:	
Unknown	
Property Use	
Historic: Single family residence	
Current: Single family residence	
Date of Construction: 1926	
Architect's Name: Not in CHRS	
Builder/Contractor: Not in CHRS	
Architectural Style:	
Vernacular	
Prepared By: C. Tolmie, M. C. Bird, J. Guarino	
Photo By: S. Katz	
Date: September 2012	

Property Description:

Stories: 1

This one-story frame cottage in the Washington Heights community is situated on a raised basement and is covered with synthetic siding. The building has a bracketed front gable roof covered with asphalt shingles and overhanging eaves with decorative rafters and brackets. The front elevation has a recessed corner porch with hollow core metal door, wood steps and railings, a faux stone corner pier support topped by a squat wood column, and bracketed gable hood. Windows include a strip of three-over-one original wood-sash windows on the first floor and a strip of three casement windows in the gable. This house lacks distinctive architectural features and is not individually eligible for listing on the National Register.



Integrity:			Additional Notes/Descriptions
Unaltered	Slight Modification	Major Alteration	Replacement door and cladding
Condition:			
Excellent	Good	Poor	
Additional Alterati	ons		
Structu	ire Usage	Exterior Wall Surface	
Current: NA		Synthetic siding	
Historic: NA			
Roof Material	Roof Features	Roof Type	
Asphalt shingle	None	Gable	
Ornamental Archit	ectural Details		Windows
Brackets under eave	s and hood		Double-hung, casement
Outbuildings (Num	ber and Description)		·
None			

Local Landmark	Y <u>N</u>	
National Register Historic Places	Y <u>N</u>	
National Register Historic District	Y <u>N</u>	Name:
Individually Eligible? No	A B C	Significance:

Additional Comments:			



Historical Resource Recordation Form

Property Name	Photos with Captions: West façade of a one-story single family residence.
Historic: Bldg. not labeled, not in CHRS	west façade of a one-story single family residence.
Common/Current: Unknown	
Property Address:	
10159 S. Michigan Avenue	
HAARGIS Number:	
Not in database	
Present Owner and /or Occupant:	
Unknown	
Property Use	
Historic: Single family residence	
Current: Single family residence	
Date of Construction: 1918	
Architect's Name: Not in CHRS	
Builder/Contractor: Not in CHRS	
Architectural Style:	
Craftsman	
Prepared By: J. Martinez, M. C. Bird, J.	
Guarino	
Photo By: S. Katz	
Date: 30 October 2012	
Property Description:	Stories: 1

This one-story brick-clad Craftsman bungalow at the northeast corner of Michigan Avenue and 102nd Street in the Roseland community has a hip roof with asphalt shingles, overhanging eaves, and three hip dormers with original paired wood casement windows. The front elevation wide roof overhang shelters the full-façade porch, which has a wood deck, side-facing wood steps with straight railings, and supports comprised of three brick piers topped by squat Doric columns. The front elevation features a metal storm door flanked by a single non-original one-over-one aluminum-sash window on either side. The 102nd Street elevation has two groups of three non-original one-over-one aluminum-sash windows and a gabled porch at its eastern end. This porch has a wood deck, side-facing wood steps with straight railings, and supports comprised of two brick piers topped by squat Doric columns. This house lacks distinguishing architectural features and is not individually eligible for listing on the National Register.



Tradio continue			Additional Natas/Descriptions
Integrity:			Additional Notes/Descriptions
Unaltered	Slight Modification	Major Alteration	Replacement windows
Condition:			
Excellent	Good	Poor	
Additional Alteration	ons		
Structu	re Usage	Exterior Wall Surface	
Current: NA		Brick	
Historic: NA			
Roof Material	Roof Features	Roof Type	
Asphalt shingles	Dormers	Hip	
Ornamental Archit	ectural Details		Windows
Doric columns			Double-hung, casement
Outbuildings (Num	ber and Description)		
None			

Local Landmark	Y <u>N</u>	
National Register Historic Places	Y <u>N</u>	
National Register Historic District	Y <u>N</u>	Name:
Individually Eligible? No	A B C	Significance:

Additional Comments:		



Historical Resource Recordation Form

Property Name	Photos with Captions: South and west façades of 1.5- story, frame residence.
Historic: Bldg. not labeled, not in CHRS	South and west façades of 1.5- story, frame residence.
Common/Current: Unknown	
Property Address:	
10213 S. Michigan Ave.	
HAARGIS Number:	
Not in database	
Present Owner and /or Occupant:	
Unknown	
Property Use	
Historic: Single family residence	
Current: Residence	
Date of Construction: 1888	
Architect's Name: Not in CHRS	
Builder/Contractor: Not in CHRS	
Architectural Style:	
Vernacular	
Prepared By: J. Martinez, M. C. Bird, J.	
Guarino	
Photo By: S. Katz	
Date: 3 October 2012	

Property Description:

Stories: 1.5

This one-and-one-half-story house in the Roseland community is situated on a raised foundation and clad with synthetic siding. It has a gable roof covered with asphalt shingles and gable wall dormers on its side elevations. Its front elevation features an enclosed hip-roofed porch with an off-center door, wood steps, and railings. There are two pairs of windows on the first floor and one pair of windows on the second; windows are modern replacements, including one-over-one, sliding glass, and glass block windows of varying sizes. An exterior wood staircase leads to a non-original door situated in the gable wall dormer of the south elevation. This house does not feature distinguishing architectural features and is not individually eligible for listing on the National Register.




Integrity:			Additional Notes/Descriptions
Unaltered	Slight Modification	Major Alteration	Replacement windows and siding
Condition:			
Excellent	Good	Poor	
Additional Alteration	ons		
External staircase ad	ded		
Structu	re Usage	Exterior Wall Surface	
Current: NA		Synthetic siding	
Historic: NA			
Roof Material	Roof Features	Roof Type	
Asphalt shingle	Dormer	Gable	
Ornamental Archit	ectural Details		Windows
None			Double-hung, glass block, sliding
Outbuildings (Num	ber and Description)		
None			

Local Landmark	Y <u>N</u>	
National Register Historic Places	Y <u>N</u>	
National Register Historic District	Y <u>N</u>	Name:
Individually Eligible? No	A B C	Significance:

Additional Comments:			



Historical Resource Recordation Form

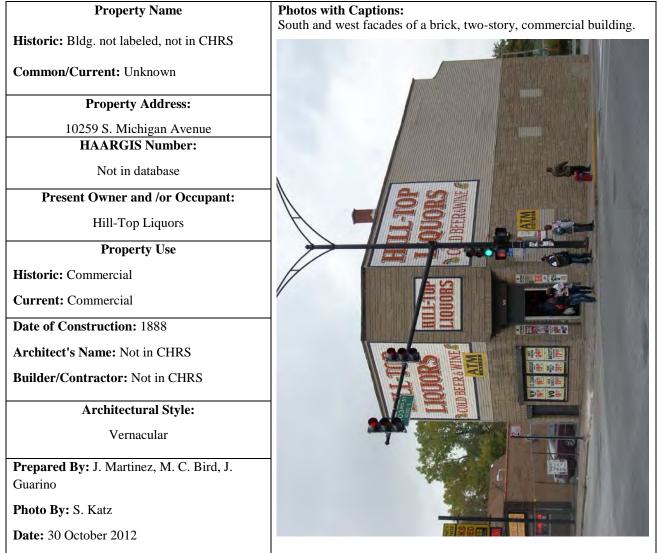

Property Description:

Stories: 2

This two-story commercial building at the northeast corner of Michigan Avenue and 103rd Street in the Roseland community is clad with a stone veneer (lower) and synthetic siding (upper) along both street elevations. The building has a flat roof, a corner entrance door, an off-center door along its Michigan Avenue elevation, and window openings along the first floor of both street elevations. All openings are secured with rolling, corrugated metal blinds. This building lacks integrity and distinguishing architectural features and is not individually eligible for listing on the National Register.




Integrity:			Additional Notes/Descriptions	
Unaltered	Slight Modificati	ion Major Alteration	Security blinds added, cladding	
Condition:				
Excellent	Good	Poor		
Additional Alteration	ons			
Second story covered	d by signs; first floor wi			
Structu	re Usage	Exterior Wall Surface		
Current: NA		Stone veneer, synthetic siding		
Historic: NA				
Roof Material	Roof Features	Roof Type		
Unknown	None	Flat		
Ornamental Archit	ectural Details	Windows		
None		Glass block, covered		
Outbuildings (Num	ber and Description)			
None				

Local Landmark	Y <u>N</u>	
National Register Historic Places	Y <u>N</u>	
National Register Historic District	Y <u>N</u>	Name:
Individually Eligible? No	A B C	Significance:

Add	litional Comments:			



Historical Resource Recordation Form

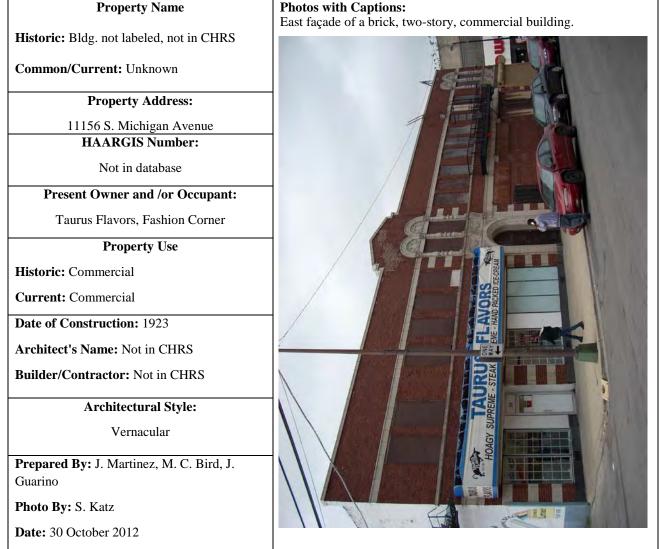

Property Description:

Stories: 2

This two-story commercial building at the northwest corner of Michigan Avenue and 112th Street in the Roseland community is clad with brown face brick on its front elevation and common brick on its side elevations. The building has a flat roof and parapet. The front elevation features a centrally located entrance pavilion with a round-arch entrance and paired windows directly above surrounded by terra cotta with Classical motifs, including pilasters, shields, and swags. The entrance features original single-light wood double doors with round-arch transom. A pair of windows on the north end of the front elevation is also surrounded by terra cotta with Classical motifs, including scrolled brackets, shields, and swags. The first floor's original storefront configuration is visible but most storefront bays, which are separated by brick and tile pilasters, have either been retrofitted with non-original doors and windows or in-filled with brick. The southernmost entrance is flanked by multi-light, fixed-pane windows. The nineteen window openings that stretch across the second story front elevation have all been covered with plywood. Other detailing includes terra cotta belt courses. Although this building has retained some nice terra cotta detailing, it does not feature sufficient overall integrity to qualify as individually eligible for listing on the National Register.




Integrity:			Additional Notes/Descriptions
Unaltered	Slight Modificati	Major Alteration	Replacement doors and windows
Condition:			
Excellent	Good	Poor	
Additional Alterati	ons		
Some openings cove	ered with plywood and o	thers in-filled with brick.	
Structu	re Usage	Exterior Wall Surface	
Current: NA		Brick	
Historic: NA			
Roof Material	Roof Features	Roof Type	
Unknown	Parapet	Flat	
Ornamental Archit	ectural Details	Windows	
Terra cotta pilasters, brackets, shields, belt courses, and swags, brick pilasters, surround			Fixed-pane, covered
Outbuildings (Num	ber and Description)		·
None			

Local Landmark	Y <u>N</u>	
National Register Historic Places	Y <u>N</u>	
National Register Historic District	Y <u>N</u>	Name:
Individually Eligible? No	A B C	Significance:

Additional Comments:			



Historical Resource Recordation Form

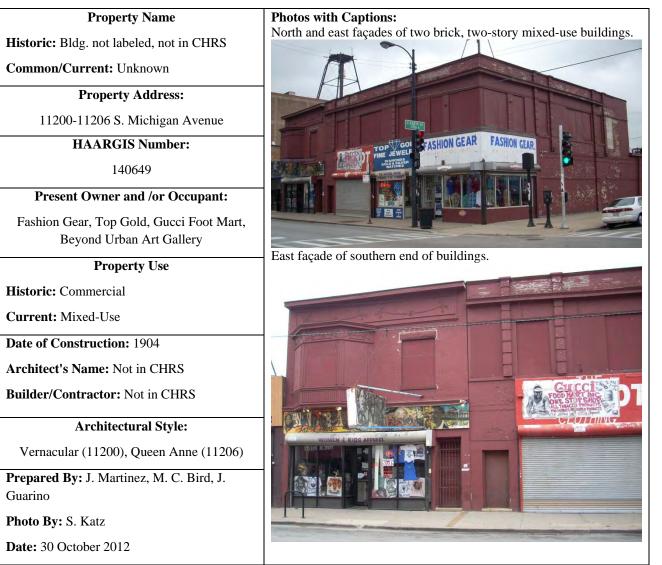

Property Description:

Stories: 2

This address comprises two conjoined buildings. The building at 11200 (top photo) is a two-story brick-clad, flatroofed commercial building at the southwest corner of Michigan Avenue and 112th Street in the Roseland community. The first floor has three non-original Michigan Avenue storefronts, including one at the corner, which has plate glass display windows and plate-glass double-doors. The middle storefront has plate glass display windows and a plate glass door. The southernmost storefront is hidden behind a roll-down corrugated metal covering. The second floor window openings on both street elevations of this building are in-filled with what appears to be wood. Detailing includes second floor pilasters, brick stringcourses, and a metal cornice.

The building at 11206 is the adjacent two-story, brick-clad, flat-roofed Queen Anne style commercial building to the south. Its non-original storefront has a recessed plate glass door and flanking plate glass display windows. An off-center wood paneled door with a transom provides access to the second floor, which has a three-sided metal bay and a single window; all window openings on the second floor have been in-filled with wood. Detailing includes swags at



the parapet level and a metal cornice with dentil molding with decorative designs above the bay as well. These two buildings lack integrity and distinguishing architectural features and are not individually eligible for listing on the National Register.

Structural Survey

Integrity:			Additional Notes/Descriptions
Unaltered	Slight Modification	on Major Alteration	Replacement doors, windows
Condition:			
Excellent	Good	Poor	
Additional Alterati	ons		
Structu	ire Usage	Exterior Wall Surface	
Current: NA		Brick	
Historic: NA			
Roof Material	Roof Features	Roof Type	
Unknown	Parapet	Flat	
Ornamental Archit	tectural Details	Windows	
Pilasters, metal cornice, brick stringcourses, swags and geometric designs,			Fixed-pane, covered
dentil molding			
Outbuildings (Num	ber and Description)		
None			

Local Landmark	Y <u>N</u>	
National Register Historic Places	Y <u>N</u>	
National Register Historic District	Y <u>N</u>	Name:
Individually Eligible? No	A B C	Significance:

Additional Comments:

CHRS coded orange: 11206 S Michigan Ave property possesses some architectural feature or historical association that made it potentially significant in the context of the surrounding community.



Property Name Photos with Captions: North and east façades of two-story, brick, industrial building. Historic: Not labeled, not in CHRS Common/Current: Unknown **Property Address:** 11563-11565 S. Michigan Ave **HAARGIS Number:** Not in database **Present Owner and /or Occupant:** Unknown **Property Use** Historic: Industrial Current: Industrial Date of Construction: 1900 (1962 addition) Architect's Name: Not in CHRS Builder/Contractor: Not in CHRS Architectural Style:

Historical Resource Recordation Form

Vernacular

Prepared By: C. Tolmie, M. C. Bird, J. Guarino

Photo By: S. Katz

Date: 10 September 2012

Property Description:

Stories: 2

This two-story industrial building in West Pullman has a flat roof and parapet. A one-story, flat-roofed north wing is a later addition (1962). The original building has been drastically altered with new brick cladding on the first floor and the removal of original doors and windows on the front elevation. The first floor of the front elevation currently features two small non-original windows. The original window openings on the second floor of the front elevation have been in-filled with brick. Two one-over-one windows have been installed on either side. Window openings on the side elevations have all been altered as well. The parapet retains original decorative brick corbelling along the front and side elevations. This building does not feature sufficient integrity or distinguishing architectural features to qualify as individually eligible for listing on the National Register.



Integrity:			Additional Notes/Descriptions
Unaltered	Slight Modification	n <u>Major Alteration</u>	Replacement windows, openings in-filled, later addition
Condition:			
Excellent	Good	Poor	
Additional Alterati	ons		
Structu	re Usage	Exterior Wall Surface	
Current: NA		Brick	
Historic: NA			
Roof Material	Roof Features	Roof Type	
Unknown	Parapet	Flat	
Ornamental Archit	ectural Details		Windows
Brick corbelling			Double-hung
Outbuildings (Num	ber and Description)		
None			

Local Landmark	Y <u>N</u>	
National Register Historic Places	Y <u>N</u>	
National Register Historic District	Y <u>N</u>	Name:
Individually Eligible? No	A B C	Significance:

Additional Comments:			



Historical Resource Recordation Form



Property Description:

Stories: 2

This two-story frame building at the northwest corner of Michigan Avenue and 116th Street in the West Pullman community is clad with synthetic siding and has a cross-gable roof covered with asphalt shingles. Its front (Michigan Avenue) elevation features a tall false front, a recessed corner storefront entrance flanked by non-original glass block windows, an off-center metal door with transom that provides access to second floor apartments, and four one-over-one windows. Fenestration along the 116th Street elevation is also comprised of one-over-one windows. This building does not feature sufficient integrity or distinguishing architectural features to qualify as individually eligible for listing on the National Register.



Integrity:			Additional Notes/Descriptions
Unaltered	Slight Modification	Major Alteration	Replacement windows & cladding
Condition:			
<u>Excellent</u>	Good	Poor	
Additional Alterati	ons		
Structu	re Usage	Exterior Wall Surface	
Current: NA		Synthetic siding	
Historic: NA			
Roof Material	Roof Features	Roof Type	
Asphalt shingle	Parapet	Cross-Gable	
Ornamental Archit	ectural Details		Windows
None			Double-hung, glass block
Outbuildings (Num	ber and Description)		·
None			

Local Landmark	Y <u>N</u>	
National Register Historic Places	Y <u>N</u>	
National Register Historic District	Y <u>N</u>	Name:
Individually Eligible? No	A B C	Significance:



Historical Resource Recordation Form

Property Name	Photos with Captions: West façade of two-story, mixed-use building.
Historic: Bldg. not labeled, not in CHRS	
Common/Current: Unknown	
Property Address:	
11593 S Michigan Avenue	
HAARGIS Number:	
Not in database	
Present Owner and /or Occupant:	
Step of Faith	
Property Use	
Historic: Commercial (Upholstery, 1938)	
Current: Mixed-Use	A Company of the second s
Date of Construction: 1883	
Architect's Name: Not in CHRS	11593 S MICHIGAN CHICAGO IL 60028 11593 S WI-
Builder/Contractor: Not in CHRS	
Architectural Style:	
Vernacular	
Prepared By: J. Martinez, M. C. Bird, J. Guarino	
Photo By: S. Katz	
Date: 2 October 2012	

Property Description:

Stories: 2

This two-story, frame, mixed-use building at the northeast corner of Michigan Ave. and 116th Street in the West Pullman community is clad with synthetic siding (upper) and brick (lower) and has a front gable roof with asphalt shingles. The front elevation has a recessed brick storefront with an entrance at corner and one at the opposite end, which is covered with plywood. Neither the doors nor the windows appear to be original. The cornice above the first floor includes wood brackets. The second floor on both street elevations features non-original one-over-one aluminum-sash windows. This building lacks integrity, does not have distinguishing architectural features, and is not individually eligible for listing on the National Register.



Integrity:			Additional Notes/Descriptions
Unaltered	Slight Modification	n <u>Major Alteration</u>	Replacement windows, doors, and cladding
Condition:			
Excellent	Good	Poor	
Additional Alteration	ons		
Structu	re Usage	Exterior Wall Surface	
Current: NA		Synthetic siding (upper),	
Historic: NA		Brick (lower)	
Roof Material	Roof Features	Roof Type	
Asphalt	None	Gable	
Ornamental Archit	ectural Details	Windows	
Wood brackets along	g first floor cornice line	Double-hung	
Outbuildings (Num	ber and Description)		·
None			

Local Landmark	Y <u>N</u>	
National Register Historic Places	Y <u>N</u>	
National Register Historic District	Y <u>N</u>	Name:
Individually Eligible? No	A B C	Significance:

Additional Comments:	



Historical Resource Recordation Form

Property Name	Photos with Captions: West and north façades of two-story, multi-family, frame building.
Historic: Bldg. not labeled, not in CHRS	west and norm raçades of two-story, multi-failing, frame building.
Common/Current: Unknown	
Property Address:	
11611 S. Michigan Ave.	
HAARGIS Number:	
Not in database	
Present Owner and /or Occupant:	
Unknown	
Property Use	
Historic: Single family residence	
Current: Multi-family residence	
Date of Construction: 1888	
Architect's Name: Not in CHRS	
Builder/Contractor: Not in CHRS	
Architectural Style:	
Vernacular	
Prepared By: J. Martinez, M. C. Bird, J.	
Guarino	
Photo By: S. Katz	
Date: 2 October 2012	

Property Description:

Stories: 2

This two-story frame house in the West Pullman community is clad with synthetic siding and has a front gable roof with asphalt shingles. Its front elevation features an off-center non-original hollow core metal door fronted by a concrete stoop with metal railings and open metal posts supporting a metal canopy. There are two windows on the first floor and two on the second, all of which are non-original one-over-one aluminum sash.

The 1938 Sanborn shows this residence as a 1.5-story building with a round bay pavilion. Subsequent alterations, including the addition of a full second floor have heavily altered this building. This house lacks integrity, does not have distinguishing architectural features, and is not individually eligible for listing on the National Register.



Integrity:			Additional Notes/Descriptions	
Unaltered	Slight Modification <u>Major Alteration</u>		Replacement windows and siding, removal of bay pavilion, addition of a second floor	
Condition:				
Excellent	Good	Poor		
Additional Alterati	ons			
Structu	ire Usage	Exterior Wall Surface		
Current: NA		Synthetic siding		
Historic: NA				
Roof Material	Roof Features	Roof Type		
Asphalt	None	Gable		
Ornamental Archit	tectural Details		Windows	
None			Double-hung	
Outbuildings (Num	ber and Description)			
None				

Local Landmark	Y	<u>N</u>	
National Register Historic Places	Y	<u>N</u>	
National Register Historic District	Y	<u>N</u>	Name:
Individually Eligible? No	Α	B C	Significance:

Additional Comments:			